CHIQUITA CANYON
A Waste Connections Company

November 3, 2026

Via E-Mail
Karen Gork
Chief Environmental Health Specialist
Los Angeles County Department of Public Health
Local Enforcement Agency
Environmental Programs Division
5050 Commerce Drive,
Baldwin Park, California 91706
KGork@ph.lacounty.gov

Re: Chiquita Canyon, LLC's Weekly Report on the Documentation and Tracking of Cover Issues

Dear Ms. Gork:

In accordance with the Local Enforcement Agency's ("LEA") May 2, 2024 letter approving Chiquita's April 16, 2024 Second Revised Written Plan for Documenting and Tracking Cover Issues ("Second Revised Written Plan"), the LEA's May 29, 2024 letter, and the LEA's June 6, 2024 Compliance Order, Chiquita presents the enclosed report for documenting and tracking cover issues for the week of October 26, 2026 to October 31, 2026.

Please contact me if you have any questions regarding this matter.

Regards,

Tessa Lenz

Tessa Lenz
Environmental Manager
Chiquita Canyon

Attachment: November 3, 2026 Weekly Cover Issues Report
cc: Mark Como, Department of Public Health
Eric Morofuji, Department of Public Health

Fissures and Tension Cracks

4050 - Chiquita Reaction Area Tracking of Fissures and Tension Cracks

26 Oct 2026 / Tom Roe

Complete

Conducted on	26 Oct 2026 11:41 AM PDT
Prepared by	Tom Roe

Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks 1	
Fissure or Tension Crack Found?	No



Photo 1

Grid number of area in photo where there is no fissure or tension crack	164
Instability	
Are there any indications of slope stability concerns?	No

4050 - Chiquita Reaction Area Tracking of Fissures and Tension Cracks

27 Oct 2026 / John Boucher

Complete

Conducted on	27 Oct 2026 1:12 PM PDT
Prepared by	John Boucher

Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks 1	
Fissure or Tension Crack Found?	No



Photo 1

Grid number of area in photo where there is no fissure or tension crack	163
Instability	
Are there any indications of slope stability concerns?	No

4050 - Chiquita Reaction Area Tracking of Fissures and Tension Cracks

28 Oct 2026 / John Boucher

Complete

Conducted on	28 Oct 2026 1:51 PM PDT
Prepared by	John Boucher

Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks 1	
Fissure or Tension Crack Found?	No



Photo 1

Grid number of area in photo where there is no fissure or tension crack	198
Instability	
Are there any indications of slope stability concerns?	No

4050 - Chiquita Reaction Area Tracking of Fissures and Tension Cracks

29 Oct 2026 / John Boucher

Complete

Conducted on	29 Oct 2026 11:03 AM PDT
Prepared by	John Boucher

Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks 1	
Fissure or Tension Crack Found?	No



Photo 1

Grid number of area in photo where there is no fissure or tension crack	199
Instability	
Are there any indications of slope stability concerns?	No

4050 - Chiquita Reaction Area Tracking of Fissures and Tension Cracks

30 Oct 2026 / Tom Roe

Complete

Conducted on	30 Oct 2026 10:48 AM PDT
Prepared by	Tom Roe

Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks 1	
Fissure or Tension Crack Found?	No



Photo 1

Grid number of area in photo where there is no fissure or tension crack	161
Instability	
Are there any indications of slope stability concerns?	No

4050 - Chiquita Reaction Area Tracking of Fissures and Tension Cracks

31 Oct 2026 / Edwin De Leon

Complete

Conducted on	31 Oct 2026 8:46 AM PDT
Prepared by	Edwin De Leon

Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks 1	
Fissure or Tension Crack Found?	No



Photo 1

Grid number of area in photo where there is no fissure or tension crack	163
Instability	
Are there any indications of slope stability concerns?	No

Settlement

The bi-weekly drone flyover was not conducted this week. The drone data from the next flyover event will be included in the next weekly report.

Geosynthetic Cover

4050 - Geosynthetic Cover Inspection


26 Oct 2026 / Tom Roe

Complete

Flagged items	0
Conducted on	26 Oct 2026 11:42 AM PDT
Prepared by	Tom Roe

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	Yes
Date and Time Issue Found	26 Oct 2026 1:53 PM PDT

Grid Location

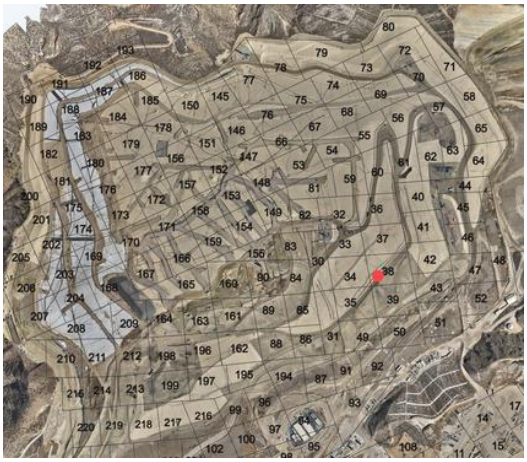

Grid Number	38

Take photo of identified issues

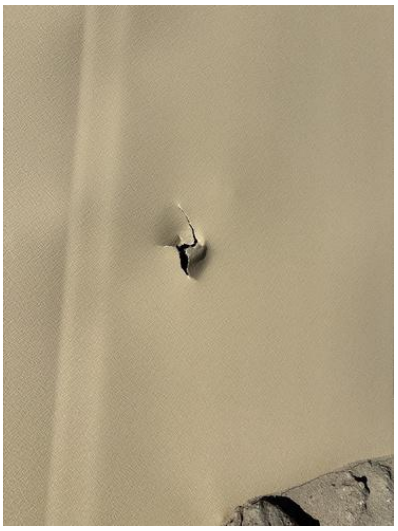


Photo 1

Notate what the issue is and what needs to be repaired	Tear in liner needs to be patched/extrusion welded.

Take photo of repair



Photo 2




Photo 3

Description of repair work	Tear taped upon discovery then patched and extrusion welded
Date and time of repair (within 2 hours)	26 Oct 2026 1:56 PM PDT
Are further permanent repairs required?	No
Date and Time of final repair (if necessary)	30 Oct 2026 3:02 PM PDT

Identified Issue 2

Are there any issues with the geosynthetic cover?	Yes
Date and Time Issue Found	26 Oct 2026 3:07 PM PDT

Grid Location

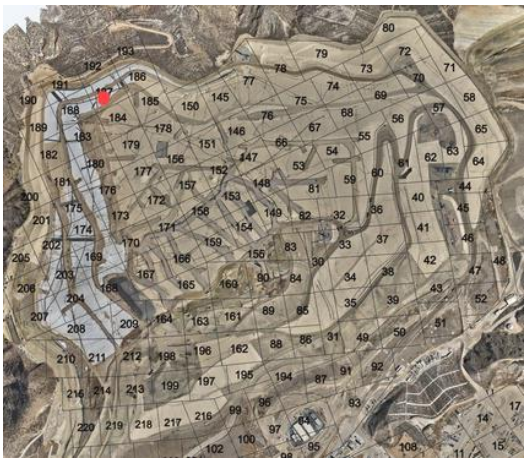

Grid Number	187

Take photo of identified issues



Photo 4

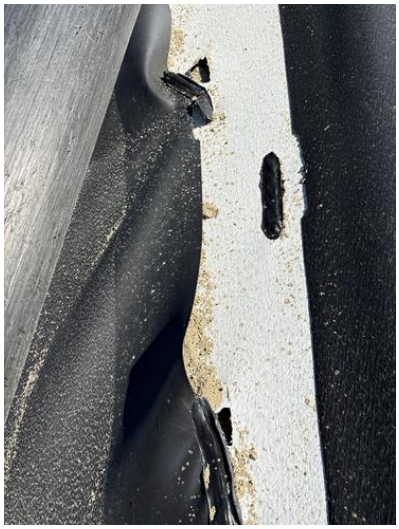


Photo 5

Notate what the issue is and what needs to be repaired

Liner torn. Needs to be patched and extrusion welded

Take photo of repair



Photo 6



Photo 7



Photo 8



Photo 9

Description of repair work	Taped upon discovery then patched and extrusion welded
Date and time of repair (within 2 hours)	26 Oct 2026 3:38 PM PDT
Are further permanent repairs required?	No
Date and Time of final repair (if necessary)	30 Oct 2026 3:05 PM PDT
Instability under the cover	
Are there any anomalous (unusual or unexpected) areas of cover damage or deformation that may indicate underlying instability?	No
Are there any signs of a downslope tension crack at the top of the slope or bulging at or near the toe of the slope?	No
Is there any movement of the equipment that vertically penetrates the cover (e.g., tilting)?	No

4050 - Geosynthetic Cover Inspection


27 Oct 2026 / Tom Roe

Complete

Flagged items	0
Conducted on	27 Oct 2026 10:16 AM PDT
Prepared by	Tom Roe

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	Yes
Date and Time Issue Found	27 Oct 2026 2:16 PM PDT

Grid Location

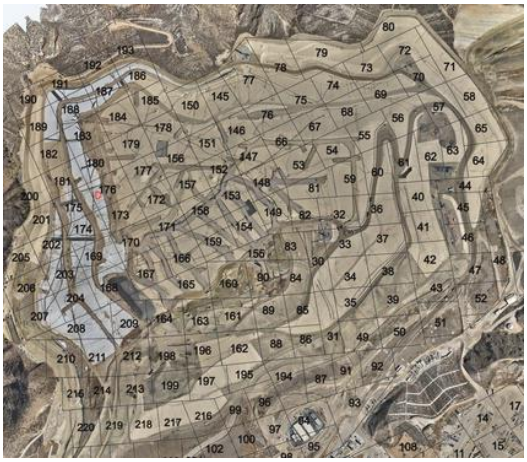

Grid Number	176

Take photo of identified issues



Photo 1



Photo 2

Notate what the issue is and what needs to be repaired	Two small tears in liner. Needs to be patched and extrusion welded

Take photo of repair

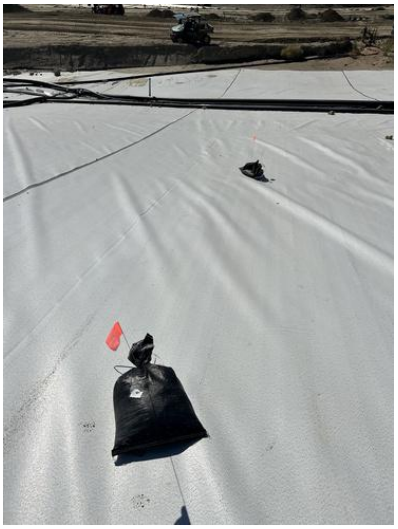


Photo 3

Description of repair work	Taped and sandbagged upon discovery
Date and time of repair (within 2 hours)	27 Oct 2026 2:44 PM PDT
Are further permanent repairs required?	Yes

Permanent repair scheduled for 11/4/26

Date and Time of final repair (if necessary)	

Instability under the cover

Are there any anomalous (unusual or unexpected) areas of cover damage or deformation that may indicate underlying instability?	No
Are there any signs of a downslope tension crack at the top of the slope or bulging at or near the toe of the slope?	No
Is there any movement of the equipment that vertically penetrates the cover (e.g., tilting)?	No

4050 - Geosynthetic Cover Inspection


28 Oct 2026 / John Boucher

Complete

Flagged items	0
Conducted on	28 Oct 2026 11:06 AM PDT
Prepared by	John Boucher

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	Yes
Date and Time Issue Found	28 Oct 2026 11:06 AM PDT

Grid Location

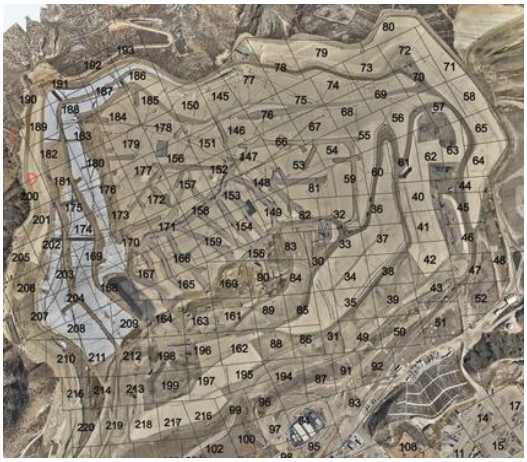

Grid Number	200

Take photo of identified issues



Photo 1

Notate what the issue is and what needs to be repaired	Liner torn. Needs to be patched and extrusion welded

Take photo of repair



Photo 2


Photo 3

Description of repair work	Taped and sandbagged upon discovery then patched and extrusion welded
Date and time of repair (within 2 hours)	28 Oct 2026 11:19 AM PDT
Are further permanent repairs required?	No
Date and Time of final repair (if necessary)	2 Nov 2026 8:37 AM PST

Identified Issue 2

Are there any issues with the geosynthetic cover?	Yes
Date and Time Issue Found	28 Oct 2026 9:16 AM PDT

Grid Location



Grid Number	149

Take photo of identified issues



Photo 4

Notate what the issue is and what needs to be repaired	Tear in liner needs to be patched/extrusion welded.

Take photo of repair



Photo 5

Description of repair work	Tear taped upon discovery
Date and time of repair (within 2 hours)	28 Oct 2026 9:45 AM PDT
Are further permanent repairs required?	Yes

Permanent repair scheduled for 11/4/26

Date and Time of final repair (if necessary)	

Identified Issue 3

Are there any issues with the geosynthetic cover?	Yes
Date and Time Issue Found	28 Oct 2026 2:49 PM PDT

Grid Location



Grid Number 96

Take photo of identified issues



Photo 6

Notate what the issue is and what needs to be repaired Hole in liner needs to be patched/extrusion welded.

Take photo of repair



Photo 7

Description of repair work	Tear taped after discovery
Date and time of repair (within 2 hours)	28 Oct 2026 4:45 PM PDT
Are further permanent repairs required?	Yes

Permanent repair scheduled for 11/4/26

Date and Time of final repair (if necessary)	

Instability under the cover

Are there any anomalous (unusual or unexpected) areas of cover damage or deformation that may indicate underlying instability?	No
Are there any signs of a downslope tension crack at the top of the slope or bulging at or near the toe of the slope?	No
Is there any movement of the equipment that vertically penetrates the cover (e.g., tilting)?	No

4050 - Geosynthetic Cover Inspection

29 Oct 2026 / John Boucher

Complete

Flagged items	0
Conducted on	29 Oct 2026 11:03 AM PDT
Prepared by	John Boucher

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	No



Photo 1



Photo 2



Photo 3



Photo 4

Instability under the cover	
Are there any anomalous (unusual or unexpected) areas of cover damage or deformation that may indicate underlying instability?	No
Are there any signs of a downslope tension crack at the top of the slope or bulging at or near the toe of the slope?	No
Is there any movement of the equipment that vertically penetrates the cover (e.g., tilting)?	No

4050 - Geosynthetic Cover Inspection


30 Oct 2026 / Tom Roe

Complete

Flagged items	0
Conducted on	30 Oct 2026 10:03 AM PDT
Prepared by	Tom Roe

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	Yes
Date and Time Issue Found	30 Oct 2026 10:57 AM PDT

Grid Location

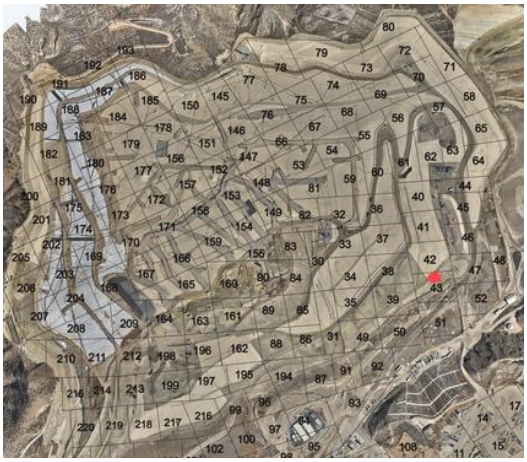

Grid Number	43

Take photo of identified issues



Photo 1

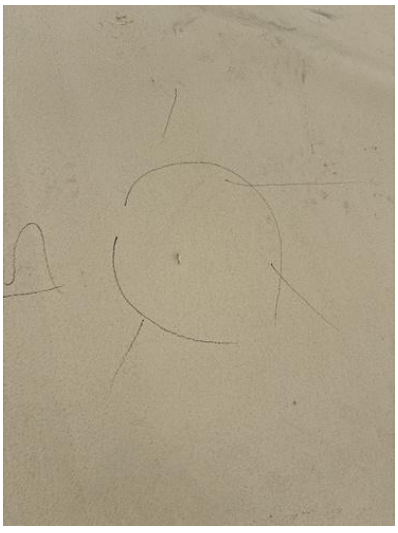


Photo 2

Notate what the issue is and what needs to be repaired	Two small holes need to be extrusion welded.

Take photo of repair



Photo 3

Description of repair work	Tears sandbagged upon discovery.
Date and time of repair (within 2 hours)	30 Oct 2026 11:00 AM PDT
Are further permanent repairs required?	Yes

Permanent repair scheduled for 11/4/26

Date and Time of final repair (if necessary)	

Instability under the cover

Are there any anomalous (unusual or unexpected) areas of cover damage or deformation that may indicate underlying instability?	No
Are there any signs of a downslope tension crack at the top of the slope or bulging at or near the toe of the slope?	No
Is there any movement of the equipment that vertically penetrates the cover (e.g., tilting)?	No

4050 - Geosynthetic Cover Inspection

31 Oct 2026 / Edwin De Leon

Complete

Flagged items	0
Conducted on	31 Oct 2026 8:03 AM PDT
Prepared by	Edwin De Leon

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	No



Photo 1

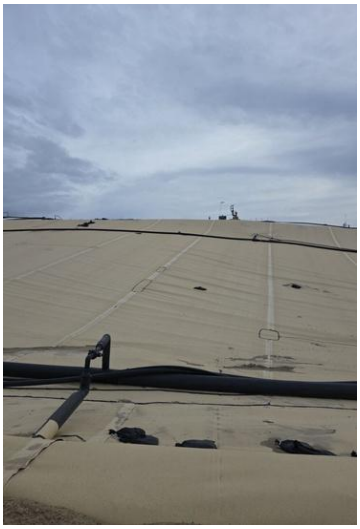


Photo 2



Photo 3



Photo 4

Instability under the cover	
Are there any anomalous (unusual or unexpected) areas of cover damage or deformation that may indicate underlying instability?	No
Are there any signs of a downslope tension crack at the top of the slope or bulging at or near the toe of the slope?	No
Is there any movement of the equipment that vertically penetrates the cover (e.g., tilting)?	No