20 de marzo de 2026
Archivo No. 01204123.42, Tarea 10

Baitong Chen, Ingeniero en Calidad del Aire, bchen@aqmd.gov
Nathaniel Dickel, Ingeniero Sénior de la Calidad del Aire, ndickel@aqmd.gov
Christina Ojeda, Inspectora de la Calidad del Aire, cojeda@aqmd.gov
Distrito de Gestión de la Calidad del Aire de la Costa Sur
21865 East Copley Drive
Diamond Bar, CA 91765-4182

Asunto: Informe Mensual de Febrero de 2026 de la Orden de Depuración Estipulada Modificada (Caso No. 6177-4), Vertedero de Chiquita Canyon (Código de Centro 119219), Castaic, California

A Quien Corresponda:

SCS Engineers (SCS), en nombre de Chiquita Canyon, LLC (Chiquita), mediante el presente le proporciona al Distrito de Gestión de la Calidad del Aire de la Costa Sur (SCAQMD) un informe mensual según la Orden de Depuración Estipulada Modificada (SOFA) (Caso No. 6177-4). La SOFA se aprobó inicialmente el 6 de septiembre de 2023 y se modificó posteriormente el 17 de enero de 2024, el 21 de marzo de 2024, el 24 de abril de 2024, el 27 de agosto de 2024, el 13 de noviembre de 2024, el 16 de abril de 2025, el 24 de junio de 2025 y el 9 de diciembre de 2025.

Este informe abarca el período mensual de febrero de 2026. Según la Condición No. 8, el informe mensual de febrero de 2026 debe entregarse el 20 del mes (o el siguiente día hábil), que es el viernes 20 de marzo de 2026.

ANTECEDENTES

El Vertedero de Chiquita Canyon (CCL) es un vertedero/centro de disposición de desechos sólidos ubicado en 29201 Henry Mayo Dr., Castaic, California, 91384 (SCAQMD Centro No. 119219). Con relación al vertedero, Chiquita opera un sistema de recolección y control de biogás.

En 2023, CCL comenzó a experimentar mayores niveles de azufre reducido total y óxidos de azufre, supuestamente incumpliendo con su permiso del Título V.[1] Además, CCL comenzó a ser sujeto de denuncias de olores del público y el SCAQMD le emitió Avisos de Violación. Las condiciones en CCL indican que el vertedero está pasando por un evento de vertedero de temperaturas elevadas (ETLF). El 6 de septiembre de 2023, se celebró una audiencia ante la Junta de Audiencias de SCAQMD para aprobar la SOFA que incluye numerosas medidas para mitigar las emisiones resultantes de las condiciones del ETLF del vertedero. La SOFA fue aprobada el 6 de septiembre de 2023. Desde ese momento, la SOFA se modificó el 17 de enero de 2024, el 21 de marzo de 2024, el 24 de abril de 2024, el 27 de agosto de 2024, el 13 de noviembre de 2024, el 16 de abril de 2025, el 24 de junio de 2025 y el 9 de diciembre

[1] CCL operó bajo una Variación de Emergencia Ex Parte (aprobada el 8 de febrero de 2023), una Variación Interina (aprobada el 15 de febrero de 2023 emitida como final el 7 de marzo de 2023) y una Variación Regular (aprobada el 3 de mayo de 2023 y emitida como final el 16 de mayo de 2023). La Variación Regular terminó el 6 de septiembre de 2023, la fecha efectiva de la SOFA inicial. La SOFA se modificó el 17 de enero de 2024, el 21 de marzo de 2024, el 24 de abril de 2024, el 27 de agosto de 2024, el 13 de noviembre de 2024, el 16 de abril de 2025 y el 24 de junio de 2025 y el 9 de diciembre de 2025.

de 2025 después de las audiencias ante el Consejo de Audiencias del SCAQMD. Este informe mensual se realiza después de haberse aprobado las condiciones de la SOFA modificada por última vez el 9 de diciembre de 2025, como corresponde.

La Condición No. 8 de la SOFA requiere que se presenten informes mensuales por e-mail a Baitong Chen, Nathaniel Dickel y Christina Ojeda del SCAQMD, que incluye la siguiente información:

A. *Las mediciones de compuestos de azufre de biogás y los análisis de laboratorio con la hora y fecha de cada medición o toma de muestra, identificadas en la Condición No. 5.*

B. *Los registros y cálculos de biogás identificados en la Condición No. 7 en un formato de planilla de cálculo en Microsoft Excel. Si los registros de biogás indican que algún equipo de combustión/control de biogás (antorchas u oxidantes térmicos) están fuera de línea por un período que excede los 7 días calendario consecutivos o que están fuera de línea por más de 15 días calendario en un mes del año calendario, el Demandado deberá informarlo proporcionando una descripción detallada de los motivos por los que el equipo estuvo fuera de línea (rotura del equipo, mantenimiento, construcción, si hubo suficiente redundancia para controlar el biogás recolectado, etc.)*

C. *El análisis integrado de la muestra de la superficie del vertedero y las lecturas de los monitoreos de la superficie del vertedero identificados en las Condiciones No. 9 y 10, en un formato de planilla de cálculo en Microsoft Excel. Los mapas de vigilancia, las mediciones de las inspecciones de campo de seguimiento con las fechas/horas asociadas, la causa de las excedencias, las acciones correctivas asociadas y la documentación (fecha, hora, razonamiento) de las inspecciones de campo no realizadas debido a la falta de accesibilidad o a condiciones peligrosas identificadas en la Condición 77.*

D. *Programa estimado para cualquier reemplazo o reacondicionamiento de medios de carbón granular activado en el Sistema de Tratamiento de Biogás (bajo el Permiso G55163, A/N 603249) identificado en la Condición No. 3. La temperatura de biogás en la entrada del Sistema de Tratamiento de Biogás (bajo el Permiso G55163, A/N 603249) identificado en la Condición No. 3(a).*

E. *Descripción de los problemas o demoras, si hubo, encontrados o que se proyectaron que podrían ocurrir pertinentes a la ejecución de contratos, como también la entrega, el reemplazo, la puesta en marcha y pruebas de cualquier operación necesaria para reponer y/o reemplazar los medios de carbón granular activado en el Sistema de Tratamiento de Biogás (bajo el Permiso G55163, A/N 603249). El demandado deberá presentar copias de los documentos o de otros registros para respaldar cualquier problema o demora notados conforme a esta Condición No. 8(e) junto con esta descripción.*

F. *Especificaciones de los equipos y materiales utilizados para las pruebas colorimétricas semanales (solo si hay un cambio con relación a las especificaciones previamente indicadas de la instrumentación colorimétrica o método utilizados).*

G. *Todas las mediciones de temperatura de cabezales de pozos, de sondas de temperatura y de concentraciones de CO de los pozos que requieren datos analíticos, mediciones de concentración de H2 de los pozos que requieren datos analíticos, mediciones de CH4, mediciones de O2, mediciones de CO2, relaciones de CH4:CO2, análisis de laboratorio y lecturas de tubos Draeger de biogás del mes pasado en formato de hoja de cálculo en Microsoft Excel.*

H. *Un mapa gráfico que muestra la ubicación de cada pozo que excede la temperatura (por encima de los 145 grados Fahrenheit), cada uno con excesos de CO (por encima de los 1,000 ppmv menores o iguales a 1,500 ppmv, por encima de los 1,500 ppmv y menores o iguales a 2,000 ppmv y por encima de los 2,000 ppmv) y estratificación de los rangos de temperatura durante ese mes, que incluye una descripción de las medidas de remediación tomadas para tratar o reducir temperaturas de pozos de gas.*

I. *Todos los pozos verticales de biogás impactados con líquidos, según la Condición No. 17, incluyendo una descripción de las medidas de remediación tomadas para tratar o reducir líquidos en pozos de biogás.*

J. *Actualizaciones sobre la investigación relacionada con la disponibilidad, viabilidad y utilización, incluyendo pruebas piloto si son necesarias, de un sistema de tratamiento de compuestos de azufre alternativo que controle, trate o remueva sulfuro de dimetilo ("DMS") y otros compuestos de azufre, si hubiera.*

K. *Un informe resumido de las mejoras implementadas en el sistema de recolección de biogás por el Demandado más allá de los agregados al sistema de recolección de biogás requeridos según la Condición No. 15 y 8(m).*

L. *Un registro de inspecciones y reparaciones de cubiertas del vertedero e inspecciones de cubiertas geosintéticas, en cumplimiento con la Condición No. 30 y los puntos de conexión, las costuras y los sellos de la cubierta geosintética, conforme a la Condición 97.*

M. *Cualquier agregado posterior al sistema de recolección de biogás, según la Condición No. 15; un mapa del pozo de extracción vertical actualizado detallando todos los pozos existentes de extracción vertical que están operando de forma completamente funcional completados dentro del mes; un mapa que muestre una plantilla de los pozos que están operando de forma completamente operativos y cuadrículas de monitoreo de la superficie del vertedero y detalles de las áreas demarcadas como exentas en el Anexo A adjunto, conforme a la Condición 15(b); copias de los registros topográficos de los pozos (en lo relacionado a las instalaciones y actualizaciones en las profundidades de los pozos) de extracción vertical completados dentro del mes; y un mapa o plano actualizado de la infraestructura de recolección y transporte de biogás conforme a obra, actualizado con respecto a cualquier modificación sustancial en los cabezales principales del sistema de recolección y control de biogás, con los límites de la Zona Reactiva incluidos.*

N. *Agregados posteriores al sistema de condensado de biogás y de recolección de lixiviados, como sumideros/bombas de desagüe u otros trabajos de desagote realizados según las pautas para desagote y el plan de implementación conforme a la Condición No. 18.*

O. *Actualizaciones sobre la adquisición e instalación de cubiertas geosintéticas conforme a la Condición No. 31, incluyendo los cambios requeridos o aprobados por la Agencia de Cumplimiento Local.*

P. *Actualizaciones sobre el trabajo de excavación en el vertedero sujeto a la Regla 1150, incluyendo las ubicaciones de las excavaciones (identificadas en los mapas gráficos del vertedero) y características de los residuos excavados/expuestos (saturados, semisecos, secos, tipo e intensidad de olor, etc.). Los trabajos de excavación que ocurren conforme a una exención como lo indican la Regla 1150(c)(3) o la Regla 1150(c)(2) del AQMD de la Costa Sur que se realizan en esta Área de Reacción también deben incluirse en estas actualizaciones.*

Q. *Actualizaciones sobre los lixiviados, que incluyen:*

- *i. Registros de temperatura de lixiviados conforme a la Condición No. 27(a);*
- *ii. Registro diario de los hallazgos de las inspecciones y actividades de contención conforme a la Condición 27(b);*
- *iii. Registro semanal de filtraciones y acumulación de lixiviados conforme a la Condición 27(c);*
- *iv. Cantidad de lixiviados medidos y nombre de la empresa y dirección física relacionados de los centros de disposición/tratamiento fuera del sitio que reciben lixiviados generados por el vertedero, conforme a la Condición 27(d); y*
- *v. Una lista de todas las instalaciones de almacenamiento y tratamiento de líquidos peligrosos y no peligrosos que se hayan contactado y el estado actual de cada una de las instalaciones, incluyendo la capacidad disponible, contratada y utilizada, para recibir líquidos del vertedero peligrosos y no peligrosos; y*
- *vi. Una actualización sobre la cantidad de tanques en cada grupo de tanques de lixiviados: la cantidad total de tanques de lixiviados tratados; la cantidad mensual y en lo que va del año de líquido recogido; la cantidad mensual y en lo que va del año de líquido tratado; y la cantidad mensual y en lo que va del año de filtraciones, acumulaciones o estancamientos recogidos.*

R. *Análisis diarios de la composición de los gases del vertedero, que incluyen CH4%, concentración de CO (ppm), CO2% y O2%, registrado por un analizador en tiempo real y/o muestras tomadas en las entradas de los equipos de control (TOx, Antorchas y equipos de control adicionales llevados al sitio para que hagan combustión con el biogás). Los análisis serán realizados por un analizador de CH4, CO2 o O2 aprobado por el AQMD de la Costa Sur*

utilizando el Método 10 de la EPA de EE. UU. o el Método ALT-144 para CO. La solicitud de aprobación deberá incluir la presentación de las especificaciones de lo analizadores.

S. *Mejoras en la adquisición de equipos necesarios para construir la Antorcha No. 4 conforme a la Condición No. 74.*

Conforme a la Condición No. 29, estos informes mensuales también deben incluir lo siguiente:

El Demandado deberá asegurarse de contar con la capacidad adecuada de condensados de lixiviados del vertedero y de biogás (en base a los informes de producción y recolección de líquidos, conforme a la Condición 8) para acumular en el sitio y/o disponible de los líquidos/lixiviados recogidos en un centro o centros apropiados.

Conforme a la Condición No. 35, estos informes mensuales también deben incluir lo siguiente:

El demandado debe proporcionar actualizaciones de estos documentos de QA/QC (si hubiera) y un registro de calibración y actividades de mantenimiento realizadas en los monitores en los informes mensuales conforme a la Condición No. 8.

Conforme a la Condición No. 42(w), estos informes mensuales también deben incluir lo siguiente, en la parte relevante:

Si el Demandado recibe un Aviso de Infracción por Incumplimiento de la Regla 402 del AQMD de la Costa Sur durante la excavación o un olor distinto (nivel 3 o superior por debajo de la Escala de Olor) resultante de la excavación en o pasando la línea de la propiedad, el Demandado deberá, conforme a este Plan de Salud y Seguridad, tomar muestras de la calidad del aire del ambiente dentro de las 2 horas desde que se recibe el Aviso de Infracción por Incumplimiento de la Regla 402 o cuando se detecta un olor distinto (nivel 3 o superior) en o pasando la línea de la propiedad y analizar los TOC y los TOCs especiados de la siguiente manera:

Escala de Olor	*Descripción de la Intensidad del Olor*
0	*No se detectó olor*
1	*Se detectó un olor muy suave*
2	*Se detectó un olor suave, distinguible*
3	*Olor moderado, muy distinguible*
4	*Olor fuerte, muy distinguible, irritable*
5	*Olor fuerte, muy distinguible, abrumador*

i. *Se deben tomar muestras en los siguientes lugares: inmediatamente a barlovento del sitio de la excavación., inmediatamente a sotavento de del sitio de la excavación, dentro de las 3 pulgadas de la cara de trabajo de la excavación expuesta, permisos de seguridad y en la línea de la propiedad a sotavento o en otros lugares aprobados por escrito por el AQMD de la Costa Sur. Si se considera inseguro, el Demandado deberá documentar la echa y las condiciones que no permiten el cumplimiento de esta condición. Deberán presentarse registros de estas condiciones en el siguiente informe mensual, conforme a la Condición 8.*

Conforme a la Condición No. 42(x), estos informes mensuales también deben incluir lo siguiente, en la parte relevante:

Durante la excavación, deberán tomarse muestras de TOC y de TOC especiado en el aire ambiental por lo menos una vez entre las 6:00 am y las 11:00 am por lo menos una vez entre las

2:00 pm y las 6:00 pm, según el Plan de Salud y Seguridad del Demandado y los siguientes requerimientos:

i. Se deben tomar muestras en los siguientes lugares: inmediatamente a barlovento del sitio de la excavación., inmediatamente a sotavento de del sitio de la excavación, dentro de las 3 pulgadas de la cara de trabajo de la excavación expuesta, permisos de seguridad y en la línea de la propiedad a sotavento o en otros lugares aprobados por escrito por el AQMD de la Costa Sur. Si se considera inseguro, el Demandado deberá documentar la echa y las condiciones que no permiten el cumplimiento de esta condición. Deberán presentarse registros de estas condiciones en el siguiente informe mensual, conforme a la Condición 8.

Conforme a la Condición No. 55(g), estos informes mensuales también deben incluir lo siguiente:

El Demandado mantiene registros de muestras/resultados de análisis de condensados para demostrar que el líquido no es peligroso, mantiene registros de flujos de inyección de condensados diarios (galones por día) y proporciona estos registros en el informe mensual conforme a la Condición No. 8.

Conforme a la Condición No. 68, estos informes mensuales también deben incluir lo siguiente:

El Demandado deberá instalar correctamente antes del 15 de junio de 2024 medidores de presión diferencial clasificados, con resolución de por lo menos una columna de agua de 0.01 pulgadas o un indicador de presión aprobado de otra manera por escrito por el AQMD de la Costa Sur, en cada tanque de almacenamiento de lixiviados. El Demandado deberá monitorear y registrar la presión diferencial diaria de cada tanque de lixiviados, el número de identificación del tanque, la fecha y hora de la lectura y el personal que realizó la lectura. Las lecturas de las presiones que indiquen el menor valor del medidor o el mayor valor del medidor deberán informarse utilizando dígitos importantes en lugar de los decimales, como "<= [valor más bajo en el medidor] (ej. <= -0.50 pulgadas de columna de agua)" y ">= [valor más alto en el medidor] (ej. >= 0.50 pulgadas de columna de agua)", respectivamente. Los tanques deberán mantenerse bajo presión negativa, demostrado en las lecturas de la presión diferencial. Las lecturas de cero y presión positiva no demuestran una presión negativa. Los medidores de presión deben calibrarse en cumplimiento con las especificaciones del fabricante y el programa de calibración. El Demandado deberá informar todas las lecturas en el informe mensual, conforme a la Condición No. 8

Conforme a la Condición No. 72, estos informes mensuales también deben incluir lo siguiente:

El demandado deberá tomar muestras y analizar, probar, instalar y monitorear la toma de lixiviados y condensados de biogás y el sistema de almacenamiento, como se especifica a continuación:

A. Por lo menos trimestralmente, realizar pruebas para tomar muestras y analizar el flujo de vapor en las tuberías utilizadas para ventilar los tanques de almacenamiento de lixiviados y los tanques de condensado de biogás y dirigir los vapores al sistema de control de biogás. Las pruebas deberán incluir por lo menos los siguientes puntos y los resultados de estas pruebas deben proporcionarse en el informe mensual, en cumplimiento con la Condición No. 8:

- *i. índice de flujo de vapores de tanques de lixiviados ventilados,*
- *ii. índice de flujo de vapores de tanques de condensados ventilados,*
- *iii. temperatura del vapor,*
- *iv. concentraciones de orgánicos especiados (incluyen, de forma enunciativa más no limitativa, Contaminantes del Aire Carcinogénicos y Tóxicos de la Tabla 1 de la Regla 1150.1),*
- *v. los compuestos de azufre total como H2S y compuestos de azufre especiado y*

vi. *analizar en cada uno de los lugares indicados a continuación:*

1. *Las ventilaciones o los colectores de los tanques que sean representativos de un set de tanques;*
2. *El cabezal/colector de cada parque de tanques de lixiviados o colector que incluye el Parque de Tanques No. 7, el Parque de Tanques No. 9, el Colector del Perímetro Norte, el Colector del Perímetro Noreste, el Colector LC, los tanques de almacenamiento de condensado de biogás y cualquier otro futuro parque de tanques o colectores, realizando las pruebas flujo arriba de la conexión de la tubería al Sistema de Recolección y Transporte de LFG donde el biogás pueda afectar los resultados; y*
3. *La entrada de antorchas antes de la combustión.*

B. *Deberá presentarse un protocolo de pruebas de origen al AQMD de la Costa Sur antes del 17 de mayo de 2024, a menos que el AQMD de la Costa Sur apruebe otra cosa por escrito. Las pruebas deberán realizarse dentro de los 45 días desde que el AQMD de la Costa Sur recibe la aprobación escrita del protocolo de prueba de origen y deberán presentarse los resultados finales en un formato de informe de prueba de origen dentro de los 30 días desde que se realizan las pruebas, a menos que el AQMD de la Costa Sur apruebe otra cosa por escrito.*

C. *Dentro de los 30 días desde el informe inicial de las pruebas de origen, el Demandado deberá presentar al AQMD de la Costa Sur una recomendación del Comité de Reacción sobre otras pruebas de flujo de vapores [atención: Baitong Chen, bchen@aqmd.gov; Nathaniel Dickel, ndickel@aqmd.gov; Christina Ojeda, cojeda@aqmd.gov]. El Comité de la Reacción podrá presentar otras recomendaciones sobre otros análisis de flujo de vapor al AQMD de la Costa Sur, dentro de los 30 días desde que se realizan los análisis adicionales de las fuentes bajo esta condición.*

D. *A partir del 29 de abril de 2024, por lo menos una vez al día, conducir pruebas y monitoreo de la presión dentro de los cabezales de HDPE que ventilan los tanques de almacenamiento de lixiviados para cuantificar el vacío de los sopladores de la estación de antorchas ejercido en los tanques de lixiviados, en pulgadas de Columna de Agua (W.C.). Las pruebas y el monitoreo de presión como se especifican en esta condición no son obligatorios ante la instalación completa de medidores de presión, como se especifica en la Condición 68.*

i. *Según la Condición No. 8 se deben presentar en el informe mensual las lecturas de presión diarias, la ubicación de las pruebas de presión, la indicación del parque de tanques representada en los resultados de las pruebas e indicación de cada uno de los tanques dentro del parque de tanques, representada por los resultados de las pruebas.*

E. *Para el 28 de junio de 2024, a menos que el AQMD de la Costa Sur apruebe otra cosa por escrito, instalar medidores de flujo dentro de los cabezales de las tuberías se HDPE para los parques de tanques de lixiviados asociados, para medir y registrar con precisión el índice de flujo (scfm) y el volumen diario total de vapores ventilados de los tanques de lixiviados que se envían a la estación de antorchas para su combustión. Los medidores de flujo deben instalarse en cumplimiento con las especificaciones y recomendaciones del fabricante para asegurar que las lecturas del flujo sean exactas.*

i. *El índice de flujo diario (scf/día), la ubicación de los medidores de flujo, la indicación del parque de tanques cuyo flujo se está midiendo y la indicación de cada tanque dentro del parque de tanques con ventilación y representada en el índice de flujo deben ser presentados en el informe mensual según la Condición No. 8.*

Conforme a la Condición No. 77, en la parte relevante, estos informes mensuales también deben incluir lo siguiente:

El demandado deberá realizar una vigilancia aérea por toda la superficie del vertedero mensualmente y sobre la Zona Reactiva definida en la Condición 9(a) todas las semanas, empleando un dron equipado con sensores con un nivel de detección mínimo de 1 ppmv de metano y conforme a OTM-51. Si alguna lectura de la vigilancia aérea llega o excede los 200 ppmv de metano, el Demandado deberá realizar inspecciones de campo de seguimiento para monitorear las emisiones superficiales en el suelo, según los procedimientos de OTM-51 y el Método 21 de la EPA de EE. UU., a menos que el Demandado no pueda monitorear las ubicaciones en cuestión debido a

que no se puede acceder o a condiciones peligrosas para un técnico. La inspección de seguimiento debe realizarse dentro de las 2 horas desde que se toma conocimiento de las excedencias en las vigilancias aéreas. Si se descubre o se confirma una excedencia de 500 ppmv de metano durante la inspección de seguimiento, el Demandado deberá implementar acciones correctivas dentro de los 2 días calendario, que incluyan, de forma enunciativa más no limitativa, mantenimiento o reparación de la cubierta geosintética, mantenimiento o reparación de la cubierta del vertedero, ajustes de vacío del campo de pozos y mantenimiento o reparación de tuberías/componentes de gases. El Demandado deberá desarrollar 1) un mapa geoespacial de metano interpolado, con coordenadas en colores, que exhiba los resultados del valor absoluto de las lecturas de metano,
2) un mapa geoespacial de metano interpolado coordinado, con colores, que exhiba el cambio en las lecturas de metano, comparadas con la vigilancia aérea previa y 3) un mapa que exhiba las coordenadas de la geoubicación con los picos de metano locales y verificación del pico de seguimiento en tierra y 4) un mapa que exhiba la ruta de vuelo del dron. El mapa de metano local pico (mapa No. 3) deberá incluir una leyenda en colores para diferenciar las ubicaciones que muestran las lecturas de metano de 1) < 200 ppmv, 2) ≥ 200 y < 500 ppmv, 3) ≥ 500 y < 1,000 ppmv, 4) ≥1,000 y < 2,000 ppmv, 5) ≥2,000 y < 5,000 ppmv y 6) ≥ 5000 ppmv o como lo apruebe de cualquier manera por escrito el AQMD de la Costa Sur. Los mapas interpolados que exhiban el valor absoluto (mapa No. 1) y el cambio en las lecturas de metano (mapa No. 2) deben incluir una leyenda de los colores, para diferenciar la magnitud de la lectura determinada por el Demandado o como lo solicite el AQMD de la Costa Sur de otra manera. Los mapas, las mediciones y las ubicaciones de las inspecciones de campo de seguimiento con las fechas/horas asociadas, las causas de las excedencias (500 ppmv para metano o mayores), las acciones correctivas realizadas y la documentación (fecha, hora, justificación) de las inspecciones de campo no realizadas debido a que no se puede acceder al lugar o a condiciones peligrosas, deberán entregarse en el informe del mes siguiente conforme a la Condición 8(c). Deben proporcionarse al AQMD de la Costa Sur los datos crudos que se utilizaron para crear cualquiera de los documentos arriba indicados, dentro de los 5 días hábiles desde la solicitud.

Conforme a la Condición No. 80, estos informes mensuales también deben incluir lo siguiente:

> *Cuando el AQMD de la Costa Sur haya permitido equipos en Varios Lugares o cuando se traigan o se operen en el sitio equipos permitidos por la Registración de Equipos Portátiles del Estado (PERP) de CARB, el Demandado deberá:*
>
> a. *Informar al AQMD de la Costa Sur por escrito la fecha y hora en la que se trajeron los equipos a las instalaciones en el informe mensual correspondiente según la Condición No. 8 e incluir una copia de los permisos en los varios lugares y/o los permisos de PERP en el informe mensual correspondiente según la Condición No. 8.*
> b. *Mantener un registro diario que incluya la siguiente información para cada unidad de permiso: número de permiso y/o número de registración, número de solicitud (si corresponde), ubicación de los equipos y hora de inicio y fin de la operación de los equipos (según corresponda). El Demandado deberá presentar el registro diario en el informe mensual correspondiente según la Condición No. 8.*
> c. *Informar al AQMD de la Costa Sur por escrito la fecha y hora en la que se retiró el equipo del lugar, en el informe mensual correspondiente, según la Condición No. 8.*

<u>Sección A - Mediciones de Compuestos de Azufre LFG Durante el Período del Informe</u>

Las mediciones de compuestos de azufre LFG y los análisis de laboratorio con la hora y fecha de cada medición o toma de muestra, como se identifican en la Condición No. 5.

> ***Condición No. 5: El demandado deberá tomar muestras, analizar y registrar los compuestos de azufre del biogás que hicieron combustión en cada antorcha (medidos en el lugar de la toma de muestra FL-150 que***

es representativa del gas que hizo combustión en las antorchas bajo el Permiso G73696, A/N 45450; A/N 624296), en el oxidante térmico/antorcha y en cualquier otro equipo de control de biogás que opere en el sitio, por lo menos una vez por semana utilizando pruebas colorimétricas para H2S y muestras tomadas por lo menos una vez al día para el análisis de compuestos de azufre total como H2S usando el Método 307-91 del AQMD de la Costa Sur. Además, el demandado deberá tomar muestras, analizar y registrar los compuestos de azufre de biogás y los compuestos orgánicos de especiación encontrados en el biogás crudo, previo al tratamiento y previo al control, tomado del Área de Reacción (como se define en la Condición 9(a)) por lo menos una vez por mes calendario, para compuestos de azufre total como H2S utilizando el Método 307-91 de South Coast AQMD y para compuestos orgánicos de especiación utilizando el Método TO-15 de la Agencia de Protección Ambiental de EE.UU. (EPA).

a. El demandado deberá registrar el análisis del Método 307-91 del AQMD de la Costa Sur al recibir el informe de los análisis de laboratorio. Cada medición o resultado registrado debe documentarse con la hora y fecha en la que se realizó la medición o toma de muestra y debe ser inicializada por el personal que condujo la medición o la toma de muestra.

b. Las lecturas y los análisis de compuestos de azufre deben ser reportados al AQMD de la Costa Sur conforme a la Condición No. 8.

i. Las bolsas de Tedlar usadas para la toma de muestras y análisis del Método 307-91 no deben contener microgotas ni residuos.

ii. Las lecturas del tubo colorimétrico deben ser realizadas tomando una lectura de una muestra de una bolsa de Tedlar usando una bomba de toma de muestras de tubos colorimétricos apropiada. Todas las tomas de muestras deben ser realizadas conforme al manual operativo para la bomba de toma de muestras de tubos colorimétricos.

iii. Las lecturas del tubo colorimétrico deben usar tubos colorimétricos de rangos de concentraciones apropiados y deben ser reportados de la siguiente manera:

1. El demandado primero debe utilizar el tubo colorimétrico del rango estimado correcto.

2. Si la lectura resultante llega a la concentración superior del rango de concentración del tubo colorimétrico, las lecturas posteriores deben tomarse usando un tubo colorimétrico con un rango de concentración que tenga un umbral de concentración superior mayor hasta que el resultado no sea el umbral de concentración superior del rango de concentración. Informe el rango de concentración del tubo y el resultado de la concentración del tubo de cada lectura.

3. Si la lectura da como resultado la concentración más baja del rango de concentración del tubo colorimétrico o no

registra un resultado, deberán tomarse lecturas posteriores usando un tubo colorimétrico con un rango de concentración que tenga un umbral de concentración más pequeño, más bajo, si hay disponible, hasta que los tubos colorimétricos disponibles en el centro den como resultado:

a. Una lectura que esté dentro del rango de concentración del tubo.

b. Una lectura es la concentración más baja del rango de concentración del tubo colorimétrico o

c. El tubo colorimétrico no registra un resultado.

4. Cuando el resultado es la concentración más baja del rango de concentración del tubo colorimétrico o no registra un resultado, la concentración más baja del tubo colorimétrico debe ser considerada el resultado de la concentración. Informe el rango de concentración del tubo y el resultado de la concentración del tubo de cada lectura. Si no se usa un tubo colorimétrico de rango más bajo y el resultado de la concentración del tubo está por debajo del rango inferior del tubo colorimétrico utilizado, el Demandado deberá informar el resultado como "menor que" o "<" el valor del rango inferior del tubo. Al margen de lo previamente dicho, el Demandado se asegurará que el resultado del tubo colorimétrico esté por debajo del rango superior del tubo colorimétrico usado y deberá informar el resultado preciso de todos los resultados que estén por encima del rango más bajo del tubo colorimétrico utilizado.

Los análisis de laboratorio realizados y los informes recibidos para el período de los informes que requieren la Condición 5 se presentan en el **Adjunto A**. Las muestras de FL-1995 (Antorcha 1), FL-2009 (Antorcha 2) y FL-2023 (Antorcha 3) son representativas del biogás que hizo combustión en las antorchas bajo el Permiso G73696 (A/N 645450; A/N 624296) en los oxidantes térmicos (TOx) y en cualquier otro equipo de LFG que opere en el sitio. La muestra de Entrada de Zeeco, Parnel y Hero son de biogás (LFG) crudo, previo al tratamiento y previo al control, tomada del Área de Reacción. Este informe incluye datos analíticos de muestras tomadas entre el 1 de febrero de 2026 y el 28 de febrero de 2026. Las muestras de las bolsas de Tedlar fueron tomadas y analizadas utilizando el Método 307.91 de SCAQMD para observar la presencia de ácido sulfhídrico, compuestos de azufre reducido, monóxido de carbono (CO), gases permanentes (metano, dióxido de carbono, oxígeno y nitrógeno) y compuestos orgánicos de especiación. Se toman muestras de los compuestos orgánicos de especiación utilizando el Método TO-15 de EPA. Se tomaron muestras de FL-2009 y de los TOx Hero, Parnel y Zeeco para el análisis TO-15 el 4 de febrero de 2026 (informado el 27 de febrero de 2026 y el 3 de marzo de 2026).

Los análisis colorimétricos semanales (tubo Dräger) requeridos y realizados conforme a la Condición 5(b)(ii) y (iii) se identifican en el **Adjunto F**. Las pruebas colorimétricas diarias comenzaron el 14 de febrero de 2024 como lo requiere la Regla 431.1 Plan de Monitoreo Alternativo con azufre total reducido (TRS) por encima de las 150 partes por millón por volumen (ppmv).

En la siguiente tabla se proporciona un resumen de las pruebas colorimétricas y de los análisis de laboratorio de azufre de LFG, que abarca el período de febrero de 2026:

Date Sampled	Permanent Flare Station					Zeeco TOx (Reaction Area)				Parnel TOx (Reaction Area)				Hero TOx (Reaction Area)			
	Flare*	Draeger Tube (ppmv)	Lab Analysis (ppmv)			Draeger Tube (ppmv)	Lab Analysis (ppmv)			Draeger Tube (ppmv)	Lab Analysis (ppmv)			Draeger Tube (ppmv)	Lab Analysis (ppmv)		
		H2S	H2S	DMS	TRS	H2S	H2S	DMS	TRS	H2S	H2S	DMS	TRS	H2S	H2S	DMS	TRS
02/01/26	FL-2009	100	151.0	281	531.7	170	256.0	280	644.4	140	173.0	681	1130.9	120	160.0	689	1132.4
02/02/26	FL-1995	100	120.0	269	472	150	228.0	282	611.4	160	157.0	620	1030.8	130	168.0	697	1153.8
02/03/26	FL-2009	120	161.0	267	522	210	227.0	257	568.7	150	163.0	653	1081.7	110	168.0	729	1215.9
02/04/26	FL-2009	80	145.0	247	479.1	175	225.0	245	549.4	125	155.0	584	979.5	120	178.0	757	1267.1
02/05/26	FL-1995	80	143.0	220	444.6	180	245.0	276	607.6	120	173.0	656	1102.2	120	174.0	732	1231.1
02/06/26	FL-2009	90	152.0	238	476.5	150	235.0	269	591.1	100	157.0	578	977.6	150	166.0	679	1144.5
02/07/26	FL-1995	100	120.0	291	511.1	250	266.0	284	645.1	170	188.0	779	1296.1	140	141.0	505	860.1
02/08/26	FL-1995	65	108.0	284	491.3	100	260.0	290	645.6	110	189.0	836	1392.8	100	162.0	630	1063
02/09/26	FL-1995	80	141.0	273	510.9	200	271.0	296	662.2	120	186	768	1277.8	100	173	600	1031.7
02/10/26	FL-1995	100	176.0	325	630.3	200	215.0	304	616.2	190	192	821	1383.7	100	137	385	633.4
02/11/26	FL-1995	160	167.0	261	532.8	180	190.0	301	585.4	210	211	698	1208.3	180	152	589	988.3
02/12/26	FL-2009	180	176.0	202	457	100	94.3	324	524.4	230	203	813	1368.9	180	152	711	1166.8
02/13/26	FL-2009	140	182.0	204	463.5	100	89.4	278	450.5	210	213	889	1484	200	163	731	1200.4
02/14/26	FL-2009	110	164.0	196	431.4	80	86.7	347	545.9	200	212	895	1489.6	200	156	706	1166.7
02/15/26	FL-2009	120	176.0	193	443.3	85	111.0	431	703.1	200	211	875	1458.9	160	177	792	1311.2
02/16/26	FL-2009	140	163.0	166	392.2	100	103.0	337	563.3	200	230.0	841	1434.5	200	181.0	773	1289
02/17/26	FL-2009	160	165.0	179	414.4	100	88.0	324	525.9	210	194.0	798	1332.2	200	170.0	793	1302
02/18/26	FL-2009	160	158.0	223	471.7	80	90.1	316	516.6	160	182.0	765	1259.7	200	172.0	747	1250.8
02/19/26	FL-2009	120	169.0	185	423.2	80	91.5	283	473.1	210	187.0	778	1289.5	200	162.0	729	1202.4
02/20/26	FL-2009	150	146.0	157	363.7	90	79.9	288	468.1	220	177.0	718	1199.5	200	153.0	744	1213.3
02/21/26	FL-2009	140	164.0	179	411.4	80	86.6	283	467.8	180	217.0	890	1488.6	160	162.0	764	1252.2
02/22/26	FL-2009	120	166.0	186	424.6	75	92.6	308	515.7	160	183.0	826	1354.9	160	160.0	806	1304.2
02/23/26	FL-2009	140	151.0	159	370	80	80.0	249	418.3	170	165.0	739	1206.7	140	140.0	684	1109.7
02/24/26	FL-2009	150	156.0	168	389.7	80	88.4	309	507.7	200	183.0	758	1254.1	200	164.0	768	1252.5
02/25/26	FL-2009	130	141.0	154	352.6	80	82.4	256	431.5	190	174.0	763	1251.5	150	144.0	707	1145
02/26/26	FL-2009	140	146.0	168	373.3	75	94.1	341	564.9	210	195.0	891	1460.5	200	164.0	835	1352.2
02/27/26	FL-2009	135	140.0	132	323	90	89.3	310	517.4	150	146.0	672	1075.8	150	126.0	599	977.7
02/28/26	FL-2009	130	133.0	123	301.8	110	93.5	327	543.1	140	167.0	852	1346.4	140	134.0	727	1162.3

*Flare 1 is FL-1995, Flare 2 is FL-2009, and Flare 3 is FL-2023

Los análisis de laboratorio resumidos arriba están incluidos en el **Adjunto A** y en el **Adjunto F.**

Sección B - Registros y Cálculos de LFG

Los registros y cálculos de biogás identificados en la Condición No. 7 en un formato de planilla de cálculo en Microsoft Excel. Si los registros de biogás indican que algún equipo de combustión/control de biogás (antorchas u oxidantes térmicos) están fuera de línea por un período que excede los 7 días calendario consecutivos o que están fuera de línea por más de 15 días calendario en un mes del año calendario, el Demandado deberá informarlo proporcionando una descripción detallada de los motivos por los que el equipo estuvo fuera de línea (rotura del equipo, mantenimiento, construcción, si hubo suficiente redundancia para controlar el biogás recolectado, etc.)

Condición No. 7: El demandado deberá mantener un registro de la siguiente información y proporcionarle estos registros al AQMD de la Costa Sur conforme a la Condición No. 8:

a. El flujo de biogás por hora y por día incinerado, en pies cúbicos, en cada antorcha (antorchas No. 1 y No. 2 bajo el Permiso G73696, A/N 645450; antorcha No. 3 bajo A/N 624296), el oxidante térmico/antorcha (bajo A/N 653611 de Zeeco) y cualquier otro equipo usado para quemar o controlar biogás en las instalaciones, como también la cantidad total de biogás incinerado en las instalaciones;

b. El flujo o biogás diario no incinerado, en pies cúbicos estándar, si corresponde; y

c. Los resultados de las lecturas de azufre, las tomas de muestras y los análisis calculados como H2S con la hora y fecha en la que se tomó cada medición o en la que se tomó cada muestra.

Los análisis de laboratorio arriba mencionados requeridos por la Condición 7(c) están incluidos en el **Adjunto A** y los cálculos están disponibles en el **Adjunto B**.

Conforme a la Condición 7(a), los índices de flujo de cada antorcha como pies cúbicos estándar por minuto, scf por hora y scf por día se indican en las tablas de los cálculos y el flujo por hora y por día de LFG incinerado para el TOx Zeeco, el TOX Parnel y el TOX Hero está disponible en el **Adjunto B**.

Conforme a la Condición 7(b), el flujo diario de LFG sin quemar se encuentra en el Adjunto B. La Planta Ameresco estuvo fuera de línea todo el mes y cada una de las antorchas experimentó períodos de inactividad varios días; hubo cero (0) días que incluyeron excesos de emisiones de LFG no quemado en febrero de 2026, como se muestra en el Adjunto B. La Planta de Ameresco ha estado fuera de línea desde el 31 de enero de 2024, ya que Ameresco determina la disposición correcta de su condensado. Ningún equipo de combustión/control de biogás

estuvo fuera de línea por un período que exceda los 7 días calendario consecutivos ni por más de 15 días calendario en febrero de 2026.

Sección C - Monitoreo de las Emisiones en la Superficie

El análisis integrado de la muestra de la superficie del vertedero y las lecturas de los monitoreos de la superficie del vertedero identificados en las Condiciones No. 9 y 10, en un formato de planilla de cálculo en Microsoft Excel.

Condición No. 9: El Demandado deberá tomar muestras integradas de la superficie del vertedero para analizarlas en toda la Zona Reactiva (como se define en la Condición 9(a)) por lo menos tres veces al mes, en intervalos de no más de una vez cada 7 días (a menos que se conduzcan otros eventos de monitoreo que excedan las tres veces por mes) y además en todo el resto del vertedero, por lo menos cuatro veces por trimestre, como se especifica en el Regla 1150.1 en el Adjunto A 2.0. En el caso de que el Demandado no pueda tomar muestras en áreas o cuadrículas específicas de la superficie del vertedero debido a que no son accesibles o a condiciones peligrosas para un técnico, el Demandado deberá documentar la fecha y las condiciones que no permiten la toma de muestras en las áreas o cuadrículas específicas. La documentación deberá ser suficiente para demostrar la inaccesibilidad o las condiciones peligrosas y podrá incluir pronósticos climático y mediciones de lluvias reales o fotografías y/o videos que exhiban las condiciones del sitio que no permitan que se realicen estas actividades de toma de muestras en cada área o cuadrícula específica afectada.

a. *El "Área de Reacción" deberá definirse inicialmente con los límites de las Celdas 1/2A, 2B/3, 4 y el Módulo 2B/3/4 P2. Los límites el Área de Reacción deberán modificarse para que incluyan el área de la superficie del vertedero asociada de las celdas y módulos que experimenten temperaturas de pozos de por lo menos 170 grados Fahrenheit, los asentamientos, las grietas en la cubierta del vertedero, la presencia y la cantidad de líquidos, la presencia de hidrógeno en el biogás y las lecturas de las sondas de temperatura (una vez que estén disponibles los datos). El Comité de Reacciones (definido en la Condición 12) deberá transmitir al AQMD de la Costa Sur [att.: Baitong Chen, bchen@aqmd.gov; Nathaniel Dickel, ndickel@aqmd.gov; Christina Ojeda, cojeda@aqmd.gov]: 1) el mapa revisado que muestre claramente los cambios propuestos en los límites y exhiba la nueva Área de Reacción; 2) un resumen narrativo que explica el razonamiento detrás de los cambios propuestos, que incluye conmemorar y discrepara de las opiniones de cualquier miembro del Comité de Reacciones; 3) todo dato de soporte del que se haya dependido al tomar la decisión de revisar el Área de Reacción; y 4) ubicaciones de cada sonda de temperatura, claramente distinguidas de los pozos de biogás en el mapa.*

b. *El Comité de la Reacción revisará los datos aplicables para determinar el alcance y el límite de la Reacción en curso. El Comité de la Reacción considerará la revisión de este límite de la Reacción determinado por datos y la Zona Reactiva definida en la Condición 9(a) con la frecuencia que sea apropiada, pero deberá tomar una determinación sobre si revisará el límite de la Reacción determinado por datos y sobre el mapa de la Zona Reactiva de la Condición 9(a) por lo menos una vez por mes. La determinación debe hacerse según las temperaturas del cabezal del pozo de biogás, las mediciones de las sondas de temperatura, la calidad del biogás*

y la relación metano-CO2, las concentraciones de monóxido de carbono e hidrógeno en el biogás, el asentamiento del vertedero, las cantidades de lixiviados, las liberaciones de lixiviados presurizados, las características del olor y las condiciones de los desechos, conforme a los registros de perforación del pozo. La evidencia de respaldo, hipótesis y explicación sobre la determinación, límite revisado de la Reacción, mapa de la Zona Reactiva (si corresponde), mapa del rango de gradiente isotérmica que consiste de mediciones de temperatura en el cabezal del pozo, mapa del rango de hidrógeno en el cabezal del pozo, mapa del rango de la relación de CH4:CO2 en el cabezal del pozo, mapa isopáquico del asentamiento trimestral del vertedero y perfiles de temperatura vertical de las sondas de temperatura [atención: Baitong Chen, bchen@aqmd.gov; Nathaniel Dickel, ndickel@aqmd.gov; Christina Ojeda, cojeda@aqmd.gov] dentro de los 10 días desde que termina el mes.

Condición No. 10: El Demandado deberá realizar un monitoreo instantáneo de la superficie del vertedero para analizarlas en toda la Zona Reactiva (como se define en la Condición 9(a)) por lo menos tres veces al mes, en intervalos de no más de una vez cada 7 días (a menos que se conduzcan otros eventos de monitoreo que excedan las tres veces por mes) y además en todo el resto del vertedero, por lo menos cuatro veces por trimestre, como se especifica en el Regla 1150.1 en el Adjunto A 3.0., comenzando a más tardar siete (7) días después de emitida esta Orden. En el caso de que el Demandado no pueda monitorear en áreas o cuadrículas específicas de la superficie del vertedero debido a que no son accesibles o a condiciones peligrosas para un técnico, el Demandado deberá documentar la fecha y las condiciones que no permiten el monitoreo de las áreas o cuadrículas específicas.

- Las tomas de muestras integradas de la superficie del vertedero de febrero se completaron el 4, 5, 9, 10, 23, 24, 25 y 26 de febrero de 2026, dando como resultado excedencias el 4, 5, 9 y 23 de febrero de 2026.
    - El 12 de febrero de 2026 se completaron la Acción Correctiva de 10 días y el monitoreo de seguimiento para los excesos del 4 y 5 de febrero de 2026 que indicaron lecturas en cumplimiento.
    - El 20 de febrero de 2026 se completaron la Acción Correctiva de 10 días y el monitoreo de seguimiento para los excesos del 9 de febrero de 2026 que indicaron lecturas en cumplimiento.
    - El 4 de Marzo de 2026 se completaron la Acción Correctiva de 10 días y el monitoreo de seguimiento para los excesos del 23 de Febrero de 2026 que indicaron lecturas en cumplimiento.

- El monitoreo instantáneo de la superficie del vertedero de febrero se realizó el 2, 3, 4, 10, 13, 20 y 21 de febrero de 2026, dando como resultado excesos el 2, 3, 10, 13, 20 y 21 de febrero de 2026.
    - El 12 de febrero de 2026 se completaron la Acción Correctiva de 10 días y el monitoreo de seguimiento para los excesos del 2 y 3 de febrero de 2026 que indicaron lecturas en cumplimiento.
    - El 20 de febrero de 2026 se completaron la Acción Correctiva de 10 días y el monitoreo de seguimiento para los excesos del 10 de febrero de 2026 que indicaron lecturas en cumplimiento.

- El 25 de febrero de 2026 se completaron la Acción Correctiva de 10 días y el monitoreo de seguimiento para los excesos del 13 de febrero de 2026 que indicaron lecturas en cumplimiento.

- El 27 de febrero de 2026 se completaron la Acción Correctiva de 10 días y el monitoreo de seguimiento para los excesos del 20 y 21 de febrero de 2026 que indicaron lecturas en cumplimiento.

- Los eventos de remonitoreo de 1 mes para las excedencias del 2 y 3 de febrero de 2026 se realizaron el 26 y el 27 de febrero 2026 e indicaron lecturas en cumplimiento.

- Los eventos de remonitoreo de 1 mes para as excedencias del 7, 8, 16, 26, 27 y 28 de enero de 2026 se realizaron el 5, 6, 12, 25 y 26 de febrero de 2026 e indicaron lecturas en cumplimiento.

El análisis de las muestras integradas de la superficie del vertedero y las lecturas del monitoreo de la superficie del vertedero se incluyen en el **Adjunto C-1**.

Incluir en el informe mensual de la Condición 8 los tres (3) mapas de vigilancia, las mediciones y las ubicaciones de las inspecciones de campo de seguimiento con las fechas/horas asociadas, la causa de las excedencias (500 ppmv de metano o superior), las acciones correctivas asociadas y la documentación (fecha, hora, razonamiento) de las inspecciones de campo no realizadas debido a la falta de accesibilidad o a condiciones peligrosas identificadas en la Condición 77.

El contratista de Chiquita realizó una vigilancia aérea semanal sobre la Zona Reactiva definida en la Condición 9(a) el 3-4, 10, 19 y 24 de febrero de 2026, empleando un dron equipado con sensores con un nivel de detección mínimo de 1 ppmv de metano y conforme a OTM-51. Si una lectura alcanzó o excedió los 200 ppmv de metano, el consultor condujo inspecciones de seguimiento de campo para monitorear las emisiones de la superficie sobre el suelo, conforme a los procedimientos de OTM-51 y al Método 21 de la EPA de EE. UU. Si se descubrió o se confirmó alguna excedencia de 500 ppmv de metano durante la inspección de seguimiento, Chiquita implementó acciones correctivas conforme a la Condición 77. El **Apéndice C-2** incluye: una narrativa que analiza las lecturas; mapas geoespaciales de metano interpolado, coordinado con colores que exhiben los resultados con los valores absolutos de las lecturas de metano; mapas geoespaciales coordinado con colores de metano interpolado que exhiben el cambio en las lecturas de metano comparadas con la vigilancia aérea previa; mapas que exhiben las coordenadas de la geoubicación con picos de metano locales y verificación de picos de seguimiento en el suelo; un mapa que exhibe la ruta de vuelo del dron; registros de las inspecciones de campo de seguimiento con mediciones y ubicaciones de las mediciones con las fechas y horas asociadas; y un cuadro que describe las causas de las excedencias de 500 ppm de metano o mayores, como también las acciones correctivas tomadas.

<u>Sección D - Programa para Reemplazar o Reacondicionar Medios de Carbón Granular Activado</u>

Programa estimado para cualquier reemplazo o reacondicionamiento de medios de carbón granular activado en el Sistema de Tratamiento de Biogás (bajo el Permiso G55163, A/N 603249) identificado en la Condición No. 3. La temperatura de biogás en la entrada del Sistema de Tratamiento de Biogás (bajo el Permiso G55163, A/N 603249) identificado en la Condición No. 3(a).

Condición No. 3: El Demandado deberá acelerar al máximo posible, el reemplazo de medios de carbón granular activado en el Sistema de Tratamiento de Biogás (bajo el Permiso G55163, A/N 603249), incluyendo la ejecución de contratos, como también la entrega, el reemplazo, la puesta en marcha y pruebas de cualquier operación necesaria para reponer y/o reemplazar los medios de carbón granular activado en el medio del Sistema de Tratamiento de Biogás.

El Demandado deberá asegurarse de que se mantenga en el sitio un inventario adecuado de todos los productos y suministros de control de olores.

a. El Demandado deberá monitorear y registrar la temperatura del biogás por lo menos una vez al día en la entrada del Sistema de Tratamiento de Biogás. La temperatura de biogás no debe exceder los 145 °F.

El Sistema de Tratamiento de Biogás (LFGTS) actualmente consiste en cuatro depósitos absorbedores de carbón. En general, tres de los cuatro depósitos habían estado completamente en línea durante las operaciones normales, habiendo estado un depósito fuera de línea, esperando que se le realice el servicio, para cambiar los medios usados o para colocarles medios de carbón activado granular nuevos que se pusieron en línea para controlar el aumento de la temperatura. Un depósito generalmente se mantiene cada 4 a 8 semanas. Los análisis colorimétricos se realizaron en la salida de los depósitos operativos, aproximadamente una vez por semana, para determinar si un depósito podría requerir un ajuste en el flujo o programar un servicio para reemplazar los medios.

Al inicio del período de informe (1 de febrero de 2026), hubo dos depósitos (ST-1 y ST-4) en línea procesando el LFG sin medios en el depósito ST-1. Al final del período de informe (28 de febrero de 2026), hubo dos depósitos (ST-1 y ST-4) en línea sin medios en el depósito ST-1. Los otros dos depósitos (ST-2 y ST-3) estuvieron cerrados durante todo el período de informe, debido a reparaciones en curso.

Las temperaturas en la entrada del LFGTS han estado por debajo de los 145 °F. Las temperaturas de entrada diarias de los depósitos se registran manualmente y están disponibles en el **Adjunto D**.

Sección E - Descripción de los Problemas o de las Demoras

Descripción de los problemas o demoras, si hubo, encontrados o que se proyectaron que podrían ocurrir pertinentes a la ejecución de contratos, como también la entrega, el reemplazo, la puesta en marcha y pruebas de cualquier operación necesaria para reponer y/o reemplazar los medios de carbón granular activado en el Sistema de Tratamiento de Biogás (bajo el Permiso G55163, A/N 603249). El demandado deberá presentar copias de los documentos o de otros registros para respaldar cualquier problema o demora notados conforme a esta Condición No. 8(e) junto con esta descripción.

El 31 de diciembre de 2025 el depósito ST-3 fue llevando lentamente a la línea para controlar el aumento de temperatura del gas de salida, pero se cerró el 12 de enero de 2026 después de haberse obtenido lecturas de temperaturas elevadas en la salida y de la observación de un área localizada de temperatura elevada en la superficie en el depósito. Según el aviso del 12 de enero de 2026 entregado al AQMD de la Costa Sur, el cierre fue necesario para enfriar el depósito y evitar daños. El depósito ST-2 también se cerró en enero de 2026; habrá más detalles en el siguiente informe mensual. El 23 de enero de 2026, se quitó el medio de carbono activado granular del depósito ST-1 y se cambió el filtro de la pantalla. No se instalaron medios y se puso en línea el depósito ST-1. El intervalo de los cambios se suspendió debido a los problemas en los depósitos, como se mencionó arriba.

Sección F - Especificaciones de los Equipos y Materiales para las Pruebas Colorimétricas Semanales

Especificaciones de los equipos y materiales utilizados para las pruebas colorimétricas semanales (solo si hay un cambio con relación a las especificaciones previamente indicadas de la instrumentación colorimétrica o método utilizados).

Las pruebas colorimétricas semanales se completan con la bomba de mano de fuelle Draeger Accuro 64000 con tubos colorimétricos de ácido sulfhídrico Draeger Modelo 6728821 (2 a 200 ppm) o Modelo CH29801

(5 a 60 ppm). Con concentraciones más altas en el TOx Zeeco se utilizan tubos colorimétricos Modelo CH29101 (100 a 2000 ppm). Las especificaciones de los equipos y materiales que fueron utilizados para la prueba colorimétrica fueron incluidas previamente en el informe inicial de variaciones semanales el 13 de febrero de 2023 en el Caso No. 6177-3, como se requiere según la variación de emergencia previa, en el informe de marzo de 2024 con el agregado de la hoja de datos del modelo CH29101 y en el informe de marzo de 2025 con el agregado de la hoja de datos del modelo CH29801 (2 a 60 ppm).

Sección G - Mediciones de Temperatura y de Gas en el Cabezal del Pozo

> **Todas las mediciones de temperatura de cabezales de pozos, de sondas de temperatura y de concentraciones de CO de los pozos que requieren datos analíticos, mediciones de concentración de H2 de los pozos que requieren datos analíticos, mediciones de CH4, mediciones de O2, mediciones de CO2, relaciones de CH4:CO2, análisis de laboratorio y lecturas de tubos Draeger de biogás del mes pasado en formato de hoja de cálculo en Microsoft Excel.**

Las lecturas de temperatura del cabezal del pozo, de la sonda de temperatura, de CO, H2, CH4, O2, CO2 requeridas con las relaciones de CH4:CO2 del último mes se incluyen en el **Adjunto E**. Los análisis de laboratorio y las lecturas del tubo Draeger del último mes están incluidos en el **Adjunto A** y en el **Adjunto F**, respectivamente.

Se instalaron las 20 sondas de monitoreo de temperatura originales (TP-1 a TP-20) y otras 20 sondas de monitoreo de temperatura adicionales (TP-21 a TP-40) y están operativas a febrero de 2026. Los datos promedio diarios de las sondas de temperatura del último mes están incluidos en el **Adjunto E**.

Sección H - Mapa Gráfico

> **Un mapa gráfico que muestra la ubicación de cada pozo que excede la temperatura (por encima de los 145 grados Fahrenheit), mediciones de CO de cada pozo (por encima de los 1,000 ppmv menores o iguales a 1,500 ppmv, por encima de los 1,500 ppmv y menores o iguales a 2,000 ppmv y por encima de los 2,000 ppmv) y estratificación de los rangos de temperatura durante ese mes, que incluye una descripción de las medidas de remediación tomadas para tratar o reducir temperaturas de pozos de gas y las concentraciones de gases.**

Se incluyen mapas gráficos con la información arriba indicada, en el **Adjunto G**. Se está extrayendo un mayor volumen de gas y lixiviados de pozos de temperatura elevada ubicados en el Área de Reacción, para ayudar remover el calor acumulado en la masa de residuos.

Sección I - Estado de los Pozos Verticales de Biogás Impactados con Líquidos

> **Todos los pozos verticales de biogás impactados con líquidos, según la Condición No. 17, incluyendo una descripción de las medidas de remediación tomadas para tratar o reducir líquidos en pozos de biogás.**
>
> > *Condición No. 17: El Demandado deberá desagotar inmediatamente los pozos que son impactados con líquidos lo máximo posible y deberá tomar medidas proactivas para remover otros líquidos del Área de Reacción, para limitar la gravedad de la reacción y su propagación. Esto deberá lograrse mediante la instalación de sumideros/bombas de desagüe en por lo menos el 60 por ciento de los pozos verticales de extracción de biogás en el Área de Reacción (como se define en la Condición 9(a)) que sean capaces de extraer líquidos antes del 15 de marzo de 2024, a menos que se determine que no es viable, según la Condición No. 17 indicada a continuación. El Demandado deberá proporcionar actualizaciones en los informes mensuales, conforme a la Condición No. 8.*

a. En el caso de que el Demandado determine que no es viable la instalación de un sumidero/bomba de desagüe en por lo menos el 60 por ciento de los pozos verticales de extracción de biogás que sean capaces de extraer líquidos, el Demandado deberá proporcionar una justificación y un razonamiento detallados en el informe mensual presentado conforme a la Condición No. 8 y deberá continuar con la implementación de las pautas para desagotes en cumplimiento con la Condición No. 18, para remover líquidos lo máximo posible.

Chiquita continuó instalando bombas nuevas y reemplazando bombas existentes en pozos de extracción vertical para desagotar de forma expeditiva los pozos impactados por líquidos en el mes de febrero de 2026. Al 5 de marzo de 2026 Chiquita había completado la instalación y estaba operando 38 bombas en pozos verticales de extracción. Chiquita retiró varias bombas de servicio durante el mes de febrero debido en gran parte a la menor capacidad de disposición de lixiviados fuera del sitio y al despliegue en curso de la cubierta de geomembrana de EVOH/HDPE. Chiquita continuó instalando más infraestructura para lixiviados y para la línea de suministro de aire e infraestructura eléctrica preparándose para la instalación de más bombas y continuó limpiando y realizando el mantenimiento de las bombas ya instaladas

Sección J - Estado de la Investigación de Sistemas de Tratamiento de Compuestos de Azufre Alternativos

Actualizaciones sobre la investigación relacionada con la disponibilidad, viabilidad y utilización, incluyendo pruebas piloto si son necesarias, de un sistema de tratamiento de compuestos de azufre alternativo que controle, trate o remueva sulfuro de dimetilo ("DMS") y otros compuestos de azufre, si hubiera.

No hay actualizaciones para febrero de 2026. Chiquita considera la investigación de la disponibilidad, la viabilidad y la utilización de un sistema de tratamiento de compuestos de azufre alternativo que controle, trate o remueva el DMS y otros compuestos de azufre completos después de la presentación al SCAQMD de los resultados de su investigación y la debilidad de la viabilidad de las alternativas identificadas por los consultores de Chiquita.

Sección K - Mejoras Implementadas por SCS

Un informe resumido de las mejoras implementadas en el sistema de recolección de biogás por el Demandado más allá de los agregados al sistema de recolección de biogás requeridos según la Condición No. 15 y 8(m).

Además de la instalación de la bomba, Chiquita continuó la expansión de los cabezales y los laterales y la infraestructura de recolección de lixiviados en febrero de 2026 incluyendo la optimización de las tres unidades TOx. Chiquita completó el proceso de instalar una tercera TOx (la Hero TOx), además de los cabezales asociados a la TOx, y la TOx comenzó a estar en línea en septiembre de 2025, para continuar expandiendo la capacidad de recolección de líquidos y gases. Se reubicó la Parnel TOx en septiembre de 2025, causando un período extendido en el que la TOx estuvo fuera de línea, pero comenzó a estar operativo el 5 de noviembre de 2025.

Sección L - Inspecciones de Cubiertas del Sistema de Recolección de LFG

Un registro de inspecciones de cubiertas del vertedero e inspecciones de las cubiertas geosintéticas, conforme a la Condición No. 30.

Condición No. 30: El Demandado deberá inspeccionar visualmente la cubierta del vertedero y las cubiertas geosintéticas en y alrededor del Área de Reacción (como se define en la Condición 9(a)) en cada día operativo y deberá reparar inmediatamente cualquier problema identificado en la cubierta, que podrá incluir agregar

y esparcir tierra nueva, regar o volver a armar las pistas del área dañada y reparar o volver a sellar la cubierta geosintética. Las reparaciones de la cubierta geosintética que incluyen el agregado de material para sumar o reemplazar la cubierta existente deben realizarse utilizando un EVOH, o si no hay EVOH disponible y la reparación se realiza dentro o antes de los tres meses desde la fecha en la que el DTSC aprueba el EVOH, una geomembrana de HDPE. El EVOH o la geomembrana de HDPE deben tener un espesor de por lo menos 60 milésimas de pulgada, cosida de forma continua y soldada a la geomembrana de HDPE de 30 milésimas de pulgada existente. Todas las acciones de reparación y corrección en la cubierta del vertedero y la reparación intermedia de la cubierta geosintética se realizarán inmediatamente antes de las dos horas desde que se identifican durante la inspección, si lo permite la seguridad. Deberá programarse inmediatamente la reparación permanente de la cubierta geosintética y deberá hacerse lo antes posible después de la identificación del problema en la cubierta. El Demandado deberá mantener un registro que demuestre que ha tratado todos los daños de la cubierta del vertedero o en la cubierta geosintética, que incluya la fecha en la que se identificó el daño, la acción tomada para reparar el daño y la hora a la que se completó la reparación. Los resultados de la inspección diaria y el registro de reparaciones requerido por esta condición deben incluirse en los informes mensuales requeridos conforme a la Condición No. 8.

Se realizaron y registraron las inspecciones y reparaciones de rutina en las cubiertas Septiembre vertedero y en las cubiertas geosintéticas durante todo el mes de febrero de 2026. Los resultados de las inspecciones diarias y de los registros de reparaciones se proporcionan en el **Adjunto H**.

<u>Sección M - Posteriores Agregados al Sistema de Recolección de LFG</u>

Cualquier agregado posterior al sistema de recolección de biogás, según la Condición No. 15; un mapa del pozo de extracción vertical actualizado detallando todos los pozos existentes de extracción vertical que están operando de forma completamente funcional completados dentro del mes; un mapa que muestre una plantilla de los pozos que están operando de forma completamente operativos y cuadrículas de monitoreo de la superficie del vertedero y detalles de las áreas demarcadas como exentas en el Anexo A adjunto, conforme a la Condición 15(b); copias de los registros topográficos de los pozos (en lo relacionado a las instalaciones y actualizaciones en las profundidades de los pozos) de extracción vertical completados dentro del mes; y un mapa o plano actualizado de la infraestructura de recolección y transporte de biogás conforme a obra, actualizado con respecto a cualquier modificación sustancial en los cabezales principales del sistema de recolección y control de biogás, con los límites de la Zona Reactiva incluidos.

Condición No. 15: El Demandado deberá continuar evaluando e instalando, según la necesidad, pozos verticales de extracción doble, para recolectar tanto biogás como lixiviados. El Demandado deberá continuar ampliando el campo de pozos según la necesidad y deberá informar al AQMD de la Costa Sur antes del 31 de octubre de 2023 la cantidad de pozos agregados, dirigidos a Baitong Chen, Ingeniero en Calidad del Aire, (bchen@aqmd.gov); Nathaniel Dickel, Ingeniero Sénior en Calidad del Aire, (ndickel@aqmd.gov) y a Christina Ojeda, Inspectora de la Calidad del Aire, (cojeda@aqmd.gov). Los agregados posteriores al campo de pozos deben ser documentados en los informes mensuales, conforme a la Condición 8. Al instalar pozos adicionales, el Demandado deberá asegurarse de que cumplen con todas las condiciones del permiso para sistemas de recolección de biogás actualmente operativos del Demandado. Al instalar otros pozos conforme a esta Condición, el Demandado además deberá tomar las siguientes medidas: (...)

En el mes de febrero de 2026 no se instalaron pozos de extracción vertical de LFG dentro ni fuera de la Zona Reactiva 9(a). En el **Adjunto I** se incluyen un mapa de todos los pozos funcionales instalados, cuadrículas de monitoreo de la superficie y

detalles de las áreas definidas como exentas. Los posteriores agregados al sistema serán documentados en estos informes mensuales. Chiquita completó previamente la instalación de un total de 247 pozos dentro de la zona reactiva 9(a), llevando la cantidad total de pozos instalados dentro de la zona reactiva 9(a) a una cantidad mayor a la densidad requerida de tres (3) pozos por acre (equivalente al 113%).

> *Condición No. 15(o): El demandado deberá determinar todos los meses si alguno de los pozos de recolección de biogás existentes en la Zona Reactiva (definida en la Condición 9(a)), que no pudimos perforar e instalar a la profundidad del pozo deseada (generalmente 30 pies por encima del revestimiento inferior), puede ampliarse a una mayor profundidad o perforarse para alcanzar la profundidad deseada inicialmente o si pueden perforarse cerca pozos de reemplazo nuevos para alcanzar la profundidad deseada inicialmente. Esta determinación deberá incluir una evaluación de las condiciones del pozo/cabezal de biogás, los datos del fujo de líquidos/lixiviados del vertedero, los datos de liberación de líquidos/lixiviados presurizados y los datos del biogás, los datos de la temperatura del cabezal del pozo., los datos de las sondas de temperatura y cualquier otro parámetro adicional que sea necesario. El demandado además deberá informar en la determinación mensual, cualquier evidencia o razonamiento que respalde la determinación, como parte del informe mensual conforme a la Condición No. 8, comenzando con el informe presentado en octubre de 2024 que abarca datos de septiembre de 2024.*

Chiquita revisó en febrero de 2026 los niveles de líquido de los pozos instalados en la Zona Reactiva 9(a) para determinar si alguno de los pozos que acaban de instalarse podrían ampliarse a mayores profundidades. Se determinó que todos los pozos dentro de la Zona Reactiva 9(a) continúan funcionando desde un flujo de gas y líquido, indicando que los cabezales están intactos. En base a los datos incluidos sobre los lixiviados, los datos de las sondas de temperatura y los datos de monitoreo de biogás, que incluyen la temperatura, todos los pozos que están en la Zona Reactiva 9(a) fueron productivos. Mientras que los niveles de lixiviados dentro de los pozos se han reducido, ninguno de estos pozos dentro de la Zona Reactiva 9(a) se desagotaron hasta el punto de requerir pozos más profundos para continuar extrayendo líquidos y biogás más profundos.

En el **Adjunto I** se proporciona un plano actualizado según diseño de la infraestructura de recolección y transporte de biogás. Como se explicó en las actualizaciones semanales de Chiquita que se le proporcionaron por separado al AQMD de la Costa Sur, se están modificando varios cabezales y laterales y debido a la cantidad de trabajo que se está realizando se debió realizar un estudio completo de las tuberías para actualizar los planos. El plano adjunto según el diseño muestra las ubicaciones de los nuevos pozos instalados hasta el 4 de marzo de 2026.

<u>Sección N - Agregados al Sistema de Recolección de Consensado de LFG y Lixiviados</u>

> **Agregados posteriores al sistema de condensado de biogás y de recolección de lixiviados, como sumideros/bombas de desagüe u otros trabajos de desagote realizados según las pautas para desagote y el plan de implementación conforme a la Condición No. 18.**
>
> > *Condición No. 18: El Demandado, además de la instalación de los sumideros/las bombas desagüe especificados en la Condición No. 17 arriba indicada, dentro de los noventa (90) días desde la emisión de la Orden Inicial, deberá proporcionar las pautas y los procedimientos de implementación de desagüe del Área de Reacción propuestos para el vertedero al AQMD de la Costa Sur (Baitong Chen, Ingeniero en Calidad del Aire, (bchen@aqmd.gov); Nathaniel Dickel, Ingeniero Sénior en Calidad del Aire, (ndickel@aqmd.gov)) que incluyan, de forma enunciativa, más no limitativa, lo siguiente: (…)*

Las pautas de desagüe fueron presentadas a SCAQMD el 5 de diciembre de 2023 y están publicadas en el sitio web de Chiquita. Las pautas modificadas para los desagües, para tratar los comentarios del SCAQMD recibidos el 13 de marzo de 2024 fueron presentadas al SCAQMD el 4 de abril de 2024. Las otras pautas modificadas para los desagües para

tratar los comentarios adicionales del SCAQMD recibidos el 21 de mayo de 2024 fueron presentadas al SCAQMD el 7 de junio de 2024.

La evaluación de pozos verticales para la instalación de bombas de desagüe es continua. Al 5 de marzo de 2026 Chiquita había completado la instalación y estaba operando 38 bombas en pozos verticales de extracción. Se pasó más tiempo más allá de la instalación de las bombas, instalando más infraestructura para lixiviados y para la línea de suministro de aire e infraestructura eléctrica y limpiando y realizando el mantenimiento de las bombas ya instaladas

Sección O - Actualizaciones sobre la Cubierta Geosintética

Actualizaciones sobre la adquisición e instalación de cubiertas geosintéticas conforme a la Condición No. 31, incluyendo los cambios requeridos o aprobados por la Agencia de Cumplimiento Local.

Condición No. 31: El Destinatario deberá instalar una cubierta geosintética sobre las partes occidentales del Módulo 2B/3/4 Fase 2, el Módulo 2B/3 y el Módulo 4 para limitar la migración de biogás del sitio. El Demandado deberá presentar al AQMD de la Costa Sur el diseño completado de la cubierta, que proporcionará una mayor definición sobre la ubicación de la cubierta, que incluya la infraestructura de extracción de biogás asociada a ser instalada debajo de la cubierta, antes del 12 de septiembre de 2023 (Baitong Chen, Ingeniero en Calidad del Aire, (bchen@aqmd.gov); Nathaniel Dickel, Ingeniero Sénior en Calidad del Aire, (ndickel@aqmd.gov), y Christina Ojeda, Inspectora de la Calidad del Aire, (cojeda@aqmd.gov)). El Demandado después deberá obtener e instalar el material de la cubierta geosintética de por lo menos 30 mil de espesor. El Demandado deberá informar al AQMD de la Costa Sur antes del 31 de octubre de 2023 (Baitong Chen, Ingeniero en Calidad del Aire, (bchen@aqmd.gov); Nathaniel Dickel, Ingeniero Sénior en Calidad del Aire, (ndickel@aqmd.gov), y Christina Ojeda, Inspectora de la Calidad del Aire, (cojeda@aqmd.gov)) sobre el progreso en la adquisición e instalación de la cubierta geosintética. El Demandante deberá incluir actualizaciones sobre la adquisición e instalación de la cubierta geosintética en los informes mensuales conforme a la Condición 8.

Al 31 de diciembre de 2024, Chiquita había instalado aproximadamente 44.6 acres de cubierta geosintética en el Vertedero, que completa la obra asociada al Objetivo 2A-1 de la Orden de Cumplimiento de la LEA emitida el 6 de junio de 2024. Además, al 3 de enero de 2025, se instalaron aproximadamente 1.3 acres de cubierta de geosintética sobre la zona de disposición, conforme al plan de trabajo de drenaje del talud oeste. El Informe de Terminación Final del Objetivo 2A-1 (Ex Medida de Mitigación #2A) se presentó el 17 de enero de 2025. La LEA, junto con el Departamento de Reciclaje y Recuperación de Recursos de California (CalRecycle), aprobó condicionalmente el Informe de Terminación Final el 9 de abril de 2025 que dependió de que Chiquita presentara un Plan de Operaciones y Mantenimiento. Chiquita presentó un Plan de Operaciones y Mantenimiento a la LEA el 9 de mayo de 2025 y un Plan de Operaciones y Mantenimiento modificado el 3 de octubre de 2025.

Además, al 27 de febrero de 2026, Chiquita había instalado aproximadamente 1,065,227 pies cuadrados de cubierta de geomembrana de EVOH/HDPE de 60 milésimas de pulgada marrón sobre la cubierta superior del Vertedero, conforme a la Medida de Mitigación 4.1 de la Orden de Cumplimiento de la LEA emitida el 1 de mayo de 2025 e instaló aproximadamente otros 140,955 de cubierta de EVOH/HDPE de 60 milésimas de pulgada sobre el área conocida como "el bol" - actualmente cubierta con cubierta de geomembrana de HDPE de 30 milésimas de pulgada. Chiquita también continuó realizando reparaciones de la cubierta de geomembrana existente de HDPE de 30 milésimas de pulgada utilizando geomembrana de EVOH/HDPE de 60 milésimas de pulgada.

Sección P - Actualizaciones de la Obra de Excavación del Vertedero Sujeta a la Regla 1150

Actualizaciones sobre el trabajo de excavación en el vertedero sujeto a la Regla 1150, incluyendo las ubicaciones de las excavaciones (identificadas en los mapas gráficos del vertedero) y características de los residuos excavados/expuestos (saturados, semisecos, secos, tipo e intensidad de olor, etc.). Los trabajos de excavación que ocurren conforme a una exención como lo indican la Regla 1150(c)(3) o la Regla 1150(c)(2) del AQMD de la Costa Sur que se realizan en esta Área de Reacción también deben incluirse en estas actualizaciones.

Chiquita no realizó ninguna obra relacionada con el proyecto de excavación de la pendiente oeste o con el proyecto de terminación del drenaje del talud; ambos proyectos están completos.

Sección Q - Actualizaciones sobre los Lixiviados

Actualizaciones sobre los lixiviados, que incluyen:

Condición No. 27: El Demandado deberá realizar las siguientes acciones e informarlas al AQMD de la Costa Sur [Baitong Chen, Ingeniero en Calidad del Aire, (bchen@aqmd.gov); Nathaniel Dickel, Ingeniero Sénior en Calidad del Aire, (ndickel@aqmd.gov), y Christina Ojeda, Inspectora de la Calidad del Aire, (cojeda@aqmd.gov)] en el informe de cada mes presentado conforme a la Condición No. 8 comenzando con el informe que debe presentarse el 19 de febrero de 2024:

i. Registros de temperatura de lixiviados conforme a la Condición No. 27(a);

a. Medir y registrar la temperatura de lixiviados dentro de todos los tubos de lixiviados de 6 pulgadas que ingresan a los tanques de fractura en el sitio y en la cañería que va hacia los tanques de todos los parques de tanques. Las mediciones de temperatura informadas deben incluir un mapa que indique claramente las ubicaciones de monitoreo de temperatura y los resultados informados deben indicar claramente qué tanques o parques de tanques están flujo abajo de la ubicación de monitoreo que recibe los lixiviados medidos;

Los datos de las temperaturas de los lixiviados de los tubos de lixiviados que ingresan a los tanques de fractura en el sitio que ingresan a los tanques de todos los parques de tanques se tomaron el 24 de febrero de 2026 y se incluyen en el **Adjunto J**.

ii. Registro diario de los hallazgos de las inspecciones y actividades de contención conforme a la Condición 27(b);

b. El Demandado debe contar con personal específico o con un contratista que conduzca y documente las inspecciones dos veces cada día calendario, una vez a la mañana, completando la inspección antes de las 10 am y una vez a la tarde, comenzando la inspección a la 1 pm a más tardar. Las inspecciones deben comenzar con la superficie de las pendientes occidental y norte del Área de Reacción para filtraciones y acumulación de líquidos/lixiviados y además deberá consistir en una inspección de los canales de aguas pluviales de las instalaciones y las cuencas de aguas pluviales de las instalaciones. El Demandado deberá mantener registros de cada inspección, que incluyan los detalles de las filtraciones y acumulaciones de lixiviados, incluyendo las ubicaciones (identificadas en los mapas gráficos del vertedero con la cuadricula del vertedero correspondiente y las coordenadas de GPS), el momento en que se descubrieron, la duración estimada de la presencia de lixiviados en esos lugares, las características del lixiviado (cantidad estimada en galones, alcance del área impactada en pies cuadrados, tipo de olor y densidad), el nivel de saturación de lixiviados de los suelos en los alrededores (con líquido libre estancado,

saturados, semisecos y secos) y otros sistemas o medidas de contención desplegados para dirigir, recolectar y contener los lixiviados expuestos y evitar una mayor exposición de los lixiviados;

i. En el caso de que dos semanas de inspecciones diarias realizadas dos veces al día demuestren que no hay filtración o acumulación de líquidos/lixiviados, el Demandado podrá reducir la frecuencia de las inspecciones a una vez al día. Si después de otras dos semanas de inspecciones diarias no se observan filtraciones o acumulación de líquidos/lixiviados expuestas, el Demandado podrá reducir la frecuencia de las inspecciones a un día por medio durante la semana operativa (es decir, tres veces por semana operativa). Si en algún momento las inspecciones demuestran filtración o acumulación de líquidos/lixiviados expuestas, la frecuencia de las inspecciones deberá volver a inspecciones de dos veces al día.

iii. Registro semanal de filtraciones y acumulación de lixiviados conforme a la Condición 27(c);

c. Todas las semanas, compile e informe los detalles de los registros de inspección de esa semana calendario requeridos bajo la Condición 27(b). El Demandado además deberá informar sobre todas las filtraciones y acumulaciones de lixiviados del vertedero que se descubra que han ocurrido en un lugar más que en una semana calendario, incluyendo las ubicaciones (identificadas en los mapas gráficos del vertedero), la duración estimada de la presencia de lixiviados en esos lugares, las características del lixiviado (cantidad estimada, alcance del área impactada, tipo de olor y densidad), la saturación de lixiviados de los suelos en los alrededores (con líquido libre estancado, saturados, semisecos y secos) y sistemas o medidas de contención desplegados para dirigir, recolectar y contener los lixiviados expuestos y evitar una mayor exposición de los lixiviados. Antes del 23 de enero de 2024, el Demandado deberá entregarle al AQMD de la Costa Sur [Baitong Chen, Ingeniero en Calidad del Aire, (bchen@aqmd.gov); Nathaniel Dickel, Ingeniero Sénior en Calidad del Aire, (ndickel@aqmd.gov), y Christina Ojeda, Inspectora de la Calidad del Aire, (cojeda@aqmd.gov)], el primer informe semanal y deberá presentar otro informe semanal cada 7 días calendario posteriormente;

Los registros diarios de los hallazgos de las inspecciones y las actividades de contención, como también los informes semanales de filtraciones y acumulación de lixiviados requeridos por las Condiciones 27(b) y 27(c) están incluidos en el **Adjunto K**.

iv. Cantidad de lixiviados medidos y nombre de la empresa y dirección física relacionados de los centros de disposición/tratamiento fuera del sitio que reciben lixiviados generados por el vertedero, conforme a la Condición 27(d); y

d. Mida y registre las cantidades de lixiviados enviados fuera del sitio para su disposición/tratamiento durante la semana previa por todo el tiempo en el que se transporte todo el lixiviado fuera del sitio para su disposición. Los registros deberán incluir el nombre de la empresa y dirección física relacionados de los centros de disposición/tratamiento fuera del sitio que reciben lixiviados generados por el vertedero. Si el Demandado comienza un tratamiento en el sitio, deberá registrar todas las semanas las cantidades de lixiviados tomados y los lixiviados tratados en el sitio. El Demandado deberá reportar esta información en los informes mensuales, conforme a la Condición No. 8(c). El demandado

deberá presentar copas de los manifiestos a South Coast AQMD dentro de las tres semanas desde su solicitud.

La cantidad de lixiviados que se envía fuera del sitio para su disposición/tratamiento, el nombre de la empresa asociada y la dirección física de los centros de disposición/tratamiento fuera del sitio están incluidos en el **Adjunto L**. Chiquita comenzó a tratar lixiviados en el sitio en febrero de 2024. Los detalles sobre la cantidad de lixiviados tratados en el sitio también están incluidos en el **Adjunto L**. Chiquita está proporcionando esta información a su mejor saber y entender; esta información se encuentra sujeta a cambios en base a mayores revisiones y verificaciones.

v. **Una lista de todas las instalaciones de almacenamiento y tratamiento de líquidos peligrosos y no peligrosos que se hayan contactado y el estado actual de cada una de las instalaciones, incluyendo la capacidad disponible, contratada y utilizada, para recibir líquidos del vertedero peligrosos y no peligrosos.**

El cuadro a continuación proporciona una lista de cada una de las instalaciones de almacenamiento y tratamiento de líquidos peligrosos y no peligrosos y sus respectivas capacidades contratadas y máximas disponibles al 28 de febrero de 2026. Ha habido cambios en las instalaciones bajo contrato en febrero de 2026, como se detalla a continuación. La capacidad disponible la establece el centro de almacenamiento y tratamiento y fluctúa día a día, sujeta a cambios y ajustes de las instalaciones. Chiquita utiliza toda la capacidad disponible por las instalaciones hasta el punto en que haya líquidos disponibles para disposición y hasta el punto en que sea viable para las instalaciones que lo reciben.

Nombre de las Instalaciones	Peligroso/No Peligroso	Capacidad Contratada	Capacidad Máxima Disponible
Avalon	No Peligroso	150,000 galones/día durante la semana (50,000 gal/día el sábado)	150,000 gal/día durante la semana (50,000 gal/día el sábado) *
East Valley Remediation	No Peligroso	13 camiones/día (aprox. 65,000 galones/día); 6 días/semana	13 camiones/día (aprox. 65,000 galones/día); 6 días/semana
Clean Harbors – UT	Peligroso	2 camiones/día (aprox. 10,000 galones/día); 5 días/semana	2 camiones/día (aprox. 10,000 galones/día); 5 días/semana
Clean Harbors – NE**	Peligroso	4 camiones/día (aprox. 20,000 galones/día); 5 días/semana	4 camiones/día (aprox. 20,000 galones/día); 5 días/semana
Clean Harbors – TX	Peligroso	3 vagones/semana (aprox. 60,000 galones/semana)	3 vagones/semana (aprox. 60,000 galones/semana)
Clean Harbors – ISO	No Peligroso	4 camiones/día (aprox. 20,000 galones/día); 5 días/semana	4 camiones/día (aprox. 20,000 galones/día); 5 días/semana
US Ecology – Nevada	No Peligroso	5 camiones/día (aprox. 10,000 galones/día); 5 días/semana	5 camiones/día (aprox. 25,000 galones/día); 5 días/semana
Durham – Arizona	No Peligroso	Aprox. 80,000 galones/día	Aprox. 80,000 galones/día
Crystal Clean Wyoming	No Peligroso	Aprox. 150,000 galones/semana	Aprox. 150,000 galones/semana
Crystal Clean Bakersfield	No Peligroso	Aprox. 100,000 galones/día	Aprox. 100,000 galones/día

Nombre de las Instalaciones	Peligroso/No Peligroso	Capacidad Contratada	Capacidad Máxima Disponible
ReWorld Advanced Processing, Inc.	No Peligroso	5 camiones/día (aprox. 25,000 galones/día); 5 días/semana	5 camiones/día (aprox. 25,000 galones/día); 5 días/semana
Industrial Recycling, Baja* **	No Peligroso	10 camiones/día (aprox. 50,000 galones/día); 5 días/semana	10 camiones/día (aprox. 50,000 galones/día); 5 días/semana

*Avalon Environmental Services (Avalon) continúa bajo contrato, pero debido a las contradicciones en las asignaciones de las agencias, entre los Distritos Sanitarios del Condado de LA, Obras Públicas y Planificación Regional, Avalon actualmente no puede aceptar envíos de lixiviados no peligrosos tratados de Chiquita de forma consistente. Por lo tanto, se redujo significativamente la aceptación diaria total de Avalon durante febrero de 2026.

**Como se indició previamente, Chiquita recientemente se enteró por Clean Harbors que Clean Harbors - Nebraska puede recibir y transferir líquido a Clean Harbors - Arkansas sin el conocimiento o la aprobación de Chiquita.

*** Chiquita celebró un nuevo contrato con Industrial Recycling, Baja, que se encuentra en México. El centro completó algunas cargas de prueba en febrero y continúa trabajando con Chiquita para aumentar su capacidad de transportar líquidos.

vi. **Una actualización sobre la cantidad de tanques en cada grupo de tanques de lixiviados: la cantidad total de tanques de lixiviados tratados; la cantidad mensual y en lo que va del año de líquido recogido; la cantidad mensual y en lo que va del año de líquido tratado; y la cantidad mensual y en lo que va del año de filtraciones, acumulaciones o estancamientos recogidos.**

Según las Condiciones 8(q) y 53 de la Orden Estipulada, Chiquita proporciona la siguiente actualización para el mes de febrero de 2026. Chiquita está proporcionando esta información a su mejor saber y entender; esta información se encuentra sujeta a cambios en base a mayores revisiones y verificaciones.

- **Cantidad de tanques en cada grupo de tanques de lixiviados.** Hubo aproximadamente 252 tanques de fraccionamiento de lixiviados en el Vertedero de Chiquita Canyon al 28 de febrero de 2026, de la siguiente manera:

  Colector de Tanque de Cubierta Superior No. 1: 0
  Colector del Perímetro Este No. 2: 0
  Colector LC No. 4: 1
  Colector del Perímetro Norte No. 6: 0
  Parque de Tanques No. 7: 25
  Parque de Tanques No. 9: 0
  Cañón D No. 10: 37
  Parque de Tanques No. 13: 151
  Cañón Principal: 14
  Área de Presentación, no está en uso: 23
  Necesitó Reparación: 1

- **Cantidad total de tanques de lixiviados tratados.** Chiquita trató 237 tanques en febrero de 2026. Chiquita trató 2,638 tanques desde el 17 de febrero de 2024 (el inicio del tratamiento) hasta el 31 de

diciembre de 2024, 3,249 tanques desde el 1 de enero de 2025 hasta el 31 de diciembre de 2025 y 449 tanques desde el 1 de enero hasta el 28 de febrero de 2026.

- **Cantidad total de líquidos recolectados mensualmente y en lo que va del año.** Chiquita estima que recogió aproximadamente 10.314.335 galones de líquido en febrero de 2026 (sin contar el condensado de las antorchas). Chiquita estima que recogió aproximadamente 62,576,218 galones desde el 1 de enero de 2024 hasta el 31 de diciembre de 2024 (sin contar condensado de las antorchas), aproximadamente 101,384,450 galones del 1 de enero de 2025 al 31 de diciembre de 2025 y aproximadamente 21,765,432 desde el 1 de enero hasta el 28 de febrero de 2026. *

- **Cantidad total de líquidos tratados mensualmente y en lo que va del año.** Asumiendo 17,000 galones por tanque, Chiquita trató aproximadamente 3,940,398 galones en febrero de 2026. Chiquita estima que trató aproximadamente 46,368,981 galones desde el 17 de febrero de 2024 (el inicio del tratamiento) hasta 1 de diciembre de 2024, aproximadamente 54,795,437 galones desde el 1 de enero de 2025 hasta el 31 de diciembre de 2025 y aproximadamente 7,282,364 desde el 1 de enero hasta el 28 de febrero de 2026.

- **Cantidad total mensual y en lo que va del año de filtraciones, acumulaciones o encharcamientos de los lixiviados recolectados.** Chiquita estima que se observaron aproximadamente 5,501 galones de filtraciones, acumulaciones o encharcamientos de lixiviados en febrero de 2026. Estas filtraciones se corrigieron como se describió en el informe semanal de inspecciones de lixiviados presentado en conformidad con la Condición 27(c) de la SOFA. El estimativo en lo que va del año desde el primer trimestre de 2024 hasta el 31 de diciembre de 2024 es de aproximadamente 175.051 galones. El estimativo en lo que va del año desde el 1 de enero de 2025 hasta el 31 de diciembre de 2025 fue menor a 185 galones. El estimativo en lo que va del año desde el 1 de enero hasta el 28 de febrero de 2026 fue de aproximadamente 5,525 galones. Estos números se basan en las inspecciones de filtraciones/acumulaciones de lixiviados que realiza Chiquita dos veces al día y a los estimativos registrados de la cantidad de galones de lixiviados filtrados/acumulados, como también en estimativos de aguas pluviales y lixiviados bombeados del canal de aguas pluviales represados durante eventos de tormenta a principios de este año. Esto sobreestima la cantidad de lixiviados recogidos porque incluye estos eventos informados previamente donde las filtraciones de lixiviados ingresaron al canal y entraron en contacto con las aguas pluviales. Se debe tener en cuenta que el volumen de cualquier filtración/acumulación de lixiviados que se toma también se captura en los totales arriba indicados, porque esos líquidos se transfieren a los tanques de fractura para su eventual disposición. También se debe tener en cuenta que Chiquita continúa informando fugas/derrames de lixiviados por separado, conforme a la Condición 27(e) de al Orden Estipulada.

* Chiquita actualmente está investigando un potencial informe excesivo de uno de los medidores de flujo del sitio, que puede estar dando como resultado un estimativo excesivo en la cantidad de volumen de extracción de lixiviados. Chiquita continúa evaluando este problema y las potenciales acciones correctivas.

<u>Sección R – Capacidad Adecuada</u>

Actualizaciones sobre la capacidad adecuada:

> *Condición No. 29. Quien responde deberá asegurarse de que tenga la capacidad adecuada para los lixiviados del vertedero y para los condensados del vertedero (en base a la producción de líquidos y a los informes de la recolección conforme a*

la Condición 8) para acumular en el sitio y/o disponer de los líquidos/lixiviados recogidos en un centro o centros apropiados.

Como se demostró arriba en la Sección Q, Chiquita había reducido la capacidad de disposición de lixiviados fuera del sitio al 7 de febrero de 2026 y continuó acumulando en el sitio y/o disponiendo de los líquidos/lixiviados/condensados recogidos en instalaciones apropiadas en febrero de 2026.

Sección S - Datos de las Estaciones de Monitoreo

Actualizaciones sobre las estaciones de monitoreo de aire:

Condición No. 35. El Demandado deberá, antes del 19 de enero de 2024, proporcionar todos los procedimientos operativos estándar (SOPs) y cualquier otro documento de Control de Calidad y Aseguramiento de la Calidad (QA/QC) que describa la operación y el mantenimiento de todos los instrumentos utilizados en las estaciones de monitoreo de aire y/o en las estaciones de monitoreo mejoradas especificadas en la Condición No. 34. Estos documentos de QA/QC deberán incluir información detallada sobre la calibración y el mantenimiento de los equipos de monitoreo e instrumentación asociada y sobre los procedimientos utilizados para la manipulación, validación y análisis de datos. Además, deberán incluir la frecuencia/el programa de estas acciones. El Demandado deberá proporcionar estos documentos de QA/QC al AQMD de la Costa Sur [Baitong Chen, Ingeniero en Calidad del Aire, (bchen@aqmd.gov); Nathaniel Dickel, Ingeniero Sénior en Calidad del Aire, (ndickel@aqmd.gov); Christina Ojeda, Inspectora de la Calidad del Aire, Payam Pakbin, Gerente de Mediciones Atmosféricas, ppakbin@aqmd.gov)]. El demandado debe proporcionar actualizaciones de estos documentos de QA/QC (si hubiera) y un registro de calibración y actividades de mantenimiento realizadas en los monitores en los informes mensuales conforme a la Condición No. 8. (...)

No hubo actualizaciones ni cambios en los documentos de QA/QC de Monitoreo del Aire durante el período de los informes. En febrero de 2026 no hubo eventos de mantenimiento que haya requerido que se realicen planillas de datos del campo.

Sección T - Toma de Muestras de Carbono Orgánico Total (TOC) Durante Eventos de Molestias y Excavaciones

Conforme a la Condición No. 42(w); estos informes mensuales deben incluir lo siguiente:

Condición No. 42(w). Si el Demandado recibe un Aviso de Infracción por Incumplimiento de la Regla 402 del AQMD de la Costa Sur durante la excavación o un olor distinto (nivel 3 o superior por debajo de la Escala de Olor) resultante de la excavación en o pasando la línea de la propiedad, el Demandado deberá, conforme a este Plan de Salud y Seguridad, tomar muestras de la calidad del aire del ambiente dentro de las 2 horas desde que se recibe el Aviso de Infracción por Incumplimiento de la Regla 402 o cuando se detecta un olor distinto (nivel 3 o superior) en o pasando la línea de la propiedad y analizar los TOC y los TOCs especiados de la siguiente manera:

Escala de Olor	*Descripción de la Intensidad del Olor*
0	*No se detectó olor*
1	*Se detectó un olor muy suave*
2	*Se detectó un olor suave, distinguible*
3	*Olor moderado, muy distinguible*
4	*Olor fuerte, muy distinguible, irritable*

5 Olor fuerte, muy distinguible, abrumador

ii. Se deben tomar muestras en los siguientes lugares: inmediatamente a barlovento del sitio de la excavación., inmediatamente a sotavento de del sitio de la excavación, dentro de las 3 pulgadas de la cara de trabajo de la excavación expuesta, permisos de seguridad y en la línea de la propiedad a sotavento o en otros lugares aprobados por escrito por el AQMD de la Costa Sur. Si se considera inseguro, el Demandado deberá documentar la echa y las condiciones que no permiten el cumplimiento de esta condición. Deberán presentarse registros de estas condiciones en el siguiente informe mensual, conforme a la Condición 8.

Durante el mes de febrero de 2026, no hubo instancias de que se hayan cumplido los criterios que activan un evento de la Condición 42(w); por lo tanto, no hubo eventos de monitoreo de la Condición 42(w).

Conforme a la Condición No. 42(x), estos informes mensuales también deben incluir lo siguiente:

Condición No. 42(x). Durante la excavación, deberán tomarse muestras de los TOC y de los TOC especiados en el aire ambiental por lo menos una vez entre las 6:00 am y las 11:00 am y por lo menos una vez entre las 2:00 pm y las 6:00 pm, según el Plan de Salud y Seguridad del Demandado y los siguientes requerimientos:

i. Se deben tomar muestras en los siguientes lugares: inmediatamente a barlovento del sitio de la excavación., inmediatamente a sotavento de del sitio de la excavación, dentro de las 3 pulgadas de la cara de trabajo de la excavación expuesta, permisos de seguridad y en la línea de la propiedad a sotavento o en otros lugares aprobados por escrito por el AQMD de la Costa Sur. Si se considera inseguro, el Demandado deberá documentar la echa y las condiciones que no permiten el cumplimiento de esta condición. Deberán presentarse registros de estas condiciones en el siguiente informe mensual, conforme a la Condición 8.

Durante el mes de febrero de 2026, no hubo instancias de que se hayan cumplido los criterios que activan un evento de la Condición 42(x); por lo tanto, no hubo eventos de monitoreo de la Condición 42(x).

Sección U - Toma de Muestras/Análisis de Condensados

Resultados de los registros de tomas de muestras/análisis de condensados:

Condición No. 55(g). El Demandado mantiene registros de muestras/resultados de análisis de condensados para demostrar que el líquido no es peligroso, mantiene registros de flujos de inyección de condensados diarios (galones por día) y proporciona estos registros en el informe mensual conforme a la Condición No. 8.

La inyección de condensados se registra en la estación de antorchas, pero actualmente está desconectada hasta que se analicen los condensados y se confirme que son no peligrosos. Por lo tanto, los flujos de inyección de condensados para febrero de 2026 son de cero.

Sección V - Información de los Registros de Presión/Flujo de los Tanques de Lixiviados

Condición No. 68. El Demandado deberá instalar correctamente antes del 15 de junio de 2024 medidores de presión diferencial clasificados, con resolución de por lo menos una columna de agua de 0.01 pulgadas o un indicador de presión aprobado de otra manera por escrito por el AQMD de la Costa Sur, en cada tanque de almacenamiento de lixiviados.

El Demandado deberá monitorear y registrar la presión diferencial diaria de cada tanque de lixiviados, el número de identificación del tanque, la fecha y hora de la lectura y el personal que realizó la lectura. Las lecturas de las presiones que indiquen el menor valor del medidor o el mayor valor del medidor deberán informarse utilizando dígitos importantes en lugar de los decimales, como "<= [valor más bajo en el medidor] (ej. <= -0.50 pulgadas de columna de agua)" y ">= [valor más alto en el medidor] (ej. >= 0.50 pulgadas de columna de agua)", respectivamente. Los tanques deberán mantenerse bajo presión negativa, demostrado en las lecturas de la presión diferencial. Las lecturas de cero y presión positiva no demuestran una presión negativa. Los medidores de presión deben calibrarse en cumplimiento con las especificaciones del fabricante y el programa de calibración. El Demandado deberá informar todas las lecturas en el informe mensual, conforme a la Condición No. 8

Como lo indica la Condición 68, Chiquita completó la instalación de medidores de presión diferencial en cada tanque de almacenamiento de lixiviados el 10 de julio de 2024, después de su solicitud de extensión del 12 de junio de 2024 y la posterior documentación de las demoras del fabricante para entregar los medidores de presión en el sitio. Después de la instalación, Chiquita experimentó complicaciones con respecto a la implementación. Como resultado, los registros comenzaron el 28 de agosto de 2024. Las lecturas del mes de febrero de 2026 se incluyen como **Adjunto M**.

Condición No. 72. El demandado deberá tomar muestras y analizar, probar, instalar y monitorear la toma de lixiviados y condensados de biogás y el sistema de almacenamiento, como se especifica a continuación:

A. *Por lo menos trimestralmente, realizar pruebas para tomar muestras y analizar el flujo de vapor en las tuberías utilizadas para ventilar los tanques de almacenamiento de lixiviados y los tanques de condensado de biogás y dirigir los vapores al sistema de control de biogás. Las pruebas deberán incluir por lo menos los siguientes puntos y los resultados de estas pruebas deben proporcionarse en el informe mensual, en cumplimiento con la Condición No. 8:*
   i. *índice de flujo de vapores de tanques de lixiviados ventilados,*
   ii. *índice de flujo de vapores de tanques de condensados ventilados,*
   iii. *temperatura del vapor,*
   iv. *concentraciones de orgánicos especiados (incluyen, de forma enunciativa más no limitativa, Contaminantes del Aire Carcinogénicos y Tóxicos de la Tabla 1 de la Regla 1150.1),*
   v. *los compuestos de azufre total como H2S y compuestos de azufre especiado y*
   vi. *analizar en cada uno de los lugares indicados a continuación:*
      1. *Las ventilaciones o los colectores de los tanques que sean representativos de un set de tanques;*
      2. *El cabezal/colector de cada parque de tanques de lixiviados o colector que incluye el Parque de Tanques No. 7, el Parque de Tanques No. 9, el Colector del Perímetro Norte, el Colector del Perímetro Noreste, el Colector LC, los tanques de almacenamiento de condensado de biogás y cualquier otro futuro parque de tanques o colectores, realizando las pruebas flujo arriba de la conexión de la tubería al Sistema de Recolección y Transporte de LFG donde el biogás pueda afectar los resultados; y*
      3. *La entrada de antorchas antes de la combustión.*
B. *Deberá presentarse un protocolo de pruebas de origen al AQMD de la Costa Sur antes del 17 de mayo de 2024, a menos que el AQMD de la Costa Sur apruebe otra cosa por escrito. Las pruebas deberán realizarse dentro de los 45 días desde que el AQMD de la Costa Sur recibe la aprobación escrita del protocolo de prueba de origen y deberán presentarse los resultados finales en un formato de informe de prueba de origen dentro de los 30 días desde que se realizan las pruebas, a menos que el AQMD de la Costa Sur apruebe otra cosa por escrito.*
C. *Dentro de los 30 días desde el informe inicial de las pruebas de origen, el Demandado*

deberá presentar al AQMD de la Costa Sur una recomendación del Comité de Reacción sobre otras pruebas de flujo de vapores [atención: Baitong Chen, bchen@aqmd.gov; Nathaniel Dickel, ndickel@aqmd.gov; Christina Ojeda, cojeda@aqmd.gov]. El Comité de la Reacción podrá presentar recomendaciones sobre otros análisis de flujo de vapor al AQMD de la Costa Sur, dentro de los 30 días desde que se realizan los análisis adicionales de las fuentes bajo esta condición.

Se presentó al AQMD de la Costa Sur un *Plan de las Pruebas de Origen para la Toma de Muestras de Lixiviados y de Vapores Condensados* en nombre de Chiquita el 12 de julio de 2024, conforme a la Condición No. 72(b). El protocolo de la prueba de origen se presentó originalmente el 17 de mayo de 2024, pero fue revisado y reenviado el 12 de julio de 2024 para tratar dudas elevadas por el AQMD de la Costa Sur. El plan modificado fue aprobado el 6 de septiembre de 2024 y la prueba de la fuente se realizó el 17 de octubre de 2024. El informe final de los análisis de origen se presentó al AQMD de la Costa Sur el 15 de noviembre de 2024. La prueba del origen más reciente para el cuarto trimestre de 2025 la completó Montrose Environmental el 24 de noviembre de 2025 y se informó al SCAQMD el 24 de diciembre de 2025. Las pruebas de origen del primer trimestre de 2026 se programaron para el 30 de marzo de 2026.

Condición No. 72(e). Para el 28 de junio de 2024, a menos que el AQMD de la Costa Sur apruebe otra cosa por escrito, instalar medidores de flujo dentro de los cabezales de las tuberías se HDPE para los parques de tanques de lixiviados asociados, para medir y registrar con precisión el índice de flujo (scfm) y el volumen diario total de vapores ventilados de los tanques de lixiviados que se envían a la estación de antorchas para su combustión. Los medidores de flujo deben instalarse en cumplimiento con las especificaciones y recomendaciones del fabricante para asegurar que las lecturas del flujo sean exactas.

i. El índice de flujo diario (scf/día), la ubicación de los medidores de flujo, la indicación del parque de tanques cuyo flujo se está midiendo y la indicación de cada tanque dentro del parque de tanques con ventilación y representada en el índice de flujo deben ser presentados en el informe mensual según la Condición No. 8.

Por los motivos descritos en la correspondencia de Chiquita del 13 de mayo de 2024 entregada a AQMD de la Costa Sur, Chiquita solicitó y recibió una extensión del plazo para la instalación de los medidores de lujo hasta el 19 de julio de 2024. El 16 de julio de 2024 Chiquita completó la instalación de los medidores de flujo dentro de los cabezales de las tuberías de HDPE para los parques de tanques de lixiviados asociados, conforme a la Condición No. 72(e). Los medidores de flujo se instalaron en cumplimiento con las especificaciones y recomendaciones del fabricante para asegurar que las lecturas del flujo sean exactas. Se incluye como **Adjunto N** un informe del índice de flujo diario (scf/día), la ubicación de los medidores de flujo, la indicación del parque de tanques cuyo flujo se está midiendo y la indicación de cada tanque dentro del parque de tanques con ventilación y representada en el índice de flujo.

Sección W - Lecturas de la Composición del Biogás

Condición No. 8(r). Análisis diarios de la composición de los gases del vertedero, que incluyen CH4%, concentración de CO (ppm), CO2% y O2%, registrado por un analizador en tiempo real y/o muestras tomadas en las entradas de los equipos de control (TOx, Antorchas y equipos de control adicionales llevados al sitio para que hagan combustión con el biogás). Los análisis serán realizados por un analizador de CH4, CO2 o O2 aprobado por el AQMD de la Costa Sur utilizando el Método 10 de la EPA de EE. UU. o el Método ALT-144 para CO. La solicitud de aprobación deberá incluir la presentación de las especificaciones de lo analizadores.

A partir del 28 de agosto de 2024, se solicitaron análisis adicionales para los TOx y las antorchas y los gases permanentes (CO2, O2 y N2) fueron analizados utilizando el método D1946 de ASTM y de CO utilizando el método de la EPA ALT-144. Los resultados analíticos están incluidos en el **Adjunto A**.

Sección X - Progreso de la Construcción de la Antorcha No. 4

> *Condición No. 74. El Demandante deberá acelerar la adquisición de los equipos necesarios para construir la Antorcha No. 4 lo máximo posible mientras que sea viable, de forma que la Antorcha No. 4 esté lista para ser construida y puesta en funcionamiento lo antes posible después de que el Demandante reciba todos los permisos y otras aprobaciones necesarios. El Demandante deberá proporcionar actualizaciones sobre la adquisición de estos equipos en el informe mensual conforme a la Condición 8(s).*

Chiquita y SCS Engineers completaron el pedido inicial de la Antorcha 4 de John Zink en el mes de enero. Además, John Zink completó la inspección de la de Antorcha 2 en enero de 2025 y confirmó que la altura de la antorcha pueda extenderse sin ninguna modificación adicional. El trabajo sobre el permiso de la Antorcha 4 y el trabajo de John Zink sobre el diseño y la adquisición de la Antorcha 4 estaban en curso durante el mes de febrero de 2026.

Sección Y - Seguimiento de Equipos en Varias Ubicaciones

> *Condición No. 80. Cuando el AQMD de la Costa Sur haya permitido equipos en Varios Lugares o cuando se traigan o se operen en el sitio equipos permitidos por la Registración de Equipos Portátiles del Estado (PERP) de CARB, el Demandado deberá:*
>
> a. *Informar al AQMD de la Costa Sur por escrito la fecha y hora en la que se trajeron los equipos a las instalaciones en el informe mensual correspondiente según la Condición No. 8 e incluir una copia de los permisos en los varios lugares y/o los permisos de PERP en el informe mensual correspondiente según la Condición No. 8.*
>
> b. *Mantener un registro diario que incluya la siguiente información para cada unidad de permiso: número de permiso y/o número de registración, número de solicitud (si corresponde), ubicación de los equipos y hora de inicio y fin de la operación de los equipos (según corresponda). El Demandado deberá presentar el registro diario en el informe mensual correspondiente según la Condición No. 8.*
>
> c. *Informar al AQMD de la Costa Sur por escrito la fecha y hora en la que se retiró el equipo del lugar, en el informe mensual correspondiente, según la Condición No. 8.*

El registro PERP de febrero de 2026 y las copias de los permisos relevantes se proporcionan como **Adjunto O.**

Sección Z - Inspecciones Semanales de la Cubierta Geosintética

> *Condición No. 97. El demandado deberá inspeccionar visualmente todos los puntos de conexión, costuras y sellos de las cubiertas geosintéticas en y alrededor de la Zona Reactiva (como se define en la Condición No. 9(a)) por lo menos una vez cada siete (7) días calendario y deberá reparar inmediatamente cualquier problema identificado en la cubierta. El demandado deberá mantener un registro que demuestre que completó cada inspección y que trató cualquier problema con cualquier punto de conexión, costura o sello de la cubierta geosintética, incluyendo la fecha en la que se identificó el problema, la acción tomada para reparar el daño y la hora en la que se completó la reparación. Los resultados de la inspección y el registro de reparaciones requerido por esta condición deben incluirse en los informes mensuales requeridos conforme a la Condición No. 8.*

Chiquita inspecciona visualmente todos los puntos de conexión y los sellos de la cubierta geosintética por lo menos una vez cada siete (7) días calendario, repara inmediatamente los problemas identificados en las cubiertas y mantiene un registro que demuestra que se completaron estas inspecciones y reparaciones, conforme a la Condición 97. Los registros semanales que detallan la inspección visual de los puntos de conexión, la costura y los sellos de la cubierta geosintética en y alrededor de la Zona Reactiva y las reparaciones de febrero de 2026 se incluyen como **Adjunto P**.

CIERRE

Si tiene preguntas o si necesita más información, por favor, comuníquese con Cornelius Fong de SCS Field Services llamando al (562) 743-7895 o con Gabrielle Stephens de SCS llamando al (562) 355-6510.

Atentamente,

Chuck Rainey
Profesional del Proyecto
SCS Engineers

Gabrielle F. Stephens
Vicepresidente
SCS Engineers

GFS/PSS

cc: Cornelius Fong, SCS Engineers;
Dylan Smith, Chiquita Canyon Landfill

Adjuntos

Attachment A

Lab Analyses from the Reporting Period

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Sulfide and Reduced Sulfur Compounds
Analysis in Tedlar Bag Sample by SCAQMD Method 307.91

Report Date: March 3, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Sampled: February 1, 2026
Date Received: February 2, 2026
Date Analyzed: February 2, 2026

ANALYSIS DESCRIPTION

Total sulfur analysis measured by gas chromatography with sulfur chemiluminescence detector (SCD), SCAQMD 307.91.

AtmAA Lab No.:	20336-10	20336-11	20336-12	20336-13
Sample I.D.:	Zeeco Inlet	FL-2009 Inlet	Hero Inlet	Parnel Inlet
Components	*(Concentration in ppmv)*			
Hydrogen sulfide	256	151	160	173
Carbonyl sulfide	<1.00	0.66	<1.50	<1.50
Methyl mercaptan	89.8	78.4	248	239
Ethyl mercaptan	1.64	1.15	3.49	3.54
Dimethyl sulfide	280	281	689	681
Carbon disulfide	<1.00	<0.50	<1.50	<1.50
i-Propyl mercaptan	2.09	1.55	1.68	2.01
t-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
n-Propyl mercaptan	3.66	3.20	8.53	8.44
s-Butyl mercaptan	3.57	3.04	6.68	6.76
i-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
Dimethyl disulfide	1.04	2.98	3.19	3.64
Tetrahydrothiophene	<1.00	0.78	2.11	2.17
Unidentified sulfurs	6.12	4.94	7.55	9.22
	(Concentration in ppmv, as H_2S)			
Total Sulfur	644.4	531.7	1132.4	1130.9

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Sampled: February 1, 2026
Date Received: February 2, 2026
Date Analyzed: February 2, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Hydrogen sulfide	Zeeco Inlet	256	256	256	0.00
	FL-2009 Inlet	154	148	151	4.0
	Hero Inlet	156	163	160	4.4
	Parnel Inlet	175	170	173	2.9
Carbonyl sulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	0.68	0.63	0.66	7.6
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Methyl mercaptan	Zeeco Inlet	89.2	90.3	89.8	1.2
	FL-2009 Inlet	81.3	75.5	78.4	7.4
	Hero Inlet	243	253	248	4.0
	Parnel Inlet	241	236	239	2.1
Ethyl mercaptan	Zeeco Inlet	1.61	1.66	1.64	3.1
	FL-2009 Inlet	1.22	1.07	1.15	13
	Hero Inlet	3.43	3.54	3.49	3.2
	Parnel Inlet	3.55	3.52	3.54	0.85
Dimethyl sulfide	Zeeco Inlet	277	282	280	1.8
	FL-2009 Inlet	288	274	281	5.0
	Hero Inlet	674	703	689	4.2
	Parnel Inlet	684	677	681	1.0
Carbon disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
i-Propyl mercaptan	Zeeco Inlet	2.00	2.18	2.09	8.6
	FL-2009 Inlet	1.61	1.48	1.55	8.4
	Hero Inlet	1.66	1.69	1.68	1.8
	Parnel Inlet	1.96	2.05	2.01	4.5
t-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
n-Propyl mercaptan	Zeeco Inlet	3.59	3.73	3.66	3.8
	FL-2009 Inlet	3.32	3.07	3.20	7.8
	Hero Inlet	8.46	8.60	8.53	1.6
	Parnel Inlet	8.25	8.62	8.44	4.4
s-Butyl mercaptan	Zeeco Inlet	3.54	3.60	3.57	1.7
	FL-2009 Inlet	3.20	2.88	3.04	11
	Hero Inlet	6.40	6.95	6.68	8.2
	Parnel Inlet	6.78	6.74	6.76	0.59
i-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Dimethyl disulfide	Zeeco Inlet	1.06	1.01	1.04	4.8
	FL-2009 Inlet	2.98	2.97	2.98	0.34
	Hero Inlet	3.02	3.35	3.19	10
	Parnel Inlet	3.66	3.62	3.64	1.1
Tetrahydrothiophene	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	0.79	0.77	0.78	2.6
	Hero Inlet	2.07	2.14	2.11	3.3
	Parnel Inlet	2.12	2.21	2.17	4.2
Unidentified sulfurs	Zeeco Inlet	5.92	6.32	6.12	6.5
	FL-2009 Inlet	5.00	4.88	4.94	2.4
	Hero Inlet	7.17	7.92	7.55	9.9
	Parnel Inlet	9.71	8.73	9.22	11

Four Tedlar bag samples, laboratory numbers 20336-(10-13), were analyzed for total sulfur compounds. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from four Tedlar bag samples is 4.6%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Permanent Gases Analysis in Tedlar Bag Sample

Report Date: February 27, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 2, 2026
Date Analyzed: February 2, 2026

ANALYSIS DESCRIPTION

Permanent gases were measured by thermal conductivity detection/ gas chromatography (TCD/GC) ASTM D1946-90.

AtmAA Lab No.	Sample ID	Oxygen (%v)	Nitrogen (%v)	Methane (%v)	Carbon Dioxide (%v)
20336-10	Zeeco Inlet	3.97	16.97	31.78	41.62
20336-11	FL-2009 Inlet	4.97	24.37	29.28	35.66
20336-12	Hero Inlet	5.70	25.16	15.98	44.77
20336-13	Parnel Inlet	5.80	24.56	17.70	43.74

The reported oxygen concentration includes any argon present in the sample. Calibration is based on a standard atmosphere containing 20.95% oxygen and 0.93% argon. The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported. Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 2, 2026
Date Analyzed: February 2, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Oxygen	Zeeco Inlet	3.97	3.97	3.97	0.0	<0.1
Nitrogen	Zeeco Inlet	16.97	16.96	16.97	0.06	<0.1
Methane	Zeeco Inlet	31.75	31.80	31.78	0.16	<0.1
Carbon Dioxide	Zeeco Inlet	41.62	41.62	41.62	0.0	<0.1

Four Tedlar bag samples, laboratory numbers 20336-(10-13), were analyzed for permanent gases. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 4 repeat measurements from 4 Tedlar bag samples is 0.05%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Carbon Monoxide Analysis in Tedlar Bag Samples

Report Date: February 27, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 2, 2026
Date Analyzed: February 2, 2026

ANALYSIS DESCRIPTION

Carbon monoxide was measured by flame ionization detection/total combustion analysis (FID/TCA), EPA Method ALT-144.

AtmAA Lab No.	Sample ID	Carbon Monoxide *(Conc. in ppmv)*
20336-10	Zeeco Inlet	337
20336-11	FL-2009 Inlet	317
20336-12	Hero Inlet	713
20336-13	Parnel Inlet	656

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analysis)

Project Name: Chiquita Canyon Landfill
Date Received: February 2, 2026
Date Analyzed: February 2, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Carbon Monoxide	Zeeco Inlet	335	338	337	0.89

Four Tedlar bag samples, laboratory numbers 20336-(10-13), were analyzed for carbon monoxide. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 4 Tedlar bag samples is 0.89%.

CHAIN OF CUSTODY RECORD

Client/Project Name	Project Location
SCS Engineers / Chiquita Canyon Landfill	29201 Henry Mayo Drive, Castaic, CA 91384
Project No.	**Field Logbook No.**
07224200.24 Task 1	
Sampler: *(Signature)*	**Chain of Custody Tape No.**

Sample No./ Identification	Type of Sample	AtmAA Lab Number	Sampling Date	Sampling Time	TRS (307.91	CH4, CO2, O2 (1946)	CO (EPA alt-144)				Special Remarks
Zeeco Inlet	LFG	20336-10	2/1/26	1:45PM	X	X	X				H2S 170 PPM
FL-2009 Inlet	LFG	-11	2/1/26	1:10PM	X	X	X				H2S 100 PPM
Hero Inlet	LFG	-12	2/1/26	1:40PM	X	X	X				H2S 120 PPM
Parnel Inlet	LFG	-13	2/1/26	1:50PM	X	X	X				H2S 140 PPM

	Date	Time		Date	Time
Relinquished by: *(Signature)*	2/1/26	3:30PM	**Received by: *(Signature)***	2/2/26	8:00am
Relinquished by: *(Signature)*	2/2/26	8:48	**Received by: *(Signature)***	2/2/26	8:48
Relinquished by: *(Signature)*	2/2/26	9:50	**Received for Laboratory by: *(Signature)***	2/2/26	9:50

Company Info:

Company: SCS Engineers
Street Address 3900 Kilroy Airport Way Suite 300
City/State/Zip: Long Beach / CA / 90806
Telephone No.: 562-743-7895 /562-335-0002
Fax No.:

Send Report to:

Company: SCS Engineers
Street Address 3900 Kilroy Airport Way Suite 300
City/State/Zip: Long Beach / CA / 90806
Project Manager: Cornelius Fong
Email Address: CFong@scsengineers.com

Analytical Laboratory

AtmAA Inc.
5107 Douglas Fir Rd.
Calabasas, CA 91302
TEL: (818) 223-3277
Email Address: info@atmaa.com

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Sulfide and Reduced Sulfur Compounds
Analysis in Tedlar Bag Sample by SCAQMD Method 307.91

Report Date: March 3, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Sampled: February 2, 2026
Date Received: February 2, 2026
Date Analyzed: February 2, 2026

ANALYSIS DESCRIPTION

Total sulfur analysis measured by gas chromatography with sulfur chemiluminescence detector (SCD), SCAQMD 307.91.

AtmAA Lab No.:	20336-14	20336-15	20336-16	20336-17
Sample I.D.:	Zeeco Inlet	FL-1995 Inlet	Hero Inlet	Parnel Inlet
Components	*(Concentration in ppmv)*			
Hydrogen sulfide	228	120	168	157
Carbonyl sulfide	<1.00	0.73	<1.50	<1.50
Methyl mercaptan	88.7	66.2	257	223
Ethyl mercaptan	1.54	1.02	3.69	3.07
Dimethyl sulfide	282	269	697	620
Carbon disulfide	<1.00	<0.50	<1.50	<1.50
i-Propyl mercaptan	2.09	1.51	2.00	1.97
t-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
n-Propyl mercaptan	3.63	3.01	8.48	7.87
s-Butyl mercaptan	3.75	3.01	6.62	6.33
i-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
Dimethyl disulfide	<1.00	2.70	2.40	2.42
Tetrahydrothiophene	<1.00	0.75	1.98	1.97
Unidentified sulfurs	2.73	2.43	5.22	5.25
	(Concentration in ppmv, as H_2S)			
Total Sulfur	611.4	472.0	1153.8	1030.8

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Sampled: February 2, 2026
Date Received: February 2, 2026
Date Analyzed: February 2, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Hydrogen sulfide	Zeeco Inlet	233	222	228	4.8
	FL-1995 Inlet	117	122	120	4.2
	Hero Inlet	169	167	168	1.2
	Parnel Inlet	156	158	157	1.3
Carbonyl sulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-1995 Inlet	0.70	0.76	0.73	8.2
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Methyl mercaptan	Zeeco Inlet	91.9	85.5	88.7	7.2
	FL-1995 Inlet	64.5	67.9	66.2	5.1
	Hero Inlet	256	257	257	0.39
	Parnel Inlet	225	220	223	2.2
Ethyl mercaptan	Zeeco Inlet	1.66	1.41	1.54	16
	FL-1995 Inlet	1.02	1.02	1.02	0.00
	Hero Inlet	3.74	3.64	3.69	2.7
	Parnel Inlet	3.16	2.98	3.07	5.9
Dimethyl sulfide	Zeeco Inlet	291	272	282	6.7
	FL-1995 Inlet	264	273	269	3.4
	Hero Inlet	687	706	697	2.7
	Parnel Inlet	627	613	620	2.3
Carbon disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-1995 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
i-Propyl mercaptan	Zeeco Inlet	2.17	2.01	2.09	7.7
	FL-1995 Inlet	1.40	1.62	1.51	15
	Hero Inlet	2.14	1.86	2.00	14
	Parnel Inlet	1.85	2.09	1.97	12
t-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-1995 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
n-Propyl mercaptan	Zeeco Inlet	3.79	3.46	3.63	9.1
	FL-1995 Inlet	3.00	3.02	3.01	0.66
	Hero Inlet	8.36	8.59	8.48	2.7
	Parnel Inlet	7.95	7.78	7.87	2.2
s-Butyl mercaptan	Zeeco Inlet	3.99	3.50	3.75	13
	FL-1995 Inlet	2.95	3.06	3.01	3.7
	Hero Inlet	6.17	7.07	6.62	14
	Parnel Inlet	6.11	6.55	6.33	7.0
i-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-1995 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Dimethyl disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-1995 Inlet	2.64	2.75	2.70	4.1
	Hero Inlet	2.38	2.41	2.40	1.3
	Parnel Inlet	2.43	2.41	2.42	0.83
Tetrahydrothiophene	Zeeco Inlet	<1.00	<1.00	---	---
	FL-1995 Inlet	0.79	0.70	0.75	12
	Hero Inlet	1.96	2.00	1.98	2.0
	Parnel Inlet	1.94	1.99	1.97	2.5
Unidentified sulfurs	Zeeco Inlet	2.70	2.76	2.73	2.2
	FL-1995 Inlet	2.59	2.27	2.43	13
	Hero Inlet	5.22	5.22	5.22	0.00
	Parnel Inlet	5.32	5.18	5.25	2.6

Four Tedlar bag samples, laboratory numbers 20336-(14-17), were analyzed for total sulfur compounds. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 39 repeat measurements from four Tedlar bag samples is 5.5%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Permanent Gases Analysis in Tedlar Bag Sample

Report Date: February 27, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 2, 2026
Date Analyzed: February 2, 2026

ANALYSIS DESCRIPTION

Permanent gases were measured by thermal conductivity detection/ gas chromatography (TCD/GC) ASTM D1946-90.

AtmAA Lab No.	Sample ID	Oxygen (%v)	Nitrogen (%v)	Methane (%v)	Carbon Dioxide (%v)
20336-14	Zeeco Inlet	4.92	20.98	29.46	40.53
20336-15	FL-1995 Inlet	6.29	27.18	28.36	34.23
20336-16	Hero Inlet	6.98	29.64	14.16	41.46
20336-17	Parnel Inlet	7.57	30.26	15.46	40.34

The reported oxygen concentration includes any argon present in the sample. Calibration is based on a standard atmosphere containing 20.95% oxygen and 0.93% argon.
The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported.
Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 2, 2026
Date Analyzed: February 2, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Oxygen	Hero Inlet	6.97	6.98	6.98	0.14	<0.1
Nitrogen	Hero Inlet	29.59	29.69	29.64	0.34	<0.1
Methane	Hero Inlet	14.15	14.17	14.16	0.14	<0.1
Carbon Dioxide	Hero Inlet	41.50	41.42	41.46	0.19	<0.1

Four Tedlar bag samples, laboratory numbers 20336-(14-17), were analyzed for permanent gases. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 4 repeat measurements from 4 Tedlar bag samples is 0.20%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Carbon Monoxide Analysis in Tedlar Bag Samples

Report Date: February 27, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 2, 2026
Date Analyzed: February 2, 2026

ANALYSIS DESCRIPTION

Carbon monoxide was measured by flame ionization detection/total combustion analysis (FID/TCA), EPA Method ALT-144.

AtmAA Lab No.	Sample ID	Carbon Monoxide *(Conc. in ppmv)*
20336-14	Zeeco Inlet	345
20336-15	FL-1995 Inlet	254
20336-16	Hero Inlet	587
20336-17	Parnel Inlet	619

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analysis)

Project Name: Chiquita Canyon Landfill
Date Received: February 2, 2026
Date Analyzed: February 2, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Carbon Monoxide	Hero Inlet	587	587	587	0.0

Four Tedlar bag samples, laboratory numbers 20336-(14-17), were analyzed for carbon monoxide. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 4 Tedlar bag samples is 0.0%.

CHAIN OF CUSTODY RECORD

Client/Project Name	Project Location
SCS Engineers / Chiquita Canyon Landfill	29201 Henry Mayo Drive, Castaic, CA 91384
Project No.	**Field Logbook No.**
07224200.24 Task 1	
Sampler: *(Signature)*	**Chain of Custody Tape No.**

Sample No./ Identification	Type of Sample	AtmAA Lab Number	Sampling Date	Sampling Time	TRS (307.91)	CH4, CO2, O2 (1946)	CO (EPA alt-144)				Special Remarks
Zeeco Inlet	LFG	20336-14	2/2/26	7:25am	X	X	X				H2S 150 PPM
~~FL-2009 Inlet~~ FL-1995 Inlet EA	LFG	-15	2/2/26	7:35am	X	X	X				H2S 100 PPM
Hero Inlet	LFG	-16	2/2/26	7:10am	X	X	X				H2S 130 PPM
Parnel Inlet	LFG	-17	2/2/26	7:20am	X	X	X				H2S 160 PPM

	Date	Time		Date	Time
Relinquished by: *(Signature)*	2/2/26	8:48	**Received by: *(Signature)***	2/2/26	8:48
Relinquished by: *(Signature)*	2/2/26	9:50	**Received by: *(Signature)***		
Relinquished by: *(Signature)*			**Received for Laboratory by: *(Signature)***	2/2/26	9:50

Company Info:	**Send Report to:**	**Analytical Laboratory**
Company: SCS Engineers	**Company:** SCS Engineers	**AtmAA Inc.**
Street Address 3900 Kilroy Airport Way Suite 300	**Street Address** 3900 Kilroy Airport Way Suite 300	**5107 Douglas Fir Rd.**
City/State/Zip: Long Beach / CA / 90806	**City/State/Zip:** Long Beach / CA / 90806	**Calabasas, CA 91302**
Telephone No.: 562-743-7895 /562-335-0002	**Project Manager:** Cornelius Fong	**TEL: (818) 223-3277**
Fax No.:	**Email Address:** CFong@scsengineers.com	**Email Address: info@atmaa.com**

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Sulfide and Reduced Sulfur Compounds
Analysis in Tedlar Bag Sample by SCAQMD Method 307.91

Report Date: March 3, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Sampled: February 3, 2026
Date Received: February 3, 2026
Date Analyzed: February 3, 2026

ANALYSIS DESCRIPTION

Total sulfur analysis measured by gas chromatography with sulfur chemiluminescence detector (SCD), SCAQMD 307.91.

AtmAA Lab No.:	20346-15	20346-16	20346-17	20346-18
Sample I.D.:	Zeeco Inlet	FL-2009 Inlet	Hero Inlet	Parnel Inlet
Components	*(Concentration in ppmv)*			
Hydrogen sulfide	227	161	168	163
Carbonyl sulfide	<1.00	0.65	<1.50	<1.50
Methyl mercaptan	71.7	74.1	285	231
Ethyl mercaptan	1.43	1.16	3.99	3.17
Dimethyl sulfide	257	267	729	653
Carbon disulfide	<1.00	<0.50	<1.50	<1.50
i-Propyl mercaptan	1.94	1.73	2.00	1.90
t-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
n-Propyl mercaptan	3.11	3.08	8.80	8.08
s-Butyl mercaptan	3.02	3.32	6.99	6.51
i-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
Dimethyl disulfide	<1.00	2.60	2.61	2.95
Tetrahydrothiophene	<1.00	0.89	1.83	1.83
Unidentified sulfurs	3.48	4.34	6.60	7.78
	(Concentration in ppmv, as H_2S)			
Total Sulfur	568.7	522.0	1215.9	1081.7

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Sampled: February 3, 2026
Date Received: February 3, 2026
Date Analyzed: February 3, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Hydrogen sulfide	Zeeco Inlet	227	227	227	0.00
	FL-2009 Inlet	165	156	161	5.6
	Hero Inlet	177	158	168	11
	Parnel Inlet	165	161	163	2.5
Carbonyl sulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	0.67	0.63	0.65	6.2
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Methyl mercaptan	Zeeco Inlet	71.5	71.9	71.7	0.56
	FL-2009 Inlet	76.0	72.2	74.1	5.1
	Hero Inlet	293	276	285	6.0
	Parnel Inlet	232	230	231	0.87
Ethyl mercaptan	Zeeco Inlet	1.44	1.41	1.43	2.1
	FL-2009 Inlet	1.22	1.10	1.16	10
	Hero Inlet	4.10	3.88	3.99	5.5
	Parnel Inlet	3.22	3.12	3.17	3.2
Dimethyl sulfide	Zeeco Inlet	254	260	257	2.3
	FL-2009 Inlet	272	262	267	3.7
	Hero Inlet	746	711	729	4.8
	Parnel Inlet	663	642	653	3.2
Carbon disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
i-Propyl mercaptan	Zeeco Inlet	1.84	2.04	1.94	10
	FL-2009 Inlet	1.79	1.66	1.73	7.5
	Hero Inlet	2.06	1.93	2.00	6.5
	Parnel Inlet	1.99	1.80	1.90	10
t-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
n-Propyl mercaptan	Zeeco Inlet	3.13	3.08	3.11	1.6
	FL-2009 Inlet	3.17	2.99	3.08	5.8
	Hero Inlet	9.07	8.53	8.80	6.1
	Parnel Inlet	8.30	7.85	8.08	5.6
s-Butyl mercaptan	Zeeco Inlet	2.96	3.08	3.02	4.0
	FL-2009 Inlet	3.36	3.28	3.32	2.4
	Hero Inlet	7.11	6.86	6.99	3.6
	Parnel Inlet	6.53	6.48	6.51	0.77
i-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Dimethyl disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	2.64	2.56	2.60	3.1
	Hero Inlet	2.78	2.44	2.61	13
	Parnel Inlet	2.93	2.97	2.95	1.4
Tetrahydrothiophene	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	0.92	0.85	0.89	7.9
	Hero Inlet	1.93	1.72	1.83	12
	Parnel Inlet	1.87	1.79	1.83	4.4
Unidentified sulfurs	Zeeco Inlet	3.60	3.36	3.48	6.9
	FL-2009 Inlet	4.55	4.13	4.34	9.7
	Hero Inlet	6.59	6.60	6.60	0.15
	Parnel Inlet	8.31	7.25	7.78	14

Four Tedlar bag samples, laboratory numbers 20346-(15-18), were analyzed for total sulfur compounds. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from four Tedlar bag samples is 5.4%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Permanent Gases Analysis in Tedlar Bag Sample

Report Date: February 27, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 3, 2026
Date Analyzed: February 3, 2026

ANALYSIS DESCRIPTION

Permanent gases were measured by thermal conductivity detection/ gas chromatography (TCD/GC) ASTM D1946-90.

AtmAA Lab No.	Sample ID	Oxygen (%v)	Nitrogen (%v)	Methane (%v)	Carbon Dioxide (%v)
20346-15	Zeeco Inlet	4.47	20.03	30.02	40.72
20346-16	FL-2009 Inlet	5.32	25.55	28.96	35.05
20346-17	Hero Inlet	5.87	26.49	14.18	44.88
20346-18	Parnel Inlet	6.39	27.25	15.94	42.40

The reported oxygen concentration includes any argon present in the sample. Calibration is based on a standard atmosphere containing 20.95% oxygen and 0.93% argon. The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported. Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 3, 2026
Date Analyzed: February 3, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Oxygen	Hero Inlet	5.86	5.87	5.87	0.17	<0.1
Nitrogen	Hero Inlet	26.45	26.53	26.49	0.30	<0.1
Methane	Hero Inlet	14.17	14.18	14.18	0.07	<0.1
Carbon Dioxide	Hero Inlet	44.90	44.86	44.88	0.09	<0.1

Four Tedlar bag samples, laboratory numbers 20346-(15-18), were analyzed for permanent gases. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 4 repeat measurements from 4 Tedlar bag samples is 0.16%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Carbon Monoxide Analysis in Tedlar Bag Samples

Report Date: February 27, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 3, 2026
Date Analyzed: February 3, 2026

ANALYSIS DESCRIPTION

Carbon monoxide was measured by flame ionization detection/total combustion analysis (FID/TCA), EPA Method ALT-144.

AtmAA Lab No.	Sample ID	Carbon Monoxide (Conc. in ppmv)
20346-15	Zeeco Inlet	322
20346-16	FL-2009 Inlet	252
20346-17	Hero Inlet	677
20346-18	Parnel Inlet	587

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analysis)

Project Name: Chiquita Canyon Landfill
Date Received: February 3, 2026
Date Analyzed: February 3, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Carbon Monoxide	Hero Inlet	676	677	677	0.15

Four Tedlar bag samples, laboratory numbers 20346-(15-18), were analyzed for carbon monoxide. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 4 Tedlar bag samples is 0.15%.

CHAIN OF CUSTODY RECORD

Client/Project Name	Project Location
SCS Engineers / Chiquita Canyon Landfill	29201 Henry Mayo Drive, Castaic, CA 91384
Project No.	**Field Logbook No.**
07224200.24 Task 1	
Sampler: *(Signature)* Victor Umeyor	**Chain of Custody Tape No.**

Sample No./ Identification	Type of Sample	AtmAA Lab Number	Sampling Date	Sampling Time	TRS (307.91	CH4, CO2, O2 (1946)	CO (EPA alt-144)				Special Remarks
Zeeco Inlet	LFG	20346-15	2/3/26	7:25Am	X	X	X				H2S 210 PPM
FL-2009 Inlet	LFG	-16	2/3/26	7:35Am	X	X	X				H2S 120 PPM
Hero Inlet	LFG	-17	2/3/26	7:05Am	X	X	X				H2S 150 PPM
Parnel Inlet	LFG	-18	2/3/26	7:15Am	X	X	X				H2S 150 PPM

ANALYSES REQUESTED

Relinquished by: *(Signature)*	Date	Time	Received by: *(Signature)*	Date	Time
Victor Umeyor	2/3/26	7:55Am		2/3/26	8:01
Relinquished by: *(Signature)*	Date	Time	Received by: *(Signature)*	Date	Time
	2/3/26	9:16			
Relinquished by: *(Signature)*	Date	Time	Received for Laboratory by: *(Signature)*	Date	Time
				2/3/26	9:16

Company Info:		Send Report to:	
Company:	SCS Engineers	Company:	SCS Engineers
Street Address	3900 Kilroy Airport Way Suite 300	Street Address	3900 Kilroy Airport Way Suite 300
City/State/Zip:	Long Beach / CA / 90806	City/State/Zip:	Long Beach / CA / 90806
Telephone No.:	562-743-7895 /562-335-0002	Project Manager:	Cornelius Fong
Fax No.:		Email Address:	CFong@scsengineers.com

Analytical Laboratory

AtmAA Inc.
5107 Douglas Fir Rd.
Calabasas, CA 91302
TEL: (818) 223-3277
Email Address: info@atmaa.com

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Sulfide and Reduced Sulfur Compounds
Analysis in Tedlar Bag Sample by SCAQMD Method 307.91

Report Date: March 3, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Sampled: February 4, 2026
Date Received: February 4, 2026
Date Analyzed: February 4, 2026

ANALYSIS DESCRIPTION

Total sulfur analysis measured by gas chromatography with sulfur chemiluminescence detector (SCD), SCAQMD 307.91.

AtmAA Lab No.:	20356-2	20356-3	20356-4
Sample I.D.:	Zeeco Inlet	FL-2009 Inlet	Parnel Inlet
Components	*(Concentration in ppmv)*		
Hydrogen sulfide	225	145	155
Carbonyl sulfide	<1.00	0.62	<1.50
Methyl mercaptan	68.7	71.5	212
Ethyl mercaptan	1.40	1.06	2.95
Dimethyl sulfide	245	247	584
Carbon disulfide	<1.00	<0.50	<1.50
i-Propyl mercaptan	2.00	1.53	1.84
t-Butyl mercaptan	<1.00	<0.50	<1.50
n-Propyl mercaptan	3.08	2.81	7.15
s-Butyl mercaptan	2.95	2.76	5.57
i-Butyl mercaptan	<1.00	<0.50	<1.50
Dimethyl disulfide	<1.00	1.95	2.83
Tetrahydrothiophene	<1.00	0.74	1.61
Unidentified sulfurs	1.31	2.70	4.76
	(Concentration in ppmv, as H_2S)		
Total Sulfur	549.4	479.1	979.5

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Sampled: February 4, 2026
Date Received: February 4, 2026
Date Analyzed: February 4, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Hydrogen sulfide	Zeeco Inlet	226	224	225	0.89
	FL-2009 Inlet	150	139	145	7.6
	Parnel Inlet	161	148	155	8.4
Carbonyl sulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	0.64	0.59	0.62	8.1
	Parnel Inlet	<1.50	<1.50	---	---
Methyl mercaptan	Zeeco Inlet	68.7	68.7	68.7	0.00
	FL-2009 Inlet	74.3	68.7	71.5	7.8
	Parnel Inlet	219	205	212	6.6
Ethyl mercaptan	Zeeco Inlet	1.40	1.39	1.40	0.72
	FL-2009 Inlet	1.09	1.02	1.06	6.6
	Parnel Inlet	3.03	2.86	2.95	5.8
Dimethyl sulfide	Zeeco Inlet	244	246	245	0.82
	FL-2009 Inlet	256	238	247	7.3
	Parnel Inlet	600	567	584	5.7
Carbon disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
i-Propyl mercaptan	Zeeco Inlet	2.06	1.93	2.00	6.5
	FL-2009 Inlet	1.55	1.51	1.53	2.6
	Parnel Inlet	1.90	1.78	1.84	6.5
t-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
n-Propyl mercaptan	Zeeco Inlet	3.06	3.09	3.08	0.98
	FL-2009 Inlet	2.95	2.66	2.81	10
	Parnel Inlet	7.23	7.07	7.15	2.2
s-Butyl mercaptan	Zeeco Inlet	2.74	3.16	2.95	14
	FL-2009 Inlet	2.84	2.67	2.76	6.2
	Parnel Inlet	5.71	5.4	5.57	5.2

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
i-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Dimethyl disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	1.98	1.92	1.95	3.1
	Parnel Inlet	2.83	2.83	2.83	0.00
Tetrahydrothiophene	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	0.84	0.64	0.74	27
	Parnel Inlet	1.77	1.44	1.61	21
Unidentified sulfurs	Zeeco Inlet	1.13	1.50	1.31	28
	FL-2009 Inlet	2.96	2.43	2.70	20
	Parnel Inlet	4.98	4.54	4.76	9.2

Three Tedlar bag samples, laboratory numbers 20356-(2-4), were analyzed for total sulfur compounds. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from three Tedlar bag samples is 7.9%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277

LABORATORY ANALYSIS REPORT specialized air assessment laboratory
atmaa.com

TO-15 Component Analysis in Tedlar Bag Sample, by GC/MS Method EPA TO-15

Report Date: February 27, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 4, 2026
Date Analyzed: February 5, 2026

AtmAA Lab No.:	20356-2	20356-3	20356-4
Sample ID:	Zeeco Inlet	FL-2009 Inlet	Parnel Inlet
Components	*(Concentations in ppmv)*		
Freon 12	<1.50	<1.50	<1.50
Chloromethane	2.94	<1.90	<1.90
Freon 114	<1.10	<1.10	<1.10
Vinyl Chloride	<1.50	<1.50	<1.50
1,3-Butadiene	<1.80	<1.80	<1.80
Bromomethane	<1.90	<1.90	<1.90
Chloroethane	<1.50	<1.50	<1.50
Acetone	142	199	375
Freon 11	<1.40	<1.40	<1.40
Isopropyl Alcohol	182	145	228
1,1-Dichloroethene	<1.90	<1.90	<1.90
Methylene Chloride	<2.20	<2.20	<2.20
Carbon Disulfide	<1.30	<1.30	<1.30
Freon 113	<1.00	<1.00	<1.00
trans-1,2-Dichloroethene	<1.90	<1.90	<1.90
1,1-Dichloroethane	<1.90	<1.90	<1.90
MTBE	<2.10	<2.10	<2.10
Vinyl Acetate	<2.60	<2.60	<2.60
2-Butanone	59.2	81.9	159
cis-1,2-Dichloroethene	<1.90	<1.90	<1.90
n-Hexane	<2.20	<2.20	2.93
Chloroform	<1.60	<1.60	<1.60
Ethyl Acetate	9.39	7.30	11.8
Tetrahydrofuran	27.2	44.3	107
1,2-Dichloroethane	<1.90	<1.90	<1.90
1,1,1-Trichloroethane	<1.40	<1.40	<1.40
Benzene	38.9	40.3	101
Carbon Tetrachloride	<1.20	<1.20	<1.20
Cyclohexane	<2.20	<2.20	<2.20
1,2-Dichloropropane	<1.70	<1.70	<1.70
Bromodichloromethane	<1.20	<1.20	<1.20
Trichloroethene	<1.40	<1.40	<1.40
1,4-Dioxane	<2.10	<2.10	<2.10
n-Heptane	<1.90	<1.90	<1.90
cis-1,3-Dichloropropene	<1.70	<1.70	<1.70
4-Methyl-2-pentanone	<1.85	<1.85	2.90
trans-1,3-Dichloropropene	<1.70	<1.70	<1.70
1,1-2-Trichloroethane	<1.40	<1.40	<1.40
Toluene	2.36	2.77	4.37
2-Hexanone	<1.90	<1.90	<1.90
Dibromochloromethane	<0.90	<0.90	<0.90
1,2-Dibromoethane	<1.00	<1.00	<1.00
Tetrachloroethene	<1.10	<1.10	<1.10
Chlorobenzene	<1.70	<1.70	<1.70
Ethylbenzene	<1.75	<1.75	<1.75
m,p-Xylene	<1.75	<1.75	<1.75
Bromoform	<0.80	<0.80	<0.80
Styrene	<1.80	<1.80	<1.80
1,1,2,2-Tetrachloroethane	<1.10	<1.10	<1.10
o-Xylene	<1.80	<1.80	<1.80
Benzyl Chloride	<1.40	<1.40	<1.40
4-Ethyl Toluene	<1.60	<1.60	<1.60
1,3,5-Trimethyl Benzene	<1.60	<1.60	<1.60
1,2,4-Trimethyl Benzene	<1.60	<1.60	<1.60
1,3-Dichlorobenzene	<1.30	<1.30	<1.30
1,4-Dichlorobenzene	<1.30	<1.30	<1.30
1,2-Dichlorobenzene	<1.30	<1.30	<1.30
1,2,4-Trichlorobenzene	<4.10	<4.10	<4.10
Hexachlorobutadiene	<2.90	<2.90	<2.90

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 4, 2026
Date Analyzed: February 5, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Freon-12	Parnel Inlet	<1.50	<1.50	---	---
Chloromethane	Parnel Inlet	<1.90	<1.90	---	---
Freon 114	Parnel Inlet	<1.10	<1.10	---	---
Vinyl Chloride	Parnel Inlet	<1.50	<1.50	---	---
1,3-Butadiene	Parnel Inlet	<1.80	<1.80	---	---
Bromomethane	Parnel Inlet	<1.90	<1.90	---	---
Chloroethane	Parnel Inlet	<1.50	<1.50	---	---
Acetone	Parnel Inlet	404	346	375	15
Freon 11	Parnel Inlet	<1.40	<1.40	---	---
Isopropyl Alcohol	Parnel Inlet	230	225	228	2.2
1,1-Dichloroethene	Parnel Inlet	<1.90	<1.90	---	---
Methylene Chloride	Parnel Inlet	<2.20	<2.20	---	---
Carbon Disulfide	Parnel Inlet	<1.30	<1.30	---	---
Freon 113	Parnel Inlet	<1.00	<1.00	---	---
trans-1,2-Dichloroethene	Parnel Inlet	<1.90	<1.90	---	---
1,1-Dichloroethane	Parnel Inlet	<1.90	<1.90	---	---
MTBE	Parnel Inlet	<2.10	<2.10	---	---
Vinyl Acetate	Parnel Inlet	<2.60	<2.60	---	---
2-Butanone	Parnel Inlet	154	163	159	5.7
cis-1,2-Dichloroethene	Parnel Inlet	<1.90	<1.90	---	---
n-Hexane	Parnel Inlet	2.84	3.01	2.93	5.8
Chloroform	Parnel Inlet	<1.60	<1.60	---	---
Ethyl Acetate	Parnel Inlet	11.6	12.0	11.8	3.4
Tetrahydrofuran	Parnel Inlet	106	108	107	1.9
1,2-Dichloroethane	Parnel Inlet	<1.90	<1.90	---	---

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
1,1,1-Trichloroethane	Parnel Inlet	<1.40	<1.40	---	---
Benzene	Parnel Inlet	101	101	101	0.00
Carbon Tetrachloride	Parnel Inlet	<1.20	<1.20	---	---
Cyclohexane	Parnel Inlet	<2.20	<2.20	---	---
1,2-Dichloropropane	Parnel Inlet	<1.70	<1.70	---	---
Bromodichloromethane	Parnel Inlet	<1.20	<1.20	---	---
Trichloroethene	Parnel Inlet	<1.40	<1.40	---	---
1,4-Dioxane	Parnel Inlet	<2.10	<2.10	---	---
n-Heptane	Parnel Inlet	<1.90	<1.90	---	---
cis-1,3-Dichloropropene	Parnel Inlet	<1.70	<1.70	---	---
4-Methyl-2-pentanone	Parnel Inlet	2.61	3.19	2.90	20
trans-1,3-Dichloropropene	Parnel Inlet	<1.70	<1.70	---	---
1,1-2-Trichloroethane	Parnel Inlet	<1.40	<1.40	---	---
Toluene	Parnel Inlet	4.37	4.37	4.37	0.00
2-Hexanone	Parnel Inlet	<1.90	<1.90	---	---
Dibromochloromethane	Parnel Inlet	<0.90	<0.90	---	---
1,2-Dibromoethane	Parnel Inlet	<1.00	<1.00	---	---
Tetrachloroethene	Parnel Inlet	<1.10	<1.10	---	---
Chlorobenzene	Parnel Inlet	<1.70	<1.70	---	---
Ethylbenzene	Parnel Inlet	<1.75	<1.75	---	---
m,p-Xylene	Parnel Inlet	<1.75	<1.75	---	---
Bromoform	Parnel Inlet	<0.80	<0.80	---	---
Styrene	Parnel Inlet	<1.80	<1.80	---	---
1,1,2,2-Tetrachloroethane	Parnel Inlet	<1.10	<1.10	---	---
o-Xylene	Parnel Inlet	<1.80	<1.80	---	---

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Benzyl Chloride	Parnel Inlet	<1.40	<1.40	---	---
4-Ethyl Toluene	Parnel Inlet	<1.60	<1.60	---	---
1,3,5-Trimethyl Benzene	Parnel Inlet	<1.60	<1.60	---	---
1,2,4-Trimethyl Benzene	Parnel Inlet	<1.60	<1.60	---	---
1,3-Dichlorobenzene	Parnel Inlet	<1.30	<1.30	---	---
1,4-Dichlorobenzene	Parnel Inlet	<1.30	<1.30	---	---
1,2-Dichlorobenzene	Parnel Inlet	<1.30	<1.30	---	---
1,2,4-Trichlorobenzene	Parnel Inlet	<4.10	<4.10	---	---
Hexachlorobutadiene	Parnel Inlet	<2.90	<2.90	---	---

Three Tedlar bag samples, laboratory numbers 20356-(2-4), were analyzed for TO-15 components, by GC/MS. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from three Tedlar bag samples is 6.0%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Permanent Gases Analysis in Tedlar Bag Sample

Report Date: February 27, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 4, 2026
Date Analyzed: February 4, 2026

ANALYSIS DESCRIPTION

Permanent gases were measured by thermal conductivity detection/gas chromatography analysis (TCD/GC), ASTM D1946-90.

AtmAA Lab No.	Sample ID	Oxygen (%v)	Nitrogen (%v)	Methane (%v)	Carbon Dioxide (%v)
20356-2	Zeeco Inlet	5.63	23.92	28.15	36.37
20356-3	FL-2009 Inlet	6.09	28.33	26.95	33.32
20356-4	Parnel Inlet	7.04	28.74	16.43	40.27

The reported oxygen concentration includes any argon present in the sample. Calibration is based on a standard atmosphere containing 20.95% oxygen and 0.93% argon.
The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported.
Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 4, 2026
Date Analyzed: February 4, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Oxygen	Zeeco Inlet	5.63	5.62	5.63	0.18	<0.1
Nitrogen	Zeeco Inlet	23.98	23.86	23.92	0.50	<0.1
Methane	Zeeco Inlet	28.17	28.13	28.15	0.14	<0.1
Carbon Dioxide	Zeeco Inlet	37.86	34.88	36.37	8.19	<0.1

Three Tedlar bag samples, laboratory numbers 20356-(2-4), were analyzed for permanent gases. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 4 repeat measurements from 3 Tedlar bag samples is 2.2%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Analysis in Tedlar Bag Samples

Report Date: February 27, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 4, 2026
Date Analyzed: February 4, 2026

ANALYSIS DESCRIPTION

Hydrogen was measured by thermal conductivity detection/ gas chromotography (TCD/GC) ASTM D1946-90.

AtmAA Lab No.	Sample ID	Hydrogen (%v)
20356-2	Zeeco Inlet	1.82
20356-3	FL-2009 Inlet	1.77
20356-4	Parnel Inlet	3.39

The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported. Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 4, 2026
Date Analyzed: February 4, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Hydrogen	Zeeco Inlet	1.82	1.82	1.82	0.0	<0.1

Three Tedlar bag samples, laboratory number 20356-(2-4), were analyzed for Hydrogen. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 3 Tedlar bag samples is 0.0%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Carbon Monoxide Analysis in Tedlar Bag Samples

Report Date: March 2, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 4, 2026
Date Analyzed: February 4, 2026

ANALYSIS DESCRIPTION

Carbon monoxide was measured by flame ionization detection/total combustion analysis (FID/TCA), EPA Method ALT-144.

AtmAA Lab No.	Sample ID	Carbon Monoxide *(Conc. in ppmv)*
20356-2	Zeeco Inlet	313
20356-3	FL-2009 Inlet	244
20356-4	Parnel Inlet	607

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analysis)

Project Name: Chiquita Canyon Landfill
Date Received: February 4, 2026
Date Analyzed: February 4, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Carbon Monoxide	Zeeco Inlet	317	308	313	2.9

Three Tedlar bag samples, laboratory numbers 20356-(2-4), were analyzed for carbon monoxide. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 3 Tedlar bag samples is 2.9%.

CHAIN OF CUSTODY RECORD

Client/Project Name	Project Location
SCS Engineers / Chiquita Canyon Landfill	29201 Henry Mayo Drive, Castaic, CA 91384
Project No. 07224200.24 Task 1	**Field Logbook No.**
Sampler: *(Signature)* Victor Chuyen	**Chain of Custody Tape No.**

Sample No./ Identification	Type of Sample	AtmAA Lab Number	Sampling Date	Sampling Time	TRS (307.91)	CH4, CO2, O2 (1946)	CO (EPA ALT-144)	VOCs (TO-15)	H2 (ASTM D1946)		Special Remarks
Zeeco Inlet	LFG	20356-2	2/4/26	7:30AM	X	X	X	X	X		H2S 175 ppm
* Hero Inlet	LFG		2/4/26	7:15AM	X	X	X	X	X		H2S 110 ppm
FL-2009 Inlet	LFG	-3	2/4/26	7:40AM	X	X	X	X	X		H2S 80 ppm
Parnel Inlet	LFG	-4	2/4/26	7:25AM	X	X	X	X	X		H2S 125 ppm

ANALYSES REQUESTED

Relinquished by: *(Signature)*	Date	Time	Received by: *(Signature)*	Date	Time
Victor Chuyen	2/4/26	8:06AM	LUIS FARFAN	2/4/26	8:19AM
Relinquished by: *(Signature)* LUIS FARFAN	2/4/26	9:21AM	Received by: *(Signature)*	Date	Time
Relinquished by: *(Signature)*	Date	Time	Received for Laboratory by: *(Signature)*	2/4/26	9:21AM

Company Info:	Send Report to:	Analytical Laboratory
Company: SCS Engineers	**Company:** SCS Engineers	AtmAA Inc.
Street Address 3900 Kilroy Airport Way Suite 300	**Street Address** 3900 Kilroy Airport Way Suite 300	5107 Douglas Fir Rd.
City/State/Zip: Long Beach / CA / 90806	**City/State/Zip:** Long Beach / CA / 90806	Calabasas, CA 91302
Telephone No.: 562-743-7895 /562-335-0002	**Project Manager:** Cornelius Fong	TEL: (818) 223-3277
Fax No.:	**Email Address:** CFong@scsengineers.com	Email Address: info@atmaa.com

* received flat

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Sulfide and Reduced Sulfur Compounds
Analysis in Tedlar Bag Sample by SCAQMD Method 307.91

Report Date: March 3, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Sampled: February 4, 2026
Date Received: February 5, 2026
Date Analyzed: February 5, 2026

ANALYSIS DESCRIPTION

Total sulfur analysis measured by gas chromatography with sulfur chemiluminescence detector (SCD), SCAQMD 307.91.

AtmAA Lab No.:	20366-11
Sample I.D.:	Hero Inlet

Components	*(Concentration in ppmv)*
Hydrogen sulfide	178
Carbonyl sulfide	<1.50
Methyl mercaptan	298
Ethyl mercaptan	4.01
Dimethyl sulfide	757
Carbon disulfide	<1.50
i-Propyl mercaptan	2.13
t-Butyl mercaptan	<1.50
n-Propyl mercaptan	9.41
s-Butyl mercaptan	7.37
i-Butyl mercaptan	<1.50
Dimethyl disulfide	<1.50
Tetrahydrothiophene	1.97
Unidentified sulfurs	9.70
	(Concentration in ppmv, as H_2S)
Total Sulfur	1267.1

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Sampled: February 4, 2026
Date Received: February 5, 2026
Date Analyzed: February 5, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Hydrogen sulfide	Hero Inlet	182	173	178	5.1
Carbonyl sulfide	Hero Inlet	<1.50	<1.50	---	---
Methyl mercaptan	Hero Inlet	302	294	298	2.7
Ethyl mercaptan	Hero Inlet	4.02	4.00	4.01	0.50
Dimethyl sulfide	Hero Inlet	760	754	757	0.79
Carbon disulfide	Hero Inlet	<1.50	<1.50	---	---
i-Propyl mercaptan	Hero Inlet	2.19	2.07	2.13	5.6
t-Butyl mercaptan	Hero Inlet	<1.50	<1.50	---	---
n-Propyl mercaptan	Hero Inlet	9.52	9.29	9.41	2.4
s-Butyl mercaptan	Hero Inlet	7.20	7.54	7.37	4.6
i-Butyl mercaptan	Hero Inlet	<1.50	<1.50	---	---
Dimethyl disulfide	Hero Inlet	<1.50	<1.50	---	---
Tetrahydrothiophene	Hero Inlet	2.08	1.86	1.97	11
Unidentified sulfurs	Hero Inlet	9.29	10.1	9.70	8.4

One Tedlar bag sample, laboratory number 20366-11, was analyzed for total sulfur compounds. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from one Tedlar bag sample is 4.6%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277

LABORATORY ANALYSIS REPORT **specialized air assessment laboratory**
atmaa.com

TO-15 Component Analysis in Tedlar Bag Sample, by GC/MS Method EPA TO-15

Report Date: February 27, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 5, 2026
Date Analyzed: February 5, 2026

Components	AtmAA Lab No.: 20366-11 Sample ID: Hero Inlet *(Concentations in ppmv)*
Freon 12	<1.50
Chloromethane	<1.90
Freon 114	<1.10
Vinyl Chloride	<1.50
1,3-Butadiene	<1.80
Bromomethane	<1.90
Chloroethane	<1.50
Acetone	624
Freon 11	<1.40
Isopropyl Alcohol	371
1,1-Dichloroethene	<1.90
Methylene Chloride	<2.20
Carbon Disulfide	<1.30
Freon 113	<1.00
trans-1,2-Dichloroethene	<1.90
1,1-Dichloroethane	<1.90
MTBE	<2.10
Vinyl Acetate	<2.60
2-Butanone	247
cis-1,2-Dichloroethene	<1.90
n-Hexane	3.21
Chloroform	<1.60
Ethyl Acetate	17.2
Tetrahydrofuran	148
1,2-Dichloroethane	<1.90
1,1,1-Trichloroethane	<1.40
Benzene	137
Carbon Tetrachloride	<1.20
Cyclohexane	<2.20
1,2-Dichloropropane	<1.70
Bromodichloromethane	<1.20
Trichloroethene	<1.40
1,4-Dioxane	3.56
n-Heptane	<1.90
cis-1,3-Dichloropropene	<1.70
4-Methyl-2-pentanone	3.54
trans-1,3-Dichloropropene	<1.70
1,1-2-Trichloroethane	<1.40
Toluene	5.89
2-Hexanone	<1.90
Dibromochloromethane	<0.90
1,2-Dibromoethane	<1.00
Tetrachloroethene	<1.10
Chlorobenzene	<1.70
Ethylbenzene	<1.75
m,p-Xylene	<1.75
Bromoform	<0.80
Styrene	<1.80
1,1,2,2-Tetrachloroethane	<1.10
o-Xylene	<1.80
Benzyl Chloride	<1.40
4-Ethyl Toluene	<1.60
1,3,5-Trimethyl Benzene	<1.60
1,2,4-Trimethyl Benzene	<1.60
1,3-Dichlorobenzene	<1.30
1,4-Dichlorobenzene	<1.30
1,2-Dichlorobenzene	<1.30
1,2,4-Trichlorobenzene	<4.10
Hexachlorobutadiene	<2.90

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 5, 2026
Date Analyzed: February 5, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Freon-12	Hero Inlet	<1.50	<1.50	---	---
Chloromethane	Hero Inlet	<1.90	<1.90	---	---
Freon 114	Hero Inlet	<1.10	<1.10	---	---
Vinyl Chloride	Hero Inlet	<1.50	<1.50	---	---
1,3-Butadiene	Hero Inlet	<1.80	<1.80	---	---
Bromomethane	Hero Inlet	<1.90	<1.90	---	---
Chloroethane	Hero Inlet	<1.50	<1.50	---	---
Acetone	Hero Inlet	619	629	624	1.6
Freon 11	Hero Inlet	<1.40	<1.40	---	---
Isopropyl Alcohol	Hero Inlet	399	342	371	15
1,1-Dichloroethene	Hero Inlet	<1.90	<1.90	---	---
Methylene Chloride	Hero Inlet	<2.20	<2.20	---	---
Carbon Disulfide	Hero Inlet	<1.30	<1.30	---	---
Freon 113	Hero Inlet	<1.00	<1.00	---	---
trans-1,2-Dichloroethene	Hero Inlet	<1.90	<1.90	---	---
1,1-Dichloroethane	Hero Inlet	<1.90	<1.90	---	---
MTBE	Hero Inlet	<2.10	<2.10	---	---
Vinyl Acetate	Hero Inlet	<2.60	<2.60	---	---
2-Butanone	Hero Inlet	252	242	247	4.0
cis-1,2-Dichloroethene	Hero Inlet	<1.90	<1.90	---	---
n-Hexane	Hero Inlet	3.48	2.94	3.21	17
Chloroform	Hero Inlet	<1.60	<1.60	---	---
Ethyl Acetate	Hero Inlet	18.3	16.0	17.2	13
Tetrahydrofuran	Hero Inlet	151	144	148	4.7
1,2-Dichloroethane	Hero Inlet	<1.90	<1.90	---	---

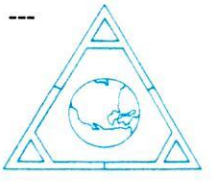

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
1,1,1-Trichloroethane	Hero Inlet	<1.40	<1.40	---	---
Benzene	Hero Inlet	139	134	137	3.7
Carbon Tetrachloride	Hero Inlet	<1.20	<1.20	---	---
Cyclohexane	Hero Inlet	<2.20	<2.20	---	---
1,2-Dichloropropane	Hero Inlet	<1.70	<1.70	---	---
Bromodichloromethane	Hero Inlet	<1.20	<1.20	---	---
Trichloroethene	Hero Inlet	<1.40	<1.40	---	---
1,4-Dioxane	Hero Inlet	3.88	3.23	3.56	18
n-Heptane	Hero Inlet	<1.90	<1.90	---	---
cis-1,3-Dichloropropene	Hero Inlet	<1.70	<1.70	---	---
4-Methyl-2-pentanone	Hero Inlet	3.53	3.55	3.54	0.56
trans-1,3-Dichloropropene	Hero Inlet	<1.70	<1.70	---	---
1,1-2-Trichloroethane	Hero Inlet	<1.40	<1.40	---	---
Toluene	Hero Inlet	6.07	5.71	5.89	6.1
2-Hexanone	Hero Inlet	<1.90	<1.90	---	---
Dibromochloromethane	Hero Inlet	<0.90	<0.90	---	---
1,2-Dibromoethane	Hero Inlet	<1.00	<1.00	---	---
Tetrachloroethene	Hero Inlet	<1.10	<1.10	---	---
Chlorobenzene	Hero Inlet	<1.70	<1.70	---	---
Ethylbenzene	Hero Inlet	<1.75	<1.75	---	---
m,p-Xylene	Hero Inlet	<1.75	<1.75	---	---
Bromoform	Hero Inlet	<0.80	<0.80	---	---
Styrene	Hero Inlet	<1.80	<1.80	---	---
1,1,2,2-Tetrachloroethane	Hero Inlet	<1.10	<1.10	---	---
o-Xylene	Hero Inlet	<1.80	<1.80	---	---

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Benzyl Chloride	Hero Inlet	<1.40	<1.40	---	---
4-Ethyl Toluene	Hero Inlet	<1.60	<1.60	---	---
1,3,5-Trimethyl Benzene	Hero Inlet	<1.60	<1.60	---	---
1,2,4-Trimethyl Benzene	Hero Inlet	<1.60	<1.60	---	---
1,3-Dichlorobenzene	Hero Inlet	<1.30	<1.30	---	---
1,4-Dichlorobenzene	Hero Inlet	<1.30	<1.30	---	---
1,2-Dichlorobenzene	Hero Inlet	<1.30	<1.30	---	---
1,2,4-Trichlorobenzene	Hero Inlet	<4.10	<4.10	---	---
Hexachlorobutadiene	Hero Inlet	<2.90	<2.90	---	---

One Tedlar bag sample, laboratory number 20366-11, was analyzed for TO-15 components, by GC/MS. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from one Tedlar bag sample is 8.5%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Permanent Gases Analysis in Tedlar Bag Sample

Report Date: February 27, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 5, 2025
Date Analyzed: February 5, 2026

ANALYSIS DESCRIPTION

Permanent gases were measured by thermal conductivity detection/ gas chromatography (TCD/GC) ASTM D1946-90.

AtmAA Lab No.	Sample ID	Oxygen (%v)	Nitrogen (%v)	Methane (%v)	Carbon Dioxide (%v)
20366-11	Hero Inlet	5.75	24.94	15.60	45.16

The reported oxygen concentration includes any argon present in the sample. Calibration is based on a standard atmosphere containing 20.95% oxygen and 0.93% argon. The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported. Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 5, 2025
Date Analyzed: February 5, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Oxygen	Hero Inlet	5.74	5.75	5.75	0.17	<0.1
Nitrogen	Hero Inlet	24.91	24.97	24.94	0.24	<0.1
Methane	Hero Inlet	15.58	15.62	15.60	0.26	<0.1
Carbon Dioxide	Hero Inlet	45.14	45.17	45.16	0.07	<0.1

One Tedlar bag sample, laboratory number 20366-11, was analyzed for permanent gases. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 4 repeat measurements from 1 Tedlar bag sample is 0.18%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Analysis in Tedlar Bag Samples

Report Date: February 27, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 5, 2025
Date Analyzed: February 5, 2026

ANALYSIS DESCRIPTION

Hydrogen was measured by thermal conductivity detection/ gas chromotography (TCD/GC) ASTM D1946-90.

AtmAA Lab No.	Sample ID	Hydrogen (%v)
20366-11	Hero Inlet	4.11

The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported. Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 5, 2025
Date Analyzed: February 5, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Hydrogen	Hero Inlet	4.11	4.10	4.11	0.24	<0.1

One Tedlar bag sample, laboratory number 20366-11, was analyzed for Hydrogen. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 1 Tedlar bag sample is 0.24%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Carbon Monoxide Analysis in Tedlar Bag Samples

Report Date: February 27, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 5, 2025
Date Analyzed: February 5, 2026

ANALYSIS DESCRIPTION

Carbon monoxide was measured by flame ionization detection/total combustion analysis (FID/TCA), EPA Method ALT-144.

AtmAA Lab No.	Sample ID	Carbon Monoxide (Conc. in ppmv)
20366-11	Hero Inlet	763

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analysis)

Project Name: Chiquita Canyon Landfill
Date Received: February 5, 2025
Date Analyzed: February 5, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Carbon Monoxide	Hero Inlet	772	754	763	2.4

One Tedlar bag sample, laboratory number 20366-11, was analyzed for carbon monoxide. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 1 Tedlar bag sample is 2.4%.

CHAIN OF CUSTODY RECORD

Client/Project Name	Project Location
SCS Engineers / Chiquita Canyon Landfill	29201 Henry Mayo Drive, Castaic, CA 91384
Project No.	**Field Logbook No.**
07224200.24 Task 1	
Sampler: (Signature)	**Chain of Custody Tape No.**

Sample No./ Identification	Type of Sample	AtmAA Lab Number	Sampling Date	Sampling Time	TRS (307.91)	CH4, CO2, O2 (1946)	CO (EPA ALT-144)	VOCs (TO-15)	H2 (ASTM D1946)		Special Remarks
Heroff Inlet.	LFG	20366-11	2/2/26	4:40 pm	X	X	X	X	X		H2S 150 ppm

ANALYSES REQUESTED

Relinquished by: (Signature)	Date	Time	Received by: (Signature)	Date	Time
	2-5-26	8:00Am	Victor Amaya	2/5/26	8:00Am
Relinquished by: (Signature) Victor Amaya	Date 2/5/26	Time 8:00Am	Received by: (Signature) LUIS FARFAN	Date 2/5/26	Time 9:34Am
Relinquished by: (Signature) LUIS F	Date 2/5/26	Time 11:53	Received for Laboratory by: (Signature)	Date 2/5/26	Time 11:53

Company Info:		Send Report to:		Analytical Laboratory
Company:	SCS Engineers	Company:	SCS Engineers	AtmAA Inc.
Street Address	3900 Kilroy Airport Way Suite 300	Street Address	3900 Kilroy Airport Way Suite 300	5107 Douglas Fir Rd.
City/State/Zip:	Long Beach / CA / 90806	City/State/Zip:	Long Beach / CA / 90806	Calabasas, CA 91302
Telephone No.:	562-743-7895 /562-335-0002	Project Manager:	Cornelius Fong	TEL: (818) 223-3277
Fax No.:		Email Address:	CFong@scsengineers.com	Email Address: info@atmaa.com

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Sulfide and Reduced Sulfur Compounds
Analysis in Tedlar Bag Sample by SCAQMD Method 307.91

Report Date: March 3, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Sampled: February 5, 2026
Date Received: February 5, 2026
Date Analyzed: February 5, 2026

ANALYSIS DESCRIPTION

Total sulfur analysis measured by gas chromatography with sulfur chemiluminescence detector (SCD), SCAQMD 307.91.

AtmAA Lab No.:	20366-12	20366-13	20366-14	20366-15
Sample I.D.:	Zeeco Inlet	Hero Inlet	Parnel Inlet	FL-1995
Components	*(Concentration in ppmv)*			
Hydrogen sulfide	245	174	173	143
Carbonyl sulfide	<1.00	<1.50	<1.50	0.61
Methyl mercaptan	73.8	295	244	66.8
Ethyl mercaptan	1.42	3.94	3.34	1.00
Dimethyl sulfide	276	732	656	220
Carbon disulfide	<1.00	<1.50	<1.50	<0.50
i-Propyl mercaptan	1.97	2.01	2.03	1.49
t-Butyl mercaptan	<1.00	<1.50	<1.50	<0.50
n-Propyl mercaptan	3.46	8.96	7.87	2.57
s-Butyl mercaptan	3.33	6.61	6.16	2.53
i-Butyl mercaptan	<1.00	<1.50	<1.50	<0.50
Dimethyl disulfide	<1.00	<1.50	<1.50	<0.50
Tetrahydrothiophene	<1.00	1.76	1.75	0.64
Unidentified sulfurs	3.16	7.86	9.06	6.51
	(Concentration in ppmv, as H_2S)			
Total Sulfur	607.6	1231.1	1102.2	444.6

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Sampled: February 5, 2026
Date Received: February 5, 2026
Date Analyzed: February 5, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Hydrogen sulfide	Zeeco Inlet	242	247	245	2.0
	Hero Inlet	176	171	174	2.9
	Parnel Inlet	180	166	173	8.1
	FL-1995	137	148	143	7.7
Carbonyl sulfide	Zeeco Inlet	<1.00	<1.00	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
	FL-1995	0.58	0.64	0.61	9.8
Methyl mercaptan	Zeeco Inlet	74.0	73.6	73.8	0.54
	Hero Inlet	301	288	295	4.4
	Parnel Inlet	253	234	244	7.8
	FL-1995	63.1	70.4	66.8	11
Ethyl mercaptan	Zeeco Inlet	1.44	1.39	1.42	3.5
	Hero Inlet	4.03	3.85	3.94	4.6
	Parnel Inlet	3.52	3.15	3.34	11
	FL-1995	0.98	1.02	1.00	4.0
Dimethyl sulfide	Zeeco Inlet	277	275	276	0.72
	Hero Inlet	736	728	732	1.1
	Parnel Inlet	676	635	656	6.3
	FL-1995	214	226	220	5.5
Carbon disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
	FL-1995	<0.50	<0.50	---	---
i-Propyl mercaptan	Zeeco Inlet	2.02	1.91	1.97	5.6
	Hero Inlet	1.97	2.05	2.01	4.0
	Parnel Inlet	2.12	1.94	2.03	8.9
	FL-1995	1.45	1.53	1.49	5.4
t-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
	FL-1995	<0.50	<0.50	---	---

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
n-Propyl mercaptan	Zeeco Inlet	3.46	3.45	3.46	0.29
	Hero Inlet	8.87	9.05	8.96	2.0
	Parnel Inlet	8.05	7.68	7.87	4.7
	FL-1995	2.52	2.62	2.57	3.9
s-Butyl mercaptan	Zeeco Inlet	3.40	3.26	3.33	4.2
	Hero Inlet	6.73	6.48	6.61	3.8
	Parnel Inlet	6.31	6.00	6.16	5.0
	FL-1995	2.41	2.64	2.53	9.1
i-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
	FL-1995	<0.50	<0.50	---	---
Dimethyl disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
	FL-1995	<0.50	<0.50	---	---
Tetrahydrothiophene	Zeeco Inlet	<1.00	<1.00	---	---
	Hero Inlet	1.79	1.72	1.76	4.0
	Parnel Inlet	1.79	1.70	1.75	5.2
	FL-1995	0.63	0.65	0.64	3.1
Unidentified sulfurs	Zeeco Inlet	3.24	3.07	3.16	5.4
	Hero Inlet	7.65	8.07	7.86	5.3
	Parnel Inlet	8.99	9.12	9.06	1.4
	FL-1995	6.22	6.79	6.51	8.8

Four Tedlar bag samples, laboratory numbers 20366-(12-15), were analyzed for total sulfur compounds. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from four Tedlar bag samples is 5.0%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Permanent Gases Analysis in Tedlar Bag Sample

Report Date: February 27, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 5, 2026
Date Analyzed: February 5, 2026

ANALYSIS DESCRIPTION

Permanent gases were measured by thermal conductivity detection/ gas chromatography (TCD/GC) ASTM D1946-90.

AtmAA Lab No.	Sample ID	Oxygen (%v)	Nitrogen (%v)	Methane (%v)	Carbon Dioxide (%v)
20366-12	Zeeco Inlet	5.37	22.87	27.91	38.54
20366-13	Hero Inlet	6.40	27.04	14.64	44.15
20366-14	Parnel Inlet	7.11	28.26	16.25	40.85
20366-15	FL-1995 Inlet	5.97	27.98	27.94	33.10

The reported oxygen concentration includes any argon present in the sample. Calibration is based on a standard atmosphere containing 20.95% oxygen and 0.93% argon.
The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported.
Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 5, 2026
Date Analyzed: February 5, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Oxygen	Zeeco Inlet	5.36	5.37	5.37	0.19	<0.1
Nitrogen	Zeeco Inlet	22.89	22.84	22.87	0.22	<0.1
Methane	Zeeco Inlet	27.95	27.86	27.91	0.32	<0.1
Carbon Dioxide	Zeeco Inlet	38.53	38.55	38.54	0.05	<0.1

Four Tedlar bag samples, laboratory numbers 20366-(12-15), were analyzed for permanent gases. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 4 repeat measurements from 4 Tedlar bag samples is 0.20%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Carbon Monoxide Analysis in Tedlar Bag Samples

Report Date: February 27, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 5, 2026
Date Analyzed: February 5, 2026

ANALYSIS DESCRIPTION

Carbon monoxide was measured by flame ionization detection/total combustion analysis (FID/TCA), EPA Method ALT-144.

AtmAA Lab No.	Sample ID	Carbon Monoxide (Conc. in ppmv)
20366-12	Zeeco Inlet	325
20366-13	Hero Inlet	783
20366-14	Parnel Inlet	609
20366-15	FL-1995 Inlet	262

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analysis)

Project Name: Chiquita Canyon Landfill
Date Received: February 5, 2026
Date Analyzed: February 5, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Carbon Monoxide	Zeeco Inlet	325	325	325	0.0

Four Tedlar bag samples, laboratory numbers 20366-(12-15), were analyzed for carbon monoxide. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 4 Tedlar bag samples is 0.0%.

CHAIN OF CUSTODY RECORD

Client/Project Name	Project Location
SCS Engineers / Chiquita Canyon Landfill	29201 Henry Mayo Drive, Castaic, CA 91384
Project No.	**Field Logbook No.**
07224200.24 Task 1	
Sampler: *(Signature)* Victor Arroyo	**Chain of Custody Tape No.**

Sample No./ Identification	Type of Sample	AtmAA Lab Number	Sampling Date	Sampling Time	TRS (307.91	CH4, CO2, O2 (1946)	CO (EPA alt-144)				Special Remarks
Zeeco Inlet	LFG	20366-12	2/5/26	7:20AM	X	X	X				H2S 180 PPM
FL-2009 Inlet	LFG				X	X	X				H2S PPM
Hero Inlet	LFG	-13	2/5/26	7:35AM	X	X	X				H2S 120 PPM
Parnel Inlet	LFG	-14	2/5/26	7:25AM	X	X	X				H2S 120 PPM
FL-1995	LFG	-15	2/5/26	7:45AM	X	X	X				H2S 80 PPM

Relinquished by: *(Signature)*	Date	Time	Received by: *(Signature)*	Date	Time
Victor Arroyo	2/5/26	8:00AM	LUIS FARFAN	2/5/26	9:34AM
Relinquished by: *(Signature)* LUIS F	Date 2/5/26	Time 11:53	Received by: *(Signature)*	Date	Time
Relinquished by: *(Signature)*	Date	Time	Received for Laboratory by: *(Signature)*	Date 2/5/26	Time 11:53

Company Info:

Company: SCS Engineers
Street Address 3900 Kilroy Airport Way Suite 300
City/State/Zip: Long Beach / CA / 90806
Telephone No.: 562-743-7895 /562-335-0002
Fax No.:

Send Report to:

Company: SCS Engineers
Street Address 3900 Kilroy Airport Way Suite 300
City/State/Zip: Long Beach / CA / 90806
Project Manager: Cornelius Fong
Email Address: CFong@scsengineers.com

Analytical Laboratory

AtmAA Inc.
5107 Douglas Fir Rd.
Calabasas, CA 91302
TEL: (818) 223-3277
Email Address: info@atmaa.com

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Sulfide and Reduced Sulfur Compounds
Analysis in Tedlar Bag Sample by SCAQMD Method 307.91

Report Date: March 3, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Sampled: February 6, 2026
Date Received: February 6, 2026
Date Analyzed: February 6, 2026

ANALYSIS DESCRIPTION

Total sulfur analysis measured by gas chromatography with sulfur chemiluminescence detector (SCD), SCAQMD 307.91.

AtmAA Lab No.:	20376-2	20376-3	20376-4	20376-5
Sample I.D.:	Zeeco Inlet	FL-2009 Inlet	Hero Inlet	Parnel Inlet
Components	*(Concentration in ppmv)*			
Hydrogen sulfide	235	152	166	157
Carbonyl sulfide	<1.00	0.65	<1.50	<1.50
Methyl mercaptan	76.9	70.3	267	214
Ethyl mercaptan	1.40	1.08	3.54	2.94
Dimethyl sulfide	269	238	679	578
Carbon disulfide	<1.00	<0.50	<1.50	<1.50
i-Propyl mercaptan	1.92	1.62	2.02	1.84
t-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
n-Propyl mercaptan	3.17	2.77	8.59	6.71
s-Butyl mercaptan	3.30	2.99	6.75	5.77
i-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
Dimethyl disulfide	<1.00	2.30	2.63	2.97
Tetrahydrothiophene	<1.00	0.81	1.98	1.53
Unidentified sulfurs	1.52	2.75	5.86	4.87
	(Concentration in ppmv, as H_2S)			
Total Sulfur	591.1	476.5	1144.5	977.6

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Sampled: February 6, 2026
Date Received: February 6, 2026
Date Analyzed: February 6, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Hydrogen sulfide	Zeeco Inlet	239	230	235	3.8
	FL-2009 Inlet	155	148	152	4.6
	Hero Inlet	158	173	166	9.1
	Parnel Inlet	152	161	157	5.8
Carbonyl sulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	0.67	0.63	0.65	6.2
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Methyl mercaptan	Zeeco Inlet	78.1	75.6	76.9	3.3
	FL-2009 Inlet	71.2	69.3	70.3	2.7
	Hero Inlet	256	277	267	7.9
	Parnel Inlet	209	218	214	4.2
Ethyl mercaptan	Zeeco Inlet	1.42	1.38	1.40	2.9
	FL-2009 Inlet	1.10	1.06	1.08	3.7
	Hero Inlet	3.49	3.58	3.54	2.5
	Parnel Inlet	2.85	3.02	2.94	5.8
Dimethyl sulfide	Zeeco Inlet	271	266	269	1.9
	FL-2009 Inlet	242	233	238	3.8
	Hero Inlet	656	701	679	6.6
	Parnel Inlet	564	592	578	4.8
Carbon disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
i-Propyl mercaptan	Zeeco Inlet	1.98	1.85	1.92	6.8
	FL-2009 Inlet	1.57	1.66	1.62	5.6
	Hero Inlet	2.00	2.03	2.02	1.5
	Parnel Inlet	1.80	1.88	1.84	4.3
t-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
n-Propyl mercaptan	Zeeco Inlet	3.23	3.10	3.17	4.1
	FL-2009 Inlet	2.78	2.76	2.77	0.72
	Hero Inlet	8.33	8.85	8.59	6.1
	Parnel Inlet	6.50	6.91	6.71	6.1
s-Butyl mercaptan	Zeeco Inlet	3.23	3.36	3.30	3.9
	FL-2009 Inlet	3.05	2.93	2.99	4.0
	Hero Inlet	6.61	6.88	6.75	4.0
	Parnel Inlet	5.82	5.71	5.77	1.9
i-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Dimethyl disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	2.30	2.30	2.30	0.00
	Hero Inlet	2.55	2.71	2.63	6.1
	Parnel Inlet	2.93	3.01	2.97	2.7
Tetrahydrothiophene	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	0.84	0.78	0.81	7.4
	Hero Inlet	1.81	2.15	1.98	17
	Parnel Inlet	1.55	1.50	1.53	3.3
Unidentified sulfurs	Zeeco Inlet	1.62	1.42	1.52	13
	FL-2009 Inlet	2.74	2.76	2.75	0.85
	Hero Inlet	5.65	6.06	5.86	7.0
	Parnel Inlet	4.98	4.76	4.87	4.5

Four Tedlar bag samples, laboratory numbers 20376-(2-5), were analyzed for total sulfur compounds. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from four Tedlar bag samples is 4.9%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Permanent Gases Analysis in Tedlar Bag Sample

Report Date: February 27, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 6, 2026
Date Analyzed: February 6, 2026

ANALYSIS DESCRIPTION

Permanent gases were measured by thermal conductivity detection/ gas chromatography (TCD/GC) ASTM D1946-90.

AtmAA Lab No.	Sample ID	Oxygen (%v)	Nitrogen (%v)	Methane (%v)	Carbon Dioxide (%v)
20376-2	Zeeco Inlet	5.15	22.12	28.12	39.38
20376-3	FL-2009 Inlet	5.72	27.60	28.32	33.54
20376-4	Hero Inlet	6.21	27.96	14.33	43.01
20376-5	Parnel Inlet	7.59	31.26	15.73	38.70

The reported oxygen concentration includes any argon present in the sample. Calibration is based on a standard atmosphere containing 20.95% oxygen and 0.93% argon. The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported. Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 6, 2026
Date Analyzed: February 6, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Oxygen	Zeeco Inlet	5.15	5.15	5.15	0.0	<0.1
Nitrogen	Zeeco Inlet	22.09	22.14	22.12	0.23	<0.1
Methane	Zeeco Inlet	28.10	28.13	28.12	0.11	<0.1
Carbon Dioxide	Zeeco Inlet	39.36	39.40	39.38	0.10	<0.1

Four Tedlar bag samples, laboratory numbers 20376-(2-5), were analyzed for permanent gases. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 4 repeat measurements from 4 Tedlar bag samples is 0.11%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Carbon Monoxide Analysis in Tedlar Bag Samples

Report Date: March 2, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 6, 2026
Date Analyzed: February 6, 2026

ANALYSIS DESCRIPTION

Carbon monoxide was measured by flame ionization detection/total combustion analysis (FID/TCA), EPA Method ALT-144.

AtmAA Lab No.	Sample ID	Carbon Monoxide *(Conc. in ppmv)*
20376-2	Zeeco Inlet	324
20376-3	FL-2009 Inlet	229
20376-4	Hero Inlet	629
20376-5	Parnel Inlet	827

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analysis)

Project Name: Chiquita Canyon Landfill
Date Received: February 6, 2026
Date Analyzed: February 6, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Carbon Monoxide	Zeeco Inlet	328	319	324	2.8

Four Tedlar bag samples, laboratory numbers 20376-(2-5), were analyzed for carbon monoxide. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 4 Tedlar bag samples is 2.8%.

CHAIN OF CUSTODY RECORD

Client/Project Name	Project Location
SCS Engineers / Chiquita Canyon Landfill	29201 Henry Mayo Drive, Castaic, CA 91384
Project No.	**Field Logbook No.**
07224200.24 Task 1	
Sampler: *(Signature)* Victor Umeyn	**Chain of Custody Tape No.**

Sample No./ Identification	Type of Sample	AtmAA Lab Number	Sampling Date	Sampling Time	TRS (307.91	CH4, CO2, O2 (1946)	CO (EPA alt-144)				Special Remarks
Zeeco Inlet	LFG	20376-2	2/6/26	5:25 AM	X	X	X				H2S 150 PPM
FL-2009 Inlet	LFG	-3	2/6/26	5:50 AM	X	X	X				H2S 10 PPM
Hero Inlet	LFG	-4	2/6/26	5:30 AM	X	X	X				H2S 150 PPM
Parnel Inlet	LFG	-5	2/6/26	5:15 AM	X	X	X				H2S 100 PPM

	Date	Time		Date	Time
Relinquished by: *(Signature)* Victor Umeyn	2/6/26	8:45 AM	**Received by:** *(Signature)* LUIS FARFAN	2/6/26	8:56
Relinquished by: *(Signature)* LUIS FARFAN	2/6/26	9:40	**Received by:** *(Signature)*		
Relinquished by: *(Signature)*			**Received for Laboratory by:** *(Signature)* AtmAA	2/6/26	9:40

Company Info:		Send Report to:		Analytical Laboratory
Company:	SCS Engineers	**Company:**	SCS Engineers	**AtmAA Inc.**
Street Address	3900 Kilroy Airport Way Suite 300	**Street Address**	3900 Kilroy Airport Way Suite 300	**5107 Douglas Fir Rd.**
City/State/Zip:	Long Beach / CA / 90806	**City/State/Zip:**	Long Beach / CA / 90806	**Calabasas, CA 91302**
Telephone No.:	562-743-7895 /562-335-0002	**Project Manager:**	Cornelius Fong	**TEL: (818) 223-3277**
Fax No.:		**Email Address:**	CFong@scsengineers.com	**Email Address: info@atmaa.com**

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Sulfide and Reduced Sulfur Compounds
Analysis in Tedlar Bag Sample by SCAQMD Method 307.91

Report Date: March 3, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Sampled: February 7, 2026
Date Received: February 7, 2026
Date Analyzed: February 7, 2026

ANALYSIS DESCRIPTION

Total sulfur analysis measured by gas chromatography with sulfur chemiluminescence detector (SCD), SCAQMD 307.91.

AtmAA Lab No.:	20386-1	20386-2	20386-3	20386-4
Sample I.D.:	Zeeco Inlet	FL-1995	Hero Inlet	Parnel Inlet
Components	*(Concentration in ppmv)*			
Hydrogen sulfide	266	120	141	188
Carbonyl sulfide	<1.00	0.65	<1.50	<1.50
Methyl mercaptan	78.7	78.7	190	288
Ethyl mercaptan	1.41	1.13	2.62	3.76
Dimethyl sulfide	284	291	505	779
Carbon disulfide	<1.00	<0.50	<1.50	<1.50
i-Propyl mercaptan	2.32	1.47	1.65	2.13
t-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
n-Propyl mercaptan	3.72	3.35	6.52	9.38
s-Butyl mercaptan	3.90	3.24	5.39	8.04
i-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
Dimethyl disulfide	1.40	3.50	1.91	3.89
Tetrahydrothiophene	<1.00	0.94	1.50	2.54
Unidentified sulfurs	2.72	4.13	4.09	8.52
	(Concentration in ppmv, as H_2S)			
Total Sulfur	645.1	511.1	860.1	1296.1

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Sampled: February 7, 2026
Date Received: February 7, 2026
Date Analyzed: February 7, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Hydrogen sulfide	Zeeco Inlet	269	263	266	2.3
	FL-1995	123	116	120	5.9
	Hero Inlet	136	145	141	6.4
	Parnel Inlet	192	183	188	4.8
Carbonyl sulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-1995	0.67	0.63	0.65	6.2
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Methyl mercaptan	Zeeco Inlet	79.5	77.9	78.7	2.0
	FL-1995	82.0	75.3	78.7	8.5
	Hero Inlet	185	194	190	4.7
	Parnel Inlet	293	282	288	3.8
Ethyl mercaptan	Zeeco Inlet	1.43	1.39	1.41	2.8
	FL-1995	1.14	1.12	1.13	1.8
	Hero Inlet	2.56	2.68	2.62	4.6
	Parnel Inlet	3.78	3.73	3.76	1.3
Dimethyl sulfide	Zeeco Inlet	284	283	284	0.35
	FL-1995	302	280	291	7.6
	Hero Inlet	493	516	505	4.6
	Parnel Inlet	796	762	779	4.4
Carbon disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-1995	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
i-Propyl mercaptan	Zeeco Inlet	2.36	2.27	2.32	3.9
	FL-1995	1.49	1.45	1.47	2.7
	Hero Inlet	1.66	1.64	1.65	1.2
	Parnel Inlet	2.22	2.04	2.13	8.5
t-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-1995	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
n-Propyl mercaptan	Zeeco Inlet	3.75	3.68	3.72	1.9
	FL-1995	3.46	3.24	3.35	6.6
	Hero Inlet	6.61	6.42	6.52	2.9
	Parnel Inlet	9.53	9.22	9.38	3.3
s-Butyl mercaptan	Zeeco Inlet	3.89	3.91	3.90	0.51
	FL-1995	3.37	3.11	3.24	8.0
	Hero Inlet	5.27	5.50	5.39	4.3
	Parnel Inlet	8.14	7.93	8.04	2.6
i-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-1995	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Dimethyl disulfide	Zeeco Inlet	1.36	1.43	1.40	5.0
	FL-1995	3.61	3.39	3.50	6.3
	Hero Inlet	1.87	1.94	1.91	3.7
	Parnel Inlet	3.92	3.85	3.89	1.8
Tetrahydrothiophene	Zeeco Inlet	<1.00	<1.00	---	---
	FL-1995	1.02	0.86	0.94	17
	Hero Inlet	1.36	1.64	1.50	19
	Parnel Inlet	2.58	2.50	2.54	3.1
Unidentified sulfurs	Zeeco Inlet	2.74	2.70	2.72	1.5
	FL-1995	4.12	4.13	4.13	0.24
	Hero Inlet	3.68	4.50	4.09	20
	Parnel Inlet	8.91	8.13	8.52	9.2

Four Tedlar bag samples, laboratory numbers 20386-(1-4), were analyzed for total sulfur compounds. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from four Tedlar bag samples is 5.1%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Permanent Gases Analysis in Tedlar Bag Sample

Report Date: February 27, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 7, 2026
Date Analyzed: February 9, 2026

ANALYSIS DESCRIPTION

Permanent gases were measured by thermal conductivity detection/ gas chromatography (TCD/GC) ASTM D1946-90.

AtmAA Lab No.	Sample ID	Oxygen (%v)	Nitrogen (%v)	Methane (%v)	Carbon Dioxide (%v)
20386-1	Zeeco Inlet	5.74	24.37	28.23	37.31
20386-2	FL-1995 Inlet	6.21	29.35	26.93	33.36
20386-3	Hero Inlet	6.45	29.20	16.19	40.90
20386-4	Parnel Inlet	7.34	30.50	14.79	40.06

The reported oxygen concentration includes any argon present in the sample. Calibration is based on a standard atmosphere containing 20.95% oxygen and 0.93% argon.
The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported.
Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 7, 2026
Date Analyzed: February 9, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Oxygen	FL-1995 Inlet	6.20	6.21	6.21	0.16	<0.1
Nitrogen	FL-1995 Inlet	29.35	29.35	29.35	0.0	<0.1
Methane	FL-1995 Inlet	26.96	26.89	26.93	0.26	<0.1
Carbon Dioxide	FL-1995 Inlet	33.39	33.33	33.36	0.18	<0.1

Four Tedlar bag samples, laboratory numbers 20386-(1-4), were analyzed for permanent gases. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 4 repeat measurements from 4 Tedlar bag samples is 0.15%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Carbon Monoxide Analysis in Tedlar Bag Samples

Report Date: February 27, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 7, 2026
Date Analyzed: February 9, 2026

ANALYSIS DESCRIPTION

Carbon monoxide was measured by flame ionization detection/total combustion analysis (FID/TCA), EPA Method ALT-144.

AtmAA Lab No.	Sample ID	Carbon Monoxide *(Conc. in ppmv)*
20386-1	Zeeco Inlet	276
20386-2	FL-1995 Inlet	243
20386-3	Hero Inlet	576
20386-4	Parnel Inlet	596

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analysis)

Project Name: Chiquita Canyon Landfill
Date Received: February 7, 2026
Date Analyzed: February 9, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Carbon Monoxide	FL-1995 Inlet	242	244	243	0.82

Four Tedlar bag samples, laboratory numbers 20386-(1-4), were analyzed for carbon monoxide. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 4 Tedlar bag samples is 0.82%.

CHAIN OF CUSTODY RECORD

Client/Project Name	Project Location
SCS Engineers / Chiquita Canyon Landfill	29201 Henry Mayo Drive, Castaic, CA 91384
Project No.	**Field Logbook No.**
07224200.24 Task 1	
Sampler: *(Signature)*	**Chain of Custody Tape No.**

Sample No./ Identification	Type of Sample	AtmAA Lab Number	Sampling Date	Sampling Time	TRS (307.91	CH4, CO2, O2 (1946)	CO (EPA alt-144)				Special Remarks
Zeeco Inlet	LFG	20386-1	2/7/26	8:15am	X	X	X				H2S 250 PPM
FL-1995 ~~FL-2009 Inlet~~	LFG	-2	2/7/26	8:30am	X	X	X				H2S 100 PPM
Hero Inlet	LFG	-3	2/7/26	8:05am	X	X	X				H2S 140 PPM
Parnel Inlet	LFG	-4	2/7/26	8:10am	X	X	X				H2S 170 PPM

ANALYSES REQUESTED

Relinquished by: *(Signature)*	Date	Time	Received by: *(Signature)*	Date	Time
	2/7/26	9:00am	LUIS FARFAN	2/7/26	9:00AM
Relinquished by: *(Signature)* LUIS FARFAN	2/7/26	9:57	Received by: *(Signature)*	Date	Time
Relinquished by: *(Signature)*	Date	Time	Received for Laboratory by: *(Signature)*	2/7/26	9:57

Company Info:	Send Report to:	Analytical Laboratory
Company: SCS Engineers	Company: SCS Engineers	AtmAA Inc.
Street Address: 3900 Kilroy Airport Way Suite 300	Street Address: 3900 Kilroy Airport Way Suite 300	5107 Douglas Fir Rd.
City/State/Zip: Long Beach / CA / 90806	City/State/Zip: Long Beach / CA / 90806	Calabasas, CA 91302
Telephone No.: 562-743-7895 /562-335-0002	Project Manager: Cornelius Fong	TEL: (818) 223-3277
Fax No.:	Email Address: CFong@scsengineers.com	Email Address: info@atmaa.com

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Sulfide and Reduced Sulfur Compounds
Analysis in Tedlar Bag Sample by SCAQMD Method 307.91

Report Date: March 5, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Sampled: February 8, 2026
Date Received: February 9, 2026
Date Analyzed: February 9, 2026

ANALYSIS DESCRIPTION

Total sulfur analysis measured by gas chromatography with sulfur chemiluminescence detector (SCD), SCAQMD 307.91.

AtmAA Lab No.:	20406-1	20406-2	20406-3	20406-4
Sample I.D.:	Zeeco Inlet	FL-1995 Inlet	Hero Inlet	Parnel Inlet
Components	*(Concentration in ppmv)*			
Hydrogen sulfide	260	108	162	189
Carbonyl sulfide	0.98	0.64	<1.50	<1.50
Methyl mercaptan	84.7	80.0	243	330
Ethyl mercaptan	1.51	1.06	3.49	4.06
Dimethyl sulfide	290	284	630	836
Carbon disulfide	<1.00	<0.50	<1.50	<1.50
i-Propyl mercaptan	2.01	1.34	1.80	2.08
t-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
n-Propyl mercaptan	3.54	3.03	7.67	9.07
s-Butyl mercaptan	3.13	2.78	5.98	7.18
i-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
Dimethyl disulfide	1.95	3.26	1.79	3.17
Tetrahydrothiophene	<1.00	0.72	1.76	1.97
Unidentified sulfurs	4.87	3.79	5.20	8.15
	(Concentration in ppmv, as H_2S)			
Total Sulfur	654.6	491.3	1063.0	1392.8

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Sampled: February 8, 2026
Date Received: February 9, 2026
Date Analyzed: February 9, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Hydrogen sulfide	Zeeco Inlet	267	253	260	5.4
	FL-1995 Inlet	107	108	108	0.93
	Hero Inlet	157	166	162	5.6
	Parnel Inlet	190	187	189	1.6
Carbonyl sulfide	Zeeco Inlet	1.00	0.95	0.98	5.1
	FL-1995 Inlet	0.63	0.65	0.64	3.1
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Methyl mercaptan	Zeeco Inlet	87.0	82.4	84.7	5.4
	FL-1995 Inlet	79.0	80.9	80.0	2.4
	Hero Inlet	239	246	243	2.9
	Parnel Inlet	327	333	330	1.8
Ethyl mercaptan	Zeeco Inlet	1.55	1.46	1.51	6.0
	FL-1995 Inlet	1.07	1.04	1.06	2.8
	Hero Inlet	3.40	3.58	3.49	5.2
	Parnel Inlet	4.02	4.10	4.06	2.0
Dimethyl sulfide	Zeeco Inlet	292	288	290	1.4
	FL-1995 Inlet	280	288	284	2.8
	Hero Inlet	618	641	630	3.7
	Parnel Inlet	834	837	836	0.36
Carbon disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-1995 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
i-Propyl mercaptan	Zeeco Inlet	2.05	1.96	2.01	4.5
	FL-1995 Inlet	1.35	1.32	1.34	2.2
	Hero Inlet	1.76	1.83	1.80	3.9
	Parnel Inlet	2.03	2.12	2.08	4.3
t-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-1995 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
n-Propyl mercaptan	Zeeco Inlet	3.61	3.47	3.54	4.0
	FL-1995 Inlet	3.03	3.03	3.03	0.00
	Hero Inlet	7.52	7.82	7.67	3.9
	Parnel Inlet	8.75	9.38	9.07	6.9
s-Butyl mercaptan	Zeeco Inlet	3.01	3.24	3.13	7.4
	FL-1995 Inlet	2.75	2.80	2.78	1.8
	Hero Inlet	5.89	6.07	5.98	3.0
	Parnel Inlet	7.09	7.27	7.18	2.5
i-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-1995 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Dimethyl disulfide	Zeeco Inlet	1.95	1.95	1.95	0.00
	FL-1995 Inlet	3.19	3.33	3.26	4.3
	Hero Inlet	1.75	1.82	1.79	3.9
	Parnel Inlet	3.09	3.24	3.17	4.7
Tetrahydrothiophene	Zeeco Inlet	<1.00	<1.00	---	---
	FL-1995 Inlet	0.75	0.68	0.72	10
	Hero Inlet	1.78	1.74	1.76	2.3
	Parnel Inlet	2.05	1.89	1.97	8.1
Unidentified sulfurs	Zeeco Inlet	5.26	4.47	4.87	16
	FL-1995 Inlet	3.62	3.96	3.79	9.0
	Hero Inlet	5.53	4.87	5.20	13
	Parnel Inlet	8.16	8.15	8.15	0.08

Four Tedlar bag samples, laboratory numbers 20406-(1-4), were analyzed for total sulfur compounds. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from four Tedlar bag samples is 4.2%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Permanent Gases Analysis in Tedlar Bag Sample

Report Date: March 4, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 9, 2026
Date Analyzed: February 9, 2026

ANALYSIS DESCRIPTION

Permanent gases were measured by thermal conductivity detection/ gas chromatography (TCD/GC) ASTM D1946-90.

AtmAA Lab No.	Sample ID	Oxygen (%v)	Nitrogen (%v)	Methane (%v)	Carbon Dioxide (%v)
20406-1	Zeeco Inlet	5.12	21.68	29.04	39.86
20406-2	FL-1995 Inlet	5.00	25.55	28.48	35.23
20406-3	Hero Inlet	5.19	25.51	17.16	44.58
20406-4	Parnel Inlet	7.34	30.50	14.79	40.06

The reported oxygen concentration includes any argon present in the sample. Calibration is based on a standard atmosphere containing 20.95% oxygen and 0.93% argon. The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported. Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 9, 2026
Date Analyzed: February 9, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Oxygen	Hero Inlet	5.19	5.18	5.19	0.19	<0.1
Nitrogen	Hero Inlet	25.48	25.53	25.51	0.20	<0.1
Methane	Hero Inlet	17.16	17.16	17.16	0.0	<0.1
Carbon Dioxide	Hero Inlet	44.56	44.59	44.58	0.07	<0.1

Four Tedlar bag samples, laboratory numbers 20406-(1-4), were analyzed for permanent gases. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 4 repeat measurements from 4 Tedlar bag samples is 0.11%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Carbon Monoxide Analysis in Tedlar Bag Samples

Report Date: March 4, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 9, 2026
Date Analyzed: February 9, 2026

ANALYSIS DESCRIPTION

Carbon monoxide was measured by flame ionization detection/total combustion analysis (FID/TCA), EPA Method ALT-144.

AtmAA Lab No.	Sample ID	Carbon Monoxide *(Conc. in ppmv)*
20406-1	Zeeco Inlet	315
20406-2	FL-1995 Inlet	261
20406-3	Hero Inlet	621
20406-4	Parnel Inlet	565

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analysis)

Project Name: Chiquita Canyon Landfill
Date Received: February 9, 2026
Date Analyzed: February 9, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Carbon Monoxide	Hero Inlet	621	620	621	0.16

Four Tedlar bag samples, laboratory numbers 20406-(1-4), were analyzed for carbon monoxide. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 4 Tedlar bag samples is 0.16%.

CHAIN OF CUSTODY RECORD

Client/Project Name	Project Location
SCS Engineers / Chiquita Canyon Landfill	29201 Henry Mayo Drive, Castaic, CA 91384
Project No.	**Field Logbook No.**
07224200.24 Task 1	
Sampler: *(Signature)*	**Chain of Custody Tape No.**

ANALYSES REQUESTED

Sample No./ Identification	Type of Sample	AtmAA Lab Number	Sampling Date	Sampling Time	TRS (307.91	CH4, CO2, O2 (1946)	CO (EPA alt-144)				Special Remarks
Zeeco Inlet	LFG	20406-1	2/8/26	12:45pm	X	X	X				H2S 100 PPM
FL-~~2009~~ 1995 Inlet	LFG	-2	2/8/26	12:19pm	X	X	X				H2S 6.5 PPM
Hero Inlet	LFG	-3	2/8/26	12:35pm	X	X	X				H2S 100 PPM
Parnel Inlet	LFG	-4	2/8/26	12:40pm	X	X	X				H2S 110 PPM

Relinquished by: *(Signature)*	**Date** 2/9/26	**Time** 7:50AM	**Received by:** *(Signature)* Vinter Amaya	**Date** 2/9/26 **Time** 7:50AM
Relinquished by: *(Signature)* Vinter Amaya	**Date** 2/9/26	**Time** 7:50AM	**Received by:** *(Signature)* LUIS FARFAN	**Date** 2/9/26 **Time** 8:02
Relinquished by: *(Signature)* LUIS FARFAN	**Date** 2/9/26	**Time** 9:07 AM	**Received for Laboratory by:** *(Signature)*	**Date** 2/9/26 **Time** 9:07 AM

Company Info:

Company: SCS Engineers
Street Address 3900 Kilroy Airport Way Suite 300
City/State/Zip: Long Beach / CA / 90806
Telephone No.: 562-743-7895 /562-335-0002
Fax No.:

Send Report to:

Company: SCS Engineers
Street Address 3900 Kilroy Airport Way Suite 300
City/State/Zip: Long Beach / CA / 90806
Project Manager: Cornelius Fong
Email Address: CFong@scsengineers.com

Analytical Laboratory

AtmAA Inc.
5107 Douglas Fir Rd.
Calabasas, CA 91302
TEL: (818) 223-3277
Email Address: info@atmaa.com

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Sulfide and Reduced Sulfur Compounds
Analysis in Tedlar Bag Sample by SCAQMD Method 307.91

Report Date: March 5, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Sampled: February 9, 2026
Date Received: February 9, 2026
Date Analyzed: February 9, 2026

ANALYSIS DESCRIPTION

Total sulfur analysis measured by gas chromatography with sulfur chemiluminescence detector (SCD), SCAQMD 307.91.

AtmAA Lab No.:	20406-5	20406-6	20406-7	20406-8
Sample I.D.:	Zeeco Inlet	Hero Inlet	Parnel Inlet	FL-1995
Components	*(Concentration in ppmv)*			
Hydrogen sulfide	271	173	186	141
Carbonyl sulfide	0.99	<1.50	<1.50	0.59
Methyl mercaptan	80.9	234	291	79.8
Ethyl mercaptan	1.51	3.20	3.75	1.15
Dimethyl sulfide	296	600	768	273
Carbon disulfide	<1.00	<0.50	<1.50	<0.50
i-Propyl mercaptan	2.19	1.73	2.02	1.46
t-Butyl mercaptan	<1.00	<1.50	<1.50	<0.50
n-Propyl mercaptan	3.77	7.19	8.62	3.08
s-Butyl mercaptan	3.93	5.73	6.57	3.13
i-Butyl mercaptan	<1.00	<1.50	<1.50	<0.50
Dimethyl disulfide	<1.00	1.73	2.74	2.19
Tetrahydrothiophene	<1.00	<1.50	1.83	0.81
Unidentified sulfurs	2.40	4.46	4.53	2.58
	(Concentration in ppmv, as H_2S)			
Total Sulfur	662.2	1031.7	1277.8	510.9

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Sampled: February 9, 2026
Date Received: February 9, 2026
Date Analyzed: February 9, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Hydrogen sulfide	Zeeco Inlet	270	272	271	0.74
	Hero Inlet	180	165	173	8.7
	Parnel Inlet	189	183	186	3.2
	FL-1995	142	140	141	1.4
Carbonyl sulfide	Zeeco Inlet	0.97	1.00	0.99	3.0
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
	FL-1995	0.59	0.58	0.59	1.7
Methyl mercaptan	Zeeco Inlet	80.7	81.1	80.9	0.49
	Hero Inlet	240	227	234	5.6
	Parnel Inlet	293	289	291	1.4
	FL-1995	80.4	79.1	79.8	1.6
Ethyl mercaptan	Zeeco Inlet	1.52	1.50	1.51	1.3
	Hero Inlet	3.28	3.12	3.20	5.0
	Parnel Inlet	3.75	3.75	3.75	0.00
	FL-1995	1.22	1.08	1.15	12
Dimethyl sulfide	Zeeco Inlet	292	299	296	2.4
	Hero Inlet	623	577	600	7.7
	Parnel Inlet	772	764	768	1.0
	FL-1995	273	273	273	0.00
Carbon disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	Hero Inlet	<0.50	<0.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
	FL-1995	<0.50	<0.50	---	---
i-Propyl mercaptan	Zeeco Inlet	2.21	2.17	2.19	1.8
	Hero Inlet	1.75	1.70	1.73	2.9
	Parnel Inlet	2.05	1.98	2.02	3.5
	FL-1995	1.49	1.43	1.46	4.1
t-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
	FL-1995	<0.50	<0.50	---	---

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
n-Propyl mercaptan	Zeeco Inlet	3.87	3.67	3.77	5.3
	Hero Inlet	7.56	6.81	7.19	10
	Parnel Inlet	8.74	8.50	8.62	2.8
	FL-1995	3.10	3.06	3.08	1.3
s-Butyl mercaptan	Zeeco Inlet	3.85	4.00	3.93	3.8
	Hero Inlet	5.86	5.60	5.73	4.5
	Parnel Inlet	6.84	6.29	6.57	8.4
	FL-1995	3.10	3.15	3.13	1.6
i-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
	FL-1995	<0.50	<0.50	---	---
Dimethyl disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	Hero Inlet	1.76	1.69	1.73	4.1
	Parnel Inlet	2.72	2.76	2.74	1.5
	FL-1995	2.22	2.16	2.19	2.7
Tetrahydrothiophene	Zeeco Inlet	<1.00	<1.00	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	1.80	1.86	1.83	3.3
	FL-1995	0.81	0.81	0.81	0.00
Unidentified sulfurs	Zeeco Inlet	2.48	2.32	2.40	6.7
	Hero Inlet	4.49	4.42	4.46	1.6
	Parnel Inlet	4.43	4.63	4.53	4.4
	FL-1995	2.59	2.56	2.58	1.2

Four Tedlar bag samples, laboratory numbers 20406-(5-8), were analyzed for total sulfur compounds. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from four Tedlar bag samples is 3.4%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Permanent Gases Analysis in Tedlar Bag Sample

Report Date: March 4, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 9, 2026
Date Analyzed: February 9, 2026

ANALYSIS DESCRIPTION

Permanent gases were measured by thermal conductivity detection/ gas chromatography (TCD/GC) ASTM D1946-90.

AtmAA Lab No.	Sample ID	Oxygen (%v)	Nitrogen (%v)	Methane (%v)	Carbon Dioxide (%v)
20406-5	Zeeco Inlet	5.06	21.55	29.40	39.05
20406-6	Hero Inlet	5.06	23.83	18.28	45.14
20406-7	Parnel Inlet	6.60	27.06	15.70	43.29
20406-8	FL-1995 Inlet	5.48	26.20	29.13	35.03

The reported oxygen concentration includes any argon present in the sample. Calibration is based on a standard atmosphere containing 20.95% oxygen and 0.93% argon.
The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported.
Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 9, 2026
Date Analyzed: February 9, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Oxygen	FL-1995 Inlet	5.47	5.48	5.48	0.18	<0.1
Nitrogen	FL-1995 Inlet	26.23	26.16	26.20	0.27	<0.1
Methane	FL-1995 Inlet	29.11	29.14	29.13	0.10	<0.1
Carbon Dioxide	FL-1995 Inlet	35.02	35.03	35.03	0.03	<0.1

Four Tedlar bag samples, laboratory numbers 20406-(5-8), were analyzed for permanent gases. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 4 repeat measurements from 4 Tedlar bag samples is 0.14%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Carbon Monoxide Analysis in Tedlar Bag Samples

Report Date: March 4, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 9, 2026
Date Analyzed: February 9, 2026

ANALYSIS DESCRIPTION

Carbon monoxide was measured by flame ionization detection/total combustion analysis (FID/TCA), EPA Method ALT-144.

AtmAA Lab No.	Sample ID	Carbon Monoxide *(Conc. in ppmv)*
20406-5	Zeeco Inlet	279
20406-6	Hero Inlet	629
20406-7	Parnel Inlet	656
20406-8	FL-1995 Inlet	242

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analysis)

Project Name: Chiquita Canyon Landfill
Date Received: February 9, 2026
Date Analyzed: February 9, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Carbon Monoxide	FL-1995 Inlet	243	240	242	1.24

Four Tedlar bag samples, laboratory numbers 20406-(5-8), were analyzed for carbon monoxide. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 4 Tedlar bag samples is 1.2%.

CHAIN OF CUSTODY RECORD

Client/Project Name	Project Location
SCS Engineers / Chiquita Canyon Landfill	29201 Henry Mayo Drive, Castaic, CA 91384
Project No.	**Field Logbook No.**
07224200.24 Task 1	
Sampler: *(Signature)* Victor Omuya	**Chain of Custody Tape No.**

Sample No./ Identification	Type of Sample	AtmAA Lab Number	Sampling Date	Sampling Time	TRS (307.91	CH4, CO2, O2 (1946)	CO (EPA alt-144)				Special Remarks
Zeeco Inlet	LFG	20406-5	2/4/26	7:30 AM	X	X	X				H2S 200 PPM
FL-2009 Inlet	LFG	-6	Erased		X	X	X				H2S PPM
Hero Inlet	LFG	-26	2/4/26	7:20 AM	X	X	X				H2S 100 PPM
Parnel Inlet	LFG	-7	2/9/26	7:35 AM	X	X	X				H2S 120 PPM
FL-1995	LFG	-8	2/9/26	7:05 AM							H2S 8 PPM

Relinquished by: *(Signature)*	Date	Time	Received by: *(Signature)*	Date	Time
Victor Omuya	2/9/26	7:50 AM	LUIS FARFAN	2/9/26	8:02
Relinquished by: *(Signature)* LUIS FARFAN	**Date** 2/9/26	**Time** 9:07 AM	**Received by: *(Signature)***	**Date**	**Time**
Relinquished by: *(Signature)*	**Date**	**Time**	**Received for Laboratory by: *(Signature)***	**Date** 2/9/26	**Time** 9:07 AM

Company Info:

Company: SCS Engineers
Street Address 3900 Kilroy Airport Way Suite 300
City/State/Zip: Long Beach / CA / 90806
Telephone No.: 562-743-7895 /562-335-0002
Fax No.:

Send Report to:

Company: SCS Engineers
Street Address 3900 Kilroy Airport Way Suite 300
City/State/Zip: Long Beach / CA / 90806
Project Manager: Cornelius Fong
Email Address: CFong@scsengineers.com

Analytical Laboratory

AtmAA Inc.
5107 Douglas Fir Rd.
Calabasas, CA 91302
TEL: (818) 223-3277
Email Address: info@atmaa.com

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Sulfide and Reduced Sulfur Compounds
Analysis in Tedlar Bag Sample by SCAQMD Method 307.91

Report Date: March 5, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Sampled: February 10, 2026
Date Received: February 10, 2026
Date Analyzed: February 10, 2026

ANALYSIS DESCRIPTION

Total sulfur analysis measured by gas chromatography with sulfur chemiluminescence detector (SCD), SCAQMD 307.91.

AtmAA Lab No.:	20416-4	20416-5	20416-6	20416-7
Sample I.D.:	Zeeco Inlet	Hero Inlet	Parnel Inlet	FL-1995
Components	*(Concentration in ppmv)*			
Hydrogen sulfide	215	137	192	176
Carbonyl sulfide	<1.00	<1.50	<1.50	0.66
Methyl mercaptan	83.8	97.0	331	111
Ethyl mercaptan	1.72	1.96	4.14	1.41
Dimethyl sulfide	304	385	821	325
Carbon disulfide	<1.00	<1.50	<1.50	<0.50
i-Propyl mercaptan	1.95	<1.50	2.32	1.68
t-Butyl mercaptan	<1.00	<1.50	<1.50	<0.50
n-Propyl mercaptan	3.82	4.20	10.0	3.52
s-Butyl mercaptan	3.67	3.19	8.13	3.42
i-Butyl mercaptan	<1.00	<1.50	<1.50	<0.50
Dimethyl disulfide	<1.00	2.02	2.55	2.20
Tetrahydrothiophene	<1.00	<1.50	2.37	0.85
Unidentified sulfurs	2.71	2.00	8.17	2.90
	(Concentration in ppmv, as H_2S)			
Total Sulfur	616.2	633.4	1383.7	630.3

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Sampled: February 10, 2026
Date Received: February 10, 2026
Date Analyzed: February 10, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Hydrogen sulfide	Zeeco Inlet	211	219	215	3.7
	Hero Inlet	139	134	137	3.7
	Parnel Inlet	191	192	192	0.52
	FL-1995	180	172	176	4.5
Carbonyl sulfide	Zeeco Inlet	<1.00	<1.00	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
	FL-1995	0.69	0.62	0.66	11
Methyl mercaptan	Zeeco Inlet	82.7	84.9	83.8	2.6
	Hero Inlet	98.0	96.0	97.0	2.1
	Parnel Inlet	331	331	331	0.00
	FL-1995	112	110	111	1.8
Ethyl mercaptan	Zeeco Inlet	1.65	1.79	1.72	8.1
	Hero Inlet	2.05	1.87	1.96	9.2
	Parnel Inlet	4.20	4.08	4.14	2.9
	FL-1995	1.44	1.37	1.41	5.0
Dimethyl sulfide	Zeeco Inlet	298	309	304	3.6
	Hero Inlet	391	378	385	3.4
	Parnel Inlet	820	822	821	0.24
	FL-1995	329	320	325	2.8
Carbon disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
	FL-1995	<0.50	<0.50	---	---
i-Propyl mercaptan	Zeeco Inlet	1.94	1.96	1.95	1.0
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	2.30	2.33	2.32	1.3
	FL-1995	1.63	1.73	1.68	6.0
t-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
	FL-1995	<0.50	<0.50	---	---

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
n-Propyl mercaptan	Zeeco Inlet	3.76	3.88	3.82	3.1
	Hero Inlet	4.36	4.03	4.20	7.9
	Parnel Inlet	10.1	9.95	10.0	1.5
	FL-1995	3.58	3.46	3.52	3.4
s-Butyl mercaptan	Zeeco Inlet	3.54	3.79	3.67	6.8
	Hero Inlet	3.52	2.85	3.19	21
	Parnel Inlet	8.30	7.95	8.13	4.3
	FL-1995	3.49	3.34	3.42	4.4
i-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
	FL-1995	<0.50	<0.50	---	---
Dimethyl disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	Hero Inlet	2.06	1.98	2.02	4.0
	Parnel Inlet	2.52	2.57	2.55	2.0
	FL-1995	2.19	2.21	2.20	0.91
Tetrahydrothiophene	Zeeco Inlet	<1.00	<1.00	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	2.54	2.19	2.37	15
	FL-1995	0.92	0.77	0.85	18
Unidentified sulfurs	Zeeco Inlet	2.56	2.86	2.71	11
	Hero Inlet	2.10	1.90	2.00	10
	Parnel Inlet	8.27	8.08	8.17	2.3
	FL-1995	3.06	2.73	2.90	11

Four Tedlar bag samples, laboratory numbers 20416-(4-7), were analyzed for total sulfur compounds. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from four Tedlar bag samples is 5.4%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Permanent Gases Analysis in Tedlar Bag Sample

Report Date: March 4, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 10, 2026
Date Analyzed: February 10, 2026

ANALYSIS DESCRIPTION

Permanent gases were measured by thermal conductivity detection/ gas chromatography (TCD/GC) ASTM D1946-90.

AtmAA Lab No.	Sample ID	Oxygen (%v)	Nitrogen (%v)	Methane (%v)	Carbon Dioxide (%v)
20416-4	Zeeco Inlet	5.31	21.85	27.39	39.76
20416-5	Hero Inlet	6.35	28.44	39.86	18.18
20416-6	Parnel Inlet	5.09	22.46	16.54	46.67
20416-7	FL-1995 Inlet	5.12	24.81	28.59	36.31

The reported oxygen concentration includes any argon present in the sample. Calibration is based on a standard atmosphere containing 20.95% oxygen and 0.93% argon. The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported. Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 10, 2026
Date Analyzed: February 10, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Oxygen	Zeeco Inlet	5.31	5.31	5.31	0.0	<0.1
Nitrogen	Zeeco Inlet	21.86	21.83	21.85	0.14	<0.1
Methane	Zeeco Inlet	27.43	27.35	27.39	0.29	<0.1
Carbon Dioxide	Zeeco Inlet	39.78	39.73	39.76	0.13	<0.1

Four Tedlar bag samples, laboratory numbers 20416-(4-7), were analyzed for permanent gases. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 4 repeat measurements from 4 Tedlar bag samples is 0.14%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Carbon Monoxide Analysis in Tedlar Bag Samples

Report Date: March 4, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 10, 2026
Date Analyzed: February 10, 2026

ANALYSIS DESCRIPTION

Carbon monoxide was measured by flame ionization detection/total combustion analysis (FID/TCA), EPA Method ALT-144.

AtmAA Lab No.	Sample ID	Carbon Monoxide (Conc. in ppmv)
20416-4	Zeeco Inlet	325
20416-5	Hero Inlet	484
20416-6	Parnel Inlet	778
20416-7	FL-1995 Inlet	335

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analysis)

Project Name: Chiquita Canyon Landfill
Date Received: February 10, 2026
Date Analyzed: February 10, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Carbon Monoxide	Zeeco Inlet	326	324	325	0.62

Four Tedlar bag samples, laboratory numbers 20416-(4-7), were analyzed for carbon monoxide. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 4 Tedlar bag samples is 0.62%.

CHAIN OF CUSTODY RECORD

Client/Project Name	Project Location
SCS Engineers / Chiquita Canyon Landfill	29201 Henry Mayo Drive, Castaic, CA 91384
Project No.	**Field Logbook No.**
07224200.24 Task 1	
Sampler: *(Signature)* Victor Amaya	**Chain of Custody Tape No.**

Sample No./ Identification	Type of Sample	AtmAA Lab Number	Sampling Date	Sampling Time	TRS (307.91	CH4, CO2, O2 (1946)	CO (EPA alt-144)				Special Remarks
Zeeco Inlet	LFG	20416-4	2/10/26	7:30 AM	X	X	X				H2S 200 PPM
FL-2009 Inlet	LFG		~~2/10/26~~		X	X	X				H2S PPM
Hero Inlet	LFG	-5	2/10/26	7:10 AM	X	X	X				H2S 100 PPM
Parnel Inlet	LFG	-6	2/10/26	7:15 AM	X	X	X				H2S 190 PPM
FL-1495	LFG	-7	2/10/26	6:55 AM	X	X	X				H2S 100 PPM

Relinquished by: *(Signature)*	Date	Time	Received by: *(Signature)*	Date	Time
Victor Amaya	2/10/26	8:00 AM	LUIS FONSECA	2/10/26	8:10
Relinquished by: *(Signature)* LUIS F	2/10/26	9:12	Received by: *(Signature)*	Date	Time
Relinquished by: *(Signature)*	Date	Time	Received for Laboratory by: *(Signature)*	Date 2/10/26	Time 9:12

Company Info:		Send Report to:		Analytical Laboratory
Company:	SCS Engineers	Company:	SCS Engineers	AtmAA Inc.
Street Address	3900 Kilroy Airport Way Suite 300	Street Address	3900 Kilroy Airport Way Suite 300	5107 Douglas Fir Rd.
City/State/Zip:	Long Beach / CA / 90806	City/State/Zip:	Long Beach / CA / 90806	Calabasas, CA 91302
Telephone No.:	562-743-7895 /562-335-0002	Project Manager:	Cornelius Fong	TEL: (818) 223-3277
Fax No.:		Email Address:	CFong@scsengineers.com	Email Address: info@atmaa.com

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Sulfide and Reduced Sulfur Compounds
Analysis in Tedlar Bag Sample by SCAQMD Method 307.91

Report Date: March 5, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Sampled: February 11, 2026
Date Received: February 11, 2026
Date Analyzed: February 11, 2026

ANALYSIS DESCRIPTION

Total sulfur analysis measured by gas chromatography with sulfur chemiluminescence detector (SCD), SCAQMD 307.91.

AtmAA Lab No.:	20426-1	20426-2	20426-3	20426-4
Sample I.D.:	Zeeco Inlet	Hero Inlet	Parnel Inlet	FL-1995
Components	*(Concentration in ppmv)*			
Hydrogen sulfide	190	152	211	167
Carbonyl sulfide	<1.00	<1.50	<1.50	0.60
Methyl mercaptan	81.5	223	266	88.4
Ethyl mercaptan	1.51	2.91	3.28	1.13
Dimethyl sulfide	301	589	698	261
Carbon disulfide	<1.00	<1.50	<1.50	<0.50
i-Propyl mercaptan	1.69	1.78	2.25	1.57
t-Butyl mercaptan	<1.00	<1.50	<1.50	<0.50
n-Propyl mercaptan	3.55	6.99	7.87	2.86
s-Butyl mercaptan	3.05	5.21	6.47	2.90
i-Butyl mercaptan	<1.00	<1.50	<1.50	<0.50
Dimethyl disulfide	1.15	2.00	3.06	2.15
Tetrahydrothiophene	<1.00	<1.50	1.93	0.68
Unidentified sulfurs	1.35	3.98	5.85	2.41
	(Concentration in ppmv, as H_2S)			
Total Sulfur	585.4	988.3	1208.3	532.8

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Sampled: February 11, 2026
Date Received: February 11, 2026
Date Analyzed: February 11, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Hydrogen sulfide	Zeeco Inlet	193	187	190	3.2
	Hero Inlet	145	159	152	9.2
	Parnel Inlet	216	206	211	4.7
	FL-1995	167	167	167	0.00
Carbonyl sulfide	Zeeco Inlet	<1.00	<1.00	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
	FL-1995	0.58	0.61	0.60	5.0
Methyl mercaptan	Zeeco Inlet	82.2	80.7	81.5	1.8
	Hero Inlet	212	233	223	9.4
	Parnel Inlet	271	261	266	3.8
	FL-1995	88.3	88.5	88.4	0.23
Ethyl mercaptan	Zeeco Inlet	1.52	1.50	1.51	1.3
	Hero Inlet	2.80	3.01	2.91	7.2
	Parnel Inlet	3.32	3.24	3.28	2.4
	FL-1995	1.12	1.14	1.13	1.8
Dimethyl sulfide	Zeeco Inlet	302	299	301	1.0
	Hero Inlet	566	612	589	7.8
	Parnel Inlet	715	680	698	5.0
	FL-1995	260	262	261	0.77
Carbon disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
	FL-1995	<0.50	<0.50	---	---
i-Propyl mercaptan	Zeeco Inlet	1.65	1.72	1.69	4.2
	Hero Inlet	1.69	1.86	1.78	9.6
	Parnel Inlet	2.23	2.27	2.25	1.8
	FL-1995	1.58	1.55	1.57	1.9
t-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
	FL-1995	<0.50	<0.50	---	---

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
n-Propyl mercaptan	Zeeco Inlet	3.54	3.55	3.55	0.28
	Hero Inlet	6.87	7.10	6.99	3.3
	Parnel Inlet	7.86	7.87	7.87	0.13
	FL-1995	2.89	2.82	2.86	2.5
s-Butyl mercaptan	Zeeco Inlet	3.06	3.03	3.05	1.0
	Hero Inlet	4.92	5.49	5.21	11
	Parnel Inlet	6.58	6.36	6.47	3.4
	FL-1995	2.86	2.93	2.90	2.4
i-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
	FL-1995	<0.50	<0.50	---	---
Dimethyl disulfide	Zeeco Inlet	1.11	1.19	1.15	7.0
	Hero Inlet	1.88	2.11	2.00	12
	Parnel Inlet	3.10	3.01	3.06	2.9
	FL-1995	2.07	2.23	2.15	7.4
Tetrahydrothiophene	Zeeco Inlet	<1.00	<1.00	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	2.01	1.85	1.93	8.3
	FL-1995	0.64	0.72	0.68	12
Unidentified sulfurs	Zeeco Inlet	1.37	1.32	1.35	3.7
	Hero Inlet	3.87	4.08	3.98	5.3
	Parnel Inlet	5.99	5.70	5.85	5.0
	FL-1995	2.44	2.38	2.41	2.5

Four Tedlar bag samples, laboratory numbers 20426-(1-4), were analyzed for total sulfur compounds. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from four Tedlar bag samples is 4.4%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Permanent Gases Analysis in Tedlar Bag Sample

Report Date: March 4, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 11, 2026
Date Analyzed: February 11, 2026

ANALYSIS DESCRIPTION

Permanent gases were measured by thermal conductivity detection/ gas chromatography (TCD/GC) ASTM D1946-90.

AtmAA Lab No.	Sample ID	Oxygen (%v)	Nitrogen (%v)	Methane (%v)	Carbon Dioxide (%v)
20426-1	Zeeco Inlet	7.19	28.19	24.22	36.31
20426-2	Hero Inlet	6.32	29.62	14.51	42.94
20426-3	Parnel Inlet	6.37	26.48	17.23	41.81
20426-4	FL-1995 Inlet	6.27	28.39	27.79	34.22

The reported oxygen concentration includes any argon present in the sample. Calibration is based on a standard atmosphere containing 20.95% oxygen and 0.93% argon. The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported. Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 11, 2026
Date Analyzed: February 11, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Oxygen	Parnel Inlet	6.37	6.36	6.37	0.16	<0.1
Nitrogen	Parnel Inlet	26.45	26.50	26.48	0.19	<0.1
Methane	Parnel Inlet	17.20	17.26	17.23	0.35	<0.1
Carbon Dioxide	Parnel Inlet	41.82	41.80	41.81	0.05	<0.1

Four Tedlar bag samples, laboratory numbers 20426-(1-4), were analyzed for permanent gases. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 4 repeat measurements from 4 Tedlar bag samples is 0.19%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Carbon Monoxide Analysis in Tedlar Bag Samples

Report Date: March 4, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 11, 2026
Date Analyzed: February 11, 2026

ANALYSIS DESCRIPTION

Carbon monoxide was measured by flame ionization detection/total combustion analysis (FID/TCA), EPA Method ALT-144.

AtmAA Lab No.	Sample ID	Carbon Monoxide *(Conc. in ppmv)*
20426-1	Zeeco Inlet	233
20426-2	Hero Inlet	668
20426-3	Parnel Inlet	596
20426-4	FL-1995 Inlet	289

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analysis)

Project Name: Chiquita Canyon Landfill
Date Received: February 11, 2026
Date Analyzed: February 11, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Carbon Monoxide	Parnel Inlet	597	595	596	0.34

Four Tedlar bag samples, laboratory numbers 20426-(1-4), were analyzed for carbon monoxide. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 4 Tedlar bag samples is 0.34%.

CHAIN OF CUSTODY RECORD

Client/Project Name	Project Location
SCS Engineers / Chiquita Canyon Landfill	29201 Henry Mayo Drive, Castaic, CA 91384
Project No.	**Field Logbook No.**
07224200.24 Task 1	
Sampler: *(Signature)* Victor Urruza	**Chain of Custody Tape No.**

Sample No./ Identification	Type of Sample	AtmAA Lab Number	Sampling Date	Sampling Time	TRS (307.91)	CH4, CO2, O2 (1946)	CO (EPA alt-144)				Special Remarks
Zeeco Inlet	LFG	20426-1	2/11/26	7:40	X	X	X				H2S 180 PPM
FL-2009 Inlet	LFG				X	X	X				H2S PPM
Hero Inlet	LFG	-2	2/11/26	7:30 AM	X	X	X				H2S 180 PPM
Parnel Inlet	LFG	-3	2/11/26	7:35 AM	X	X	X				H2S 210 PPM
FL-1945	LFG	-4	2/11/26	6:55 AM	X	X	X				H2S 160 PPM

Relinquished by: *(Signature)* Victor Urruza	**Date** 2/11/26	**Time** 8:05 AM	**Received by: *(Signature)*** LUIS F	**Date** 2/11/26	**Time** 8:12
Relinquished by: *(Signature)* LUIS F	**Date** 2/11/26	**Time** 9:08	**Received by: *(Signature)***	**Date**	**Time**
Relinquished by: *(Signature)*	**Date**	**Time**	**Received for Laboratory by: *(Signature)***	**Date** 2/11/26	**Time** 9:04

Company Info:	**Send Report to:**	**Analytical Laboratory**
Company: SCS Engineers	**Company:** SCS Engineers	**AtmAA Inc.**
Street Address 3900 Kilroy Airport Way Suite 300	**Street Address** 3900 Kilroy Airport Way Suite 300	**5107 Douglas Fir Rd.**
City/State/Zip: Long Beach / CA / 90806	**City/State/Zip:** Long Beach / CA / 90806	**Calabasas, CA 91302**
Telephone No.: 562-743-7895 /562-335-0002	**Project Manager:** Cornelius Fong	**TEL: (818) 223-3277**
Fax No.:	**Email Address:** CFong@scsengineers.com	**Email Address: info@atmaa.com**

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Sulfide and Reduced Sulfur Compounds
Analysis in Tedlar Bag Sample by SCAQMD Method 307.91

Report Date: March 5, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Sampled: February 12, 2026
Date Received: February 12, 2026
Date Analyzed: February 12, 2026

ANALYSIS DESCRIPTION

Total sulfur analysis measured by gas chromatography with sulfur chemiluminescence detector (SCD), SCAQMD 307.91.

AtmAA Lab No.:	20436-3	20436-4	20436-5	20436-6
Sample I.D.:	Zeeco Inlet	FL-2009 Inlet	Hero Inlet	Parnel Inlet
Components		*(Concentration in ppmv)*		
Hydrogen sulfide	94.3	176	152	203
Carbonyl sulfide	<1.00	0.80	<1.50	<1.50
Methyl mercaptan	91.2	66.6	272	317
Ethyl mercaptan	1.66	0.99	3.57	3.81
Dimethyl sulfide	324	202	711	813
Carbon disulfide	<1.00	<0.50	<1.50	<1.50
i-Propyl mercaptan	<1.00	1.67	1.94	2.27
t-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
n-Propyl mercaptan	4.02	2.19	8.53	9.04
s-Butyl mercaptan	3.08	2.36	6.64	7.04
i-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
Dimethyl disulfide	1.82	1.27	2.45	3.34
Tetrahydrothiophene	<1.00	<0.50	1.86	1.89
Unidentified sulfurs	2.58	1.88	5.38	6.17
		(Concentration in ppmv, as H_2S)		
Total Sulfur	524.4	457.0	1166.8	1368.9

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Sampled: February 12, 2026
Date Received: February 12, 2026
Date Analyzed: February 12, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Hydrogen sulfide	Zeeco Inlet	95.9	92.6	94.3	3.5
	FL-2009 Inlet	173	179	176	3.4
	Hero Inlet	151	152	152	0.66
	Parnel Inlet	206	199	203	3.5
Carbonyl sulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	0.80	0.80	0.80	0.00
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Methyl mercaptan	Zeeco Inlet	92.5	89.8	91.2	3.0
	FL-2009 Inlet	66.0	67.1	66.6	1.7
	Hero Inlet	271	272	272	0.37
	Parnel Inlet	316	318	317	0.63
Ethyl mercaptan	Zeeco Inlet	1.69	1.62	1.66	4.2
	FL-2009 Inlet	0.94	1.04	0.99	10
	Hero Inlet	3.66	3.47	3.57	5.3
	Parnel Inlet	3.76	3.86	3.81	2.6
Dimethyl sulfide	Zeeco Inlet	328	320	324	2.5
	FL-2009 Inlet	201	203	202	0.99
	Hero Inlet	711	711	711	0.00
	Parnel Inlet	807	818	813	1.4
Carbon disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
i-Propyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	1.65	1.68	1.67	1.8
	Hero Inlet	1.96	1.91	1.94	2.6
	Parnel Inlet	2.30	2.23	2.27	3.1
t-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
n-Propyl mercaptan	Zeeco Inlet	4.14	3.90	4.02	6.0
	FL-2009 Inlet	2.26	2.12	2.19	6.4
	Hero Inlet	8.55	8.51	8.53	0.47
	Parnel Inlet	9.09	8.99	9.04	1.1
s-Butyl mercaptan	Zeeco Inlet	3.21	2.94	3.08	8.8
	FL-2009 Inlet	2.30	2.41	2.36	4.7
	Hero Inlet	6.62	6.66	6.64	0.60
	Parnel Inlet	7.08	7.00	7.04	1.1
i-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Dimethyl disulfide	Zeeco Inlet	1.85	1.78	1.82	3.9
	FL-2009 Inlet	1.25	1.28	1.27	2.4
	Hero Inlet	2.36	2.53	2.45	7.0
	Parnel Inlet	3.34	3.33	3.34	0.30
Tetrahydrothiophene	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	1.84	1.88	1.86	2.2
	Parnel Inlet	1.96	1.82	1.89	7.4
Unidentified sulfurs	Zeeco Inlet	2.72	2.43	2.58	11
	FL-2009 Inlet	1.82	1.94	1.88	6.4
	Hero Inlet	5.26	5.51	5.38	4.6
	Parnel Inlet	6.34	5.99	6.17	5.7

Four Tedlar bag samples, laboratory numbers 20436-(3-6), were analyzed for total sulfur compounds. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from four Tedlar bag samples is 3.4%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Permanent Gases Analysis in Tedlar Bag Sample

Report Date: March 4, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 12, 2026
Date Analyzed: February 12, 2026

ANALYSIS DESCRIPTION

Permanent gases were measured by thermal conductivity detection/ gas chromatography (TCD/GC) ASTM D1946-90.

AtmAA Lab No.	Sample ID	Oxygen (%v)	Nitrogen (%v)	Methane (%v)	Carbon Dioxide (%v)
20436-3	Zeeco Inlet	11.25	43.66	14.11	26.85
20436-4	FL-2009 Inlet	5.35	24.79	31.07	34.98
20436-5	Hero Inlet	6.24	30.16	13.00	43.19
20436-6	Parnel Inlet	5.82	24.74	15.28	46.90

The reported oxygen concentration includes any argon present in the sample. Calibration is based on a standard atmosphere containing 20.95% oxygen and 0.93% argon. The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported. Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 12, 2026
Date Analyzed: February 12, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Oxygen	Zeeco Inlet	11.24	11.25	11.25	0.09	<0.1
Nitrogen	Zeeco Inlet	43.65	43.66	43.66	0.02	<0.1
Methane	Zeeco Inlet	14.13	14.09	14.11	0.28	<0.1
Carbon Dioxide	Zeeco Inlet	26.83	26.86	26.85	0.11	<0.1

Four Tedlar bag samples, laboratory numbers 20436-(3-6), were analyzed for permanent gases. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 4 repeat measurements from 4 Tedlar bag samples is 0.13%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Carbon Monoxide Analysis in Tedlar Bag Samples

Report Date: March 4, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 12, 2026
Date Analyzed: February 13, 2026

ANALYSIS DESCRIPTION

Carbon monoxide was measured by flame ionization detection/total combustion analysis (FID/TCA), EPA Method ALT-144.

AtmAA Lab No.	Sample ID	Carbon Monoxide *(Conc. in ppmv)*
20436-3	Zeeco Inlet	256
20436-4	FL-2009 Inlet	186
20436-5	Hero Inlet	601
20436-6	Parnel Inlet	673

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analysis)

Project Name: Chiquita Canyon Landfill
Date Received: February 12, 2026
Date Analyzed: February 13, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Carbon Monoxide	Zeeco Inlet	252	259	256	2.7

Four Tedlar bag samples, laboratory numbers 20436-(3-6), were analyzed for carbon monoxide. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 4 Tedlar bag samples is 2.7%.

CHAIN OF CUSTODY RECORD

Client/Project Name	Project Location
SCS Engineers / Chiquita Canyon Landfill	29201 Henry Mayo Drive, Castaic, CA 91384
Project No.	**Field Logbook No.**
07224200.24 Task 1	
Sampler: *(Signature)* Victor Umaya	**Chain of Custody Tape No.**

Sample No./ Identification	Type of Sample	AtmAA Lab Number	Sampling Date	Sampling Time	TRS (307.91	CH4, CO2, O2 (1946)	CO (EPA alt-144)				Special Remarks
Zeeco Inlet	LFG	20436-3	2-12-26	7:35AM	X	X	X				H2S 100 PPM
FL-2009 Inlet	LFG	-4	2-12-26	7:15AM	X	X	X				H2S 180 PPM
Hero Inlet	LFG	-5	2-12-26	7:25AM	X	X	X				H2S 180 PPM
Parnel Inlet	LFG	-6	2-12-26	7:30AM	X	X	X				H2S 230 PPM

	Date	Time		Date	Time
Relinquished by: *(Signature)* Victor Umaya	2/12/26	7:50A	**Received by: *(Signature)*** LUIS F	2/12/26	8:06
Relinquished by: *(Signature)* LUIS F	2/12/26	9:07	**Received by: *(Signature)***		
Relinquished by: *(Signature)*			**Received for Laboratory by: *(Signature)*** AtmAA	2/12/26	9:07

Company Info:

Company: SCS Engineers
Street Address 3900 Kilroy Airport Way Suite 300
City/State/Zip: Long Beach / CA / 90806
Telephone No.: 562-743-7895 /562-335-0002
Fax No.:

Send Report to:

Company: SCS Engineers
Street Address 3900 Kilroy Airport Way Suite 300
City/State/Zip: Long Beach / CA / 90806
Project Manager: Cornelius Fong
Email Address: CFong@scsengineers.com

Analytical Laboratory

AtmAA Inc.
5107 Douglas Fir Rd.
Calabasas, CA 91302
TEL: (818) 223-3277
Email Address: info@atmaa.com

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Sulfide and Reduced Sulfur Compounds
Analysis in Tedlar Bag Sample by SCAQMD Method 307.91

Report Date: March 5, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Sampled: February 13, 2026
Date Received: February 13, 2026
Date Analyzed: February 13, 2026

ANALYSIS DESCRIPTION

Total sulfur analysis measured by gas chromatography with sulfur chemiluminescence detector (SCD), SCAQMD 307.91.

AtmAA Lab No.:	20446-39	20446-40	20446-41	20446-42
Sample I.D.:	Zeeco Inlet	FL-2009 Inlet	Hero Inlet	Parnel Inlet
Components	*(Concentration in ppmv)*			
Hydrogen sulfide	89.4	182	163	213
Carbonyl sulfide	<1.00	0.80	<1.50	<1.50
Methyl mercaptan	69.1	67.0	272	338
Ethyl mercaptan	1.30	0.94	3.40	3.87
Dimethyl sulfide	278	204	731	889
Carbon disulfide	<1.00	<0.50	<1.50	<1.50
i-Propyl mercaptan	1.04	1.70	1.96	2.47
t-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
n-Propyl mercaptan	3.40	2.14	8.40	10.1
s-Butyl mercaptan	2.66	2.22	6.68	8.43
i-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
Dimethyl disulfide	1.53	1.13	2.28	4.41
Tetrahydrothiophene	<1.00	<0.50	1.84	2.29
Unidentified sulfurs	2.66	1.49	7.54	8.53
	(Concentration in ppmv, as H_2S)			
Total Sulfur	450.5	463.5	1200.4	1484.0

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Sampled: February 13, 2026
Date Received: February 13, 2026
Date Analyzed: February 13, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Hydrogen sulfide	Zeeco Inlet	83.0	95.8	89.4	14
	FL-2009 Inlet	182	181	182	0.55
	Hero Inlet	170	156	163	8.6
	Parnel Inlet	204	222	213	8.5
Carbonyl sulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	0.79	0.81	0.80	2.5
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Methyl mercaptan	Zeeco Inlet	63.9	74.2	69.1	15
	FL-2009 Inlet	67.0	66.9	67.0	0.15
	Hero Inlet	281	263	272	6.6
	Parnel Inlet	329	347	338	5.3
Ethyl mercaptan	Zeeco Inlet	1.21	1.39	1.30	14
	FL-2009 Inlet	0.94	0.94	0.94	0.00
	Hero Inlet	3.46	3.33	3.40	3.8
	Parnel Inlet	3.75	3.98	3.87	6.0
Dimethyl sulfide	Zeeco Inlet	258	298	278	14
	FL-2009 Inlet	204	203	204	0.49
	Hero Inlet	753	709	731	6.0
	Parnel Inlet	868	909	889	4.6
Carbon disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
i-Propyl mercaptan	Zeeco Inlet	0.95	1.13	1.04	17
	FL-2009 Inlet	1.72	1.67	1.70	2.9
	Hero Inlet	1.98	1.94	1.96	2.0
	Parnel Inlet	2.48	2.45	2.47	1.2
t-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
n-Propyl mercaptan	Zeeco Inlet	3.19	3.60	3.40	12
	FL-2009 Inlet	2.16	2.11	2.14	2.3
	Hero Inlet	8.71	8.08	8.40	7.5
	Parnel Inlet	10.0	10.2	10.1	2.0
s-Butyl mercaptan	Zeeco Inlet	2.48	2.83	2.66	13
	FL-2009 Inlet	2.26	2.17	2.22	4.1
	Hero Inlet	6.69	6.66	6.68	0.45
	Parnel Inlet	8.38	8.48	8.43	1.2
i-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Dimethyl disulfide	Zeeco Inlet	1.43	1.62	1.53	12
	FL-2009 Inlet	1.13	1.12	1.13	0.89
	Hero Inlet	2.33	2.22	2.28	4.8
	Parnel Inlet	4.42	4.39	4.41	0.68
Tetrahydrothiophene	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	1.92	1.76	1.84	8.7
	Parnel Inlet	2.34	2.23	2.29	4.8
Unidentified sulfurs	Zeeco Inlet	2.86	2.45	2.66	15
	FL-2009 Inlet	1.51	1.46	1.49	3.4
	Hero Inlet	8.11	6.97	7.54	15
	Parnel Inlet	8.22	8.83	8.53	7.2

Four Tedlar bag samples, laboratory numbers 20446-(39-42), were analyzed for total sulfur compounds. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from four Tedlar bag samples is 6.4%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Permanent Gases Analysis in Tedlar Bag Sample

Report Date: March 4, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 13, 2026
Date Analyzed: February 13, 2026

ANALYSIS DESCRIPTION

Permanent gases were measured by thermal conductivity detection/ gas chromatography (TCD/GC) ASTM D1946-90.

AtmAA Lab No.	Sample ID	Oxygen (%v)	Nitrogen (%v)	Methane (%v)	Carbon Dioxide (%v)
20446-39	Zeeco Inlet	11.09	42.94	15.57	27.32
20446-40	FL-2009 Inlet	4.72	22.11	33.04	36.87
20446-41	Hero Inlet	5.39	26.44	14.50	45.85
20446-42	Parnel Inlet	5.39	26.48	14.55	45.80

The reported oxygen concentration includes any argon present in the sample. Calibration is based on a standard atmosphere containing 20.95% oxygen and 0.93% argon. The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported. Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 13, 2026
Date Analyzed: February 13, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Oxygen	Zeeco Inlet	11.06	11.12	11.09	0.54	<0.1
Nitrogen	Zeeco Inlet	42.91	42.96	42.94	0.12	<0.1
Methane	Zeeco Inlet	15.52	15.61	15.57	0.58	<0.1
Carbon Dioxide	Zeeco Inlet	27.34	27.30	27.32	0.15	<0.1

Four Tedlar bag samples, laboratory numbers 20446-(39-42), were analyzed for permanent gases. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 4 repeat measurements from 4 Tedlar bag samples is 0.35%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Carbon Monoxide Analysis in Tedlar Bag Samples

Report Date: March 4, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 13, 2026
Date Analyzed: February 13, 2026

ANALYSIS DESCRIPTION

Carbon monoxide was measured by flame ionization detection/total combustion analysis (FID/TCA), EPA Method ALT-144.

AtmAA Lab No.	Sample ID	Carbon Monoxide *(Conc. in ppmv)*
20446-39	Zeeco Inlet	225
20446-40	FL-2009 Inlet	161
20446-41	Hero Inlet	635
20446-42	Parnel Inlet	736

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analysis)

Project Name: Chiquita Canyon Landfill
Date Received: February 13, 2026
Date Analyzed: February 13, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Carbon Monoxide	Zeeco Inlet	227	223	225	1.8

Four Tedlar bag samples, laboratory numbers 20446-(39-42), were analyzed for carbon monoxide. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 4 Tedlar bag samples is 1.8%.

CHAIN OF CUSTODY RECORD

Client/Project Name	Project Location
SCS Engineers / Chiquita Canyon Landfill	29201 Henry Mayo Drive, Castaic, CA 91384
Project No.	**Field Logbook No.**
07224200.24 Task 1	
Sampler: *(Signature)* Victor Arroyo	**Chain of Custody Tape No.**

Sample No./ Identification	Type of Sample	AtmAA Lab Number	Sampling Date	Sampling Time	TRS (307.91	CH4, CO2, O2 (1946)	CO (EPA alt-144)				Special Remarks
Zeeco Inlet	LFG	20446-39	2/13/26	7:25AM	X	X	X				H2S 100 PPM
FL-2009 Inlet	LFG	-40	2/13/26	6:50AM	X	X	X				H2S 140 PPM
Hero Inlet	LFG	-41	2/13/26	7:10AM	X	X	X				H2S 200 PPM
Parnel Inlet	LFG	-42	2/13/26	7:20AM	X	X	X				H2S 210 PPM

Relinquished by: *(Signature)*	Date	Time	Received by: *(Signature)*	Date	Time
Victor Arroyo	2/13/25	7:55AM	LUIS F	2/13/26	9:48
Relinquished by: *(Signature)* LUIS F	2/13/26	12:24	**Received by: *(Signature)***	2/13/26	12:36 PM
Relinquished by: *(Signature)*	**Date**	**Time**	**Received for Laboratory by: *(Signature)***	**Date**	**Time**

Company Info:		Send Report to:		Analytical Laboratory
Company:	SCS Engineers	**Company:**	SCS Engineers	**AtmAA Inc.**
Street Address	3900 Kilroy Airport Way Suite 300	**Street Address**	3900 Kilroy Airport Way Suite 300	**5107 Douglas Fir Rd.**
City/State/Zip:	Long Beach / CA / 90806	**City/State/Zip:**	Long Beach / CA / 90806	**Calabasas, CA 91302**
Telephone No.:	562-743-7895 /562-335-0002	**Project Manager:**	Cornelius Fong	**TEL: (818) 223-3277**
Fax No.:		**Email Address:**	CFong@scsengineers.com	**Email Address: info@atmaa.com**

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Sulfide and Reduced Sulfur Compounds
Analysis in Tedlar Bag Sample by SCAQMD Method 307.91

Report Date: March 5, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Sampled: February 14, 2026
Date Received: February 14, 2026
Date Analyzed: February 14, 2026

ANALYSIS DESCRIPTION

Total sulfur analysis measured by gas chromatography with sulfur chemiluminescence detector (SCD), SCAQMD 307.91.

AtmAA Lab No.:	20456-1	20456-2	20456-3	20456-4
Sample I.D.:	Zeeco Inlet	FL-2009 Inlet	Hero Inlet	Parnel Inlet
Components	*(Concentration in ppmv)*			
Hydrogen sulfide	86.7	164	156	212
Carbonyl sulfide	<1.00	0.74	<1.50	<1.50
Methyl mercaptan	96.5	61.0	276	343
Ethyl mercaptan	1.73	0.85	3.26	3.98
Dimethyl sulfide	347	196	706	895
Carbon disulfide	<1.00	<0.50	<1.50	<1.50
i-Propyl mercaptan	1.09	1.54	1.97	2.43
t-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
n-Propyl mercaptan	4.27	1.97	7.93	9.68
s-Butyl mercaptan	3.21	2.20	6.04	7.61
i-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
Dimethyl disulfide	1.51	1.02	1.90	3.69
Tetrahydrothiophene	<1.00	<0.50	1.38	1.77
Unidentified sulfurs	2.98	1.56	4.39	7.29
	(Concentration in ppmv, as H_2S)			
Total Sulfur	545.9	431.4	1166.7	1489.6

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Sampled: February 14, 2026
Date Received: February 14, 2026
Date Analyzed: February 14, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Hydrogen sulfide	Zeeco Inlet	88.6	84.7	86.7	4.5
	FL-2009 Inlet	164	163	164	0.61
	Hero Inlet	163	149	156	9.0
	Parnel Inlet	209	214	212	2.4
Carbonyl sulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	0.74	0.74	0.74	0.00
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Methyl mercaptan	Zeeco Inlet	99.0	94.0	96.5	5.2
	FL-2009 Inlet	60.5	61.5	61.0	1.6
	Hero Inlet	289	263	276	9.4
	Parnel Inlet	339	347	343	2.3
Ethyl mercaptan	Zeeco Inlet	1.85	1.60	1.73	14
	FL-2009 Inlet	0.85	0.85	0.85	0.00
	Hero Inlet	3.44	3.07	3.26	11
	Parnel Inlet	3.96	4.00	3.98	1.0
Dimethyl sulfide	Zeeco Inlet	356	337	347	5.5
	FL-2009 Inlet	196	196	196	0.00
	Hero Inlet	735	677	706	8.2
	Parnel Inlet	876	914	895	4.2
Carbon disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
i-Propyl mercaptan	Zeeco Inlet	1.11	1.06	1.09	4.6
	FL-2009 Inlet	1.53	1.55	1.54	1.3
	Hero Inlet	2.08	1.85	1.97	12
	Parnel Inlet	2.38	2.48	2.43	4.1
t-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
n-Propyl mercaptan	Zeeco Inlet	4.26	4.28	4.27	0.47
	FL-2009 Inlet	1.97	1.97	1.97	0.00
	Hero Inlet	8.36	7.49	7.93	11
	Parnel Inlet	9.36	10.0	9.68	6.6
s-Butyl mercaptan	Zeeco Inlet	3.32	3.09	3.21	7.2
	FL-2009 Inlet	2.22	2.17	2.20	2.3
	Hero Inlet	6.24	5.84	6.04	6.6
	Parnel Inlet	7.39	7.82	7.61	5.7
i-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Dimethyl disulfide	Zeeco Inlet	1.54	1.47	1.51	4.7
	FL-2009 Inlet	0.98	1.05	1.02	6.9
	Hero Inlet	1.98	1.81	1.90	9.0
	Parnel Inlet	3.56	3.81	3.69	6.8
Tetrahydrothiophene	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	1.52	1.24	1.38	20
	Parnel Inlet	1.74	1.79	1.77	2.8
Unidentified sulfurs	Zeeco Inlet	3.23	2.73	2.98	17
	FL-2009 Inlet	1.48	1.63	1.56	9.6
	Hero Inlet	4.50	4.28	4.39	5.0
	Parnel Inlet	6.83	7.74	7.29	12

Four Tedlar bag samples, laboratory numbers 20456-(1-4), were analyzed for total sulfur compounds. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from four Tedlar bag samples is 6.0%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Permanent Gases Analysis in Tedlar Bag Sample

Report Date: March 4, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 14, 2026
Date Analyzed: February 14, 2026

ANALYSIS DESCRIPTION

Permanent gases were measured by thermal conductivity detection/ gas chromatography (TCD/GC) ASTM D1946-90.

AtmAA Lab No.	Sample ID	Oxygen (%v)	Nitrogen (%v)	Methane (%v)	Carbon Dioxide (%v)
20456-1	Zeeco Inlet	11.80	45.61	12.58	26.48
20456-2	FL-2009 Inlet	5.15	24.13	31.12	36.23
20456-3	Hero Inlet	5.00	25.19	13.95	47.64
20456-4	Parnel Inlet	5.18	22.20	16.09	48.71

The reported oxygen concentration includes any argon present in the sample. Calibration is based on a standard atmosphere containing 20.95% oxygen and 0.93% argon.
The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported.
Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 14, 2026
Date Analyzed: February 14, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Oxygen	Zeeco Inlet	11.70	11.89	11.80	1.6	<0.1
Nitrogen	Zeeco Inlet	45.46	45.75	45.61	0.64	<0.1
Methane	Zeeco Inlet	12.56	12.59	12.58	0.24	<0.1
Carbon Dioxide	Zeeco Inlet	26.43	26.52	26.48	0.34	<0.1

Four Tedlar bag samples, laboratory numbers 20456-(1-4), were analyzed for permanent gases. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 4 repeat measurements from 4 Tedlar bag samples is 0.71%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Carbon Monoxide Analysis in Tedlar Bag Samples

Report Date: March 4, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 14, 2026
Date Analyzed: February 14, 2026

ANALYSIS DESCRIPTION

Carbon monoxide was measured by flame ionization detection/total combustion analysis (FID/TCA), EPA Method ALT-144.

AtmAA Lab No.	Sample ID	Carbon Monoxide (Conc. in ppmv)
20456-1	Zeeco Inlet	322
20456-2	FL-2009 Inlet	208
20456-3	Hero Inlet	762
20456-4	Parnel Inlet	806

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analysis)

Project Name: Chiquita Canyon Landfill
Date Received: February 14, 2026
Date Analyzed: February 14, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Carbon Monoxide	Zeeco Inlet	315	328	322	4.0

Four Tedlar bag samples, laboratory numbers 20456-(1-4), were analyzed for carbon monoxide. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 4 Tedlar bag samples is 4.0%.

CHAIN OF CUSTODY RECORD

Client/Project Name	Project Location
SCS Engineers / Chiquita Canyon Landfill	29201 Henry Mayo Drive, Castaic, CA 91384
Project No.	**Field Logbook No.**
07224200.24 Task 1	
Sampler: *(Signature)*	**Chain of Custody Tape No.**

Sample No./ Identification	Type of Sample	AtmAA Lab Number	Sampling Date	Sampling Time	TRS (307.91	CH4, CO2, O2 (1946)	CO (EPA alt-144)				Special Remarks
Zeeco Inlet	LFG	20456-1	2/14/26	8:15Am	X	X	X				H2S 80 PPM
FL-2009 Inlet	LFG	-2	2/14/26	7:50Am	X	X	X				H2S 110 PPM
Hero Inlet	LFG	-3	2/14/26	8:00Am	X	X	X				H2S 200 PPM
Parnel Inlet	LFG	-4	2/14/26	8:10Am	X	X	X				H2S 200 PPM

ANALYSES REQUESTED

Relinquished by: *(Signature)*	Date	Time	Received by: *(Signature)*	Date	Time
	2/14/26	9:00Am	LUIS F	2/14/26	9:00
Relinquished by: *(Signature)*	**Date**	**Time**	**Received by: *(Signature)***	**Date**	**Time**
LUIS F	2/14/26	9:01		2/14/26	10:41Am
Relinquished by: *(Signature)*	**Date**	**Time**	**Received for Laboratory by: *(Signature)***	**Date**	**Time**

Company Info:		Send Report to:		Analytical Laboratory
Company:	SCS Engineers	Company:	SCS Engineers	AtmAA Inc.
Street Address	3900 Kilroy Airport Way Suite 300	Street Address	3900 Kilroy Airport Way Suite 300	5107 Douglas Fir Rd.
City/State/Zip:	Long Beach / CA / 90806	City/State/Zip:	Long Beach / CA / 90806	Calabasas, CA 91302
Telephone No.:	562-743-7895 /562-335-0002	Project Manager:	Cornelius Fong	TEL: (818) 223-3277
Fax No.:		Email Address:	CFong@scsengineers.com	Email Address: info@atmaa.com

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Sulfide and Reduced Sulfur Compounds
Analysis in Tedlar Bag Sample by SCAQMD Method 307.91

Report Date: March 9, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Sampled: February 15, 2026
Date Received: February 16, 2026
Date Analyzed: February 16, 2026

ANALYSIS DESCRIPTION

Total sulfur analysis measured by gas chromatography with sulfur chemiluminescence detector (SCD), SCAQMD 307.91.

AtmAA Lab No.:	20476-33	20476-34	20476-35	20476-36
Sample I.D.:	Zeeco Inlet	FL-2009 Inlet	Hero Inlet	Parnel Inlet
Components	*(Concentration in ppmv)*			
Hydrogen sulfide	111	176	177	211
Carbonyl sulfide	<1.00	0.81	<1.50	<1.50
Methyl mercaptan	139	60.5	309	331
Ethyl mercaptan	2.23	0.90	3.77	3.91
Dimethyl sulfide	431	193	792	875
Carbon disulfide	<1.00	<0.50	<1.50	<1.50
i-Propyl mercaptan	1.27	1.56	2.05	2.50
t-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
n-Propyl mercaptan	5.44	2.13	9.12	9.70
s-Butyl mercaptan	3.96	2.32	7.35	7.79
i-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
Dimethyl disulfide	1.92	1.17	2.10	4.05
Tetrahydrothiophene	1.01	0.50	2.03	2.09
Unidentified sulfurs	4.84	3.30	5.72	8.85
	(Concentration in ppmv, as H_2S)			
Total Sulfur	703.1	443.3	1311.2	1458.9

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Sampled: February 15, 2026
Date Received: February 16, 2026
Date Analyzed: February 16, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Hydrogen sulfide	Zeeco Inlet	109	113	111	3.6
	FL-2009 Inlet	168	184	176	9.1
	Hero Inlet	173	181	177	4.5
	Parnel Inlet	213	209	211	1.9
Carbonyl sulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	0.77	0.84	0.81	8.7
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Methyl mercaptan	Zeeco Inlet	134	143	139	6.5
	FL-2009 Inlet	58.6	62.4	60.5	6.3
	Hero Inlet	299	318	309	6.2
	Parnel Inlet	334	327	331	2.1
Ethyl mercaptan	Zeeco Inlet	2.13	2.32	2.23	8.5
	FL-2009 Inlet	0.86	0.93	0.90	7.8
	Hero Inlet	3.59	3.95	3.77	9.5
	Parnel Inlet	3.96	3.85	3.91	2.8
Dimethyl sulfide	Zeeco Inlet	414	448	431	7.9
	FL-2009 Inlet	188	198	193	5.2
	Hero Inlet	768	815	792	5.9
	Parnel Inlet	875	874	875	0.11
Carbon disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
i-Propyl mercaptan	Zeeco Inlet	1.25	1.28	1.27	2.4
	FL-2009 Inlet	1.52	1.60	1.56	5.1
	Hero Inlet	1.98	2.11	2.05	6.4
	Parnel Inlet	2.57	2.42	2.50	6.0
t-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
n-Propyl mercaptan	Zeeco Inlet	5.22	5.65	5.44	7.9
	FL-2009 Inlet	2.01	2.24	2.13	11
	Hero Inlet	8.86	9.38	9.12	5.7
	Parnel Inlet	9.71	9.68	9.70	0.31
s-Butyl mercaptan	Zeeco Inlet	3.77	4.15	3.96	9.6
	FL-2009 Inlet	2.28	2.35	2.32	3.0
	Hero Inlet	6.92	7.77	7.35	12
	Parnel Inlet	7.59	7.98	7.79	5.0
i-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Dimethyl disulfide	Zeeco Inlet	1.81	2.02	1.92	11
	FL-2009 Inlet	1.16	1.17	1.17	0.86
	Hero Inlet	1.96	2.24	2.10	13
	Parnel Inlet	3.97	4.13	4.05	4.0
Tetrahydrothiophene	Zeeco Inlet	0.96	1.06	1.01	10
	FL-2009 Inlet	0.46	0.53	0.50	14
	Hero Inlet	1.97	2.08	2.03	5.4
	Parnel Inlet	2.14	2.04	2.09	4.8
Unidentified sulfurs	Zeeco Inlet	4.92	4.76	4.84	3.3
	FL-2009 Inlet	3.01	3.58	3.30	17
	Hero Inlet	5.50	5.95	5.72	7.8
	Parnel Inlet	9.12	8.57	8.85	6.2

Four Tedlar bag samples, laboratory numbers 20476-(33-36), were analyzed for total sulfur compounds. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from four Tedlar bag samples is 6.6%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Permanent Gases Analysis in Tedlar Bag Sample

Report Date: March 6, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 16, 2026
Date Analyzed: February 16, 2026

ANALYSIS DESCRIPTION

Permanent gases were measured by thermal conductivity detection/ gas chromatography (TCD/GC) ASTM D1946-90.

AtmAA Lab No.	Sample ID	Oxygen (%v)	Nitrogen (%v)	Methane (%v)	Carbon Dioxide (%v)
20476-33	Zeeco Inlet	9.44	37.63	14.97	32.53
20476-34	FL-2009 Inlet	4.10	19.87	33.21	38.15
20476-35	Hero Inlet	3.82	20.76	14.91	50.23
20476-36	Parnel Inlet	4.10	18.10	17.54	50.66

The reported oxygen concentration includes any argon present in the sample. Calibration is based on a standard atmosphere containing 20.95% oxygen and 0.93% argon. The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported. Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 16, 2026
Date Analyzed: February 16, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Oxygen	Zeeco Inlet	9.42	9.46	9.44	0.42	<0.1
Nitrogen	Zeeco Inlet	37.65	37.60	37.63	0.13	<0.1
Methane	Zeeco Inlet	14.96	14.97	14.97	0.07	<0.1
Carbon Dioxide	Zeeco Inlet	32.51	32.54	32.53	0.09	<0.1

Four Tedlar bag samples, laboratory numbers 20476-(33-36), were analyzed for permanent gases. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 4 repeat measurements from 4 Tedlar bag samples is 0.18%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Carbon Monoxide Analysis in Tedlar Bag Samples

Report Date: March 6, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 16, 2026
Date Analyzed: February 16, 2026

ANALYSIS DESCRIPTION

Carbon monoxide was measured by flame ionization detection/total combustion analysis (FID/TCA), EPA Method ALT-144.

AtmAA Lab No.	Sample ID	Carbon Monoxide (Conc. in ppmv)
20476-33	Zeeco Inlet	407
20476-34	FL-2009 Inlet	180
20476-35	Hero Inlet	808
20476-36	Parnel Inlet	761

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analysis)

Project Name: Chiquita Canyon Landfill
Date Received: February 16, 2026
Date Analyzed: February 16, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Carbon Monoxide	Zeeco Inlet	405	409	407	1.0

Four Tedlar bag samples, laboratory numbers 20476-(33-36), were analyzed for carbon monoxide. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 4 Tedlar bag samples is 0.98%.

CHAIN OF CUSTODY RECORD

Client/Project Name	Project Location
SCS Engineers / Chiquita Canyon Landfill	29201 Henry Mayo Drive, Castaic, CA 91384
Project No.	**Field Logbook No.**
07224200.24 Task 1	
Sampler: *(Signature)*	**Chain of Custody Tape No.**

Sample No./ Identification	Type of Sample	AtmAA Lab Number	Sampling Date	Sampling Time	TRS (307.91	CH4, CO2, O2 (1946)	CO (EPA alt-144)				Special Remarks
Zeeco Inlet	LFG	20476-33	2/15/26	1:25PM	X	X	X				H2S 85 PPM
FL-2009 Inlet	LFG	-34	2/15/26	1:35 PM	X	X	X				H2S 120 PPM
Hero Inlet	LFG	-35	2/15/26	1:15PM	X	X	X				H2S 160 PPM
Parnel Inlet	LFG	-36	2/15/26	1:20PM	X	X	X				H2S 200 PPM

Relinquished by: *(Signature)*	**Date** 2/15/26	**Time** 4:30PM	**Received by: *(Signature)***	**Date** 2/16/26	**Time** ~~9~~ 9:50AM
Relinquished by: *(Signature)*	**Date** 2/16/26	**Time** 9:50AM	**Received by: *(Signature)***	**Date** 2/16	**Time** 10:08
Relinquished by: *(Signature)*	**Date**	**Time**	**Received for Laboratory by: *(Signature)***	**Date** 2/16	**Time** 10:48AM

Company Info:	**Send Report to:**	**Analytical Laboratory**
Company: SCS Engineers	**Company:** SCS Engineers	**AtmAA Inc.**
Street Address 3900 Kilroy Airport Way Suite 300	**Street Address** 3900 Kilroy Airport Way Suite 300	**5107 Douglas Fir Rd.**
City/State/Zip: Long Beach / CA / 90806	**City/State/Zip:** Long Beach / CA / 90806	**Calabasas, CA 91302**
Telephone No.: 562-743-7895 /562-335-0002	**Project Manager:** Cornelius Fong	**TEL: (818) 223-3277**
Fax No.:	**Email Address:** CFong@scsengineers.com	**Email Address: info@atmaa.com**

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Sulfide and Reduced Sulfur Compounds
Analysis in Tedlar Bag Sample by SCAQMD Method 307.91

Report Date: March 9, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Sampled: February 16, 2026
Date Received: February 16, 2026
Date Analyzed: February 16, 2026

ANALYSIS DESCRIPTION

Total sulfur analysis measured by gas chromatography with sulfur chemiluminescence detector (SCD), SCAQMD 307.91.

AtmAA Lab No.:	20476-29	20476-30	20476-31	20476-32
Sample I.D.:	Zeeco Inlet	FL-2009 Inlet	Hero Inlet	Parnel Inlet
Components	*(Concentration in ppmv)*			
Hydrogen sulfide	103	163	181	230
Carbonyl sulfide	<1.00	0.74	<1.50	<1.50
Methyl mercaptan	109	53.2	304	329
Ethyl mercaptan	1.87	0.79	3.74	3.90
Dimethyl sulfide	337	166	773	841
Carbon disulfide	<1.00	<0.50	<1.50	<1.50
i-Propyl mercaptan	1.18	1.56	2.12	2.50
t-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
n-Propyl mercaptan	4.35	1.83	8.92	8.79
s-Butyl mercaptan	3.04	2.02	6.95	6.94
i-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
Dimethyl disulfide	1.37	0.88	1.86	3.15
Tetrahydrothiophene	<1.00	<0.50	1.64	1.47
Unidentified sulfurs	2.16	1.37	4.96	6.14
	(Concentration in ppmv, as H_2S)			
Total Sulfur	563.3	392.2	1289.0	1434.5

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Sampled: February 16, 2026
Date Received: February 16, 2026
Date Analyzed: February 16, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Hydrogen sulfide	Zeeco Inlet	102	103	103	0.98
	FL-2009 Inlet	169	157	163	7.4
	Hero Inlet	182	179	181	1.7
	Parnel Inlet	227	232	230	2.2
Carbonyl sulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	0.76	0.71	0.74	6.8
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Methyl mercaptan	Zeeco Inlet	108	109	109	0.92
	FL-2009 Inlet	55.2	51.1	53.2	7.7
	Hero Inlet	308	300	304	2.6
	Parnel Inlet	328	329	329	0.30
Ethyl mercaptan	Zeeco Inlet	1.95	1.78	1.87	9.1
	FL-2009 Inlet	0.81	0.77	0.79	5.1
	Hero Inlet	3.71	3.76	3.74	1.3
	Parnel Inlet	3.90	3.89	3.90	0.26
Dimethyl sulfide	Zeeco Inlet	334	340	337	1.8
	FL-2009 Inlet	171	161	166	6.0
	Hero Inlet	762	783	773	2.7
	Parnel Inlet	847	834	841	1.5
Carbon disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
i-Propyl mercaptan	Zeeco Inlet	1.20	1.16	1.18	3.4
	FL-2009 Inlet	1.61	1.51	1.56	6.4
	Hero Inlet	2.01	2.23	2.12	10
	Parnel Inlet	2.46	2.54	2.50	3.2
t-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
n-Propyl mercaptan	Zeeco Inlet	4.27	4.42	4.35	3.5
	FL-2009 Inlet	1.85	1.80	1.83	2.7
	Hero Inlet	8.72	9.11	8.92	4.4
	Parnel Inlet	8.82	8.75	8.79	0.80
s-Butyl mercaptan	Zeeco Inlet	3.04	3.03	3.04	0.33
	FL-2009 Inlet	2.08	1.96	2.02	5.9
	Hero Inlet	6.87	7.02	6.95	2.2
	Parnel Inlet	6.78	7.09	6.94	4.5
i-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Dimethyl disulfide	Zeeco Inlet	1.37	1.36	1.37	0.73
	FL-2009 Inlet	0.89	0.86	0.88	3.4
	Hero Inlet	1.82	1.90	1.86	4.3
	Parnel Inlet	3.08	3.22	3.15	4.4
Tetrahydrothiophene	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	1.59	1.69	1.64	6.1
	Parnel Inlet	1.41	1.52	1.47	7.5
Unidentified sulfurs	Zeeco Inlet	2.25	2.07	2.16	8.3
	FL-2009 Inlet	1.47	1.26	1.37	15
	Hero Inlet	4.93	4.98	4.96	1.0
	Parnel Inlet	6.18	6.10	6.14	1.3

Four Tedlar bag samples, laboratory numbers 20476-(29-32), were analyzed for total sulfur compounds. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from four Tedlar bag samples is 4.1%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Permanent Gases Analysis in Tedlar Bag Sample

Report Date: March 6, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 16, 2026
Date Analyzed: February 16, 2026

ANALYSIS DESCRIPTION

Permanent gases were measured by thermal conductivity detection/ gas chromatography (TCD/GC) ASTM D1946-90.

AtmAA Lab No.	Sample ID	Oxygen (%v)	Nitrogen (%v)	Methane (%v)	Carbon Dioxide (%v)
20476-29	Zeeco Inlet	9.97	39.55	14.94	30.52
20476-30	FL-2009 Inlet	4.43	20.83	33.52	37.59
20476-31	Hero Inlet	4.18	21.71	15.07	49.75
20476-32	Parnel Inlet	4.26	18.91	17.89	50.28

The reported oxygen concentration includes any argon present in the sample. Calibration is based on a standard atmosphere containing 20.95% oxygen and 0.93% argon. The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported. Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 16, 2026
Date Analyzed: February 16, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Oxygen	Zeeco Inlet	9.97	9.96	9.97	0.1	<0.1
Nitrogen	Zeeco Inlet	39.65	39.45	39.55	0.51	<0.1
Methane	Zeeco Inlet	15.01	14.86	14.94	1.0	<0.1
Carbon Dioxide	Zeeco Inlet	30.59	30.45	30.52	0.46	<0.1

Four Tedlar bag samples, laboratory numbers 20476-(29-32), were analyzed for permanent gases. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 4 repeat measurements from 4 Tedlar bag samples is 0.52%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Carbon Monoxide Analysis in Tedlar Bag Samples

Report Date: March 6, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 16, 2026
Date Analyzed: February 16, 2026

ANALYSIS DESCRIPTION

Carbon monoxide was measured by flame ionization detection/total combustion analysis (FID/TCA), EPA Method ALT-144.

AtmAA Lab No.	Sample ID	Carbon Monoxide *(Conc. in ppmv)*
20476-29	Zeeco Inlet	335
20476-30	FL-2009 Inlet	182
20476-31	Hero Inlet	792
20476-32	Parnel Inlet	790

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analysis)

Project Name: Chiquita Canyon Landfill
Date Received: February 16, 2026
Date Analyzed: February 16, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Carbon Monoxide	Zeeco Inlet	337	332	335	1.5

Four Tedlar bag samples, laboratory numbers 20476-(29-32), were analyzed for carbon monoxide. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 4 Tedlar bag samples is 1.5%.

CHAIN OF CUSTODY RECORD

Client/Project Name	Project Location
SCS Engineers / Chiquita Canyon Landfill	29201 Henry Mayo Drive, Castaic, CA 91384
Project No.	**Field Logbook No.**
07224200.24 Task 1	
Sampler: *(Signature)*	**Chain of Custody Tape No.**

ANALYSES REQUESTED

Sample No./ Identification	Type of Sample	AtmAA Lab Number	Sampling Date	Sampling Time	TRS (307.91)	CH4, CO2, O2 (1946)	CO (EPA alt-144)				Special Remarks
Zeeco Inlet	LFG	20476-29	2/16/26	6:55Am	X	X	X				H2S 100 PPM
FL-2009 Inlet	LFG	-30	2/16/26	6:40Am	X	X	X				H2S 140 PPM
Hero Inlet	LFG	-31	2/16/26	6:45Am	X	X	X				H2S 200 PPM
Parnel Inlet	LFG	-32	2/16/26	6:50Am	X	X	X				H2S 200 PPM

Relinquished by: *(Signature)*	**Date** 2/16/26	**Time** 9:50Am	**Received by: *(Signature)***	**Date** 2/16	**Time** 10:00
Relinquished by: *(Signature)*	**Date**	**Time**	**Received by: *(Signature)***	**Date** 2/16	**Time** 10:48Am
Relinquished by: *(Signature)*	**Date**	**Time**	**Received for Laboratory by: *(Signature)***	**Date**	**Time**

Company Info:	**Send Report to:**	**Analytical Laboratory**
Company: SCS Engineers	**Company:** SCS Engineers	**AtmAA Inc.**
Street Address 3900 Kilroy Airport Way Suite 300	**Street Address** 3900 Kilroy Airport Way Suite 300	**5107 Douglas Fir Rd.**
City/State/Zip: Long Beach / CA / 90806	**City/State/Zip:** Long Beach / CA / 90806	**Calabasas, CA 91302**
Telephone No.: 562-743-7895 /562-335-0002	**Project Manager:** Cornelius Fong	**TEL: (818) 223-3277**
Fax No.:	**Email Address:** CFong@scsengineers.com	**Email Address: info@atmaa.com**

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Sulfide and Reduced Sulfur Compounds
Analysis in Tedlar Bag Sample by SCAQMD Method 307.91

Report Date: March 9, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Sampled: February 17, 2026
Date Received: February 17, 2026
Date Analyzed: February 17, 2026

ANALYSIS DESCRIPTION

Total sulfur analysis measured by gas chromatography with sulfur chemiluminescence detector (SCD), SCAQMD 307.91.

AtmAA Lab No.:	20486-3	20486-4	20486-5	20486-6
Sample I.D.:	Zeeco Inlet	FL-2009 Inlet	Hero Inlet	Parnel Inlet
Components	*(Concentration in ppmv)*			
Hydrogen sulfide	88.0	165	170	194
Carbonyl sulfide	<1.00	0.81	<1.50	<1.50
Methyl mercaptan	97.8	57.1	301	299
Ethyl mercaptan	1.58	0.83	3.72	3.54
Dimethyl sulfide	324	179	793	798
Carbon disulfide	<1.00	<0.50	<1.50	<1.50
i-Propyl mercaptan	1.15	1.76	2.10	2.59
t-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
n-Propyl mercaptan	4.17	2.13	9.60	9.39
s-Butyl mercaptan	3.17	2.52	7.82	7.56
i-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
Dimethyl disulfide	1.96	1.42	3.01	4.69
Tetrahydrothiophene	<1.00	0.60	2.25	2.17
Unidentified sulfurs	2.72	2.39	6.48	7.05
	(Concentration in ppmv, as H_2S)			
Total Sulfur	525.9	414.4	1302.0	1332.2

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Sampled: February 17, 2026
Date Received: February 17, 2026
Date Analyzed: February 17, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Hydrogen sulfide	Zeeco Inlet	84.7	91.2	88.0	7.4
	FL-2009 Inlet	169	161	165	4.8
	Hero Inlet	166	174	170	4.7
	Parnel Inlet	189	199	194	5.2
Carbonyl sulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	0.80	0.82	0.81	2.5
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Methyl mercaptan	Zeeco Inlet	96.4	99.2	97.8	2.9
	FL-2009 Inlet	57.9	56.2	57.1	3.0
	Hero Inlet	300	302	301	0.66
	Parnel Inlet	299	299	299	0.00
Ethyl mercaptan	Zeeco Inlet	1.51	1.64	1.58	8.3
	FL-2009 Inlet	0.84	0.81	0.83	3.6
	Hero Inlet	3.60	3.84	3.72	6.5
	Parnel Inlet	3.55	3.53	3.54	0.56
Dimethyl sulfide	Zeeco Inlet	317	330	324	4.0
	FL-2009 Inlet	184	173	179	6.2
	Hero Inlet	789	797	793	1.0
	Parnel Inlet	803	792	798	1.4
Carbon disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
i-Propyl mercaptan	Zeeco Inlet	1.11	1.18	1.15	6.1
	FL-2009 Inlet	1.81	1.70	1.76	6.3
	Hero Inlet	2.19	2.00	2.10	9.1
	Parnel Inlet	2.42	2.76	2.59	13
t-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
n-Propyl mercaptan	Zeeco Inlet	3.94	4.39	4.17	11
	FL-2009 Inlet	2.23	2.02	2.13	9.9
	Hero Inlet	9.30	9.90	9.60	6.3
	Parnel Inlet	9.49	9.29	9.39	2.1
s-Butyl mercaptan	Zeeco Inlet	3.01	3.33	3.17	10
	FL-2009 Inlet	2.61	2.42	2.52	7.6
	Hero Inlet	7.82	7.82	7.82	0.00
	Parnel Inlet	7.52	7.60	7.56	1.1
i-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Dimethyl disulfide	Zeeco Inlet	1.78	2.13	1.96	18
	FL-2009 Inlet	1.43	1.41	1.42	1.4
	Hero Inlet	2.99	3.02	3.01	1.0
	Parnel Inlet	4.64	4.74	4.69	2.1
Tetrahydrothiophene	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	0.63	0.57	0.60	10
	Hero Inlet	2.26	2.23	2.25	1.3
	Parnel Inlet	2.27	2.07	2.17	9.2
Unidentified sulfurs	Zeeco Inlet	2.53	2.91	2.72	14
	FL-2009 Inlet	2.58	2.20	2.39	16
	Hero Inlet	6.80	6.16	6.48	9.9
	Parnel Inlet	7.01	7.08	7.05	0.95

Four Tedlar bag samples, laboratory numbers 20496-(29-32), were analyzed for total sulfur compounds. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from four Tedlar bag samples is 5.7%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Permanent Gases Analysis in Tedlar Bag Sample

Report Date: March 6, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 17, 2026
Date Analyzed: February 17, 2026

ANALYSIS DESCRIPTION

Permanent gases were measured by thermal conductivity detection/ gas chromatography (TCD/GC) ASTM D1946-90.

AtmAA Lab No.	Sample ID	Oxygen (%v)	Nitrogen (%v)	Methane (%v)	Carbon Dioxide (%v)
20486-3	Zeeco Inlet	11.52	45.51	13.01	26.10
20486-4	FL-2009 Inlet	5.64	26.15	31.01	34.14
20486-5	Hero Inlet	5.46	26.96	14.03	45.24
20486-6	Parnel Inlet	5.51	23.78	16.86	46.56

The reported oxygen concentration includes any argon present in the sample. Calibration is based on a standard atmosphere containing 20.95% oxygen and 0.93% argon.
The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported.
Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 17, 2026
Date Analyzed: February 17, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Oxygen	FL-2009 Inlet	5.64	5.64	5.64	0.0	<0.1
Nitrogen	FL-2009 Inlet	26.19	26.10	26.15	0.34	<0.1
Methane	FL-2009 Inlet	31.02	30.99	31.01	0.10	<0.1
Carbon Dioxide	FL-2009 Inlet	34.10	34.17	34.14	0.21	<0.1

Four Tedlar bag samples, laboratory numbers 20486-(3-6), were analyzed for permanent gases. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 4 repeat measurements from 4 Tedlar bag samples is 0.16%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Carbon Monoxide Analysis in Tedlar Bag Samples

Report Date: March 6, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 17, 2026
Date Analyzed: February 17, 2026

ANALYSIS DESCRIPTION

Carbon monoxide was measured by flame ionization detection/total combustion analysis (FID/TCA), EPA Method ALT-144.

AtmAA Lab No.	Sample ID	Carbon Monoxide (Conc. in ppmv)
20486-3	Zeeco Inlet	440
20486-4	FL-2009 Inlet	191
20486-5	Hero Inlet	797
20486-6	Parnel Inlet	660

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analysis)

Project Name: Chiquita Canyon Landfill
Date Received: February 17, 2026
Date Analyzed: February 17, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Carbon Monoxide	FL-2009 Inlet	191	190	191	0.52

Four Tedlar bag samples, laboratory numbers 20486-(3-6), were analyzed for carbon monoxide. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 4 Tedlar bag samples is 0.52%.

CHAIN OF CUSTODY RECORD

Client/Project Name	Project Location
SCS Engineers / Chiquita Canyon Landfill	29201 Henry Mayo Drive, Castaic, CA 91384
Project No.	**Field Logbook No.**
07224200.24 Task 1	
Sampler: *(Signature)* Victor Arroyo	**Chain of Custody Tape No.**

Sample No./ Identification	Type of Sample	AtmAA Lab Number	Sampling Date	Sampling Time	TRS (307.91	CH4, CO2, O2 (1946)	CO (EPA alt-144)				Special Remarks
Zeeco Inlet	LFG	20486-3	2/17/26	6:50AM	X	X	X				H2S 100 PPM
FL-2009 Inlet	LFG	-4	2/17/26	7:20AM	X	X	X				H2S 160 PPM
Hero Inlet	LFG	-5	2/17/26	7:10AM	X	X	X				H2S 200 PPM
Parnel Inlet	LFG	-6	2/17/26	6:55AM	X	X	X				H2S 210 PPM

ANALYSES REQUESTED

Relinquished by: *(Signature)*	Date	Time	Received by: *(Signature)*	Date	Time
Victor Arroyo	2/17/26	7:35AM	LUIS F	2/17/26	8:00
Relinquished by: *(Signature)* LUIS F	2/17/26	8:56	Received by: *(Signature)*	Date	Time
Relinquished by: *(Signature)*	Date	Time	Received for Laboratory by: *(Signature)*	Date	Time
				2/17/26	8:56

Company Info:	Send Report to:	Analytical Laboratory
Company: SCS Engineers	Company: SCS Engineers	AtmAA Inc.
Street Address: 3900 Kilroy Airport Way Suite 300	Street Address: 3900 Kilroy Airport Way Suite 300	5107 Douglas Fir Rd.
City/State/Zip: Long Beach / CA / 90806	City/State/Zip: Long Beach / CA / 90806	Calabasas, CA 91302
Telephone No.: 562-743-7895 /562-335-0002	Project Manager: Cornelius Fong	TEL: (818) 223-3277
Fax No.:	Email Address: CFong@scsengineers.com	Email Address: info@atmaa.com

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Sulfide and Reduced Sulfur Compounds
Analysis in Tedlar Bag Sample by SCAQMD Method 307.91

Report Date: March 9, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Sampled: February 18, 2026
Date Received: February 18, 2026
Date Analyzed: February 18, 2026

ANALYSIS DESCRIPTION

Total sulfur analysis measured by gas chromatography with sulfur chemiluminescence detector (SCD), SCAQMD 307.91.

AtmAA Lab No.:	20496-1	20496-2	20496-3
Sample I.D.:	Zeeco Inlet	FL-2009 Inlet	Hero Inlet
Components	*(Concentration in ppmv)*		
Hydrogen sulfide	90.1	158	172
Carbonyl sulfide	<1.00	0.74	<1.50
Methyl mercaptan	93.4	76.6	300
Ethyl mercaptan	1.59	1.08	3.67
Dimethyl sulfide	316	223	747
Carbon disulfide	<1.00	<0.50	<1.50
i-Propyl mercaptan	1.10	1.82	2.06
t-Butyl mercaptan	<1.00	<0.50	<1.50
n-Propyl mercaptan	4.19	2.59	8.39
s-Butyl mercaptan	3.19	2.88	6.47
i-Butyl mercaptan	<1.00	<0.50	<1.50
Dimethyl disulfide	2.08	1.37	2.19
Tetrahydrothiophene	<1.00	0.77	1.76
Unidentified sulfurs	3.36	2.02	6.08
	(Concentration in ppmv, as H_2S)		
Total Sulfur	516.6	471.7	1250.8

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Sampled: February 18, 2026
Date Received: February 18, 2026
Date Analyzed: February 18, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Hydrogen sulfide	Zeeco Inlet	89.9	90.3	90.1	0.44
	FL-2009 Inlet	157	158	158	0.63
	Hero Inlet	171	172	172	0.58
Carbonyl sulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	0.74	0.74	0.74	0.00
	Hero Inlet	<1.50	<1.50	---	---
Methyl mercaptan	Zeeco Inlet	91.8	95.0	93.4	3.4
	FL-2009 Inlet	76.4	76.8	76.6	0.52
	Hero Inlet	303	296	300	2.3
Ethyl mercaptan	Zeeco Inlet	1.55	1.63	1.59	5.0
	FL-2009 Inlet	1.05	1.10	1.08	4.7
	Hero Inlet	3.77	3.57	3.67	5.4
Dimethyl sulfide	Zeeco Inlet	312	319	316	2.2
	FL-2009 Inlet	223	223	223	0.00
	Hero Inlet	758	736	747	2.9
Carbon disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
i-Propyl mercaptan	Zeeco Inlet	1.10	1.10	1.10	0.00
	FL-2009 Inlet	1.82	1.82	1.82	0.00
	Hero Inlet	2.11	2.00	2.06	5.4
t-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
n-Propyl mercaptan	Zeeco Inlet	4.14	4.23	4.19	2.2
	FL-2009 Inlet	2.60	2.58	2.59	0.77
	Hero Inlet	8.58	8.19	8.39	4.7
s-Butyl mercaptan	Zeeco Inlet	3.12	3.26	3.19	4.4
	FL-2009 Inlet	2.85	2.90	2.88	1.7
	Hero Inlet	6.64	6.29	6.47	5.4

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
i-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
Dimethyl disulfide	Zeeco Inlet	2.05	2.11	2.08	2.9
	FL-2009 Inlet	1.38	1.36	1.37	1.5
	Hero Inlet	2.19	2.19	2.19	0.00
Tetrahydrothiophene	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	0.78	0.76	0.77	2.6
	Hero Inlet	1.84	1.67	1.76	9.7
Unidentified sulfurs	Zeeco Inlet	3.23	3.49	3.36	7.7
	FL-2009 Inlet	2.00	2.03	2.02	1.5
	Hero Inlet	6.52	5.64	6.08	14

Four Tedlar bag samples, laboratory numbers 20496-(1-3), were analyzed for total sulfur compounds. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from four Tedlar bag samples is 3.1%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Permanent Gases Analysis in Tedlar Bag Sample

Report Date: March 6, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 18, 2026
Date Analyzed: February 18, 2026

ANALYSIS DESCRIPTION

Permanent gases were measured by thermal conductivity detection/gas chromatography analysis (TCD/GC), ASTM D1946-90.

AtmAA Lab No.	Sample ID	Oxygen (%v)	Nitrogen (%v)	Methane (%v)	Carbon Dioxide (%v)
20496-1	Zeeco Inlet	11.12	44.68	13.13	26.49
20496-2	FL-2009 Inlet	5.23	24.58	29.78	35.19
20496-3	Hero Inlet	5.43	26.55	13.93	45.71

The reported oxygen concentration includes any argon present in the sample. Calibration is based on a standard atmosphere containing 20.95% oxygen and 0.93% argon.
The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported.
Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 18, 2026
Date Analyzed: February 18, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Oxygen	Hero Inlet	5.42	5.43	5.43	0.18	<0.1
Nitrogen	Hero Inlet	26.55	26.54	26.55	0.04	<0.1
Methane	Hero Inlet	13.90	13.95	13.93	0.36	<0.1
Carbon Dioxide	Hero Inlet	45.70	45.72	45.71	0.04	<0.1

Three Tedlar bag samples, laboratory numbers 20496-(1-3), were analyzed for permanent gases. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 4 repeat measurements from 3 Tedlar bag samples is 0.16%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Carbon Monoxide Analysis in Tedlar Bag Samples

Report Date: March 6, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 18, 2026
Date Analyzed: February 18, 2026

ANALYSIS DESCRIPTION

Carbon monoxide was measured by flame ionization detection/total combustion analysis (FID/TCA), EPA Method ALT-144.

AtmAA Lab No.	Sample ID	Carbon Monoxide *(Conc. in ppmv)*
20496-1	Zeeco Inlet	336
20496-2	FL-2009 Inlet	221
20496-3	Hero Inlet	771

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analysis)

Project Name: Chiquita Canyon Landfill
Date Received: February 18, 2026
Date Analyzed: February 18, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Carbon Monoxide	Hero Inlet	771	770	771	0.13

Three Tedlar bag samples, laboratory numbers 20496-(1-3), were analyzed for carbon monoxide. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 3 Tedlar bag samples is 0.13%.

CHAIN OF CUSTODY RECORD

Client/Project Name	Project Location
SCS Engineers / Chiquita Canyon Landfill	29201 Henry Mayo Drive, Castaic, CA 91384
Project No.	**Field Logbook No.**
07224200.24 Task 1	
Sampler: *(Signature)* Victor Arroyo	**Chain of Custody Tape No.**

Sample No./ Identification	Type of Sample	AtmAA Lab Number	Sampling Date	Sampling Time	TRS (307.91	CH4, CO2, O2 (1946)	CO (EPA alt-144)				Special Remarks
Zeeco Inlet	LFG	204906-1	2/18/26	7:30 AM	X	X	X				H2S 80 PPM
FL-2009 Inlet	LFG	-2	2/18/26	6:30AM	X	X	X				H2S 160 PPM
Hero Inlet	LFG	-3	2/18/26	7:10 AM	X	X	X				H2S 200 PPM
Parnel Inlet	LFG	[redacted]			X	X	X				H2S [redacted] PPM

Relinquished by: *(Signature)*	Date	Time	Received by: *(Signature)*	Date	Time
Victor Arroyo	2-18-26	7:58AM	LUIS F	2/18/26	8:06
Relinquished by: *(Signature)* LUIS F	2/18/26	9:09	**Received by: *(Signature)***	**Date**	**Time**
Relinquished by: *(Signature)*	**Date**	**Time**	**Received for Laboratory by: *(Signature)***	2/18/26	9:09

Company Info:		Send Report to:		Analytical Laboratory
Company:	SCS Engineers	**Company:**	SCS Engineers	**AtmAA Inc.**
Street Address	3900 Kilroy Airport Way Suite 300	**Street Address**	3900 Kilroy Airport Way Suite 300	**5107 Douglas Fir Rd.**
City/State/Zip:	Long Beach / CA / 90806	**City/State/Zip:**	Long Beach / CA / 90806	**Calabasas, CA 91302**
Telephone No.:	562-743-7895 /562-335-0002	**Project Manager:**	Cornelius Fong	**TEL: (818) 223-3277**
Fax No.:		**Email Address:**	CFong@scsengineers.com	**Email Address: info@atmaa.com**

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Sulfide and Reduced Sulfur Compounds
Analysis in Tedlar Bag Sample by SCAQMD Method 307.91

Report Date: March 9, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Sampled: February 18, 2026
Date Received: February 19, 2026
Date Analyzed: February 19, 2026

ANALYSIS DESCRIPTION

Total sulfur analysis measured by gas chromatography with sulfur chemiluminescence detector (SCD), SCAQMD 307.91.

AtmAA Lab No.:	20506-2
Sample I.D.:	Parnel Inlet

Components	*(Concentration in ppmv)*
Hydrogen sulfide	182
Carbonyl sulfide	<1.50
Methyl mercaptan	278
Ethyl mercaptan	3.26
Dimethyl sulfide	765
Carbon disulfide	<1.50
i-Propyl mercaptan	2.40
t-Butyl mercaptan	<1.50
n-Propyl mercaptan	8.05
s-Butyl mercaptan	6.19
i-Butyl mercaptan	<1.50
Dimethyl disulfide	4.28
Tetrahydrothiophene	1.72
Unidentified sulfurs	5.00
	(Concentration in ppmv, as H_2S)
Total Sulfur	1259.7

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Sampled: February 18, 2026
Date Received: February 19, 2026
Date Analyzed: February 19, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Hydrogen sulfide	Parnel Inlet	180	184	182	2.2
Carbonyl sulfide	Parnel Inlet	<1.50	<1.50	---	---
Methyl mercaptan	Parnel Inlet	269	286	278	6.1
Ethyl mercaptan	Parnel Inlet	3.21	3.31	3.26	3.1
Dimethyl sulfide	Parnel Inlet	750	780	765	3.9
Carbon disulfide	Parnel Inlet	<1.50	<1.50	---	---
i-Propyl mercaptan	Parnel Inlet	2.24	2.55	2.40	13
t-Butyl mercaptan	Parnel Inlet	<1.50	<1.50	---	---
n-Propyl mercaptan	Parnel Inlet	7.85	8.25	8.05	5.0
s-Butyl mercaptan	Parnel Inlet	6.11	6.27	6.19	2.6
i-Butyl mercaptan	Parnel Inlet	<1.50	<1.50	---	---
Dimethyl disulfide	Parnel Inlet	4.32	4.24	4.28	1.9
Tetrahydrothiophene	Parnel Inlet	1.71	1.72	1.72	0.58
Unidentified sulfurs	Parnel Inlet	4.96	5.04	5.00	1.6

One Tedlar bag sample, laboratory number 20506-2, was analyzed for total sulfur compounds. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from one Tedlar bag sample is 4.0%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Permanent Gases Analysis in Tedlar Bag Sample

Report Date: March 6, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 19, 2026
Date Analyzed: February 19, 2026

ANALYSIS DESCRIPTION

Permanent gases were measured by thermal conductivity detection/ gas chromatography (TCD/GC) ASTM D1946-90.

AtmAA Lab No.	Sample ID	Oxygen (%v)	Nitrogen (%v)	Methane (%v)	Carbon Dioxide (%v)
20506-2	Parnel Inlet	4.80	21.12	17.53	48.69

The reported oxygen concentration includes any argon present in the sample. Calibration is based on a standard atmosphere containing 20.95% oxygen and 0.93% argon. The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported. Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 19, 2026
Date Analyzed: February 19, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Oxygen	Parnel Inlet	4.80	4.79	4.80	0.21	<0.1
Nitrogen	Parnel Inlet	21.15	21.09	21.12	0.28	<0.1
Methane	Parnel Inlet	17.52	17.54	17.53	0.11	<0.1
Carbon Dioxide	Parnel Inlet	48.71	48.66	48.69	0.10	<0.1

One Tedlar bag sample, laboratory number 20506-2, was analyzed for permanent gases. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 4 repeat measurements from 1 Tedlar bag sample is 0.18%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Carbon Monoxide Analysis in Tedlar Bag Samples

Report Date: March 6, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 19, 2026
Date Analyzed: February 19, 2026

ANALYSIS DESCRIPTION

Carbon monoxide was measured by flame ionization detection/total combustion analysis (FID/TCA), EPA Method ALT-144.

AtmAA Lab No.	Sample ID	Carbon Monoxide *(Conc. in ppmv)*
20506-2	Parnel Inlet	744

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analysis)

Project Name: Chiquita Canyon Landfill
Date Received: February 19, 2026
Date Analyzed: February 19, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Carbon Monoxide	Parnel Inlet	750	737	744	1.7

One Tedlar bag sample, laboratory number 20506-2, was analyzed for carbon monoxide. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 1 Tedlar bag sample is 1.7%.

CHAIN OF CUSTODY RECORD

Client/Project Name	Project Location
SCS Engineers / Chiquita Canyon Landfill	29201 Henry Mayo Drive, Castaic, CA 91384
Project No.	**Field Logbook No.**
07224200.24 Task 1	
Sampler: *(Signature)* Victor Amaya	**Chain of Custody Tape No.**

ANALYSES REQUESTED

Sample No./ Identification	Type of Sample	AtmAA Lab Number	Sampling Date	Sampling Time	TRS (307.91	CH4, CO2, O2 (1946)	CO (EPA alt-144)				Special Remarks
Zeeco Inlet	LFG				X	X	X				H2S PPM
FL-2009 Inlet	LFG				X	X	X				H2S PPM
Hero Inlet	LFG				X	X	X				H2S PPM
Parnel Inlet	LFG	20506-2	2/18/26	16:22	X	X	X				H2S 160 PPM

Relinquished by: *(Signature)* Victor Amaya	**Date** 2/19/26	**Time** 8:05 AM	**Received by: *(Signature)***	**Date** 2/19/26 **Time** 8:15
Relinquished by: *(Signature)*	**Date** 2/19/26	**Time** 9:20	**Received by: *(Signature)***	**Date** **Time**
Relinquished by: *(Signature)*	**Date**	**Time**	**Received for Laboratory by: *(Signature)***	**Date** 2/19/26 **Time** 9:20

Company Info:	**Send Report to:**	**Analytical Laboratory**
Company: SCS Engineers	**Company:** SCS Engineers	**AtmAA Inc.**
Street Address 3900 Kilroy Airport Way Suite 300	**Street Address** 3900 Kilroy Airport Way Suite 300	**5107 Douglas Fir Rd.**
City/State/Zip: Long Beach / CA / 90806	**City/State/Zip:** Long Beach / CA / 90806	**Calabasas, CA 91302**
Telephone No.: 562-743-7895 /562-335-0002	**Project Manager:** Cornelius Fong	**TEL: (818) 223-3277**
Fax No.:	**Email Address:** CFong@scsengineers.com	**Email Address: info@atmaa.com**

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Sulfide and Reduced Sulfur Compounds
Analysis in Tedlar Bag Sample by SCAQMD Method 307.91

Report Date: March 9, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Sampled: February 19, 2026
Date Received: February 19, 2026
Date Analyzed: February 19, 2026

ANALYSIS DESCRIPTION

Total sulfur analysis measured by gas chromatography with sulfur chemiluminescence detector (SCD), SCAQMD 307.91.

AtmAA Lab No.:	20506-3	20506-4	20506-5	20506-6
Sample I.D.:	Zeeco Inlet	FL-2009 Inlet	Hero Inlet	Parnel Inlet
Components	*(Concentration in ppmv)*			
Hydrogen sulfide	91.5	169	162	187
Carbonyl sulfide	<1.00	0.78	<1.50	<1.50
Methyl mercaptan	85.5	57.7	282	290
Ethyl mercaptan	1.45	0.85	3.32	3.50
Dimethyl sulfide	283	185	729	778
Carbon disulfide	<1.00	<0.50	<1.50	<1.50
i-Propyl mercaptan	0.98	1.73	2.05	2.32
t-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
n-Propyl mercaptan	3.42	2.00	8.06	8.42
s-Butyl mercaptan	2.57	2.40	6.24	6.32
i-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
Dimethyl disulfide	1.74	1.16	2.23	4.26
Tetrahydrothiophene	<1.00	0.49	1.62	1.61
Unidentified sulfurs	1.72	1.91	4.18	4.84
	(Concentration in ppmv, as H_2S)			
Total Sulfur	473.1	423.2	1202.4	1289.5

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Sampled: February 19, 2026
Date Received: February 19, 2026
Date Analyzed: February 19, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Hydrogen sulfide	Zeeco Inlet	91.5	91.5	91.5	0.00
	FL-2009 Inlet	170	167	169	1.8
	Hero Inlet	166	158	162	4.9
	Parnel Inlet	184	189	187	2.7
Carbonyl sulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	0.79	0.77	0.78	2.6
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Methyl mercaptan	Zeeco Inlet	86.5	84.4	85.5	2.5
	FL-2009 Inlet	58.7	56.7	57.7	3.5
	Hero Inlet	288	276	282	4.3
	Parnel Inlet	286	294	290	2.8
Ethyl mercaptan	Zeeco Inlet	1.39	1.51	1.45	8.3
	FL-2009 Inlet	0.88	0.82	0.85	7.1
	Hero Inlet	3.45	3.19	3.32	7.8
	Parnel Inlet	3.31	3.68	3.50	11
Dimethyl sulfide	Zeeco Inlet	284	281	283	1.1
	FL-2009 Inlet	189	180	185	4.9
	Hero Inlet	746	711	729	4.8
	Parnel Inlet	780	775	778	0.64
Carbon disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
i-Propyl mercaptan	Zeeco Inlet	1.11	0.85	0.98	27
	FL-2009 Inlet	1.75	1.70	1.73	2.9
	Hero Inlet	2.13	1.96	2.05	8.3
	Parnel Inlet	2.55	2.09	2.32	20
t-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
n-Propyl mercaptan	Zeeco Inlet	3.56	3.27	3.42	8.5
	FL-2009 Inlet	2.01	1.98	2.00	1.5
	Hero Inlet	8.14	7.98	8.06	2.0
	Parnel Inlet	8.25	8.59	8.42	4.0
s-Butyl mercaptan	Zeeco Inlet	2.66	2.48	2.57	7.0
	FL-2009 Inlet	2.45	2.35	2.40	4.2
	Hero Inlet	6.38	6.10	6.24	4.5
	Parnel Inlet	6.27	6.37	6.32	1.6
i-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Dimethyl disulfide	Zeeco Inlet	1.74	1.74	1.74	0.00
	FL-2009 Inlet	1.16	1.15	1.16	0.87
	Hero Inlet	2.23	2.23	2.23	0.00
	Parnel Inlet	4.24	4.28	4.26	0.94
Tetrahydrothiophene	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	0.46	0.51	0.49	10
	Hero Inlet	1.57	1.66	1.62	5.6
	Parnel Inlet	1.72	1.50	1.61	14
Unidentified sulfurs	Zeeco Inlet	1.74	1.70	1.72	2.3
	FL-2009 Inlet	2.05	1.77	1.91	15
	Hero Inlet	4.15	4.20	4.18	1.2
	Parnel Inlet	5.04	4.63	4.84	8.5

Four Tedlar bag samples, laboratory numbers 20506-(3-6), were analyzed for total sulfur compounds. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from four Tedlar bag samples is 5.5%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Permanent Gases Analysis in Tedlar Bag Sample

Report Date: March 6, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 19, 2026
Date Analyzed: February 19, 2026

ANALYSIS DESCRIPTION

Permanent gases were measured by thermal conductivity detection/ gas chromatography (TCD/GC) ASTM D1946-90.

AtmAA Lab No.	Sample ID	Oxygen (%v)	Nitrogen (%v)	Methane (%v)	Carbon Dioxide (%v)
20506-3	Zeeco Inlet	10.60	43.75	13.70	26.72
20506-4	FL-2009 Inlet	5.00	23.67	31.92	35.03
20506-5	Hero Inlet	4.80	24.83	14.31	46.35
20506-6	Parnel Inlet	5.18	22.75	16.91	47.07

The reported oxygen concentration includes any argon present in the sample. Calibration is based on a standard atmosphere containing 20.95% oxygen and 0.93% argon.
The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported.
Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 19, 2026
Date Analyzed: February 19, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Oxygen	Hero Inlet	4.80	4.79	4.80	0.21	<0.1
Nitrogen	Hero Inlet	24.83	24.82	24.83	0.04	<0.1
Methane	Hero Inlet	14.31	14.30	14.31	0.07	<0.1
Carbon Dioxide	Hero Inlet	46.37	46.32	46.35	0.11	<0.1

Four Tedlar bag samples, laboratory numbers 20106-(1-4), were analyzed for permanent gases. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 4 repeat measurements from 4 Tedlar bag samples is 0.11%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Carbon Monoxide Analysis in Tedlar Bag Samples

Report Date: March 6, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 19, 2026
Date Analyzed: February 19, 2026

ANALYSIS DESCRIPTION

Carbon monoxide was measured by flame ionization detection/total combustion analysis (FID/TCA), EPA Method ALT-144.

AtmAA Lab No.	Sample ID	Carbon Monoxide (Conc. in ppmv)
20506-3	Zeeco Inlet	164
20506-4	FL-2009 Inlet	249
20506-5	Hero Inlet	845
20506-6	Parnel Inlet	895

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analysis)

Project Name: Chiquita Canyon Landfill
Date Received: February 19, 2026
Date Analyzed: February 19, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Carbon Monoxide	Hero Inlet	855	835	845	2.4

Four Tedlar bag samples, laboratory numbers 20506-(3-6), were analyzed for carbon monoxide. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 4 Tedlar bag samples is 2.4%.

CHAIN OF CUSTODY RECORD

Client/Project Name	Project Location
SCS Engineers / Chiquita Canyon Landfill	29201 Henry Mayo Drive, Castaic, CA 91384
Project No.	**Field Logbook No.**
07224200.24 Task 1	
Sampler: (Signature) Victor Arroyo	**Chain of Custody Tape No.**

ANALYSES REQUESTED

Sample No./ Identification	Type of Sample	AtmAA Lab Number	Sampling Date	Sampling Time	TRS (307.91)	CH4, CO2, O2 (1946)	CO (EPA alt-144)				Special Remarks
Zeeco Inlet	LFG	20506-3	2/19/26	7:45AM	X	X	X				H2S 80 PPM
FL-2009 Inlet	LFG	-4	2/19/26	7:05AM	X	X	X				H2S 120 PPM
Hero Inlet	LFG	-5	2/19/26	7:30AM	X	X	X				H2S 200 PPM
Parnel Inlet	LFG	-6	2/19/26	7:35AM	X	X	X				H2S 210 PPM

	Date	Time		Date	Time
Relinquished by: (Signature) Victor Arroyo	2/19/26	8:05AM	**Received by: (Signature)**	2/19/26	8:45
Relinquished by: (Signature)	2/19/26	9:20	**Received by: (Signature)**		
Relinquished by: (Signature)			**Received for Laboratory by: (Signature)**	2/19/26	9:20

Company Info:	Send Report to:	Analytical Laboratory
Company: SCS Engineers	**Company:** SCS Engineers	**AtmAA Inc.**
Street Address 3900 Kilroy Airport Way Suite 300	**Street Address** 3900 Kilroy Airport Way Suite 300	**5107 Douglas Fir Rd.**
City/State/Zip: Long Beach / CA / 90806	**City/State/Zip:** Long Beach / CA / 90806	**Calabasas, CA 91302**
Telephone No.: 562-743-7895 /562-335-0002	**Project Manager:** Cornelius Fong	**TEL: (818) 223-3277**
Fax No.:	**Email Address:** CFong@scsengineers.com	**Email Address: info@atmaa.com**

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Sulfide and Reduced Sulfur Compounds
Analysis in Tedlar Bag Sample by SCAQMD Method 307.91

Report Date: March 9, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon
Project No.: 07224200.24 Task 1
Date Sampled: February 20, 2026
Date Received: February 20, 2026
Date Analyzed: February 20, 2026

ANALYSIS DESCRIPTION

Total sulfur analysis measured by gas chromatography with sulfur chemiluminescence detector (SCD), SCAQMD 307.91.

AtmAA Lab No.:	20516-1	20516-2	20516-3	20516-4
Sample I.D.:	Zeeco Inlet	FL-2009 Inlet	Hero Inlet	Parnel Inlet
Components	*(Concentration in ppmv)*			
Hydrogen sulfide	79.9	146	153	177
Carbonyl sulfide	<1.00	0.71	<1.50	<1.50
Methyl mercaptan	83.7	49.9	283	274
Ethyl mercaptan	1.41	0.78	3.54	3.34
Dimethyl sulfide	288	157	744	718
Carbon disulfide	<1.00	<0.50	<1.50	<1.50
i-Propyl mercaptan	1.04	1.57	2.01	2.19
t-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
n-Propyl mercaptan	3.80	1.83	8.84	7.75
s-Butyl mercaptan	3.06	2.22	7.14	5.73
i-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
Dimethyl disulfide	1.67	1.00	2.40	3.27
Tetrahydrothiophene	<1.00	0.57	2.00	<1.50
Unidentified sulfurs	4.40	1.66	6.54	5.44
	(Concentration in ppmv, as H_2S)			
Total Sulfur	468.1	363.7	1213.3	1199.5

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon
Date Sampled: February 20, 2026
Date Received: February 20, 2026
Date Analyzed: February 20, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Hydrogen sulfide	Zeeco Inlet	80.3	79.5	79.9	1.0
	FL-2009 Inlet	139	153	146	9.6
	Hero Inlet	146	159	153	8.5
	Parnel Inlet	176	177	177	0.57
Carbonyl sulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	0.66	0.76	0.71	14
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Methyl mercaptan	Zeeco Inlet	82.4	85.0	83.7	3.1
	FL-2009 Inlet	47.7	52.1	49.9	8.8
	Hero Inlet	268	297	283	10
	Parnel Inlet	269	279	274	3.6
Ethyl mercaptan	Zeeco Inlet	1.36	1.45	1.41	6.4
	FL-2009 Inlet	0.74	0.82	0.78	10
	Hero Inlet	3.41	3.66	3.54	7.1
	Parnel Inlet	3.31	3.36	3.34	1.5
Dimethyl sulfide	Zeeco Inlet	286	289	288	1.0
	FL-2009 Inlet	149	164	157	9.6
	Hero Inlet	711	776	744	8.7
	Parnel Inlet	711	725	718	1.9
Carbon disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
i-Propyl mercaptan	Zeeco Inlet	1.03	1.05	1.04	1.9
	FL-2009 Inlet	1.53	1.60	1.57	4.5
	Hero Inlet	1.90	2.12	2.01	11
	Parnel Inlet	2.13	2.24	2.19	5.0
t-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
n-Propyl mercaptan	Zeeco Inlet	3.70	3.90	3.80	5.3
	FL-2009 Inlet	1.76	1.90	1.83	7.7
	Hero Inlet	8.52	9.15	8.84	7.1
	Parnel Inlet	7.55	7.94	7.75	5.0
s-Butyl mercaptan	Zeeco Inlet	3.14	2.98	3.06	5.2
	FL-2009 Inlet	2.19	2.24	2.22	2.3
	Hero Inlet	6.86	7.41	7.14	7.7
	Parnel Inlet	5.47	5.99	5.73	9.1
i-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Dimethyl disulfide	Zeeco Inlet	1.68	1.66	1.67	1.2
	FL-2009 Inlet	0.98	1.02	1.00	4.0
	Hero Inlet	2.38	2.41	2.40	1.3
	Parnel Inlet	3.15	3.39	3.27	7.3
Tetrahydrothiophene	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	0.58	0.56	0.57	3.5
	Hero Inlet	2.04	1.96	2.00	4.0
	Parnel Inlet	<1.50	<1.50	---	---
Unidentified sulfurs	Zeeco Inlet	4.53	4.26	4.40	6.1
	FL-2009 Inlet	1.63	1.69	1.66	3.6
	Hero Inlet	6.49	6.58	6.54	1.4
	Parnel Inlet	5.87	5.01	5.44	16

Four Tedlar bag samples, laboratory numbers 20516-(1-4), were analyzed for total sulfur compounds. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from four Tedlar bag samples is 5.8%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Permanent Gases Analysis in Tedlar Bag Sample

Report Date: March 6, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 20, 2026
Date Analyzed: February 20, 2026

ANALYSIS DESCRIPTION

Permanent gases were measured by thermal conductivity detection/ gas chromatography (TCD/GC) ASTM D1946-90.

AtmAA Lab No.	Sample ID	Oxygen (%v)	Nitrogen (%v)	Methane (%v)	Carbon Dioxide (%v)
20516-1	Zeeco Inlet	11.46	46.14	13.09	25.82
20516-2	FL-2009 Inlet	5.63	26.32	30.60	33.63
20516-3	Hero Inlet	5.62	27.82	13.65	44.62
20516-4	Parnel Inlet	5.91	25.23	16.05	45.02

The reported oxygen concentration includes any argon present in the sample. Calibration is based on a standard atmosphere containing 20.95% oxygen and 0.93% argon. The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported. Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 20, 2026
Date Analyzed: February 20, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Oxygen	Zeeco Inlet	11.42	11.49	11.46	0.61	<0.1
Nitrogen	Zeeco Inlet	46.11	46.16	46.14	0.11	<0.1
Methane	Zeeco Inlet	13.10	13.08	13.09	0.15	<0.1
Carbon Dioxide	Zeeco Inlet	25.85	25.78	25.82	0.27	<0.1

Four Tedlar bag samples, laboratory numbers 20516-(1-4), were analyzed for permanent gases. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 4 repeat measurements from 4 Tedlar bag samples is 0.29%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Carbon Monoxide Analysis in Tedlar Bag Samples

Report Date: March 6, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 20, 2026
Date Analyzed: February 20, 2026

ANALYSIS DESCRIPTION

Carbon monoxide was measured by flame ionization detection/total combustion analysis (FID/TCA), EPA Method ALT-144.

AtmAA Lab No.	Sample ID	Carbon Monoxide (Conc. in ppmv)
20516-1	Zeeco Inlet	314
20516-2	FL-2009 Inlet	176
20516-3	Hero Inlet	793
20516-4	Parnel Inlet	752

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analysis)

Project Name: Chiquita Canyon Landfill
Date Received: February 20, 2026
Date Analyzed: February 20, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Carbon Monoxide	Zeeco Inlet	314	313	314	0.32

Four Tedlar bag samples, laboratory numbers 20516-(1-4), were analyzed for carbon monoxide. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 4 Tedlar bag samples is 0.32%.

CHAIN OF CUSTODY RECORD

Client/Project Name	Project Location
SCS Engineers / Chiquita Canyon Landfill	29201 Henry Mayo Drive, Castaic, CA 91384
Project No.	**Field Logbook No.**
07224200.24 Task 1	
Sampler: *(Signature)* Victor Arroyo	**Chain of Custody Tape No.**

Sample No./ Identification	Type of Sample	AtmAA Lab Number	Sampling Date	Sampling Time	TRS (307.91	CH4, CO2, O2 (1946)	CO (EPA alt-144)				Special Remarks
Zeeco Inlet	LFG	20516-1	2/20/26	7:25AM	X	X	X				H2S 90 PPM
FL-2009 Inlet	LFG	-2	2/20/26	7:00AM	X	X	X				H2S 150 PPM
Hero Inlet	LFG	-3	2/20/26	7:10AM	X	X	X				H2S 200 PPM
Parnel Inlet	LFG	-4	2/20/26	7:20 AM	X	X	X				H2S 220 PPM

Relinquished by: *(Signature)* Victor Arroyo	**Date** 2/20/26	**Time** 8:15AM	**Received by: *(Signature)*** LUIS F	**Date** 2/20/26	**Time** 9:08
Relinquished by: *(Signature)* LUIS F	**Date** 2/20/26	**Time** 10:00	**Received by: *(Signature)***	**Date**	**Time**
Relinquished by: *(Signature)*	**Date**	**Time**	**Received for Laboratory by: *(Signature)*** AtmAA	**Date** 2/20/26	**Time** 10:40

Company Info:	**Send Report to:**	**Analytical Laboratory**
Company: SCS Engineers	**Company:** SCS Engineers	**AtmAA Inc.**
Street Address 3900 Kilroy Airport Way Suite 300	**Street Address** 3900 Kilroy Airport Way Suite 300	**5107 Douglas Fir Rd.**
City/State/Zip: Long Beach / CA / 90806	**City/State/Zip:** Long Beach / CA / 90806	**Calabasas, CA 91302**
Telephone No.: 562-743-7895 /562-335-0002	**Project Manager:** Cornelius Fong	**TEL: (818) 223-3277**
Fax No.:	**Email Address:** CFong@scsengineers.com	**Email Address: info@atmaa.com**

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Sulfide and Reduced Sulfur Compounds
Analysis in Tedlar Bag Sample by SCAQMD Method 307.91

Report Date: March 9, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon
Project No.: 07224200.24 Task 1
Date Sampled: February 21, 2026
Date Received: February 21, 2026
Date Analyzed: February 21, 2026

ANALYSIS DESCRIPTION

Total sulfur analysis measured by gas chromatography with sulfur chemiluminescence detector (SCD), SCAQMD 307.91.

AtmAA Lab No.:	20526-1	20526-2	20526-3	20526-4
Sample I.D.:	Zeeco Inlet	FL-2009 Inlet	Hero Inlet	Parnel Inlet
Components	*(Concentration in ppmv)*			
Hydrogen sulfide	86.6	164	162	217
Carbonyl sulfide	<1.00	0.77	<1.50	<1.50
Methyl mercaptan	82.1	55.8	292	338
Ethyl mercaptan	1.30	0.85	3.46	4.02
Dimethyl sulfide	283	179	764	890
Carbon disulfide	<1.00	<0.50	<1.50	<1.50
i-Propyl mercaptan	1.04	1.78	2.14	2.56
t-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
n-Propyl mercaptan	3.75	2.07	8.91	9.56
s-Butyl mercaptan	2.90	2.45	6.88	7.59
i-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
Dimethyl disulfide	1.82	1.25	2.57	5.16
Tetrahydrothiophene	<1.00	0.56	1.93	2.11
Unidentified sulfurs	3.57	2.65	6.76	8.41
	(Concentration in ppmv, as H_2S)			
Total Sulfur	467.8	411.4	1252.2	1488.6

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon
Date Sampled: February 21, 2026
Date Received: February 21, 2026
Date Analyzed: February 21, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Hydrogen sulfide	Zeeco Inlet	86.3	86.9	86.6	0.69
	FL-2009 Inlet	167	160	164	4.3
	Hero Inlet	162	161	162	0.62
	Parnel Inlet	230	203	217	12
Carbonyl sulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	0.82	0.72	0.77	13
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Methyl mercaptan	Zeeco Inlet	82.1	82.0	82.1	0.12
	FL-2009 Inlet	56.7	54.8	55.8	3.4
	Hero Inlet	295	289	292	2.1
	Parnel Inlet	349	326	338	6.8
Ethyl mercaptan	Zeeco Inlet	1.37	1.23	1.30	11
	FL-2009 Inlet	0.88	0.81	0.85	8.3
	Hero Inlet	3.56	3.36	3.46	5.8
	Parnel Inlet	4.06	3.98	4.02	2.0
Dimethyl sulfide	Zeeco Inlet	284	282	283	0.71
	FL-2009 Inlet	185	172	179	7.3
	Hero Inlet	764	763	764	0.13
	Parnel Inlet	909	871	890	4.3
Carbon disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
i-Propyl mercaptan	Zeeco Inlet	1.04	1.04	1.04	0.00
	FL-2009 Inlet	1.84	1.72	1.78	6.7
	Hero Inlet	2.23	2.05	2.14	8.4
	Parnel Inlet	2.61	2.51	2.56	3.9
t-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
n-Propyl mercaptan	Zeeco Inlet	3.71	3.78	3.75	1.9
	FL-2009 Inlet	2.16	1.97	2.07	9.2
	Hero Inlet	8.92	8.90	8.91	0.22
	Parnel Inlet	9.27	9.84	9.56	6.0
s-Butyl mercaptan	Zeeco Inlet	2.89	2.90	2.90	0.35
	FL-2009 Inlet	2.56	2.34	2.45	9.0
	Hero Inlet	6.86	6.89	6.88	0.44
	Parnel Inlet	7.70	7.48	7.59	2.9
i-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Dimethyl disulfide	Zeeco Inlet	1.87	1.76	1.82	6.1
	FL-2009 Inlet	1.27	1.22	1.25	4.0
	Hero Inlet	2.56	2.58	2.57	0.78
	Parnel Inlet	5.09	5.23	5.16	2.7
Tetrahydrothiophene	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	0.55	0.57	0.56	3.6
	Hero Inlet	1.96	1.90	1.93	3.1
	Parnel Inlet	2.15	2.07	2.11	3.8
Unidentified sulfurs	Zeeco Inlet	3.75	3.39	3.57	10
	FL-2009 Inlet	2.60	2.70	2.65	3.8
	Hero Inlet	6.96	6.55	6.76	6.1
	Parnel Inlet	8.46	8.37	8.41	1.1

Four Tedlar bag samples, laboratory numbers 20526-(1-4), were analyzed for total sulfur compounds. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from four Tedlar bag samples is 4.4%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Permanent Gases Analysis in Tedlar Bag Sample

Report Date: March 6, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 21, 2026
Date Analyzed: February 23, 2026

ANALYSIS DESCRIPTION

Permanent gases were measured by thermal conductivity detection/ gas chromatography (TCD/GC) ASTM D1946-90.

AtmAA Lab No.	Sample ID	Oxygen (%v)	Nitrogen (%v)	Methane (%v)	Carbon Dioxide (%v)
20526-1	Zeeco Inlet	11.48	46.17	13.22	25.71
20526-2	FL-2009 Inlet	5.11	25.01	31.47	34.71
20526-3	Hero Inlet	5.51	27.64	13.29	44.79
20526-4	Parnel Inlet	6.14	26.14	15.44	44.75

The reported oxygen concentration includes any argon present in the sample. Calibration is based on a standard atmosphere containing 20.95% oxygen and 0.93% argon.
The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported.
Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 21, 2026
Date Analyzed: February 23, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Oxygen	Zeeco Inlet	11.45	11.50	11.48	0.44	<0.1
Nitrogen	Zeeco Inlet	46.19	46.14	46.17	0.11	<0.1
Methane	Zeeco Inlet	13.20	13.24	13.22	0.30	<0.1
Carbon Dioxide	Zeeco Inlet	25.71	25.71	25.71	0.0	<0.1

Four Tedlar bag samples, laboratory numbers 20526-(1-4), were analyzed for permanent gases. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 4 repeat measurements from 4 Tedlar bag samples is 0.21%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Carbon Monoxide Analysis in Tedlar Bag Samples

Report Date: March 6, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 21, 2026
Date Analyzed: February 23, 2026

ANALYSIS DESCRIPTION

Carbon monoxide was measured by flame ionization detection/total combustion analysis (FID/TCA), EPA Method ALT-144.

AtmAA Lab No.	Sample ID	Carbon Monoxide *(Conc. in ppmv)*
20526-1	Zeeco Inlet	242
20526-2	FL-2009 Inlet	151
20526-3	Hero Inlet	650
20526-4	Parnel Inlet	678

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analysis)

Project Name: Chiquita Canyon Landfill
Date Received: February 21, 2026
Date Analyzed: February 23, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Carbon Monoxide	Zeeco Inlet	242	242	242	0.0

Four Tedlar bag samples, laboratory numbers 20526-(1-4), were analyzed for carbon monoxide. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 4 Tedlar bag samples is 0.0%.

CHAIN OF CUSTODY RECORD

Client/Project Name	Project Location
SCS Engineers / Chiquita Canyon Landfill	29201 Henry Mayo Drive, Castaic, CA 91384
Project No.	**Field Logbook No.**
07224200.24 Task 1	
Sampler: *(Signature)*	**Chain of Custody Tape No.**

Sample No./ Identification	Type of Sample	AtmAA Lab Number	Sampling Date	Sampling Time	TRS (307.91	CH4, CO2, O2 (1946)	CO (EPA alt-144)				Special Remarks
Zeeco Inlet	LFG	20526-1	2/21/26	8:00am	X	X	X				H2S 80 PPM
FL-2009 Inlet	LFG	-2	2/21/26	8:10am	X	X	X				H2S 140 PPM
Hero Inlet	LFG	-3	2/21/26	7:45am	X	X	X				H2S 160 PPM
Parnel Inlet	LFG	-4	2/21/26	7:55am	X	X	X				H2S 180 PPM

ANALYSES REQUESTED

Relinquished by: *(Signature)*	Date	Time	Received by: *(Signature)*	Date	Time
	2/21/26	9:00 am	LUIS F	2/21/26	9:07
Relinquished by: *(Signature)* LUIS F	**Date** 2/21/26	**Time** 9:59	**Received by: *(Signature)***	**Date**	**Time**
Relinquished by: *(Signature)*	**Date**	**Time**	**Received for Laboratory by: *(Signature)***	**Date** 2/21/26	**Time** 9:59

Company Info:		Send Report to:		Analytical Laboratory
Company:	SCS Engineers	**Company:**	SCS Engineers	AtmAA Inc.
Street Address	3900 Kilroy Airport Way Suite 300	**Street Address**	3900 Kilroy Airport Way Suite 300	5107 Douglas Fir Rd.
City/State/Zip:	Long Beach / CA / 90806	**City/State/Zip:**	Long Beach / CA / 90806	Calabasas, CA 91302
Telephone No.:	562-743-7895 /562-335-0002	**Project Manager:**	Cornelius Fong	TEL: (818) 223-3277
Fax No.:		**Email Address:**	CFong@scsengineers.com	Email Address: info@atmaa.com

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Sulfide and Reduced Sulfur Compounds
Analysis in Tedlar Bag Sample by SCAQMD Method 307.91

Report Date: March 9, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon
Project No.: 07224200.24 Task 1
Date Sampled: February 22, 2026
Date Received: February 23, 2026
Date Analyzed: February 23, 2026

ANALYSIS DESCRIPTION

Total sulfur analysis measured by gas chromatography with sulfur chemiluminescence detector (SCD), SCAQMD 307.91.

AtmAA Lab No.:	20546-25	20546-26	20546-27	20546-28
Sample I.D.:	Zeeco Inlet	FL-2009 Inlet	Hero Inlet	Parnel Inlet
Components	*(Concentration in ppmv)*			
Hydrogen sulfide	92.6	166	160	183
Carbonyl sulfide	<1.00	0.79	<1.50	<1.50
Methyl mercaptan	95.7	57.9	299	297
Ethyl mercaptan	1.72	0.90	3.72	3.80
Dimethyl sulfide	308	186	806	826
Carbon disulfide	<1.00	<0.50	<1.50	<1.50
i-Propyl mercaptan	1.02	1.64	2.13	2.26
t-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
n-Propyl mercaptan	4.04	2.10	9.52	9.56
s-Butyl mercaptan	3.16	2.36	7.52	8.04
i-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
Dimethyl disulfide	2.11	1.41	2.98	5.92
Tetrahydrothiophene	<1.00	0.56	2.24	2.56
Unidentified sulfurs	5.39	4.10	8.65	11.9
	(Concentration in ppmv, as H_2S)			
Total Sulfur	515.7	424.6	1304.2	1354.9

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon
Date Sampled: February 22, 2026
Date Received: February 23, 2026
Date Analyzed: February 23, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Hydrogen sulfide	Zeeco Inlet	94.8	90.3	92.6	4.9
	FL-2009 Inlet	160	172	166	7.2
	Hero Inlet	159	161	160	1.3
	Parnel Inlet	179	186	183	3.8
Carbonyl sulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	0.76	0.81	0.79	6.4
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Methyl mercaptan	Zeeco Inlet	97.4	93.9	95.7	3.7
	FL-2009 Inlet	56.2	59.5	57.9	5.7
	Hero Inlet	288	310	299	7.4
	Parnel Inlet	291	302	297	3.7
Ethyl mercaptan	Zeeco Inlet	1.77	1.66	1.72	6.4
	FL-2009 Inlet	0.87	0.93	0.90	6.7
	Hero Inlet	3.57	3.86	3.72	7.8
	Parnel Inlet	3.76	3.84	3.80	2.1
Dimethyl sulfide	Zeeco Inlet	313	303	308	3.2
	FL-2009 Inlet	180	191	186	5.9
	Hero Inlet	784	827	806	5.3
	Parnel Inlet	799	853	826	6.5
Carbon disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
i-Propyl mercaptan	Zeeco Inlet	0.99	1.05	1.02	5.9
	FL-2009 Inlet	1.60	1.67	1.64	4.3
	Hero Inlet	2.17	2.08	2.13	4.2
	Parnel Inlet	2.22	2.30	2.26	3.5
t-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
n-Propyl mercaptan	Zeeco Inlet	4.02	4.06	4.04	1.0
	FL-2009 Inlet	2.03	2.17	2.10	6.7
	Hero Inlet	9.60	9.44	9.52	1.7
	Parnel Inlet	9.11	10.0	9.56	9.3
s-Butyl mercaptan	Zeeco Inlet	3.22	3.09	3.16	4.1
	FL-2009 Inlet	2.30	2.41	2.36	4.7
	Hero Inlet	7.41	7.63	7.52	2.9
	Parnel Inlet	7.78	8.30	8.04	6.5
i-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Dimethyl disulfide	Zeeco Inlet	2.11	2.11	2.11	0.00
	FL-2009 Inlet	1.38	1.43	1.41	3.6
	Hero Inlet	2.82	3.13	2.98	10
	Parnel Inlet	5.70	6.13	5.92	7.3
Tetrahydrothiophene	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	0.56	0.56	0.56	0.00
	Hero Inlet	2.19	2.29	2.24	4.5
	Parnel Inlet	2.50	2.62	2.56	4.7
Unidentified sulfurs	Zeeco Inlet	5.71	5.07	5.39	12
	FL-2009 Inlet	4.14	4.05	4.10	2.2
	Hero Inlet	8.58	8.73	8.65	1.8
	Parnel Inlet	11.8	12.0	11.9	1.7

Four Tedlar bag samples, laboratory numbers 20546-(25-28), were analyzed for total sulfur compounds. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from four Tedlar bag samples is 4.8%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Permanent Gases Analysis in Tedlar Bag Sample

Report Date: March 6, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 23, 2026
Date Analyzed: February 23, 2026

ANALYSIS DESCRIPTION

Permanent gases were measured by thermal conductivity detection/ gas chromatography (TCD/GC) ASTM D1946-90.

AtmAA Lab No.	Sample ID	Oxygen (%v)	Nitrogen (%v)	Methane (%v)	Carbon Dioxide (%v)
20546-25	Zeeco Inlet	10.00	42.17	13.84	27.70
20546-26	FL-2009 Inlet	4.38	22.30	32.40	35.91
20546-27	Hero Inlet	4.62	24.70	14.43	47.56
20546-28	Parnel Inlet	4.77	21.62	16.35	47.58

The reported oxygen concentration includes any argon present in the sample. Calibration is based on a standard atmosphere containing 20.95% oxygen and 0.93% argon.
The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported.
Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 23, 2026
Date Analyzed: February 23, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Oxygen	Hero Inlet	4.62	4.61	4.62	0.22	<0.1
Nitrogen	Hero Inlet	24.71	24.69	24.70	0.08	<0.1
Methane	Hero Inlet	14.44	14.42	14.43	0.14	<0.1
Carbon Dioxide	Hero Inlet	47.52	47.60	47.56	0.17	<0.1

Four Tedlar bag samples, laboratory numbers 20546-(25-28), were analyzed for permanent gases. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 4 repeat measurements from 4 Tedlar bag samples is 0.15%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Carbon Monoxide Analysis in Tedlar Bag Samples

Report Date: March 6, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 23, 2026
Date Analyzed: February 23, 2026

ANALYSIS DESCRIPTION

Carbon monoxide was measured by flame ionization detection/total combustion analysis (FID/TCA), EPA Method ALT-144.

AtmAA Lab No.	Sample ID	Carbon Monoxide *(Conc. in ppmv)*
20546-25	Zeeco Inlet	278
20546-26	FL-2009 Inlet	144
20546-27	Hero Inlet	704
20546-28	Parnel Inlet	671

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analysis)

Project Name: Chiquita Canyon Landfill
Date Received: February 23, 2026
Date Analyzed: February 23, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Carbon Monoxide	Hero Inlet	702	705	704	0.43

Four Tedlar bag samples, laboratory numbers 20546-(25-28), were analyzed for carbon monoxide. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 4 Tedlar bag samples is 0.43%.

CHAIN OF CUSTODY RECORD

Client/Project Name	Project Location
SCS Engineers / Chiquita Canyon Landfill	29201 Henry Mayo Drive, Castaic, CA 91384
Project No. 07224200.24 Task 1	**Field Logbook No.**
Sampler: *(Signature)*	**Chain of Custody Tape No.**

Sample No./ Identification	Type of Sample	AtmAA Lab Number	Sampling Date	Sampling Time	TRS (307.91	CH4, CO2, O2 (1946)	CO (EPA alt-144)				Special Remarks
Zeeco Inlet	LFG	20546-25	2/22/26	2:20PM	X	X	X				H2S 75 PPM
FL-2009 Inlet	LFG	-26	2/22/26	1:55PM	X	X	X				H2S 120 PPM
Hero Inlet	LFG	-27	2/22/26	2:05PM	X	X	X				H2S 160 PPM
Parnel Inlet	LFG	-28	2/22/26	2:15PM	X	X	X				H2S 160 PPM

ANALYSES REQUESTED

Relinquished by: *(Signature)*	Date	Time	Received by: *(Signature)*	Date	Time
	2/22/26	4:30PM	Eric Arias	2/23/26	8:45AM
Relinquished by: *(Signature)*	Date 2/23/26	Time 8:45	Received by: *(Signature)*	Date 2/23/26	Time 9:50
Relinquished by: *(Signature)*	Date	Time	Received for Laboratory by: *(Signature)*	Date 2/23/26	Time 9:30

Company Info:	Send Report to:	Analytical Laboratory
Company: SCS Engineers	**Company:** SCS Engineers	AtmAA Inc.
Street Address 3900 Kilroy Airport Way Suite 300	**Street Address** 3900 Kilroy Airport Way Suite 300	5107 Douglas Fir Rd.
City/State/Zip: Long Beach / CA / 90806	**City/State/Zip:** Long Beach / CA / 90806	Calabasas, CA 91302
Telephone No.: 562-743-7895 /562-335-0002	**Project Manager:** Cornelius Fong	TEL: (818) 223-3277
Fax No.:	**Email Address:** CFong@scsengineers.com	Email Address: info@atmaa.com

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Sulfide and Reduced Sulfur Compounds
Analysis in Tedlar Bag Sample by SCAQMD Method 307.91

Report Date: March 9, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon
Project No.: 07224200.24 Task 1
Date Sampled: February 23, 2026
Date Received: February 23, 2026
Date Analyzed: February 23, 2026

ANALYSIS DESCRIPTION

Total sulfur analysis measured by gas chromatography with sulfur chemiluminescence detector (SCD), SCAQMD 307.91.

AtmAA Lab No.:	20546-29	20546-30	20546-31	20546-32
Sample I.D.:	Zeeco Inlet	FL-2009 Inlet	Hero Inlet	Parnel Inlet
Components	*(Concentration in ppmv)*			
Hydrogen sulfide	80.0	151	140	165
Carbonyl sulfide	<1.00	0.72	<1.50	<1.50
Methyl mercaptan	76.8	49.5	256	262
Ethyl mercaptan	1.33	0.79	3.30	3.17
Dimethyl sulfide	249	159	684	739
Carbon disulfide	<1.00	<0.50	<1.50	<1.50
i-Propyl mercaptan	<1.00	1.53	1.83	2.24
t-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
n-Propyl mercaptan	3.20	1.80	7.74	8.34
s-Butyl mercaptan	2.44	1.99	6.29	7.15
i-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
Dimethyl disulfide	1.61	0.96	2.29	4.68
Tetrahydrothiophene	<1.00	<0.50	1.82	2.28
Unidentified sulfurs	2.35	1.80	5.17	8.62
	(Concentration in ppmv, as H_2S)			
Total Sulfur	418.3	370.0	1109.7	1206.7

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon
Date Sampled: February 23, 2026
Date Received: February 23, 2026
Date Analyzed: February 23, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Hydrogen sulfide	Zeeco Inlet	80.7	79.3	80.0	1.8
	FL-2009 Inlet	151	151	151	0.00
	Hero Inlet	136	143	140	5.0
	Parnel Inlet	164	166	165	1.2
Carbonyl sulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	0.69	0.74	0.72	7.0
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Methyl mercaptan	Zeeco Inlet	76.4	77.2	76.8	1.0
	FL-2009 Inlet	48.5	50.4	49.5	3.8
	Hero Inlet	244	267	256	9.0
	Parnel Inlet	264	259	262	1.9
Ethyl mercaptan	Zeeco Inlet	1.34	1.31	1.33	2.3
	FL-2009 Inlet	0.76	0.82	0.79	7.6
	Hero Inlet	3.14	3.46	3.30	9.7
	Parnel Inlet	3.25	3.09	3.17	5.0
Dimethyl sulfide	Zeeco Inlet	251	247	249	1.6
	FL-2009 Inlet	156	162	159	3.8
	Hero Inlet	657	711	684	7.9
	Parnel Inlet	747	731	739	2.2
Carbon disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
i-Propyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	1.49	1.57	1.53	5.2
	Hero Inlet	1.75	1.90	1.83	8.2
	Parnel Inlet	2.28	2.20	2.24	3.6
t-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
n-Propyl mercaptan	Zeeco Inlet	3.21	3.19	3.20	0.63
	FL-2009 Inlet	1.72	1.87	1.80	8.4
	Hero Inlet	7.39	8.08	7.74	8.9
	Parnel Inlet	8.48	8.20	8.34	3.4
s-Butyl mercaptan	Zeeco Inlet	2.35	2.52	2.44	7.0
	FL-2009 Inlet	1.92	2.05	1.99	6.5
	Hero Inlet	5.96	6.61	6.29	10
	Parnel Inlet	7.09	7.20	7.15	1.5
i-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Dimethyl disulfide	Zeeco Inlet	1.60	1.62	1.61	1.2
	FL-2009 Inlet	0.93	0.99	0.96	6.2
	Hero Inlet	2.18	2.39	2.29	9.2
	Parnel Inlet	4.62	4.74	4.68	2.6
Tetrahydrothiophene	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	1.68	1.95	1.82	15
	Parnel Inlet	2.47	2.08	2.28	17
Unidentified sulfurs	Zeeco Inlet	2.38	2.31	2.35	3.0
	FL-2009 Inlet	1.93	1.66	1.80	15
	Hero Inlet	4.98	5.35	5.17	7.2
	Parnel Inlet	8.81	8.43	8.62	4.4

Four Tedlar bag samples, laboratory numbers 20546-(29-32), were analyzed for total sulfur compounds. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from four Tedlar bag samples is 5.7%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Permanent Gases Analysis in Tedlar Bag Sample

Report Date: March 6, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 23, 2026
Date Analyzed: February 23, 2026

ANALYSIS DESCRIPTION

Permanent gases were measured by thermal conductivity detection/ gas chromatography (TCD/GC) ASTM D1946-90.

AtmAA Lab No.	Sample ID	Oxygen (%v)	Nitrogen (%v)	Methane (%v)	Carbon Dioxide (%v)
20546-29	Zeeco Inlet	10.82	44.53	13.57	26.05
20546-30	FL-2009 Inlet	4.56	23.43	32.18	34.93
20546-31	Hero Inlet	5.28	26.11	13.84	45.63
20546-32	Parnel Inlet	5.41	23.87	16.76	46.04

The reported oxygen concentration includes any argon present in the sample. Calibration is based on a standard atmosphere containing 20.95% oxygen and 0.93% argon. The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported. Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 23, 2026
Date Analyzed: February 23, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Oxygen	Parnel Inlet	5.40	5.41	5.41	0.19	<0.1
Nitrogen	Parnel Inlet	23.91	23.82	23.87	0.38	<0.1
Methane	Parnel Inlet	16.74	16.77	16.76	0.18	<0.1
Carbon Dioxide	Parnel Inlet	46.05	46.03	46.04	0.04	<0.1

Four Tedlar bag samples, laboratory numbers 20546-(29-32), were analyzed for permanent gases. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 4 repeat measurements from 4 Tedlar bag samples is 0.20%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Carbon Monoxide Analysis in Tedlar Bag Samples

Report Date: March 6, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 23, 2026
Date Analyzed: February 23, 2026

ANALYSIS DESCRIPTION

Carbon monoxide was measured by flame ionization detection/total combustion analysis (FID/TCA), EPA Method ALT-144.

AtmAA Lab No.	Sample ID	Carbon Monoxide (Conc. in ppmv)
20546-29	Zeeco Inlet	259
20546-30	FL-2009 Inlet	152
20546-31	Hero Inlet	635
20546-32	Parnel Inlet	690

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analysis)

Project Name: Chiquita Canyon Landfill
Date Received: February 23, 2026
Date Analyzed: February 23, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Carbon Monoxide	Parnel Inlet	696	684	690	1.7

Four Tedlar bag samples, laboratory numbers 20546-(29-32), were analyzed for carbon monoxide. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 4 Tedlar bag samples is 1.7%.

CHAIN OF CUSTODY RECORD

Client/Project Name	Project Location
SCS Engineers / Chiquita Canyon Landfill	29201 Henry Mayo Drive, Castaic, CA 91384
Project No.	**Field Logbook No.**
07224200.24 Task 1	
Sampler: *(Signature)*	**Chain of Custody Tape No.**

ANALYSES REQUESTED

Sample No./ Identification	Type of Sample	AtmAA Lab Number	Sampling Date	Sampling Time	TRS (307.91	CH4, CO2, O2 (1946)	CO (EPA alt-144)				Special Remarks
Zeeco Inlet	LFG	20546-29	2/23/26	7:20am	X	X	X				H2S 80 PPM
FL-2009 Inlet	LFG	-30	2/23/26	7:30am	X	X	X				H2S 140 PPM
Hero Inlet	LFG	-31	2/23/26	7:00am	X	X	X				H2S 190 PPM
Parnel Inlet	LFG	-32	2/23/26	7:10am	X	X	X				H2S 170 PPM

	Date	Time		Date	Time
Relinquished by: *(Signature)*	2/23/26	8:00am	**Received by:** *(Signature)*	2/23/26	8:45.
Relinquished by: *(Signature)*	2/28/26	9:50	**Received by:** *(Signature)*	Date	Time
Relinquished by: *(Signature)*	Date	Time	**Received for Laboratory by:** *(Signature)*	Date 2/23/26	Time 9:30

Company Info:

Company: SCS Engineers
Street Address 3900 Kilroy Airport Way Suite 300
City/State/Zip: Long Beach / CA / 90806
Telephone No.: 562-743-7895 /562-335-0002
Fax No.:

Send Report to:

Company: SCS Engineers
Street Address 3900 Kilroy Airport Way Suite 300
City/State/Zip: Long Beach / CA / 90806
Project Manager: Cornelius Fong
Email Address: CFong@scsengineers.com

Analytical Laboratory

AtmAA Inc.
5107 Douglas Fir Rd.
Calabasas, CA 91302
TEL: (818) 223-3277
Email Address: info@atmaa.com

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Sulfide and Reduced Sulfur Compounds
Analysis in Tedlar Bag Sample by SCAQMD Method 307.91

Report Date: March 12, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon
Project No.: 07224200.24 Task 1
Date Sampled: February 24, 2026
Date Received: February 24, 2026
Date Analyzed: February 24, 2026

ANALYSIS DESCRIPTION

Total sulfur analysis measured by gas chromatography with sulfur chemiluminescence detector (SCD), SCAQMD 307.91.

AtmAA Lab No.:	20556-1	20556-2	20556-3	20556-4
Sample I.D.:	Zeeco Inlet	FL-2009 Inlet	Hero Inlet	Parnel Inlet
Components	*(Concentration in ppmv)*			
Hydrogen sulfide	88.4	156	164	183
Carbonyl sulfide	<1.00	0.73	<1.50	<1.50
Methyl mercaptan	92.2	52.2	285	274
Ethyl mercaptan	1.60	0.79	3.76	3.52
Dimethyl sulfide	309	168	768	758
Carbon disulfide	<1.00	<0.50	<1.50	<1.50
i-Propyl mercaptan	1.12	1.70	2.41	2.34
t-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
n-Propyl mercaptan	4.08	1.95	8.99	8.84
s-Butyl mercaptan	3.20	2.34	6.94	7.35
i-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
Dimethyl disulfide	2.10	1.29	2.58	4.48
Tetrahydrothiophene	<1.00	0.52	2.00	2.15
Unidentified sulfurs	4.50	3.92	6.78	6.41
	(Concentration in ppmv, as H_2S)			
Total Sulfur	507.7	389.7	1252.5	1254.1

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon
Date Sampled: February 24, 2026
Date Received: February 24, 2026
Date Analyzed: February 24, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Hydrogen sulfide	Zeeco Inlet	93.0	83.7	88.4	11
	FL-2009 Inlet	156	155	156	0.64
	Hero Inlet	161	167	164	3.7
	Parnel Inlet	188	178	183	5.5
Carbonyl sulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	0.73	0.73	0.73	0.00
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Methyl mercaptan	Zeeco Inlet	96.9	87.5	92.2	10
	FL-2009 Inlet	52.6	51.7	52.2	1.7
	Hero Inlet	280	289	285	3.2
	Parnel Inlet	281	266	274	5.5
Ethyl mercaptan	Zeeco Inlet	1.68	1.52	1.60	10
	FL-2009 Inlet	0.84	0.74	0.79	13
	Hero Inlet	3.64	3.88	3.76	6.4
	Parnel Inlet	3.64	3.39	3.52	7.1
Dimethyl sulfide	Zeeco Inlet	319	298	309	6.8
	FL-2009 Inlet	168	167	168	0.60
	Hero Inlet	755	781	768	3.4
	Parnel Inlet	777	739	758	5.0
Carbon disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
i-Propyl mercaptan	Zeeco Inlet	1.10	1.13	1.12	2.7
	FL-2009 Inlet	1.71	1.69	1.70	1.2
	Hero Inlet	2.22	2.59	2.41	15
	Parnel Inlet	2.31	2.37	2.34	2.6
t-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
n-Propyl mercaptan	Zeeco Inlet	4.33	3.83	4.08	12
	FL-2009 Inlet	2.00	1.90	1.95	5.1
	Hero Inlet	9.04	8.94	8.99	1.1
	Parnel Inlet	8.92	8.75	8.84	1.9
s-Butyl mercaptan	Zeeco Inlet	3.37	3.02	3.20	11
	FL-2009 Inlet	2.38	2.29	2.34	3.9
	Hero Inlet	6.81	7.06	6.94	3.6
	Parnel Inlet	7.44	7.26	7.35	2.4
i-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Dimethyl disulfide	Zeeco Inlet	2.20	1.99	2.10	10
	FL-2009 Inlet	1.29	1.28	1.29	0.78
	Hero Inlet	2.57	2.59	2.58	0.78
	Parnel Inlet	4.49	4.47	4.48	0.45
Tetrahydrothiophene	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	0.58	0.46	0.52	23
	Hero Inlet	1.81	2.18	2.00	19
	Parnel Inlet	2.16	2.14	2.15	0.93
Unidentified sulfurs	Zeeco Inlet	4.89	4.11	4.50	17
	FL-2009 Inlet	4.16	3.67	3.92	13
	Hero Inlet	6.60	6.96	6.78	5.3
	Parnel Inlet	6.46	6.37	6.41	1.4

Four Tedlar bag samples, laboratory numbers 20556-(1-4), were analyzed for total sulfur compounds. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from four Tedlar bag samples is 6.2%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Permanent Gases Analysis in Tedlar Bag Sample

Report Date: March 11, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 24, 2026
Date Analyzed: February 24, 2026

ANALYSIS DESCRIPTION

Permanent gases were measured by thermal conductivity detection/ gas chromatography (TCD/GC) ASTM D1946-90.

AtmAA Lab No.	Sample ID	Oxygen (%v)	Nitrogen (%v)	Methane (%v)	Carbon Dioxide (%v)
20556-1	Zeeco Inlet	10.62	43.10	14.43	27.94
20556-2	FL-2009 Inlet	4.70	23.55	31.70	35.00
20556-3	Hero Inlet	4.93	25.30	14.16	46.35
20556-4	Parnel Inlet	5.05	22.65	16.80	47.04

The reported oxygen concentration includes any argon present in the sample. Calibration is based on a standard atmosphere containing 20.95% oxygen and 0.93% argon.
The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported.
Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 24, 2026
Date Analyzed: February 24, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Oxygen	Zeeco Inlet	10.64	10.59	10.62	0.47	<0.1
Nitrogen	Zeeco Inlet	43.07	43.13	43.10	0.14	<0.1
Methane	Zeeco Inlet	14.45	14.40	14.43	0.35	<0.1
Carbon Dioxide	Zeeco Inlet	27.92	27.96	27.94	0.14	<0.1

Four Tedlar bag samples, laboratory numbers 20556-(1-4), were analyzed for permanent gases. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 4 repeat measurements from 4 Tedlar bag samples is 0.28%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Carbon Monoxide Analysis in Tedlar Bag Samples

Report Date: March 11, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 24, 2026
Date Analyzed: February 24, 2026

ANALYSIS DESCRIPTION

Carbon monoxide was measured by flame ionization detection/total combustion analysis (FID/TCA), EPA Method ALT-144.

AtmAA Lab No.	Sample ID	Carbon Monoxide (Conc. in ppmv)
20556-1	Zeeco Inlet	328
20556-2	FL-2009 Inlet	251
20556-3	Hero Inlet	847
20556-4	Parnel Inlet	799

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analysis)

Project Name: Chiquita Canyon Landfill
Date Received: February 24, 2026
Date Analyzed: February 24, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Carbon Monoxide	Zeeco Inlet	329	327	328	0.61

Four Tedlar bag samples, laboratory numbers 20556-(1-4), were analyzed for carbon monoxide. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 4 Tedlar bag samples is 0.61%.

CHAIN OF CUSTODY RECORD

Client/Project Name	Project Location
SCS Engineers / Chiquita Canyon Landfill	29201 Henry Mayo Drive, Castaic, CA 91384
Project No.	**Field Logbook No.**
07224200.24 Task 1	
Sampler: *(Signature)*	**Chain of Custody Tape No.**

ANALYSES REQUESTED

Sample No./ Identification	Type of Sample	AtmAA Lab Number	Sampling Date	Sampling Time	TRS (307.91	CH4, CO2, O2 (1946)	CO (EPA alt-144)				Special Remarks
Zeeco Inlet	LFG	20556-1	2/24/26	06:47	X	X	X				H2S 80 PPM
FL-2009 Inlet	LFG	-2	2/24/26	06:55	X	X	X				H2S 150 PPM
Hero Inlet	LFG	-3	2/24/26	06:38	X	X	X				H2S 200 PPM
Parnel Inlet	LFG	-4	2/24/26	06:43	X	X	X				H2S 200 PPM

	Date	Time		Date	Time
Relinquished by: *(Signature)*	2/24/26	08:59	**Received by: *(Signature)***	2/24/26	8:59
Relinquished by: *(Signature)*	2/24/26	10:00	**Received by: *(Signature)***		
Relinquished by: *(Signature)*			**Received for Laboratory by: *(Signature)***	2/24/26	10:10

Company Info:		**Send Report to:**		**Analytical Laboratory**
Company:	SCS Engineers	**Company:**	SCS Engineers	**AtmAA Inc.**
Street Address	3900 Kilroy Airport Way Suite 300	**Street Address**	3900 Kilroy Airport Way Suite 300	**5107 Douglas Fir Rd.**
City/State/Zip:	Long Beach / CA / 90806	**City/State/Zip:**	Long Beach / CA / 90806	**Calabasas, CA 91302**
Telephone No.:	562-743-7895 /562-335-0002	**Project Manager:**	Cornelius Fong	**TEL: (818) 223-3277**
Fax No.:		**Email Address:**	CFong@scsengineers.com	**Email Address: info@atmaa.com**

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Sulfide and Reduced Sulfur Compounds
Analysis in Tedlar Bag Sample by SCAQMD Method 307.91

Report Date: March 12, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon
Project No.: 07224200.24 Task 1
Date Sampled: February 25, 2026
Date Received: February 25, 2026
Date Analyzed: February 25, 2026

ANALYSIS DESCRIPTION

Total sulfur analysis measured by gas chromatography with sulfur chemiluminescence detector (SCD), SCAQMD 307.91.

AtmAA Lab No.:	20566-1	20566-2	20566-3	20566-4
Sample I.D.:	Zeeco Inlet	FL-2009 Inlet	Hero Inlet	Parnel Inlet
Components	*(Concentration in ppmv)*			
Hydrogen sulfide	82.4	141	144	174
Carbonyl sulfide	<1.00	0.69	<1.50	<1.50
Methyl mercaptan	78.0	48.1	264	278
Ethyl mercaptan	1.38	0.72	3.29	3.44
Dimethyl sulfide	256	154	707	763
Carbon disulfide	<1.00	<0.50	<1.50	<1.50
i-Propyl mercaptan	0.97	1.48	1.90	2.32
t-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
n-Propyl mercaptan	3.36	1.72	7.90	8.22
s-Butyl mercaptan	2.60	2.03	6.17	6.67
i-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
Dimethyl disulfide	1.82	1.04	2.34	3.69
Tetrahydrothiophene	<1.00	<0.50	1.81	1.78
Unidentified sulfurs	3.31	1.84	4.77	7.23
	(Concentration in ppmv, as H_2S)			
Total Sulfur	431.5	352.6	1145.0	1251.5

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon
Date Sampled: February 25, 2026
Date Received: February 25, 2026
Date Analyzed: February 25, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Hydrogen sulfide	Zeeco Inlet	79.9	84.8	82.4	6.0
	FL-2009 Inlet	142	139	141	2.1
	Hero Inlet	142	146	144	2.8
	Parnel Inlet	179	169	174	5.7
Carbonyl sulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	0.70	0.67	0.69	4.4
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Methyl mercaptan	Zeeco Inlet	76.0	79.9	78.0	5.0
	FL-2009 Inlet	48.5	47.6	48.1	1.9
	Hero Inlet	255	273	264	6.8
	Parnel Inlet	284	272	278	4.3
Ethyl mercaptan	Zeeco Inlet	1.33	1.42	1.38	6.5
	FL-2009 Inlet	0.72	0.71	0.72	1.4
	Hero Inlet	3.13	3.44	3.29	9.4
	Parnel Inlet	3.55	3.32	3.44	6.7
Dimethyl sulfide	Zeeco Inlet	252	260	256	3.1
	FL-2009 Inlet	154	153	154	0.65
	Hero Inlet	690	723	707	4.7
	Parnel Inlet	780	745	763	4.6
Carbon disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
i-Propyl mercaptan	Zeeco Inlet	0.88	1.05	0.97	18
	FL-2009 Inlet	1.46	1.50	1.48	2.7
	Hero Inlet	1.87	1.92	1.90	2.6
	Parnel Inlet	2.47	2.16	2.32	13
t-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
n-Propyl mercaptan	Zeeco Inlet	3.20	3.52	3.36	10
	FL-2009 Inlet	1.75	1.69	1.72	3.5
	Hero Inlet	7.82	7.97	7.90	1.9
	Parnel Inlet	8.50	7.94	8.22	6.8
s-Butyl mercaptan	Zeeco Inlet	2.40	2.79	2.60	15
	FL-2009 Inlet	2.06	2.00	2.03	3.0
	Hero Inlet	5.98	6.35	6.17	6.0
	Parnel Inlet	6.64	6.70	6.67	0.90
i-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Dimethyl disulfide	Zeeco Inlet	1.76	1.87	1.82	6.1
	FL-2009 Inlet	1.05	1.03	1.04	1.9
	Hero Inlet	2.24	2.44	2.34	8.5
	Parnel Inlet	3.69	3.69	3.69	0.00
Tetrahydrothiophene	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	1.77	1.84	1.81	3.9
	Parnel Inlet	1.72	1.83	1.78	6.2
Unidentified sulfurs	Zeeco Inlet	3.36	3.25	3.31	3.3
	FL-2009 Inlet	1.87	1.81	1.84	3.0
	Hero Inlet	4.38	5.17	4.77	16
	Parnel Inlet	7.36	7.10	7.23	3.6

Four Tedlar bag samples, laboratory numbers 20566-(1-4), were analyzed for total sulfur compounds. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from four Tedlar bag samples is 5.4%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Permanent Gases Analysis in Tedlar Bag Sample

Report Date: March 11, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 25, 2026
Date Analyzed: February 25, 2026

ANALYSIS DESCRIPTION

Permanent gases were measured by thermal conductivity detection/ gas chromatography (TCD/GC) ASTM D1946-90.

AtmAA Lab No.	Sample ID	Oxygen (%v)	Nitrogen (%v)	Methane (%v)	Carbon Dioxide (%v)
20566-1	Zeeco Inlet	10.59	43.64	13.87	27.10
20566-2	FL-2009 Inlet	4.59	23.19	32.45	35.97
20566-3	Hero Inlet	4.57	23.98	13.49	47.50
20566-4	Parnel Inlet	4.48	20.58	16.36	48.13

The reported oxygen concentration includes any argon present in the sample. Calibration is based on a standard atmosphere containing 20.95% oxygen and 0.93% argon. The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported. Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 25, 2026
Date Analyzed: February 25, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Oxygen	Hero Inlet	4.57	4.56	4.57	0.22	<0.1
Nitrogen	Hero Inlet	23.94	24.02	23.98	0.33	<0.1
Methane	Hero Inlet	13.47	13.50	13.49	0.22	<0.1
Carbon Dioxide	Hero Inlet	47.49	47.50	47.50	0.02	<0.1

Four Tedlar bag samples, laboratory numbers 20566-(1-4), were analyzed for permanent gases. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 4 repeat measurements from 4 Tedlar bag samples is 0.20%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Carbon Monoxide Analysis in Tedlar Bag Samples

Report Date: March 11, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 25, 2026
Date Analyzed: February 25, 2026

ANALYSIS DESCRIPTION

Carbon monoxide was measured by flame ionization detection/total combustion analysis (FID/TCA), EPA Method ALT-144.

AtmAA Lab No.	Sample ID	Carbon Monoxide *(Conc. in ppmv)*
20566-1	Zeeco Inlet	266
20566-2	FL-2009 Inlet	156
20566-3	Hero Inlet	630
20566-4	Parnel Inlet	641

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analysis)

Project Name: Chiquita Canyon Landfill
Date Received: February 25, 2026
Date Analyzed: February 25, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Carbon Monoxide	Hero Inlet	636	623	630	2.1

Four Tedlar bag samples, laboratory numbers 20566-(1-4), were analyzed for carbon monoxide. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 4 Tedlar bag samples is 2.1%.

CHAIN OF CUSTODY RECORD

Client/Project Name	Project Location
SCS Engineers / Chiquita Canyon Landfill	29201 Henry Mayo Drive, Castaic, CA 91384
Project No.	**Field Logbook No.**
07224200.24 Task 1	
Sampler: *(Signature)* Victor Arroyo	**Chain of Custody Tape No.**

Sample No./ Identification	Type of Sample	AtmAA Lab Number	Sampling Date	Sampling Time	TRS (307.91	CH4, CO2, O2 (1946)	CO (EPA alt-144)				Special Remarks
Zeeco Inlet	LFG	20566-1	2/25/26	5:55AM	X	X	X				H2S 80 PPM
FL-2009 Inlet	LFG	-2	2/25/26	5:30AM	X	X	X				H2S 170 PPM
Hero Inlet	LFG	-3	2/25/26	5:40AM	X	X	X				H2S 150 PPM
Parnel Inlet	LFG	-4	2/25/26	5:50AM	X	X	X				H2S 190 PPM

Relinquished by: *(Signature)*	Date	Time	Received by: *(Signature)*	Date	Time
Victor Arroyo	2/25/26	6:50AM		2/25/26	8:30
Relinquished by: *(Signature)*	**Date**	**Time**	**Received by: *(Signature)***	**Date**	**Time**
	2/25/26	8:30	LUIS F	2/25/26	8:27
Relinquished by: *(Signature)*	**Date**	**Time**	**Received for Laboratory by: *(Signature)***	**Date**	**Time**
LUIS F	2/25/26	9:29		2/25/26	9:29

Company Info:		Send Report to:		Analytical Laboratory
Company:	SCS Engineers	**Company:**	SCS Engineers	**AtmAA Inc.**
Street Address	3900 Kilroy Airport Way Suite 300	**Street Address**	3900 Kilroy Airport Way Suite 300	**5107 Douglas Fir Rd.**
City/State/Zip:	Long Beach / CA / 90806	**City/State/Zip:**	Long Beach / CA / 90806	**Calabasas, CA 91302**
Telephone No.:	562-743-7895 /562-335-0002	**Project Manager:**	Cornelius Fong	**TEL: (818) 223-3277**
Fax No.:		**Email Address:**	CFong@scsengineers.com	**Email Address: info@atmaa.com**

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Sulfide and Reduced Sulfur Compounds
Analysis in Tedlar Bag Sample by SCAQMD Method 307.91

Report Date: March 12, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon
Project No.: 07224200.24 Task 1
Date Sampled: February 26, 2026
Date Received: February 26, 2026
Date Analyzed: February 26, 2026

ANALYSIS DESCRIPTION

Total sulfur analysis measured by gas chromatography with sulfur chemiluminescence detector (SCD), SCAQMD 307.91.

AtmAA Lab No.:	20576-22	20576-23	20576-24
Sample I.D.:	FL-2009 Inlet	Hero Inlet	Parnel Inlet
Components	*(Concentration in ppmv)*		
Hydrogen sulfide	146	164	195
Carbonyl sulfide	0.66	<1.50	<1.50
Methyl mercaptan	49.4	319	329
Ethyl mercaptan	0.76	3.77	3.87
Dimethyl sulfide	168	835	891
Carbon disulfide	<0.50	<1.50	<1.50
i-Propyl mercaptan	1.39	2.04	2.23
t-Butyl mercaptan	<0.50	<1.50	<1.50
n-Propyl mercaptan	1.85	9.08	9.62
s-Butyl mercaptan	1.93	7.13	7.69
i-Butyl mercaptan	<0.50	<1.50	<1.50
Dimethyl disulfide	1.24	2.74	5.58
Tetrahydrothiophene	<0.50	2.00	2.69
Unidentified sulfurs	1.84	5.70	9.28
	(Concentration in ppmv, as H_2S)		
Total Sulfur	373.3	1352.2	1460.5

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon
Date Sampled: February 26, 2026
Date Received: February 26, 2026
Date Analyzed: February 26, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Hydrogen sulfide	FL-2009 Inlet	148	143	146	3.4
	Hero Inlet	167	160	164	4.3
	Parnel Inlet	195	195	195	0.00
Carbonyl sulfide	FL-2009 Inlet	0.67	0.65	0.66	3.0
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Methyl mercaptan	FL-2009 Inlet	50.6	48.2	49.4	4.9
	Hero Inlet	324	314	319	3.1
	Parnel Inlet	326	331	329	1.5
Ethyl mercaptan	FL-2009 Inlet	0.78	0.73	0.76	6.6
	Hero Inlet	3.95	3.58	3.77	9.8
	Parnel Inlet	3.88	3.86	3.87	0.52
Dimethyl sulfide	FL-2009 Inlet	173	162	168	6.6
	Hero Inlet	847	822	835	3.0
	Parnel Inlet	882	899	891	1.9
Carbon disulfide	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
i-Propyl mercaptan	FL-2009 Inlet	1.43	1.34	1.39	6.5
	Hero Inlet	2.06	2.02	2.04	2.0
	Parnel Inlet	2.26	2.20	2.23	2.7
t-Butyl mercaptan	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
n-Propyl mercaptan	FL-2009 Inlet	1.84	1.85	1.85	0.54
	Hero Inlet	9.29	8.87	9.08	4.6
	Parnel Inlet	9.70	9.53	9.62	1.8
s-Butyl mercaptan	FL-2009 Inlet	2.01	1.85	1.93	8.3
	Hero Inlet	7.40	6.85	7.13	7.7
	Parnel Inlet	7.52	7.85	7.69	4.3

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
i-Butyl mercaptan	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Dimethyl disulfide	FL-2009 Inlet	1.26	1.22	1.24	3.2
	Hero Inlet	2.72	2.76	2.74	1.5
	Parnel Inlet	5.42	5.74	5.58	5.7
Tetrahydrothiophene	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	2.03	1.97	2.00	3.0
	Parnel Inlet	2.95	2.43	2.69	19
Unidentified sulfurs	FL-2009 Inlet	1.90	1.77	1.84	7.1
	Hero Inlet	5.68	5.72	5.70	0.70
	Parnel Inlet	9.67	8.89	9.28	8.4

Three Tedlar bag samples, laboratory numbers 20576-(22-24), were analyzed for total sulfur compounds. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from three Tedlar bag samples is 4.5%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Permanent Gases Analysis in Tedlar Bag Sample

Report Date: March 11, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 26, 2026
Date Analyzed: February 26, 2026

ANALYSIS DESCRIPTION

Permanent gases were measured by thermal conductivity detection/gas chromatography analysis (TCD/GC), ASTM D1946-90.

AtmAA Lab No.	Sample ID	Oxygen (%v)	Nitrogen (%v)	Methane (%v)	Carbon Dioxide (%v)
20576-22	FL-2009 Inlet	5.08	23.98	30.94	35.62
20576-23	Hero Inlet	4.72	23.06	14.26	48.84
20576-24	Parnel Inlet	4.75	20.51	17.05	49.16

The reported oxygen concentration includes any argon present in the sample. Calibration is based on a standard atmosphere containing 20.95% oxygen and 0.93% argon.
The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported.
Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 26, 2026
Date Analyzed: February 26, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Oxygen	Hero Inlet	4.72	4.71	4.72	0.21	<0.1
Nitrogen	Hero Inlet	23.10	23.01	23.06	0.39	<0.1
Methane	Hero Inlet	14.25	14.26	14.26	0.07	<0.1
Carbon Dioxide	Hero Inlet	48.87	48.81	48.84	0.12	<0.1

Three Tedlar bag samples, laboratory numbers 20576-(22-24), were analyzed for permanent gases. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 4 repeat measurements from 3 Tedlar bag samples is 0.20%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Carbon Monoxide Analysis in Tedlar Bag Samples

Report Date: March 11, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 26, 2026
Date Analyzed: February 26, 2026

ANALYSIS DESCRIPTION

Carbon monoxide was measured by flame ionization detection/total combustion analysis (FID/TCA), EPA Method ALT-144.

AtmAA Lab No.	Sample ID	Carbon Monoxide (Conc. in ppmv)
20576-22	FL-2009 Inlet	182
20576-23	Hero Inlet	806
20576-24	Parnel Inlet	741

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analysis)

Project Name: Chiquita Canyon Landfill
Date Received: February 26, 2026
Date Analyzed: February 26, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Carbon Monoxide	Hero Inlet	818	793	806	3.1

Three Tedlar bag samples, laboratory numbers 20576-(22-24), were analyzed for carbon monoxide. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 3 Tedlar bag samples is 3.1%.

CHAIN OF CUSTODY RECORD

Client/Project Name	Project Location
SCS Engineers / Chiquita Canyon Landfill	29201 Henry Mayo Drive, Castaic, CA 91384
Project No.	**Field Logbook No.**
07224200.24 Task 1	
Sampler: *(Signature)*	**Chain of Custody Tape No.**
Alberto Higuera	

Sample No./ Identification	Type of Sample	AtmAA Lab Number	Sampling Date	Sampling Time	TRS (307.91)	CH4, CO2, O2 (1946)	CO (EPA alt-144)				Special Remarks
Zeeco Inlet	LFG				X	X	X				H2S PPM
FL-2009 Inlet	LFG	20576-22	2-26-26	7:45 AM	X	X	X				H2S 140 ~~PPM~~
Hero Inlet	LFG	-23	2-26-26	7:24 AM	X	X	X				H2S 200 ~~PPM~~
Parnel Inlet	LFG	-24	2-26-26	7:36 AM	X	X	X				H2S 210 ~~PPM~~

Relinquished by: *(Signature)*	Date	Time	Received by: *(Signature)*	Date	Time
Alberto Higuera	2-26-26	8:30	Alberto Higuera	2-26-26	9:05 AM
Relinquished by: *(Signature)*	Date	Time	Received by: *(Signature)*	Date	Time
Ruben G	4/26/26	9:07	Ruben G	2/26/26	10:08
Relinquished by: *(Signature)*	Date	Time	Received for Laboratory by: *(Signature)*	Date	Time
				2/26/26	@ 10:08

Company Info:	Send Report to:	Analytical Laboratory
Company: SCS Engineers	Company: SCS Engineers	AtmAA Inc.
Street Address: 3900 Kilroy Airport Way Suite 300	Street Address: 3900 Kilroy Airport Way Suite 300	5107 Douglas Fir Rd.
City/State/Zip: Long Beach / CA / 90806	City/State/Zip: Long Beach / CA / 90806	Calabasas, CA 91302
Telephone No.: 562-743-7895 /562-335-0002	Project Manager: Cornelius Fong	TEL: (818) 223-3277
Fax No.:	Email Address: CFong@scsengineers.com	Email Address: info@atmaa.com

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Sulfide and Reduced Sulfur Compounds
Analysis in Tedlar Bag Sample by SCAQMD Method 307.91

Report Date: March 12, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Sampled: February 26, 2026
Date Received: February 27, 2026
Date Analyzed: February 27, 2026

ANALYSIS DESCRIPTION

Total sulfur analysis measured by gas chromatography with sulfur chemiluminescence detector (SCD), SCAQMD 307.91.

AtmAA Lab No.: 20586-5
Sample I.D.: Zeeco Inlet

Components	*(Concentration in ppmv)*
Hydrogen sulfide	94.1
Carbonyl sulfide	<1.00
Methyl mercaptan	110
Ethyl mercaptan	1.81
Dimethyl sulfide	341
Carbon disulfide	<1.00
i-Propyl mercaptan	1.07
t-Butyl mercaptan	<1.00
n-Propyl mercaptan	4.40
s-Butyl mercaptan	3.30
i-Butyl mercaptan	<1.00
Dimethyl disulfide	2.71
Tetrahydrothiophene	<1.00
Unidentified sulfurs	4.29
	(Concentration in ppmv, as H_2S)
Total Sulfur	564.9

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Sampled: February 26, 2026
Date Received: February 27, 2026
Date Analyzed: February 27, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Hydrogen sulfide	Zeeco Inlet	94.3	93.9	94.1	0.43
Carbonyl sulfide	Zeeco Inlet	<1.00	<1.00	---	---
Methyl mercaptan	Zeeco Inlet	111	109	110	1.8
Ethyl mercaptan	Zeeco Inlet	1.83	1.79	1.81	2.2
Dimethyl sulfide	Zeeco Inlet	349	332	341	5.0
Carbon disulfide	Zeeco Inlet	<1.00	<1.00	---	---
i-Propyl mercaptan	Zeeco Inlet	1.04	1.10	1.07	5.6
t-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
n-Propyl mercaptan	Zeeco Inlet	4.36	4.43	4.40	1.6
s-Butyl mercaptan	Zeeco Inlet	3.44	3.15	3.30	8.8
i-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
Dimethyl disulfide	Zeeco Inlet	2.76	2.65	2.71	4.1
Tetrahydrothiophene	Zeeco Inlet	<1.00	<1.00	---	---
Unidentified sulfurs	Zeeco Inlet	4.34	4.23	4.29	2.6

One Tedlar bag sample, laboratory number 20586-5, was analyzed for total sulfur compounds. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from one Tedlar bag sample is 3.6%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Permanent Gases Analysis in Tedlar Bag Sample

Report Date: March 11, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 27, 2026
Date Analyzed: February 27, 2026

ANALYSIS DESCRIPTION

Permanent gases were measured by thermal conductivity detection/ gas chromatography (TCD/GC) ASTM D1946-90.

AtmAA Lab No.	Sample ID	Oxygen (%v)	Nitrogen (%v)	Methane (%v)	Carbon Dioxide (%v)
20586-5	Zeeco Inlet	9.71	39.03	31.39	15.41

The reported oxygen concentration includes any argon present in the sample. Calibration is based on a standard atmosphere containing 20.95% oxygen and 0.93% argon. The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported. Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 27, 2026
Date Analyzed: February 27, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Oxygen	Zeeco Inlet	9.71	9.71	9.71	0.0	<0.1
Nitrogen	Zeeco Inlet	39.11	38.94	39.03	0.44	<0.1
Methane	Zeeco Inlet	31.41	31.37	31.39	0.13	<0.1
Carbon Dioxide	Zeeco Inlet	15.44	15.38	15.41	0.39	<0.1

One Tedlar bag sample, laboratory number 20586-5, was analyzed for permanent gases. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 4 repeat measurements from 1 Tedlar bag sample is 0.24%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Carbon Monoxide Analysis in Tedlar Bag Samples

Report Date: March 11, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 27, 2026
Date Analyzed: February 27, 2026

ANALYSIS DESCRIPTION

Carbon monoxide was measured by flame ionization detection/total combustion analysis (FID/TCA), EPA Method ALT-144.

AtmAA Lab No.	Sample ID	Carbon Monoxide *(Conc. in ppmv)*
20586-5	Zeeco Inlet	343

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analysis)

Project Name: Chiquita Canyon Landfill
Date Received: February 27, 2026
Date Analyzed: February 27, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Carbon Monoxide	Zeeco Inlet	341	345	343	1.2

One Tedlar bag sample, laboratory number 20586-5, was analyzed for carbon monoxide. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 1 Tedlar bag sample is 1.2%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Sulfide and Reduced Sulfur Compounds
Analysis in Tedlar Bag Sample by SCAQMD Method 307.91

Report Date: March 12, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon
Project No.: 07224200.24 Task 1
Date Sampled: February 27, 2026
Date Received: February 27, 2026
Date Analyzed: February 27, 2026

ANALYSIS DESCRIPTION

Total sulfur analysis measured by gas chromatography with sulfur chemiluminescence detector (SCD), SCAQMD 307.91.

AtmAA Lab No.:	20586-6	20586-7	20586-8	20586-9
Sample I.D.:	Zeeco Inlet	FL-2009 Inlet	Hero Inlet	Parnel Inlet
Components	*(Concentration in ppmv)*			
Hydrogen sulfide	89.3	140	126	146
Carbonyl sulfide	<1.00	0.67	<1.50	<1.50
Methyl mercaptan	101	42.7	225	227
Ethyl mercaptan	1.79	0.63	2.93	2.85
Dimethyl sulfide	310	132	599	672
Carbon disulfide	<1.00	<0.50	<1.50	<1.50
i-Propyl mercaptan	1.12	1.28	1.66	1.64
t-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
n-Propyl mercaptan	3.78	1.39	7.04	6.79
s-Butyl mercaptan	3.01	1.61	5.94	5.48
i-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
Dimethyl disulfide	2.11	0.86	2.04	4.40
Tetrahydrothiophene	<1.00	<0.50	1.78	1.42
Unidentified sulfurs	3.73	1.59	5.28	4.31
	(Concentration in ppmv, as H_2S)			
Total Sulfur	517.4	323.0	977.7	1075.8

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon
Date Sampled: February 27, 2026
Date Received: February 27, 2026
Date Analyzed: February 27, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Hydrogen sulfide	Zeeco Inlet	92.6	85.9	89.3	7.5
	FL-2009 Inlet	141	138	140	2.2
	Hero Inlet	130	122	126	6.3
	Parnel Inlet	140	152	146	8.2
Carbonyl sulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	0.68	0.66	0.67	3.0
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Methyl mercaptan	Zeeco Inlet	105	96	101	8.9
	FL-2009 Inlet	43.5	41.8	42.7	4.0
	Hero Inlet	225	224	225	0.45
	Parnel Inlet	212	241	227	13
Ethyl mercaptan	Zeeco Inlet	1.93	1.65	1.79	16
	FL-2009 Inlet	0.63	0.63	0.63	0.00
	Hero Inlet	2.80	3.06	2.93	8.9
	Parnel Inlet	2.71	2.98	2.85	9.5
Dimethyl sulfide	Zeeco Inlet	320	300	310	6.5
	FL-2009 Inlet	134	130	132	3.0
	Hero Inlet	610	587	599	3.8
	Parnel Inlet	640	704	672	9.5
Carbon disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
i-Propyl mercaptan	Zeeco Inlet	1.12	1.11	1.12	0.90
	FL-2009 Inlet	1.32	1.23	1.28	7.1
	Hero Inlet	1.76	1.56	1.66	12
	Parnel Inlet	1.50	1.78	1.64	17
t-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
n-Propyl mercaptan	Zeeco Inlet	3.81	3.74	3.78	1.9
	FL-2009 Inlet	1.42	1.36	1.39	4.3
	Hero Inlet	6.96	7.11	7.04	2.1
	Parnel Inlet	6.33	7.24	6.79	13
s-Butyl mercaptan	Zeeco Inlet	3.16	2.85	3.01	10
	FL-2009 Inlet	1.62	1.60	1.61	1.2
	Hero Inlet	5.86	6.01	5.94	2.5
	Parnel Inlet	5.25	5.70	5.48	8.2
i-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Dimethyl disulfide	Zeeco Inlet	2.16	2.05	2.11	5.2
	FL-2009 Inlet	0.85	0.86	0.86	1.2
	Hero Inlet	2.02	2.06	2.04	2.0
	Parnel Inlet	4.28	4.51	4.40	5.2
Tetrahydrothiophene	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	1.81	1.74	1.78	3.9
	Parnel Inlet	1.34	1.50	1.42	11
Unidentified sulfurs	Zeeco Inlet	4.02	3.44	3.73	16
	FL-2009 Inlet	1.50	1.68	1.59	11
	Hero Inlet	5.58	4.97	5.28	12
	Parnel Inlet	4.24	4.38	4.31	3.2

Four Tedlar bag samples, laboratory numbers 20586-(6-9), were analyzed for total sulfur compounds. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from four Tedlar bag samples is 6.7%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Permanent Gases Analysis in Tedlar Bag Sample

Report Date: March 11, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 27, 2026
Date Analyzed: February 27, 2026

ANALYSIS DESCRIPTION

Permanent gases were measured by thermal conductivity detection/ gas chromatography (TCD/GC) ASTM D1946-90.

AtmAA Lab No.	Sample ID	Oxygen (%v)	Nitrogen (%v)	Methane (%v)	Carbon Dioxide (%v)
20586-6	Zeeco Inlet	10.39	41.35	29.91	14.53
20586-7	FL-2009 Inlet	4.97	23.74	35.50	31.75
20586-8	Hero Inlet	5.30	26.45	46.26	13.68
20586-9	Parnel Inlet	5.75	24.08	46.19	16.03

The reported oxygen concentration includes any argon present in the sample. Calibration is based on a standard atmosphere containing 20.95% oxygen and 0.93% argon.
The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported.
Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 27, 2026
Date Analyzed: February 27, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Oxygen	Zeeco Inlet	10.36	10.41	10.39	0.48	<0.1
Nitrogen	Zeeco Inlet	41.30	41.40	41.35	0.24	<0.1
Methane	Zeeco Inlet	29.91	29.90	29.91	0.03	<0.1
Carbon Dioxide	Zeeco Inlet	14.55	14.51	14.53	0.28	<0.1

Four Tedlar bag samples, laboratory numbers 20586-(6-9), were analyzed for permanent gases. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 4 repeat measurements from 4 Tedlar bag samples is 0.26%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Carbon Monoxide Analysis in Tedlar Bag Samples

Report Date: March 11, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 27, 2026
Date Analyzed: February 27, 2026

ANALYSIS DESCRIPTION

Carbon monoxide was measured by flame ionization detection/total combustion analysis (FID/TCA), EPA Method ALT-144.

AtmAA Lab No.	Sample ID	Carbon Monoxide *(Conc. in ppmv)*
20586-6	Zeeco Inlet	318
20586-7	FL-2009 Inlet	170
20586-8	Hero Inlet	707
20586-9	Parnel Inlet	757

Michael S. Porter
Senior Analyst

CHAIN OF CUSTODY RECORD

Client/Project Name	Project Location
SCS Engineers / Chiquita Canyon Landfill	29201 Henry Mayo Drive, Castaic, CA 91384
Project No.	**Field Logbook No.**
07224200.24 Task 1	
Sampler: *(Signature)*	**Chain of Custody Tape No.**
[signature]	

Sample No./ Identification	Type of Sample	AtmAA Lab Number	Sampling Date	Sampling Time	TRS (307.91)	CH4, CO2, O2 (1946)	CO (EPA alt-144)				Special Remarks
Zeeco Inlet	LFG	20586-6	2-27-26	7:20 AM	X	X	X				H2S 90 PPM
FL-2009 Inlet	LFG	-7	2-27-26	7:35 AM	X	X	X				H2S 135 PPM
Hero Inlet	LFG	-8	2-27-26	7:15 AM	X	X	X				H2S 150 PPM
Parnel Inlet	LFG	-9	2-27-26	7:25 AM	X	X	X				H2S 150 PPM
Zeeco Inlet	LFG	20586-5	2-26-26	2:30 PM							H2S 75 PPM

Relinquished by: *(Signature)*	Date	Time	Received by: *(Signature)*	Date	Time
[signature]	2/27/26	08:08	[signature]	2/27/26	08:08
Relinquished by: *(Signature)*	Date	Time	Received by: *(Signature)*	Date	Time
[signature]	2/27/26	8:44	[signature]	2/27/26	8:45
Relinquished by: *(Signature)*	Date	Time	Received for Laboratory by: *(Signature)*	Date	Time
[signature]	2/27/26	9:55	[signature]	2/27/26	9:55

Company Info:	Send Report to:	Analytical Laboratory
Company: SCS Engineers	Company: SCS Engineers	AtmAA Inc.
Street Address: 3900 Kilroy Airport Way Suite 300	Street Address: 3900 Kilroy Airport Way Suite 300	5107 Douglas Fir Rd.
City/State/Zip: Long Beach / CA / 90806	City/State/Zip: Long Beach / CA / 90806	Calabasas, CA 91302
Telephone No.: 562-743-7895 /562-335-0002	Project Manager: Cornelius Fong	TEL: (818) 223-3277
Fax No.:	Email Address: CFong@scsengineers.com	Email Address: info@atmaa.com

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Hydrogen Sulfide and Reduced Sulfur Compounds
Analysis in Tedlar Bag Sample by SCAQMD Method 307.91

Report Date: March 12, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon
Project No.: 07224200.24 Task 1
Date Sampled: February 28, 2026
Date Received: February 28, 2026
Date Analyzed: February 28, 2026

ANALYSIS DESCRIPTION

Total sulfur analysis measured by gas chromatography with sulfur chemiluminescence detector (SCD), SCAQMD 307.91.

AtmAA Lab No.:	20596-1	20596-2	20596-3	20596-4
Sample I.D.:	Zeeco Inlet	FL-2009 Inlet	Hero Inlet	Parnel Inlet
Components	*(Concentration in ppmv)*			
Hydrogen sulfide	93.5	133	134	167
Carbonyl sulfide	<1.00	0.63	<1.50	<1.50
Methyl mercaptan	106	38.0	267	282
Ethyl mercaptan	1.55	0.59	3.45	3.52
Dimethyl sulfide	327	123	727	852
Carbon disulfide	<1.00	<0.50	<1.50	<1.50
i-Propyl mercaptan	1.20	1.26	1.93	2.10
t-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
n-Propyl mercaptan	3.93	1.27	8.52	9.64
s-Butyl mercaptan	3.60	1.65	7.10	7.92
i-Butyl mercaptan	<1.00	<0.50	<1.50	<1.50
Dimethyl disulfide	1.76	0.79	2.34	5.41
Tetrahydrothiophene	<1.00	<0.50	2.49	3.12
Unidentified sulfurs	3.37	1.44	7.65	9.79
	(Concentration in ppmv, as H_2S)			
Total Sulfur	543.1	301.8	1162.3	1346.4

Brian W. Fung
Laboratory Director

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon
Date Sampled: February 28, 2026
Date Received: February 28, 2026
Date Analyzed: February 28, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Hydrogen sulfide	Zeeco Inlet	96.1	90.8	93.5	5.7
	FL-2009 Inlet	129	137	133	6.0
	Hero Inlet	135	132	134	2.2
	Parnel Inlet	169	164	167	3.0
Carbonyl sulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	0.62	0.63	0.63	1.6
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Methyl mercaptan	Zeeco Inlet	109	102	106	6.6
	FL-2009 Inlet	37.1	38.8	38.0	4.5
	Hero Inlet	266	267	267	0.38
	Parnel Inlet	288	275	282	4.6
Ethyl mercaptan	Zeeco Inlet	1.54	1.56	1.55	1.3
	FL-2009 Inlet	0.60	0.57	0.59	5.1
	Hero Inlet	3.41	3.49	3.45	2.3
	Parnel Inlet	3.48	3.56	3.52	2.3
Dimethyl sulfide	Zeeco Inlet	333	321	327	3.7
	FL-2009 Inlet	120	125	123	4.1
	Hero Inlet	720	733	727	1.8
	Parnel Inlet	856	847	852	1.1
Carbon disulfide	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
i-Propyl mercaptan	Zeeco Inlet	1.15	1.24	1.20	7.5
	FL-2009 Inlet	1.24	1.27	1.26	2.4
	Hero Inlet	1.94	1.92	1.93	1.0
	Parnel Inlet	2.16	2.04	2.10	5.7
t-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)
(continued)

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
n-Propyl mercaptan	Zeeco Inlet	3.98	3.87	3.93	2.8
	FL-2009 Inlet	1.34	1.20	1.27	11
	Hero Inlet	8.57	8.47	8.52	1.2
	Parnel Inlet	9.72	9.56	9.64	1.7
s-Butyl mercaptan	Zeeco Inlet	3.74	3.45	3.60	8.1
	FL-2009 Inlet	1.60	1.69	1.65	5.5
	Hero Inlet	7.01	7.18	7.10	2.4
	Parnel Inlet	8.13	7.71	7.92	5.3
i-Butyl mercaptan	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	<1.50	<1.50	---	---
	Parnel Inlet	<1.50	<1.50	---	---
Dimethyl disulfide	Zeeco Inlet	1.83	1.68	1.76	8.5
	FL-2009 Inlet	0.78	0.80	0.79	2.5
	Hero Inlet	2.22	2.46	2.34	10
	Parnel Inlet	5.66	5.15	5.41	9.4
Tetrahydrothiophene	Zeeco Inlet	<1.00	<1.00	---	---
	FL-2009 Inlet	<0.50	<0.50	---	---
	Hero Inlet	2.49	2.49	2.49	0.00
	Parnel Inlet	3.53	2.71	3.12	26
Unidentified sulfurs	Zeeco Inlet	3.55	3.18	3.37	11
	FL-2009 Inlet	1.41	1.46	1.44	3.5
	Hero Inlet	7.67	7.63	7.65	0.50
	Parnel Inlet	10.4	9.17	9.79	13

Four Tedlar bag samples, laboratory numbers 20596-(1-4), were analyzed for total sulfur compounds. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD from four Tedlar bag samples is 5.0%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Permanent Gases Analysis in Tedlar Bag Sample

Report Date: March 11, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 28, 2026
Date Analyzed: March 2, 2026

ANALYSIS DESCRIPTION

Permanent gases were measured by thermal conductivity detection/ gas chromatography (TCD/GC) ASTM D1946-90.

AtmAA Lab No.	Sample ID	Oxygen (%v)	Nitrogen (%v)	Methane (%v)	Carbon Dioxide (%v)
20596-1	Zeeco Inlet	9.26	38.18	15.78	31.69
20596-2	FL-2009 Inlet	5.10	25.41	30.96	33.34
20596-3	Hero Inlet	6.01	29.84	12.22	43.46
20596-4	Parnel Inlet	6.35	26.64	14.79	43.91

The reported oxygen concentration includes any argon present in the sample. Calibration is based on a standard atmosphere containing 20.95% oxygen and 0.93% argon.
The accuracy of permanent gas analysis by TCD/GC is +/- 2%, actual results are reported.
Actual analysis results are reported on a "wet" basis.

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analyses)

Project Name: Chiquita Canyon Landfill
Date Received: February 28, 2026
Date Analyzed: March 2, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD	MRL %,v
		(Concentration in %,v)				
Oxygen	Zeeco Inlet	9.26	9.25	9.26	0.11	<0.1
Nitrogen	Zeeco Inlet	38.15	38.20	38.18	0.13	<0.1
Methane	Zeeco Inlet	15.75	15.80	15.78	0.32	<0.1
Carbon Dioxide	Zeeco Inlet	31.71	31.66	31.69	0.16	<0.1

Four Tedlar bag samples, laboratory numbers 20596-(1-4), were analyzed for permanent gases. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 4 repeat measurements from 4 Tedlar bag samples is 0.18%.

AtmAA Inc.
5107 Douglas Fir Rd., Calabasas, CA 91302 • (818) 223-3277
specialized air assessment laboratory
atmaa.com

LABORATORY ANALYSIS REPORT

Carbon Monoxide Analysis in Tedlar Bag Samples

Report Date: March 11, 2026
Client: SCS Engineers
Project Name: Chiquita Canyon Landfill
Project No.: 07224200.24 Task 1
Date Received: February 28, 2026
Date Analyzed: March 2, 2026

ANALYSIS DESCRIPTION

Carbon monoxide was measured by flame ionization detection/total combustion analysis (FID/TCA), EPA Method ALT-144.

AtmAA Lab No.	Sample ID	Carbon Monoxide (Conc. in ppmv)
20596-1	Zeeco Inlet	421
20596-2	FL-2009 Inlet	170
20596-3	Hero Inlet	707
20596-4	Parnel Inlet	831

Michael S. Porter
Senior Analyst

QUALITY ASSURANCE SUMMARY
(Repeat Analysis)

Project Name: Chiquita Canyon Landfill
Date Received: February 28, 2026
Date Analyzed: March 2, 2026

Components	Sample ID	Repeat Analysis Run #1	Repeat Analysis Run #2	Mean Conc.	% RPD
		(Concentration in ppmv)			
Carbon Monoxide	Zeeco Inlet	422	419	421	0.71

Four Tedlar bag samples, laboratory numbers 20596-(1-4), were analyzed for carbon monoxide. Agreement between repeat analyses is a measure of precision and is shown above in the column "% RPD". The average % RPD for 1 repeat measurement from 4 Tedlar bag samples is 0.71%.

CHAIN OF CUSTODY RECORD

Client/Project Name	Project Location
SCS Engineers / Chiquita Canyon Landfill	29201 Henry Mayo Drive, Castaic, CA 91384
Project No.	**Field Logbook No.**
07224200.24 Task 1	
Sampler: *(Signature)*	**Chain of Custody Tape No.**
tWilliams	

Sample No./ Identification	Type of Sample	AtmAA Lab Number	Sampling Date	Sampling Time	TRS (307.91)	CH4, CO2, O2 (1946)	CO (EPA alt-144)				Special Remarks
Zeeco Inlet	LFG	20596-1	2-28-26	7:20 AM	X	X	X				H2S 110 PPM
FL-2009 Inlet	LFG	-2	2-28-26	7:35 AM	X	X	X				H2S 130 PPM
Hero Inlet	LFG	-3	2-28-26	7:15 AM	X	X	X				H2S 140 PPM
Parnel Inlet	LFG	-4	2-28-26	7:23 AM	X	X	X				H2S 140 PPM

ANALYSES REQUESTED

Relinquished by: *(Signature)*	Date	Time	Received by: *(Signature)*	Date	Time
tWilliams	2-28-26	9:01 AM	LUIS F	2/28/26	9:00
Relinquished by: *(Signature)*	Date	Time	Received by: *(Signature)*	Date	Time
LUIS F	2/28/26	9:55			
Relinquished by: *(Signature)*	Date	Time	Received for Laboratory by: *(Signature)*	Date	Time
			BFong	2/28/26	9:55

Company Info:		Send Report to:		Analytical Laboratory
Company:	SCS Engineers	Company:	SCS Engineers	AtmAA Inc.
Street Address	3900 Kilroy Airport Way Suite 300	Street Address	3900 Kilroy Airport Way Suite 300	5107 Douglas Fir Rd.
City/State/Zip:	Long Beach / CA / 90806	City/State/Zip:	Long Beach / CA / 90806	Calabasas, CA 91302
Telephone No.:	562-743-7895 /562-335-0002	Project Manager:	Cornelius Fong	TEL: (818) 223-3277
Fax No.:		Email Address:	CFong@scsengineers.com	Email Address: info@atmaa.com

Attachment B

Calculations

Chiquita Canyon Landfill
Total Emissions
Monthly Report Period: February 2026

	Flare No. 1 John Zink (FL-150) (FL-1995)				Flare No. 2 John Zink (Zule) (FL-100) (FL-2009)				Flare No. 3 John Zink (Zule) (FL-2023)				Zeeco Thermal Oxidizer (TOx)				Parnel Vapor Combustor				Hero Vapor Combustor	All Control Devices (Flare No. 1, Flare No. 2, Flare No. 3, Zeeco, Parnel, Hero)			Lab Analysis Total Reduced Sulfur (TRS) as H2S (ppmv)
Date	Total LFG Combusted (scf/day)	Runtime (hr)	Flow Rate (scfm)	Flow Rate (scf/hr)	Total LFG Combusted (scf/day)	Runtime (hr)	Flow Rate (scfm)	Flow Rate (scf/hr)	Total LFG Combusted (scf/day)	Runtime (hr)	Flow Rate (scfm)	Flow Rate (scf/hr)	Total LFG Combusted (scf/day)	Runtime (hr)	Flow Rate (scfm)	Flow Rate (scf/hr)	Total LFG Combusted (scf/day)	Runtime (hr)	Flow Rate (scfm)	Flow Rate (scf/hr)	Total LFG Combusted (scf/day)	Total LFG Combusted (scf/day)	Total Flow Rate (scfm)	Total Flow Rate (scf/hr)	
2/1/2026	4,119,750	24.00	2,861	171,656	1,728,794	10.15	1,201	72,033	7,427,439	24.00	5,158	309,477	3,527,045	23.98	2,449	146,960	2,449,418	24.00	1,701	102,059	2,686,071	21,938,516	15,235	914,105	532
2/2/2026	3,641,127	24.00	2,529	151,714	2,176,437	12.65	1,511	90,685	6,893,041	22.87	4,787	287,210	3,569,928	24.00	2,479	148,747	1,537,030	24.00	1,067	64,043	2,708,484	20,526,046	14,254	855,252	472
2/3/2026	3,786,284	24.00	2,629	157,762	2,564,274	14.17	1,781	106,845	6,521,285	23.50	4,529	271,720	3,577,986	24.00	2,485	149,083	1,254,730	23.97	871	52,280	2,707,130	20,411,687	14,175	850,487	522
2/4/2026	4,397,975	24.00	3,054	183,249	2,501,269	13.47	1,737	104,220	7,139,344	24.00	4,958	297,473	3,541,487	24.00	2,459	147,562	1,140,658	24.00	792	47,527	2,670,794	21,391,526	14,855	891,314	479
2/5/2026	3,981,197	22.68	2,765	165,883	2,413,299	13.95	1,676	100,554	6,766,887	23.55	4,699	281,954	3,570,894	24.00	2,480	148,787	1,464,428	24.00	1,017	61,018	2,693,855	20,890,559	14,507	870,440	445
2/6/2026	4,244,266	24.00	2,947	176,844	2,357,699	13.97	1,637	98,237	6,894,556	24.00	4,788	287,273	3,557,150	24.00	2,470	148,215	1,824,366	24.00	1,267	76,015	2,697,001	21,575,037	14,983	898,960	477
2/7/2026	4,682,329	24.00	3,252	195,097	1,279,644	7.48	889	53,319	7,370,072	24.00	5,118	307,086	3,567,985	24.00	2,478	148,666	1,849,315	23.98	1,284	77,055	2,723,502	21,472,847	14,912	894,702	511
2/8/2026	5,028,040	24.00	3,492	209,502	0	0.00	0	0	7,765,676	24.00	5,393	323,570	3,574,630	24.00	2,482	148,943	1,199,583	17.15	833	49,983	2,728,061	20,295,990	14,094	845,666	491
2/9/2026	4,450,822	24.00	3,091	185,451	2,170,132	12.10	1,507	90,422	7,195,049	24.00	4,997	299,794	3,532,622	24.00	2,453	147,193	1,329,024	16.92	923	55,376	2,066,220	20,743,868	14,405	864,328	511
2/10/2026	3,627,702	21.92	2,519	151,154	2,515,862	13.38	1,747	104,828	7,029,165	24.00	4,881	292,882	3,433,579	24.00	2,384	143,066	1,786,339	24.00	1,241	74,431	2,087,634	20,480,280	14,222	853,345	630
2/11/2026	3,433,972	23.97	2,385	143,082	4,389,544	22.98	3,048	182,898	6,962,832	24.00	4,835	290,118	3,189,511	24.00	2,215	132,896	1,702,159	24.00	1,182	70,923	2,541,122	22,219,139	15,430	925,797	533
2/12/2026	3,428,856	24.00	2,381	142,869	4,565,608	24.00	3,171	190,234	7,062,725	24.00	4,905	294,280	3,052,565	24.00	2,120	127,190	1,713,026	24.00	1,190	71,376	2,538,699	22,361,478	15,529	931,728	457
2/13/2026	3,244,885	24.00	2,253	135,204	4,297,400	24.00	2,984	179,058	6,840,324	24.00	4,750	285,013	3,077,641	24.00	2,137	128,235	1,718,719	24.00	1,194	71,613	2,587,359	21,766,327	15,116	906,930	464
2/14/2026	3,386,487	24.00	2,352	141,104	4,510,372	24.00	3,132	187,932	7,312,486	24.00	5,078	304,687	3,045,319	24.00	2,115	126,888	1,697,989	24.00	1,179	70,750	2,573,276	22,525,929	15,643	938,580	431
2/15/2026	3,347,584	24.00	2,325	139,483	4,486,656	24.00	3,116	186,944	7,213,628	24.00	5,009	300,568	3,064,827	24.00	2,128	127,701	1,682,640	24.00	1,169	70,110	2,521,940	22,317,274	15,498	929,886	443
2/16/2026	3,209,214	24.00	2,229	133,717	4,393,276	24.00	3,051	183,053	7,247,471	24.00	5,033	301,978	3,088,987	24.00	2,145	128,708	1,639,393	24.00	1,138	68,308	2,306,512	21,884,852	15,198	911,869	392
2/17/2026	3,190,064	24.00	2,215	132,919	4,375,527	24.00	3,039	182,314	7,312,625	24.00	5,078	304,693	3,074,646	24.00	2,135	128,110	1,621,511	23.98	1,126	67,563	2,460,888	22,035,261	15,302	918,136	414
2/18/2026	3,233,247	24.00	2,245	134,719	4,405,712	24.00	3,060	183,571	7,415,945	24.00	5,150	308,998	3,071,835	24.00	2,133	127,993	981,840	23.07	682	40,910	2,528,601	21,637,179	15,026	901,549	472
2/19/2026	3,171,549	24.00	2,202	132,148	4,355,917	24.00	3,025	181,497	7,319,814	24.00	5,083	304,992	3,070,641	24.00	2,132	127,943	1,585,768	24.00	1,101	66,074	2,530,596	22,034,284	15,302	918,095	423
2/20/2026	3,186,084	24.00	2,213	132,754	4,360,163	24.00	3,028	181,673	7,270,973	24.00	5,049	302,957	3,039,201	24.00	2,111	126,633	1,523,314	24.00	1,058	63,471	2,503,907	21,883,641	15,197	911,818	364
2/21/2026	3,186,705	24.00	2,213	132,779	4,353,857	24.00	3,024	181,411	7,298,082	24.00	5,068	304,087	3,051,344	24.00	2,119	127,139	1,566,138	24.00	1,088	65,256	2,539,196	21,995,322	15,275	916,472	411
2/22/2026	3,233,556	24.00	2,246	134,732	4,370,733	24.00	3,035	182,114	7,324,899	24.00	5,087	305,204	3,054,272	24.00	2,121	127,261	1,565,612	24.00	1,087	65,234	2,550,778	22,099,850	15,347	920,827	425
2/23/2026	3,203,765	23.33	2,225	133,490	4,141,741	22.70	2,876	172,573	6,833,672	22.42	4,746	284,736	3,066,336	24.00	2,129	127,764	1,588,284	24.00	1,103	66,179	2,560,288	21,394,085	14,857	891,420	370
2/24/2026	3,518,431	24.00	2,443	146,601	4,552,122	24.00	3,161	189,672	7,537,645	24.00	5,234	314,069	3,027,988	24.00	2,103	126,166	1,450,328	23.60	1,007	60,430	2,513,407	22,599,920	15,694	941,663	390
2/25/2026	3,590,050	24.00	2,493	149,585	4,658,311	24.00	3,235	194,096	7,696,832	24.00	5,345	320,701	906,238	7.20	629	37,760	1,668,524	24.00	1,159	69,522	2,523,894	21,043,848	14,614	876,827	353
2/26/2026	3,556,182	24.00	2,470	148,174	4,621,738	24.00	3,210	192,572	7,699,427	24.00	5,347	320,809	1,931,663	13.87	1,341	80,486	1,845,798	24.00	1,282	76,908	2,495,855	22,150,662	15,382	922,944	373
2/27/2026	3,531,960	24.00	2,453	147,165	4,528,624	24.00	3,145	188,693	7,613,509	24.00	5,287	317,230	3,419,255	24.00	2,374	142,469	1,783,630	24.00	1,239	74,318	2,399,561	23,276,538	16,164	969,856	323
2/28/2026	3,515,090	24.00	2,441	146,462	4,486,291	23.98	3,115	186,929	7,606,711	24.00	5,282	316,946	3,470,777	24.00	418	144,616	1,751,167	23.98	1,216	72,965	2,401,117	23,231,153	16,133	967,965	302

*Flare Flow and Runtime from chart recorder data. Ameresco's variance was approved on February 15, 2023 and Ameresco began operations on February 16, 2023.

*Date of lab data based on date sampled.

Chiquita Canyon Landfill
LFG Not Combusted
Monthly Report Period: February 2026

Date	Flare 1, 2, 3, Zeeco, Parnel, Hero Total Flow Rate (scf/day)	2024 Baseline Flow Rate (scf/day)	LFG Not Combusted (scf/day)[1]	Ameresco LFG Processed (scf/day)[2]	LFG Not Combusted (scfm)
2/1/2026	21,938,516	--	--	0	--
2/2/2026	20,526,046	--	--	0	--
2/3/2026	20,411,687	--	--	0	
2/4/2026	21,391,526	--	--	0	--
2/5/2026	20,890,559	--	--	0	--
2/6/2026	21,575,037	--	--	0	--
2/7/2026	21,472,847	--	--	0	--
2/8/2026	20,295,990	--	--	0	--
2/9/2026	20,743,868	--	--	0	--
2/10/2026	20,480,280	--	--	0	--
2/11/2026	22,219,139	--	--	0	--
2/12/2026	22,361,478	--	--	0	--
2/13/2026	21,766,327	--	--	0	--
2/14/2026	22,525,929	--	--	0	--
2/15/2026	22,317,274	--	--	0	--
2/16/2026	21,884,852	--	--	0	--
2/17/2026	22,035,261	--	--	0	--
2/18/2026	21,637,179	--	--	0	--
2/19/2026	22,034,284	--	--	0	--
2/20/2026	21,883,641	--	--	0	--
2/21/2026	21,995,322	--	--	0	--
2/22/2026	22,099,850	--	--	0	--
2/23/2026	21,394,085	--	--	0	--
2/24/2026	22,599,920	--	--	0	--
2/25/2026	21,043,848	--	--	0	--
2/26/2026	22,150,662	--	--	0	--
2/27/2026	23,276,538	--	--	0	--
2/28/2026	23,231,153	--	--	0	--
Total/Average					

[1]Total LFG not combusted is calculated based on the difference from modeled flow rate from all control devices in 2024 (baseline) and flow rate from Flares 1, 2, 3, and the Zeeco & Parnel Thermal Oxidizers during the reporting period. Ameresco applied for variance to operate the LFG turbine plant under a variance order, and their variance was approved on February 15, 2023. Ameresco restarted operations on February 16, 2023, returning LFG collection and control system at CCL to full capacity. Therefore, the daily flow of LFG not flared per Section B ended on February 17, 2023, except for periods when the Ameresco Plant and/or the Flares are offline or processing less LFG for other reasons.

[2]Actual Ameresco LFG flow rate after restarting operations are greater than the unflared amount while Ameresco was off-line.

*Flare Flow and Runtime from chart recorder data.

*Date of lab data based on date sampled.

2024 Baseline Flow Rate					
Devices	**Gas Recovery (scf)**	**Flow Rate (scf/day)**	**Flow Rate (scfm)**	**LandGEM Generation (scfm)**	**% Change**
2022	4,351,276,471	11,921,305	8,279	12,800	
2023	5,373,366,012	14,721,551	10,223	13,400	4.69%
2024	5,613,964,490	**15,380,725**	10,681	14,000	4.48%

*Flare flow from chart recorder data. LFGTE Facility flow from Ameresco.

Attachment C-1

Surface Emissions Monitoring

2026 Chiquita Surface Emissions Exceedance

Integrated (Monthly)

Grid	Flag	Location Description	Latitude	Longitude	Initial Date	Initial Time	Initial Exceedance >25 (PPM)	10-Day Corrective Action Date	10-Day Corrective Action	First Remonitoring Date (10-days)	PPM	2nd 10-Day Corrective Action Date	2nd 10-Day Corrective Action	Second Remonitoring Date (10-days)	PPM	Monthly Corrective Action Date	Monthly Corrective Action	Monthly Remonitoring Date	PPM	45-Day Corrective Action Deadline	45-Day Corrective Action Date	45-Day Corrective Action	45-Day Corrective Action Date / Remonitoring Date	PPM
155					1/6/26		55.77	1/8/26	Cover Compaction	1/14/26	23.7													
210					1/7/26		77.42	1/8/26	Flow Increase	1/14/26	19.7													
215					1/7/26		69.91	1/8/26	Cover Compaction; Flow Increase	1/14/26	17.8													
242					1/13/26		30.25	1/15/26	Flow Increase	1/20/26	22.11													
93					1/14/26		47.34	1/15/26	Flow Increase	1/20/26	16.19													
252					1/14/26		49.50	1/15/26	Flow Increase	1/20/26	19.34													
237					1/14/26		27.40	1/15/26	Flow Increase	1/20/26	11.7													
95					1/14/26		72.84	1/15/26	Flow Increase	1/20/26	13.93													
98					1/14/26		51.70	1/15/26	Flow Increase	1/20/26	17.89													
104					1/14/26		58.42	1/15/26	Flow Increase	1/20/26	23.41													
185					1/19/26		114.00	1/22/26	Flow Increase	1/28/26	21.6													
179					1/19/26		111.20	1/22/26	Flow Increase	1/28/26	17.1													
177					1/19/26		49.50	1/22/26	Flow Increase	1/28/26	23.67													
156					1/19/26		70.96	1/22/26	Flow Increase	1/28/26	10.3													
157					1/19/26		49.20	1/22/26	Flow Increase	1/28/26	17.2													
172					1/19/26		105.00	1/22/26	Flow Increase	1/28/26	19.5													
173					1/19/26		50.10	1/22/26	Flow Increase	1/28/26	21.16													
53					1/19/26		35.10	1/22/26	Flow Increase	1/28/26	18.6													
148					1/19/26		64.60	1/22/26	Flow Increase	1/28/26	22.84													
171					1/19/26		27.50	1/22/26	Flow Increase	1/28/26	20.5													
187					1/19/26		25.52	1/22/26	Flow Increase	1/28/26	16.2													
188					1/19/26		77.95	1/22/26	Flow Increase	1/28/26	17.7													
186					1/19/26		91.67	1/22/26	Flow Increase	1/28/26	18.3													
193					1/19/26		91.02	1/22/26	Flow Increase	1/28/26	15.9													
170					1/19/26		64.70	1/22/26	Flow Increase	1/28/26	10.4													
169					1/19/26		88.90	1/22/26	Flow Increase	1/28/26	19.5													
174					1/19/26		61.73	1/22/26	Flow Increase	1/28/26	15.3													
202					1/19/26		99.07	1/22/26	Flow Increase	1/28/26	22.16													
205					1/19/26		27.63	1/22/26	Flow Increase	1/28/26	16.18													
79					1/19/26		26.56	1/22/26	Flow Increase	1/28/26	20.35													
176					1/19/26		43.20	1/22/26	Flow Increase	1/28/26	24.41													
175					1/19/26		51.60	1/22/26	Flow Increase	1/28/26	22.37													
181					1/19/26		59.40	1/22/26	Flow Increase	1/28/26	20.87													
200					1/19/26		39.70	1/22/26	Flow Increase	1/28/26	21.39													
67					1/19/26		41.60	1/22/26	Flow Increase	1/28/26	18.77													
75					1/19/26		47.60	1/22/26	Flow Increase	1/28/26	20.85													
198					1/20/26		52.83	1/22/26	Flow Increase	1/29/26	15.7													
196					1/20/26		55.25	1/22/26	Flow Increase	1/29/26	16.3													
162					1/20/26		156.00	1/22/26	Flow Increase	1/29/26	18.9													
88					1/20/26		96.57	1/22/26	Flow Increase	1/29/26	13.45													
86					1/20/26		53.17	1/22/26	Flow Increase	1/29/26	22.32													
164					1/20/26		74.93	1/22/26	Flow Increase	1/29/26	14.5													
209					1/20/26		52.29	1/22/26	Flow Increase	1/29/26	9.79													
208					1/20/26		45.02	1/22/26	Flow Increase	1/29/26	8.59													
204					1/20/26		43.05	1/22/26	Flow Increase	1/29/26	10.41													
203					1/20/26		92.80	1/22/26	Flow Increase	1/29/26	24.32													
160					1/20/26		78.20	1/22/26	Flow Increase	1/29/26	15.31													
165					1/20/26		42.30	1/22/26	Flow Increase	1/29/26	10.71													
166					1/20/26		46.80	1/22/26	Flow Increase	1/29/26	10.85													
167					1/20/26		48.60	1/22/26	Flow Increase	1/29/26	10.2													
168					1/20/26		35.20	1/22/26	Flow Increase	1/29/26	10.07													
199					1/20/26		37.10	1/22/26	Flow Increase	1/29/26	16.71													
197					1/20/26		47.20	1/22/26	Flow Increase	1/29/26	21.72													
195					1/20/26		46.50	1/22/26	Flow Increase	1/29/26	16.82													
194					1/20/26		38.50	1/22/26	Flow Increase	1/29/26	15.97													
96					1/20/26		40.20	1/22/26	Flow Increase	1/29/26	17.42													
210					1/20/26		62.63	1/22/26	Flow Increase	1/29/26	13.09													
207					1/20/26		40.37	1/22/26	Flow Increase	1/29/26	16.41													
31					1/20/26		191.00	1/22/26	Flow Increase	1/29/26	20.4													
85					1/20/26		210.00	1/22/26	Flow Increase	1/29/26	19.69													

2026 Chiquita Surface Emissions Exceedance

Integrated (Monthly)

Grid	Flag	Location Description	Latitude	Longitude	Initial Date	Initial Time	Initial Exceedance >25 (PPM)	10-Day Corrective Action Date	10-Day Corrective Action	First Remonitoring Date (10-days)	PPM	2nd 10-Day Corrective Action Date	2nd 10-Day Corrective Action	Second Remonitoring Date (10-days)	PPM	Monthly Corrective Action Date	Monthly Corrective Action	Monthly Remonitoring Date	PPM	45-Day Corrective Action Deadline	45-Day Corrective Action Date	45-Day Corrective Action	45-Day Corrective Action Date / Remonitoring Date	PPM
89					1/20/26		51.10	1/22/26	Flow Increase	1/29/26	12.9													
161					1/20/26		49.30	1/22/26	Flow Increase	1/29/26	14.16													
163					1/20/26		51.90	1/22/26	Flow Increase	1/29/26	18.13													
218					1/20/26		34.40	1/22/26	Flow Increase	1/29/26	19.3													
217					1/20/26		31.20	1/22/26	Flow Increase	1/29/26	21.13													
216					1/20/26		32.90	1/22/26	Flow Increase	1/29/26	14.72													
99					1/20/26		41.70	1/22/26	Flow Increase	1/29/26	20.62													
100					1/20/26		71.40	1/22/26	Flow Increase	1/29/26	21.72													
83					1/20/26		52.47	1/22/26	Flow Increase	1/29/26	22.8													
30					1/20/26		50.16	1/22/26	Flow Increase	1/29/26	10.05													
84					1/20/26		41.22	1/22/26	Flow Increase	1/29/26	8.16													
90					1/20/26		45.11	1/22/26	Flow Increase	1/29/26	16.6													
155					1/20/26		31.18	1/22/26	Flow Increase	1/29/26	6.21													
213					1/20/26		34.21	1/22/26	Flow Increase	1/29/26	12.42													
214					1/20/26		39.14	1/22/26	Flow Increase	1/29/26	17.91													
215					1/20/26		72.16	1/22/26	Flow Increase	1/29/26	17.75													
220					1/20/26		61.13	1/22/26	Flow Increase	1/29/26	23.48													
219					1/20/26		59.25	1/22/26	Flow Increase	1/29/26	12.6													
85					1/21/26		25.07	1/22/26	Flow Increase	1/29/26	19.2													
87					1/21/26		36.27	1/22/26	Flow Increase	1/29/26	10.35													
93					1/21/26		41.07	1/22/26	Flow Increase	1/29/26	18.22													
32					1/21/26		55.40	1/22/26	Flow Increase	1/29/26	12.31													
36					1/21/26		48.70	1/22/26	Flow Increase	1/29/26	13.62													
37					1/21/26		38.17	1/22/26	Flow Increase	1/29/26	12.25													
49					1/21/26		47.30	1/22/26	Flow Increase	1/29/26	15.32													
50					1/21/26		30.10	1/22/26	Flow Increase	1/29/26	10.02													
59					1/21/26		40.30	1/22/26	Flow Increase	1/29/26	10.8													
60					1/21/26		49.12	1/22/26	Flow Increase	1/29/26	11.4													
61					1/21/26		111.00	1/22/26	Flow Increase	1/29/26	12.3													
62					1/21/26		39.60	1/22/26	Flow Increase	1/29/26	11.8													
63					1/21/26		42.10	1/22/26	Flow Increase	1/29/26	11.1													
98					1/21/26		61.91	1/22/26	Flow Increase	1/29/26	20.68													
97					1/21/26		52.01	1/22/26	Flow Increase	1/29/26	19.29													
104					1/21/26		56.85	1/22/26	Flow Increase	1/29/26	20.5													
103					1/21/26		40.23	1/22/26	Flow Increase	1/29/26	6.91													
236					1/22/26		36.50	1/22/26	Flow Increase	1/29/26	18.29													
235					1/22/26		41.20	1/22/26	Flow Increase	1/29/26	16.94													
234					1/22/26		52.50	1/22/26	Flow Increase	1/29/26	20.61													
233					1/22/26		56.44	1/22/26	Flow Increase	1/29/26	17.53													
253					1/22/26		78.20	1/22/26	Flow Increase	1/29/26	22.02													
244					1/22/26		178.00	1/22/26	Flow Increase	1/29/26	24.33													
243					1/22/26		183.00	1/22/26	Flow Increase	1/29/26	23.97													
242					1/22/26		145.00	1/22/26	Flow Increase	1/29/26	24.27													
241					1/22/26		53.01	1/22/26	Flow Increase	1/29/26	20.64													
240					1/22/26		70.05	1/22/26	Flow Increase	1/29/26	18.39													
245					1/22/26		31.70	1/22/26	Flow Increase	1/29/26	12.53													
246					1/22/26		160.00	1/22/26	Flow Increase	1/29/26	24.29													
247					1/22/26		93.75	1/22/26	Flow Increase	1/29/26	23.73													
248					1/22/26		110.00	1/22/26	Flow Increase	1/29/26	23.38													
249					1/22/26		75.19	1/22/26	Flow Increase	1/29/26	19.48													
38					1/22/26		111.00	1/22/26	Flow Increase	1/29/26	23.54													
221					1/22/26		27.82	1/22/26	Flow Increase	1/29/26	10.06													
222					1/22/26		33.11	1/22/26	Flow Increase	1/29/26	11.21													
229					1/22/26		27.22	1/22/26	Flow Increase	1/29/26	13.74													
83					2/4/26		41.13	2/12/26	Flow Increase	2/12/26	18.31													
205					2/5/26		37.28	2/12/26	Flow Increase	2/12/26	9.1													
176					2/5/26		49.95	2/12/26	Flow Increase	2/12/26	9.19													
182					2/5/26		25.73	2/12/26	Flow Increase	2/12/26	8.67													
200					2/5/26		25.99	2/12/26	Flow Increase	2/12/26	8.73													
181					2/5/26		36.91	2/12/26	Flow Increase	2/12/26	9.61													
176					2/9/26		25.35	2/20/26	Flow Increase	2/20/26	5.25													

2026 Chiquita Surface Emissions Exceedance

Integrated (Monthly)																							
Grid	Flag	Location Description	Latitude	Longitude	Initial Date	Initial Time	Initial Exceedance >25 (PPM)	10-Day Corrective Action Date	10-Day Corrective Action	First Remonitoring Date (10-days)	PPM	2nd 10-Day Corrective Action Date	2nd 10-Day Corrective Action	Second Remonitoring Date (10-days)	PPM	Monthly Corrective Action Date	Monthly Corrective Action	Monthly Remonitoring Date	PPM	45-Day Corrective Action Deadline	45-Day Corrective Action Date	45-Day Corrective Action	45-Day Corrective Action Date / Remonitoring Date	PPM
165					2/9/26		40.78	2/20/26	Flow Increase	2/20/26	4.03													
82					2/9/26		76.65	2/20/26	Flow Increase	2/20/26	5.72													
83					2/9/26		105.00	2/20/26	Flow Increase	2/20/26	6.04													
155					2/9/26		77.67	2/20/26	Flow Increase	2/20/26	4.91													
30					2/23/26		28.20	3/4/26	Flow Increase	3/4/26	19.7													
175					2/23/26		35.75	3/4/26	Flow Increase	3/4/26	11.6													

2026 Chiquita Surface Emissions Exceedance

Instantaneous (Monthly)

Grid	Flag	Location Description	Latitude	Longitude	Initial Date	Initial Time	Initial Exceedance >500, 200-499 (PPM)	10-Day Corrective Action Date	10-Day Corrective Action	First Remonitoring Date (10-days)	PPM	2nd 10-Day Corrective Action Date	2nd 10-Day Corrective Action	Second Remonitoring Date (10-days)	PPM	Monthly Corrective Action Date	Monthly Corrective Action	Monthly Remonitoring Date	PPM	45-Day Corrective Action Deadline	45-Day Corrective Action Date	45-Day Corrective Action	45-Day Corrective Action Date / Remonitoring Date	PPM
176	Y21	CV-24032	34.43510	-118.64962	1/7/26	7:48	797	1/8/26	Boot Repaired	1/14/26	16.7					1/8/26	Boot Repaired	2/6/26	32.3					
176	Y22	CV-24031 (FP-032 was flagged)	34.43488	-118.64982	1/7/26	7:54	1,248	1/8/26	Flow Increase	1/14/26	61.9					1/8/26	Flow Increase	2/6/26	5.7					
202	Y23	CV-24142	34.43402	-118.65133	1/7/26	8:13	506	1/8/26	Flow Increase	1/14/26	26.3					1/8/26	Flow Increase	2/6/26	9.6					
173	Y24	CV-24036	34.43447	-118.64970	1/7/26	8:31	600	1/8/26	Flow Increase	1/14/26	16.8					1/8/26	Flow Increase	2/6/26	153					
173	Y25	FP-030	34.43453	-118.64968	1/7/26	8:34	1,100	1/8/26	Flow Increase	1/14/26	15.1					1/8/26	Flow Increase	2/6/26	488					
156	Y26	Surface	34.43569	-118.64841	1/7/26	8:56	609	1/8/26	Cover Repaired	1/14/26	11.8					1/8/26	Cover Repaired	2/6/26	7.7					
164	Y61	CV-24176	34.43262	-118.64884	1/7/26	8:02	541	1/8/26	Flow Increase	1/14/26	11.3					1/8/26	Flow Increase	2/6/26	17.9					
163	Y62	H-1760S	34.43276	-118.64790	1/7/26	8:18	768	1/8/26	Flow Increase	1/14/26	23.2					1/8/26	Flow Increase	2/6/26	21.1					
89	Y63	CV-24107	34.43257	-118.64616	1/7/26	8:33	1,718	1/8/26	Cover Compaction; Flow Increase	1/14/26	17.6					1/8/26	Cover Compaction; Flow Increase	2/6/26	15.5					
160	Y64	CV-24088	34.43360	-118.64768	1/7/26	9:03	667	1/8/26	Boot Repaired	1/14/26	16					1/8/26	Boot Repaired	2/6/26	11					
155	Y65	CV-24160	34.43381	-118.64624	1/7/26	9:18	1,013	1/8/26	Cover Compaction	1/14/26	23.7					1/8/26	Cover Compaction	2/6/26	63.4					
83	Y66	CV-24161	34.43387	-118.64562	1/7/26	9:24	537	1/8/26	Flow Increase	1/14/26	34.1					1/8/26	Flow Increase	2/6/26	42.4					
53	Y67	CV-2559	34.43574	-118.64551	1/7/26	9:46	903	1/8/26	Flow Increase	1/14/26	26.7					1/8/26	Flow Increase	2/6/26	47.7					
183	Y41	CV-2337	34.43547	-118.65077	1/7/26	8:41	714	1/8/26	Cover Compaction	1/14/26	19.6					1/8/26	Cover Compaction	2/6/26	7.4					
180	Y42	Riser	34.43532	-118.65047	1/7/26	8:47	2,131	1/8/26	Flow Increase	1/14/26	12.4					1/8/26	Flow Increase	2/6/26	432					
183	Y43	CV-2326	34.43617	-118.65052	1/7/26	8:53	2,408	1/8/26	Boot Repaired	1/14/26	11.3					1/8/26	Boot Repaired	2/6/26	5.9					
183	Y44	CV-24011	34.43618	-118.65022	1/7/26	9:08	83,274	1/8/26	Boot Repaired; Flow Increase	1/14/26	10.1					1/8/26	Boot Repaired; Flow Increase	2/6/26	6					
184	Y45	Surface	34.43622	-118.64970	1/7/26	9:21	18,036	1/8/26	Cover Repaired	1/14/26	10.8					1/8/26	Cover Repaired	2/6/26	5.9					
184	Y46	CV-24012	34.43616	-118.64939	1/7/26	9:27	89,095	1/8/26	Flow Increase	1/14/26	13.9					1/8/26	Flow Increase	2/6/26	6.2					
185	Y47	CV-24021	34.43615	-118.64906	1/7/26	9:48	981	1/8/26	Boot Repaired; Flow Increase	1/14/26	11.3					1/8/26	Boot Repaired; Flow Increase	2/6/26	7.3					
185	Y48	CV-24014	34.43677	-118.64894	1/7/26	9:53	3,399	1/8/26	Flow Increase	1/14/26	13					1/8/26	Flow Increase	2/6/26	12.4					
185	Y49	CV-24013	34.43662	-118.64925	1/7/26	9:55	96,075	1/9/26	Flow Increase	1/14/26	31.4					1/9/26	Flow Increase	2/6/26	6.3					
76	Y61	CV-2008	34.43625	-118.64625	1/8/26	8:49	650	1/8/26	Cover Compaction	1/14/26	20.4					1/8/26	Cover Compaction	2/5/26	111					
215	Y1	H-105A	34.43116	-118.65063	1/8/26	8:23	500	1/8/26	Cover Compaction	1/14/26	448					1/8/26	Cover Compaction	2/5/26	146					
211	B1	CV-24188	34.43156	-118.65007	1/8/26	7:57	225	1/8/26	Flow Increase	1/14/26	6.8													
214	B2	H-2059W	34.43110	-118.65023	1/8/26	8:07	200	1/8/26	Flow Increase	1/14/26	29.3													
76	B61	H-1771A	34.43637	-118.64643	1/8/26	8:48	325	1/8/26	Flow Increase	1/14/26	19.1													
79	B62	Surface	34.43724	-118.64545	1/8/26	8:25	230	1/8/26	Flow Increase	1/14/26	7.7													
215	Y1	Surface	34.43118	-118.65062	1/16/26	8:01	1,172	1/22/26	Flow Increase	1/26/26	15.43					1/22/26	Flow Increase	2/12/26	125					
210	Y2	Surface	34.43173	-118.65075	1/16/26	8:07	1,352	1/22/26	Flow Increase	1/26/26	6.42					1/22/26	Flow Increase	2/12/26	69.71					
162	Y3	CV-24106	34.43211	-118.64673	1/16/26	8:32	610	1/22/26	Flow Increase	1/26/26	331					1/22/26	Flow Increase	2/12/26	132					
161	Y4	CV-24175	34.43286	-118.64768	1/16/26	8:52	10,157	1/22/26	Flow Increase	1/26/26	34.2					1/22/26	Flow Increase	2/12/26	9.83					
149	Y15	Surface	34.43435	-118.64576	1/16/26	8:34	1,424	1/22/26	Flow Increase	1/26/26	96.03					1/22/26	Flow Increase	2/12/26	7.93					
177	Y30	Surface	34.43518	-118.64890	1/16/26	8:47	860	1/22/26	Flow Increase	1/26/26	103					1/22/26	Flow Increase	2/12/26	340					
173	B45	Surface	34.43439	-118.64951	1/16/26	8:54	275	1/22/26	Flow Increase	1/26/26	105													
176	Y21	Surface	34.43491	-118.64984	1/26/26	8:08	1,756	1/30/26	Cover Compaction	2/5/26	42.16					1/30/26	Cover Compaction	2/25/26	5.9					
176	Y23	CV-24031	34.43490	-118.64986	1/26/26	8:11	2,345	1/30/26	Cover Compaction	2/5/26	46.1					1/30/26	Cover Compaction	2/25/26	6.2					
176	Y24	CV-24032	34.43511	-118.64962	1/26/26	8:18	6,421	1/30/26	Cover Compaction	2/5/26	32.79					1/30/26	Cover Compaction	2/25/26	5.3					
177	Y25	Surface	34.43521	-118.64920	1/26/26	8:22	623	1/30/26	Cover Compaction	2/5/26	17.11					1/30/26	Cover Compaction	2/25/26	4.9					
177	Y26	Near CV-2303	34.43533	-118.64914	1/26/26	8:26	599	1/30/26	Boot Repaired	2/5/26	38.96					1/30/26	Boot Repaired	2/25/26	5.2					
77	Y27	6x4 reducer near CV-113	34.43696	-118.64674	1/26/26	9:05	562	1/30/26	Pipe Repaired	2/5/26	10.19					1/30/26	Pipe Repaired	2/25/26	22.3					
77	Y28	Hero Sump	34.43734	-118.64678	1/26/26	9:30	962	1/30/26	Cover Compaction	2/5/26	22.15					1/30/26	Cover Compaction	2/25/26	16.2					
78	Y29	CV-2563	34.43730	-118.64578	1/26/26	9:52	5,623	1/29/26	Flow Increase	2/5/26	13.12					1/29/26	Flow Increase	2/25/26	51.4					
86	Y81	Riser	34.43239	-118.64574	1/26/26	8:29	1,863	1/29/26	Cover Compaction	2/5/26	22.11					1/29/26	Cover Compaction	2/25/26	19.2					
88	Y82	H-2275E	34.43241	-118.64624	1/26/26	8:35	2,971	1/29/26	Cover Compaction; Flow Increase	2/5/26	38.62					1/29/26	Cover Compaction; Flow Increase	2/25/26	28.2					
162	Y83	CV-24106	34.43215	-118.64677	1/26/26	8:41	3,884	1/29/26	Flow Increase	2/5/26	197					1/29/26	Flow Increase	2/25/26	64.2					
197	Y84	CV-24198	34.43157	-118.64760	1/26/26	8:51	2,191	1/30/26	Flow Increase	2/5/26	19.03					1/30/26	Flow Increase	2/25/26	415					
198	Y85	CV-24104	34.43173	-118.64811	1/26/26	9:02	4,756	1/30/26	Flow Increase	2/5/26	37.13					1/30/26	Flow Increase	2/25/26	23.9					
212	Y86	CV-2539	34.43171	-118.64923	1/26/26	9:17	2,849	1/29/26	Flow Increase	2/5/26	29.76					1/29/26	Flow Increase	2/25/26	19.1					
212	Y87	CV-2565	34.43198	-118.64901	1/26/26	9:45	2,771	1/29/26	Flow Increase	2/5/26	11.13					1/29/26	Flow Increase	2/25/26	75.9					
197	Y88	CV-2503	34.43123	-118.64777	1/26/26	10:28	5,939	1/30/26	Flow Increase	2/5/26	27.63					1/30/26	Flow Increase	2/25/26	22.4					
194	Y89	CV-24203	34.43154	-118.64601	1/26/26	10:48	845	1/30/26	Cover Compaction; Flow Increase	2/5/26	311					1/30/26	Cover Compaction; Flow Increase	2/25/26	117					
82	Y61	H-1804B	34.43426	-118.64567	1/26/26	8:26	1,200	1/29/26	Cover Compaction; Flow Increase	2/5/26	34.68					1/29/26	Cover Compaction; Flow Increase	2/25/26	47.7					
160	Y62	CV-24172	34.43299	-118.64732	1/26/26	9:03	765	1/30/26	Cover Compaction; Flow Increase	2/5/26	19.28					1/30/26	Cover Compaction; Flow Increase	2/25/26	16.6					
160	Y63	CV-24168	34.43329	-118.64735	1/26/26	9:10	1,300	1/30/26	Flow Increase	2/5/26	17.13					1/30/26	Flow Increase	2/25/26	7.9					
161	Y64	H-2274B	34.43266	-118.64696	1/26/26	10:36	1,100	1/29/26	Flow Increase	2/5/26	29.63					1/29/26	Flow Increase	2/25/26	8.5					
85	Y65	CV-24210	34.43265	-118.64562	1/26/26	11:06	1,000	1/29/26	Cover Compaction; Flow Increase	2/5/26	43.76					1/29/26	Cover Compaction; Flow Increase	2/25/26	9.2					
172	Y41	CV-24038	34.43485	-118.64879	1/26/26	8:37	2,200	1/30/26	Seal Repaired; Flow Increase	2/5/26	5.85					1/30/26	Seal Repaired; Flow Increase	2/25/26	7.5					
172	Y42	CV-24045	34.43471	-118.64855	1/26/26	10:53	1,500	1/30/26	Seal Repaired; Flow Increase	2/5/26	13.18					1/30/26	Seal Repaired; Flow Increase	2/25/26	303					
173	Y43	CV-24032	34.43476	-118.64945	1/26/26	8:45	890	1/30/26	Cover Compaction	2/5/26	24					1/30/26	Cover Compaction	2/25/26	7.1					
202	Y44	CV-1532A	34.43385	-118.65095	1/26/26	8:57	700	1/29/26	Cover Compaction	2/5/26	15.5					1/29/26	Cover Compaction	2/25/26	17.7					
169	Y45	CV-24050	34.43358	-118.64995	1/26/26	9:34	650	1/29/26	Flow Increase	2/5/26	24.13					1/29/26	Flow Increase	2/25/26	30.1					
68	Y102	CV-2009	34.43627	-118.64529	1/26/26	8:40	10,000	1/30/26	Flow Increase	2/5/26	37.61					1/30/26	Flow Increase	2/25/26	10.9					
69	Y103	CV-24214	34.43674	-118.64355	1/26/26	9:00	797	1/30/26	Flow Increase	2/5/26	386					1/30/26	Flow Increase	2/25/26	7.1					
78	B22	Riser	34.43733	-118.64588	1/26/26	9:46	200	1/30/26	Flow Increase	2/5/26	21.14													
76	B23	Surface	34.43638	-118.64599	1/26/26	10:45	200	1/30/26	Flow Increase	2/5/26	38.66													
83	B61	CV-24190	34.43380	-118.64628	1/26/26	8:34	325	1/30/26	Flow Increase	2/5/26	88.17													
84	B62	CV-24092	34.43332	-118.64616	1/26/26	10:49	210	1/30/26	Flow Increase	2/5/26	9.17													
84	B63	H-1764N	34.43316	-118.64565	1/26/26	10:59	315	1/30/26	Flow Increase	2/5/26	194													
67	B101	Surface	34.43623	-118.64488	1/26/26	8:33	233	1/30/26	Flow Increase	2/5/26	17.77													
32	Y21	CV-24110	34.43455	-118.64478	1/27/26	8:28	940	1/30/26	Flow Increase	2/4/26	210					1/30/26	Flow Increase	2/26/26	44.2					
33	Y22	CV-24109	34.43400	-118.64485	1/27/26	8:33	1,200	1/29/26	Cover Compaction	2/4/26	413					1/29/26	Cover Compaction	2/26/26	18.3					
30	Y23	H-1805B	34.43372	-118.64510	1/27/26	8:34	1,000	1/29/26	Cover Compaction	2/4/26	18.59					1/29/26	Cover Compaction	2/26/26	104					
30	Y24	CV-24162	34.43357	-118.64515	1/27/26	8:38	650	1/29/26	Flow Increase	2/4/26	31.66					1/29/26	Flow Increase	2/26/26	4.6					

2026 Chiquita Surface Emissions Exceedance

Instantaneous (Monthly)

Grid	Flag	Location Description	Latitude	Longitude	Initial Date	Initial Time	Initial Exceedance >500, 200-499 (PPM)	10-Day Corrective Action Date	10-Day Corrective Action	First Remonitoring Date (10-days)	PPM	2nd 10-Day Corrective Action Date	2nd 10-Day Corrective Action	Second Remonitoring Date (10-days)	PPM	Monthly Corrective Action Date	Monthly Corrective Action	Monthly Remonitoring Date	PPM	45-Day Corrective Action Deadline	45-Day Corrective Action Date	45-Day Corrective Action	45-Day Corrective Action Date / Remonitoring Date	PPM
34	Y25	CV-24163	34.43340	-118.64455	1/27/26	8:45	700	1/30/26	Flow Increase	2/4/26	9.13					1/30/26	Flow Increase	2/26/26	11.1					
50	Y26	CV-2531	34.43264	-118.64321	1/27/26	9:12	1,300	1/30/26	Flow Increase	2/4/26	421					1/30/26	Flow Increase	2/26/26	470					
36	Y27	H-1957B	34.43448	-118.64388	1/27/26	9:29	800	1/29/26	Flow Increase	2/4/26	34.08					1/29/26	Flow Increase	2/26/26	303					
41	Y28	CV-2011A	34.43446	-118.64306	1/27/26	9:35	620	1/30/26	Flow Increase	2/4/26	12.36					1/30/26	Flow Increase	2/26/26	30.2					
42	Y29	CV-24119	34.43376	-118.64239	1/27/26	10:23	2,000	1/30/26	Cover Compaction	2/4/26	409					1/30/26	Cover Compaction	2/26/26	113					
43	Y30	CV-2529	34.43317	-118.64245	1/27/26	10:31	900	1/30/26	Cover Compaction	2/4/26	69.11					1/30/26	Cover Compaction	2/26/26	14.4					
48	Y1	C-10	34.43473	-118.64120	1/27/26	8:44	1,048	1/30/26	Cover Compaction	2/4/26	167					1/30/26	Cover Compaction	2/26/26	5.2					
48	Y2	C-8	34.43365	-118.64087	1/27/26	8:50	875	1/30/26	Cover Compaction; Flow Increase	2/4/26	169					1/30/26	Cover Compaction; Flow Increase	2/26/26	12.6					
45	Y30	CV-2529	34.43317	-118.64245	1/27/26	10:31	1,082	1/30/26	Cover Compaction	2/4/26	126					1/30/26	Cover Compaction	2/26/26	77.1					
45	Y4	CV-2525	34.43499	-118.64176	1/27/26	9:05	1,698	1/30/26	Flow Increase	2/4/26	281					1/30/26	Flow Increase	2/26/26	411					
47	Y5	CV-2528	34.43381	-118.64125	1/27/26	9:10	4,975	1/30/26	Flow Increase	2/4/26	479					1/30/26	Flow Increase	2/26/26	37.9					
51	Y6	CV-05	34.43285	-118.64223	1/27/26	9:43	2,480	1/30/26	Flow Increase	2/4/26	80.67					1/30/26	Flow Increase	2/26/26	20.9					
52	Y7	CV-04	34.43314	-118.64169	1/27/26	9:49	650	1/30/26	Flow Increase	2/4/26	61.36					1/30/26	Flow Increase	2/26/26	27.6					
47	Y8	CV-24222	34.43358	-118.64201	1/27/26	10:10	578	1/30/26	Flow Increase	2/4/26	73.06					1/30/26	Flow Increase	2/26/26	13.7					
47	Y9	H-2170S	34.43361	-118.64151	1/27/26	10:18	1,650	1/30/26	Flow Increase	2/4/26	105					1/30/26	Flow Increase	2/26/26	33.4					
226	Y61	CV-2512	34.42926	-118.65063	1/27/26	9:14	1,842	1/30/26	Flow Increase	2/4/26	111					1/30/26	Flow Increase	2/26/26	10.8					
223	Y62	CV-2508	34.42971	-118.64878	1/27/26	9:40	1,054	1/30/26	Cover Compaction; Flow Increase	2/4/26	21.63					1/30/26	Cover Compaction; Flow Increase	2/26/26	40.6					
222	Y63	CV-2507	34.43014	-118.64817	1/27/26	9:51	792	1/30/26	Flow Increase	2/4/26	222					1/30/26	Flow Increase	2/26/26	183					
233	Y64	CV-2514	34.42962	-118.64782	1/27/26	10:20	1,394	1/30/26	Cover Compaction; Flow Increase	2/4/26	99.64					1/30/26	Cover Compaction; Flow Increase	2/26/26	29.2					
38	Y21	CV-1701S	34.43358	-118.64334	1/28/26	8:58	10,000	1/30/26	Cover Compaction; Flow Increase	2/5/26	328					1/30/26	Cover Compaction; Flow Increase	2/26/26	467					
38	Y22	Surface	34.43332	-118.64341	1/28/26	9:02	1,400	1/30/26	Cover Compaction	2/5/26	75.67					1/30/26	Cover Compaction	2/26/26	371					
38	Y23	CV-24118	34.43329	-118.64386	1/28/26	10:33	10,000	1/30/26	Cover Compaction	2/5/26	23.1					1/30/26	Cover Compaction	2/26/26	179					
87	Y24	CV-24208	34.43182	-118.64500	1/28/26	9:28	20,000	1/30/26	Cover Compaction; Flow Increase	2/5/26	53.71					1/30/26	Cover Compaction; Flow Increase	2/26/26	23.2					
87	Y25	CV-2534	34.43131	-118.64481	1/28/26	9:38	4,671	1/30/26	Flow Increase	2/5/26	160					1/30/26	Flow Increase	2/26/26	42.7					
249	Y26	GAB1C	34.42745	-118.64864	1/28/26	10:13	4,631	1/30/26	Cover Compaction	2/5/26	390					1/30/26	Cover Compaction	2/26/26	56.1					
87	B21	Surface	34.43123	-118.64516	1/28/26	9:36	270	1/30/26	Flow Increase	2/5/26	51.13													
241	B22	Surface	34.42824	-118.64989	1/28/26	9:55	341	1/30/26	Flow Increase	2/5/26	30.16													
172	Y41	FP-019	34.43471	-118.64906	2/2/26	8:22	900	2/4/26	Cover Compaction	2/12/26	5.51					2/4/26	Cover Compaction	2/26/26	11.2					
169	Y42	CV-2341	34.43362	-118.65031	2/2/26	8:54	800	2/4/26	Cover Compaction; Flow Increase	2/12/26	6.62					2/4/26	Cover Compaction; Flow Increase	2/26/26	13.8					
55	Y43	CV-2207	34.43602	-118.64423	2/2/26	9:47	660	2/4/26	Cover Compaction; Flow Increase	2/12/26	8.11					2/4/26	Cover Compaction; Flow Increase	2/26/26	7.7					
176	Y21	CV-1902A	34.43464	-118.65032	2/2/26	8:27	700	2/4/26	Cover Compaction	2/12/26	480					2/4/26	Cover Compaction	2/26/26	16.2					
79	Y22	CV-48R	34.43730	-118.64586	2/2/26	9:27	625	2/4/26	Flow Increase	2/12/26	8.71					2/4/26	Flow Increase	2/26/26	21.6					
79	Y23	CV-2563	34.43727	-118.64576	2/2/26	9:30	900	2/4/26	Flow Increase	2/12/26	7.88					2/4/26	Flow Increase	2/26/26	13.9					
84	Y81	CV-24108	34.43316	-118.64544	2/2/26	9:14	3,571	2/4/26	Cover Compaction; Flow Increase	2/12/26	7.82					2/4/26	Cover Compaction; Flow Increase	2/26/26	11.7					
85	Y82	CV-24210	34.43298	-118.64545	2/2/26	9:47	4,790	2/4/26	Flow Increase	2/12/26	12.61					2/4/26	Flow Increase	2/26/26	9.8					
162	Y83	CV-24106	34.43214	-118.64674	2/2/26	9:38	3,396	2/4/26	Flow Increase	2/12/26	13.15					2/4/26	Flow Increase	2/26/26	13.3					
163	Y84	CV-24090	34.43268	-118.64755	2/2/26	9:56	2,987	2/4/26	Cover Compaction	2/12/26	17.05					2/4/26	Cover Compaction	2/26/26	7.9					
196	Y85	CV-2567	34.43195	-118.64807	2/2/26	10:20	589	2/4/26	Cover Compaction	2/12/26	8.21					2/4/26	Cover Compaction	2/26/26	19.1					
198	Y86	CV-24104	34.43172	-118.64809	2/2/26	10:18	4,990	2/4/26	Cover Compaction	2/12/26	18.733					2/4/26	Cover Compaction	2/26/26	22.3					
215	Y87	Riser	34.43113	-118.65056	2/2/26	10:59	1,237	2/4/26	Cover Compaction; Removed Riser	2/12/26	23.51					2/4/26	Cover Compaction; Removed Riser	2/26/26	147					
82	B62	FP-057	34.43472	-118.64555	2/2/26	9:23	302	2/4/26	Flow Increase	2/12/26	8.52													
207	B72	West side perimeter header	34.43244	-118.65107	2/2/26	10:54	200	2/4/26	Cover Compaction; Flow Increase	2/12/26	6.52													
71	B21	CV-24133	34.43742	-118.64273	2/2/26	10:16	285	2/4/26	Flow Increase	2/12/26	51.17													
56	Y41	CV-24213	34.43659	-118.64297	2/3/26	8:45	10,900	2/5/26	Cover Compaction; Flow Increase	2/12/26	47.5					2/5/26	Cover Compaction; Flow Increase	2/27/26	137					
228	Y61	CV-2510	34.42906	-118.64985	2/3/26	8:38	1,371	2/6/26	Flow Increase	2/12/26	432					2/6/26	Flow Increase	2/27/26	193					
33	Y81	CV-24109	34.43396	-118.64483	2/3/26	8:38	911	2/5/26	Flow Increase	2/12/26	20.48					2/5/26	Flow Increase	2/27/26	13.2					
30	Y82	CV-24162	34.43364	-118.64515	2/3/26	8:42	1,200	2/5/26	Cover Compaction	2/12/26	387					2/5/26	Cover Compaction	2/27/26	19.9					
34	Y83	CV-24163	34.43342	-118.64451	2/3/26	8:46	800	2/6/26	Cover Compaction; Flow Increase	2/12/26	54.83					2/6/26	Cover Compaction; Flow Increase	2/27/26	11.7					
35	Y84	TC-1961E	34.43274	-118.64437	2/3/26	8:52	1,400	2/5/26	Cover Compaction; Flow Increase	2/12/26	32.64					2/5/26	Cover Compaction; Flow Increase	2/27/26	22.4					
42	Y85	CV-24119	34.43388	-118.64230	2/3/26	9:19	2,000	2/6/26	Flow Increase	2/12/26	321					2/6/26	Flow Increase	2/27/26	16.6					
43	Y86	CV-2529	34.43310	-118.64225	2/3/26	9:36	850	2/5/26	Cover Compaction; Flow Increase	2/12/26	21.61					2/5/26	Cover Compaction; Flow Increase	2/27/26	30.1					
51	Y87	CV-05	34.43280	-118.64220	2/3/26	9:42	1,000	2/5/26	Flow Increase	2/12/26	210					2/5/26	Flow Increase	2/27/26	14.6					
50	Y89	CV-06	34.43251	-118.64285	2/3/26	9:46	690	2/5/26	Flow Increase	2/12/26	221					2/5/26	Flow Increase	2/27/26	52.1					
49	Y90	CV-2532	34.43221	-118.64382	2/3/26	9:53	1,700	2/5/26	Cover Compaction; Flow Increase	2/12/26	111					2/5/26	Cover Compaction; Flow Increase	2/27/26	210					
93	Y121	A-1	34.43122	-118.64377	2/3/26	9:41	1,147	2/6/26	Cover Compaction; Flow Increase	2/12/26	163					2/6/26	Cover Compaction; Flow Increase	2/27/26	80.1					
93	Y122	South Manifold	34.43120	-118.64424	2/3/26	9:45	9,471	2/5/26	Added Dirt; Cover Compaction	2/12/26	185					2/5/26	Added Dirt; Cover Compaction	2/27/26	76.4					
93	Y123	2-in steel pipe	34.43110	-118.64445	2/3/26	9:48	10,000	2/5/26	Added Dirt; Cover Compaction	2/12/26	142					2/5/26	Added Dirt; Cover Compaction	2/27/26	44.8					
91	Y124	South Manifold Pump 1	34.43150	-118.64416	2/3/26	9:52	1,153	2/5/26	Cover Compaction	2/12/26	219					2/5/26	Cover Compaction	2/27/26	31					
91	Y125	CV-2533	34.43190	-118.64414	2/3/26	10:03	1,336	2/6/26	Cover Compaction; Flow Increase	2/12/26	165					2/6/26	Cover Compaction; Flow Increase	2/27/26	61.7					
92	Y126	2 in pipe	34.43205	-118.64380	2/3/26	10:05	517	2/5/26	Sealed Pipe	2/12/26	105					2/5/26	Sealed Pipe	2/27/26	56.2					
92	Y127	Surface	34.43153	-118.64370	2/3/26	10:09	523	2/5/26	Cover Compaction	2/12/26	135					2/5/26	Cover Compaction	2/27/26	63.3					
92	Y128	Surface	34.43171	-118.64398	2/3/26	10:13	5,160	2/5/26	Cover Compaction	2/12/26	202					2/5/26	Cover Compaction	2/27/26	305					
181	Y1	Lorentz panel for CV-2532	34.43516	-118.65114	2/3/26	8:32	600	2/6/26	Cover Compaction	2/12/26	5.36					2/6/26	Cover Compaction	2/27/26	9.5					
180	Y2	Surface	34.43530	-118.65050	2/3/26	8:46	3,242	2/6/26	Repaired Liner	2/12/26	155					2/6/26	Repaired Liner	2/27/26	479					
183	Y3	Surface	34.43589	-118.65025	2/3/26	8:58	5,213	2/6/26	Cover Compaction	2/12/26	4.36					2/6/26	Cover Compaction	2/27/26	2.3					
183	Y4	CV-24016	34.43591	-118.65028	2/3/26	9:03	542	2/6/26	Inspected; 2/10/26 reconnected well	2/12/26	4.41					2/6/26	Inspected; 2/10/26 reconnected well	2/27/26	2.4					
183	Y5	CV-2336	34.43599	-118.65091	2/3/26	9:10	541	2/6/26	Cover Compaction	2/12/26	4.35					2/6/26	Cover Compaction	2/27/26	2.7					
184	Y6	CV-2311	34.43631	-118.64989	2/3/26	9:33	546	2/5/26	Cover Compaction; Boot Repaired	2/12/26	6.26					2/5/26	Cover Compaction; Boot Repaired	2/27/26	2.5					
184	Y7	Surface	34.43622	-118.64962	2/3/26	9:38	5,421	2/5/26	Flow Increase	2/12/26	4.28					2/5/26	Flow Increase	2/27/26	3					
179	Y8	4-in 90 fittng near CV-24033	34.43577	-118.64975	2/3/26	9:46	1,245	2/6/26	Cover Compaction	2/12/26	4.34					2/6/26	Cover Compaction	2/27/26	2.8					
179	Y9	CV-24026	34.43567	-118.64926	2/3/26	9:50	543	2/6/26	Inspected; 2/12/26 reconnected well	2/12/26	5.31					2/6/26	Inspected; 2/12/26 reconnected well	2/27/26	5.1					
179	Y10	Surface	34.43567	-118.64926	2/3/26	9:51	4,123	2/6/26	Flow Increase	2/12/26	5.21					2/6/26	Flow Increase	2/27/26	3.9					
178	Y11	CV-2308	34.43588	-118.64890	2/3/26	9:59	4,128	2/5/26	Boot Repaired	2/12/26	4.8					2/5/26	Boot Repaired	2/27/26	2.9					
178	Y12	CV-24027	34.43612	-118.64872	2/3/26	10:00	1,359	2/6/26	New liner being installed	2/12/26	4.42					2/6/26	New liner being installed	2/27/26	3.6					

2026 Chiquita Surface Emissions Exceedance

Instantaneous (Monthly)

Grid	Flag	Location Description	Latitude	Longitude	Initial Date	Initial Time	Initial Exceedance >500, 200-499 (PPM)	10-Day Corrective Action Date	10-Day Corrective Action	First Remonitoring Date (10-days)	PPM	2nd 10-Day Corrective Action Date	2nd 10-Day Corrective Action	Second Remonitoring Date (10-days)	PPM	Monthly Corrective Action Date	Monthly Corrective Action	Monthly Remonitoring Date	PPM	45-Day Corrective Action Deadline	45-Day Corrective Action Date	45-Day Corrective Action	45-Day Corrective Action Date / Remonitoring Date	PPM
185	Y13	CV-24022	34.43650	-118.64882	2/3/26	10:05	1,723	2/5/26	Cover Compaction; 2/10/26 Reconnected Well	2/12/26	4.58					2/5/26	Cover Compaction; 2/10/26 Reconnected Well	2/27/26	6.8					
185	Y14	CV-24013	34.43658	-118.64923	2/3/26	10:09	523	2/6/26	New liner being installed	2/12/26	4.5					2/6/26	New liner being installed	2/27/26	2.7					
185	Y15	CV-24014	34.43674	-118.64895	2/3/26	10:14	529	2/6/26	New liner being installed	2/12/26	4.8					2/6/26	New liner being installed	2/27/26	7.3					
93	B121	HV-044A	34.43095	-118.64407	2/3/26	9:38	334	2/4/26	Flow Increase	2/12/26	57.59													
91	B122	South Manifold Pump 1	34.43152	-118.64437	2/3/26	9:55	376	2/4/26	Flow Increase	2/12/26	125													
182	B1	CV-24141	34.43550	-118.65132	2/3/26	8:24	223	2/4/26	Flow Increase	2/12/26	24.52													
220	B29	CV-24023	34.43056	-118.65024	2/3/26	8:26	400	2/4/26	Flow Increase	2/12/26	9.04													
227	B30	H-2401N	34.42944	-118.65106	2/3/26	9:24	300	2/4/26	Flow Increase	2/12/26	154													
175	B2	Surface	34.43574	-118.64950	2/3/26	9:48	200	2/4/26	Flow Increase	2/12/26	4.56													
79	Y121	Force main on east perimeter	34.43767	-118.64431	2/10/26	10:29	10,000	2/11/26	Flow Increase; 2/23/26 Cover Compaction	2/20/26	58													
80	Y122	H-01	34.43767	-118.64416	2/10/26	9:25	10,000	2/11/26	Flow Increase; 2/23/26 Cover Compaction	2/20/26	60.13													
171	Y41	CV-24061	34.43434	-118.64862	2/10/26	8:10	937	2/11/26	Flow Increase	2/20/26	5.33													
173	Y42	CV-24044	34.43439	-118.64939	2/10/26	8:26	767	2/11/26	Flow Increase	2/20/26	90.41													
175	Y43	CV-2338	34.43487	-118.65050	2/10/26	8:58	988	2/11/26	Flow Increase	2/20/26	42.11													
181	Y2	Near CV-2352	34.43494	-118.65094	2/10/26	10:13	5,695	2/11/26	Flow Increase	2/20/26	4.34													
180	Y4	Lorentz panel near CV-2338	34.43535	-118.65051	2/10/26	10:24	1,043	2/11/26	Flow Increase; 2/23/26 Boot Repaired	2/20/26	15.22													
180	Y5	2 inch steel pipe	34.43532	-118.65031	2/10/26	10:26	1,506	2/11/26	Flow Increase; 2/23/26 Taped Pipe	2/20/26	3.86													
179	Y6	CV-2303	34.43543	-118.64969	2/10/26	10:32	633	2/11/26	Flow Increase; 2/23/26 Cover Compaction	2/20/26	31.25													
179	Y7	CV-24033	34.43540	-118.64946	2/10/26	10:34	607	2/11/26	Flow Increase	2/20/26	17.64													
178	Y8	CV-24040	34.43567	-118.64839	2/10/26	10:43	801	2/11/26	Flow Increase	2/20/26	10.28													
178	Y9	CV-24027	34.43615	-118.64872	2/10/26	10:49	789	2/11/26	Flow Increase; Boot Repaired	2/20/26	4.03													
172	Y21	CV-2304	34.43456	-118.64876	2/10/26	8:08	2,148	2/11/26	Flow Increase	2/20/26	3.61													
172	Y22	CV-24045	34.43475	-118.64906	2/10/26	8:10	1,192	2/11/26	Flow Increase	2/20/26	5.07													
156	Y23	CV-24039	34.43528	-118.64870	2/10/26	8:17	527	2/11/26	Flow Increase	2/20/26	22.54													
158	Y24	CV-24073	34.43465	-118.64771	2/10/26	8:34	723	2/11/26	Flow Increase; Boot Repaired	2/20/26	4.88													
153	Y25	FP-050	34.43490	-118.64725	2/10/26	8:39	4,213	2/11/26	Flow Increase	2/20/26	3.65													
153	Y26	CV-24149	34.43480	-118.64696	2/10/26	8:48	527	2/11/26	Flow Increase	2/20/26	4.73													
148	Y27	CV-24148	34.43507	-118.64668	2/10/26	8:52	757	2/11/26	Flow Increase	2/20/26	3.61													
78	Y28	Near CV-2563	34.43729	-118.64604	2/10/26	9:35	4,856	2/11/26	Flow Increase; 2/23/26 Cover Compaction	2/20/26	8.42													
178	Y29	CV-48R	34.43733	-118.64585	2/10/26	9:41	821	2/11/26	Flow Increase	2/20/26	165													
82	Y61	CV-2549	34.43438	-118.64527	2/10/26	8:40	561	2/11/26	Flow Increase; 2/23/26 Cover Compaction	2/20/26	4.42													
82	Y62	CV-2548	34.43435	-118.64557	2/10/26	8:46	2,584	2/11/26	Flow Increase	2/20/26	4.54													
83	Y63	H-1804B	34.43425	-118.64564	2/10/26	8:52	1,202	2/11/26	Flow Increase	2/20/26	4.28													
149	Y64	CV-24154	34.43427	-118.64609	2/10/26	8:57	4,391	2/11/26	Flow Increase	2/20/26	3.67													
154	Y65	CV-24152	34.43435	-118.64710	2/10/26	9:13	3,499	2/11/26	Flow Increase; Boot Repaired	2/20/26	3.59													
154	Y66	CV-2544	34.43403	-118.64723	2/10/26	9:19	4,563	2/11/26	Flow Increase	2/20/26	3.5													
159	Y67	H-1952S	34.43382	-118.64764	2/10/26	9:29	633	2/11/26	Flow Increase	2/20/26	3.72													
155	Y68	CV-24160	34.43380	-118.64627	2/10/26	9:39	3,884	2/11/26	Flow Increase; 2/23/26 Cover Compaction	2/20/26	7.6													
83	Y69	Surface	34.43406	-118.64567	2/10/26	9:48	1,124	2/11/26	Flow Increase; 2/23/26 Cover Compaction	2/20/26	9.23													
90	Y70	CV-24171	34.43317	-118.64665	2/10/26	9:55	1,071	2/11/26	Flow Increase; 2/23/26 Cover Compaction	2/20/26	6.86													
160	Y71	CV-24207	34.43328	-118.64694	2/10/26	10:00	3,637	2/11/26	Flow Increase; 2/23/26 Cover Compaction	2/20/26	3.75													
160	Y72	H-1408E	34.43335	-118.64717	2/10/26	10:06	7,279	2/11/26	Flow Increase	2/20/26	3.78													
160	Y73	CV-24168	34.43331	-118.64733	2/10/26	10:10	4,982	2/11/26	Flow Increase; 2/23/26 Cover Compaction	2/20/26	3.64													
163	Y74	H-1760S	34.43277	-118.64789	2/10/26	10:28	635	2/11/26	Flow Increase	2/20/26	4.21													
89	Y75	Surface	34.43265	-118.64629	2/10/26	10:43	1,053	2/11/26	Flow Increase; 2/23/26 Cover Compaction	2/20/26	3.35													
88	Y76	H-2275E	34.43242	-118.64621	2/10/26	10:48	978	2/11/26	Flow Increase	2/20/26	3.77													
170	B41	CV-2553	34.43419	-118.64891	2/10/26	8:20	462	2/11/26	Flow Increase	2/20/26	4.91													
181	B1	Surface	34.43499	-118.65097	2/10/26	10:11	205	2/11/26	Flow Increase	2/20/26	5.66													
180	B3	CV-2337	34.43550	-118.65078	2/10/26	10:20	243	2/11/26	Flow Increase	2/20/26	4.08													
156	B21	CV-24010	34.43566	-118.64838	2/10/26	8:24	200	2/11/26	Flow Increase	2/20/26	9.12													
212	Y21	CV-2565	34.43199	-118.64902	2/13/26	7:41	920	2/11/26	Flow Increase; 2/23/26 Cover Compaction	2/25/26	72.5													
196	Y22	CV-24195	34.43182	-118.64788	2/13/26	7:57	5,231	2/11/26	Flow Increase	2/25/26	19.7													
196	Y23	CV-24104	34.43177	-118.64804	2/13/26	8:00	4,213	2/11/26	Flow Increase	2/25/26	23.9													
214	Y41	H-104A	34.43108	-118.65022	2/13/26	8:08	1,590	2/11/26	Flow Increase; 2/23/26 Cover Compaction	2/25/26	210													
215	Y42	H-2059W	34.43111	-118.65057	2/13/26	8:14	5,762	2/11/26	Flow Increase	2/25/26	179													
217	Y81	CV-24114	34.43076	-118.64853	2/13/26	7:57	825	2/11/26	Flow Increase; 2/23/26 Cover Compaction	2/25/26	24.7													
77	Y1	CV-48R	34.43737	-118.64679	2/20/26	9:49	526	2/24/26	Flow Increase	2/27/26	17.4													
78	Y2	CV-2563	34.43732	-118.64580	2/20/26	10:00	946	2/23/26	Cover Compaction; Flow Increase	2/27/26	21.8													
32	Y61	CV-24110	34.43471	-118.64467	2/20/26	8:10	750	2/24/26	Flow Increase	2/27/26	31.4													
36	Y62	H-2168E	34.43448	-118.64383	2/20/26	9:22	800	2/24/26	Flow Increase	2/27/26	125													
90	Y81	CV-24092	34.43333	-118.64614	2/20/26	9:28	3,659	2/24/26	Flow Increase	2/27/26	319													
212	Y82	CV-2565	34.43201	-118.64899	2/20/26	10:50	1,265	2/23/26	Cover Compaction; Flow Increase	2/27/26	8.5													
84	Y101	CV-1905	34.43350	-118.64597	2/20/26	8:07	887	2/23/26	Flow Increase	2/27/26	42.4													
38	Y103	CV-24118	34.43331	-118.64384	2/20/26	8:28	1,326	2/24/26	Cover Compaction; Flow Increase	2/27/26	47.7													
215	Y161	2 inch steel pipe	34.43117	-118.65037	2/20/26	9:15	2,361	2/24/26	Cover Compaction	2/27/26	313													
215	Y162	Surface	34.43144	-118.65062	2/20/26	9:26	1,078	2/24/26	Cover Compaction	2/27/26	240													
84	B102	H-1764N	34.43316	-118.64561	2/20/26	8:11	304	2/27/26	Flow Increase	2/27/26	13.6													
218	B104	CV-1701S	34.43362	-118.64335	2/20/26	8:33	218	2/27/26	Flow Increase	2/27/26	24.6													
42	B105	CV-24119	34.43372	-118.64234	2/20/26	8:42	204	2/27/26	Flow Increase	2/27/26	109													
196	B221	Surface	34.43154	-118.64785	2/21/26	8:28	320	2/27/26	Flow Increase	2/27/26	14.8													
244	Y241	Near CV-24244	34.42889	-118.65133	2/21/26	9:08	625	2/24/26	Added Dirt; Cover Compaction; Flow Increase	2/27/26	112													

Attachment C-2

Aerial Survey Maps

February 2026 Condition 77 Data

Chiquita Canyon Landfill (Chiquita) observed a decrease in the number of peak methane events occurring in February 2026 in comparison to January 2026. The peak value and average values also decreased in February 2026 as compared to January 2026. The drone survey conducted on February 3 and 4, 2026, occurred during a series of unplanned Flare 2 shutdowns due to flame failure between February 1 and February 8, 2026. 13 of the 30 (~43%) peak methane events in February 2026 were from the survey conducted on those two dates. The drone survey conducted on February 10, 2026, was completed following the same series of unplanned Flare 2 shutdowns previously described. 7 of the 30 (~23%) peak methane events in February were associated with this survey. The drone survey conducted on February 19, 2026, was completed following rain events starting February 10, 2026, and February 16, 2026. Rain can contribute to spots of erosion and cracking of the surface, which can contribute to methane spikes. This survey resulted in 2 of 30 (~7%) peak methane events in February. The drone survey conducted on February 24, 2026, was completed following the same rain events described above, which contributed to spots of erosion and cracking on the ground surface, and therefore an increase in methane spikes was observed during that period. This survey resulted in 8 of 30 (~27%) peak methane events in February. As systems were brought back online during February 2026, landfill gas was collected more efficiently, resulting in fewer methane spikes being observed during the February 2026 drone flights. Chiquita expects these instances and peaks to continue to trend downward provided systems remain online.

February 2026 Tracking Spreadsheet

Chiquita Canyon Landfill (February 2026) - Prepared Pursuant to Condition 77 of the Stipulated Order for Abatement in Case No. 6177-4												
Aerial Surveillance Reading Date (UTC)	Aerial Surveillance Reading Time (UTC)	Follow-up Field Inspection Date (UTC)	Follow-up Field Inspection Time (UTC)	Grid	Verified Lat	Verified Long	Sniffer Drone PPM	Verified PPM	Action Required (≥ 500 PPM)	Cause of Exceedance (≥ 500 ppmv methane)	Action Taken	Date Action Taken
2/3/2026	16:18	2/3/2026	17:03	60	34.43582	-118.64358	532	950	Yes	crack on surface	added soil track walk	2/5/2026
2/3/2026	16:26	2/3/2026	16:58	63	34.43611	-118.64203	515	930	Yes	crack on surface	added soil track walk	2/5/2026
2/3/2026	20:53	2/3/2026	21:25	87	34.43127	-118.64482	392	830	Yes	crack on surface	added soil track walk	2/5/2026
2/4/2026	18:00	2/4/2026	18:27	222	34.43014	-118.64821	1,871	2,000	Yes	crack on surface	added soil track walk	2/5/2026
2/4/2026	18:07	2/4/2026	18:53	243	34.42843	-118.65101	300	180	No			
2/4/2026	18:10	2/4/2026	18:32	229	34.42913	-118.64963	671	5,000	Yes	crack on surface	added soil track walk	2/5/2026
2/4/2026	18:12	2/4/2026	18:36	229	34.42891	-118.64976	520	620	Yes	crack on surface	added soil track walk	2/5/2026
2/4/2026	18:14	2/4/2026	18:45	240	34.42828	-118.64968	209	10	No			
2/4/2026	19:15	2/4/2026	19:27	249	34.42755	-118.6487	300	2,000	Yes	crack on surface	added soil track walk	2/5/2026
2/4/2026	19:51	2/4/2026	20:14	225	34.43024	-118.65004	397	690	Yes	water erosion	added soil track walk	2/5/2026
2/4/2026	19:53	2/4/2026	20:17	226	34.43	-118.65052	331	860	Yes	crack on surface	added soil track walk	2/5/2026
2/4/2026	19:54	2/4/2026	20:23	244	34.42925	-118.65149	242	1,000	Yes	crack on surface	added soil track walk	2/5/2026
2/4/2026	21:29	2/4/2026	21:40	82	34.43443	-118.6457	433	1,000	Yes	crack on surface	added soil track walk	2/5/2026
2/10/2026	17:16	2/10/2026	17:48	169	34.43417	-118.64983	207	980	Yes	geomembrane cover had tear	repaired geomembrane cover	2/12/2026
2/10/2026	17:16	2/10/2026	17:50	173	34.43429	-118.64987	227	2,000	Yes	geomembrane cover had tear	repaired geomembrane cover	2/12/2026
2/10/2026	17:16	2/10/2026	17:53	176	34.43474	-118.65003	383	430	No			
2/10/2026	17:16	2/10/2026	17:59	169	34.43383	-118.64963	210	20,000	Yes	geomembrane cover had tear	repaired geomembrane cover	2/12/2026
2/10/2026	18:57	2/10/2026	19:12	163	34.43267	-118.64752	614	1,000	Yes	crack on surface	added soil track walk	2/12/2026
2/10/2026	18:57	2/10/2026	19:15	163	34.43261	-118.64783	219	760	Yes	crack on surface	added soil track walk	2/12/2026
2/10/2026	18:57	2/10/2026	19:19	164	34.43243	-118.64834	208	380	No			
2/19/26	21:19	2/19/2026	21:43	214	34.43104	-118.65012	358	940	Yes	crack on surface	added soil track walk	2/20/2026
2/19/26	22:31	2/19/2026	22:50	78	34.43716	-118.64607	711	990	Yes	crack on surface	added soil track walk	2/20/2026
2/24/26	15:57	2/24/2026	16:24	173	34.43459	-118.64993	221	580	Yes	unknown	no issues found; no cracks or tears of geomembrane cover	2/26/2026
2/24/26	16:38	2/24/2026	17:00	170	34.43437	-118.64896	952	1,000	Yes	unknown	no issues found; no cracks or tears of geomembrane cover	2/26/2026
2/24/26	18:17	2/24/2026	18:38	145	34.43704	-118.64722	312	1,000	Yes	unknown	no issues found; no cracks or tears of geomembrane cover	2/26/2026
2/24/26	19:00	2/24/2026	19:13	78	34.43716	-118.64606	387	5,000	Yes	water erosion	added soil track walk	2/25/2026
2/24/26	19:00	2/24/2026	19:14	78	34.43714	-118.64616	211	630	Yes	water erosion	added soil track walk	2/25/2026
2/24/26	19:38	2/24/2026	19:51	84	34.43321	-118.64571	368	2,000	Yes	water erosion	added soil track walk	2/25/2026
2/24/26	20:07	2/24/2026	20:33	211	34.43168	-118.65025	347	820	Yes	water erosion	added soil track walk	2/25/2026
2/24/26	20:09	2/24/2026	20:37	215	34.43150	-118.65051	392	650	Yes	water erosion	added soil track walk	2/25/2026

Week 6 (February 3-4, 2026)

Waste Connections Chiquita Canyon Landfill
Project: 2026 02 Week 06 Emission Study
Job: Emission Study
Report Submitted Feb 05, 2026

Emission Study Daily Peaks Verification Report

Information presented within provides results from the emissions monitoring inspection performed by technicians with Sniffer Robotics, Inc. associated with the emission study site and date listed herein. Following the inspection, this report will be updated and disseminated by no later than 12:00 PM local time the next morning.

This report provides details of methane leak locations as determined by the SnifferDRONE™ and manual verification of those leak locations as determined by handheld methane detectors. When an aerial surveillance reading reaches or exceeds 200 PPM methane, a follow-up ground-based surface emissions monitoring field inspection is conducted according to the procedures of OTM-51 and U.S. EPA Method 21, except in the case(s) that the site is unable to monitor the locations due to inaccessibility or dangerous conditions. Report details include: coordinate locations of SnifferDRONE leaks and manual verifications, associated location descriptions (where applicable), date and time of verified readings, SnifferDRONE identified and manually verified PPM values, additional notes, map(s) displaying locations of leaks, and photographic documentation of leaks.

Key

Manual Verification ≥ 500 ppm
Manual Verification < 500 ppm

This daily report is not meant for compliance purposes and only intended for customer review.

WEATHER CONDITIONS	Date:	**3-Feb**	**4-Feb**
	Sky:	Clear Sky	Clear Sky
	Ground:	Dry	Dry
	Temperature:	80 °F	80 °F
	Wind Direction:	NE	N
	Wind Speed:	11 MPH	3 MPH
	Barometric Pressure:	30.75"	30.72"
	Humidity:	15%	15%

LOCATION DETAILS						**INSPECTION RESULTS**						
Ref	**SnifferDRONE Lat**	**SnifferDRONE Long**	**Verified Lat**	**Verified Long**	**Location Description**	**SnifferDRONE Date (UTC)**	**SnifferDRONE Time (UTC)**	**SnifferDRONE PPM**	**Verified Date (UTC)**	**Verified Time (UTC)**	**Verified PPM**	**Notes**
1	34.429149	-118.64959	34.42913353	-118.64963		2/4/2026	18:10	671	2/4/2026	18:32	***5,000***	
2	34.430101	-118.64822	34.43013696	-118.64821		2/4/2026	18:00	1,871	2/4/2026	18:27	***2,000***	
3	34.42756	-118.64869	34.42754557	-118.64870		2/4/2026	19:15	300	2/4/2026	19:27	***2,000***	
4	34.42920	-118.65143	34.42925152	-118.65149		2/4/2026	19:54	242	2/4/2026	20:23	***1,000***	
5	34.43440	-118.64572	34.43442985	-118.64570		2/4/2026	21:29	433	2/4/2026	21:40	***1,000***	
6	34.43579	-118.64353	34.4358248	-118.64358		2/3/2026	16:18	532	2/3/2026	17:03	***950***	
7	34.43603	-118.64204	34.43610884	-118.64203		2/3/2026	16:26	515	2/3/2026	16:58	***930***	
8	34.43003	-118.65054	34.42999509	-118.65052		2/4/2026	19:53	331	2/4/2026	20:17	***860***	
9	34.43131	-118.64486	34.43126879	-118.64482		2/3/2026	20:53	392	2/3/2026	21:25	***830***	
10	34.43026	-118.65010	34.4302443	-118.65004		2/4/2026	19:51	397	2/4/2026	20:14	***690***	
11	34.42890	-118.64973	34.42890834	-118.64976		2/4/2026	18:12	520	2/4/2026	18:36	***620***	
12	34.42848	-118.65108	34.42842775	-118.65101		2/4/2026	18:07	300	2/4/2026	18:53	180	
13	34.42837	-118.64965	34.42828247	-118.64968		2/4/2026	18:14	209	2/4/2026	18:45	10	

Peak Verification Map

Project: 2026 02 Week 06 Emission Study
Job: Emission Study
Report Submitted Feb 05, 2026

Legend

Peak Verification	Drone Flight Peaks
0 – 499 PPM	200 - 499 PPM
500+ PPM	500 + PPM

Notes:
1. Basemap: As-built drawing provided by SCS Engineers, dated Dec 2023; high resolution RGB imagery provided by Waste Connections, dated Jan 2026.
2. Projected Coordinate System: WGS 1984 UTM Zone 11N

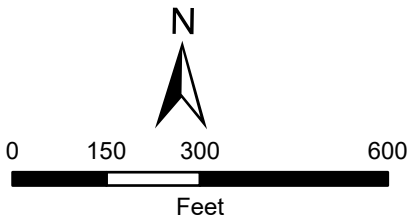

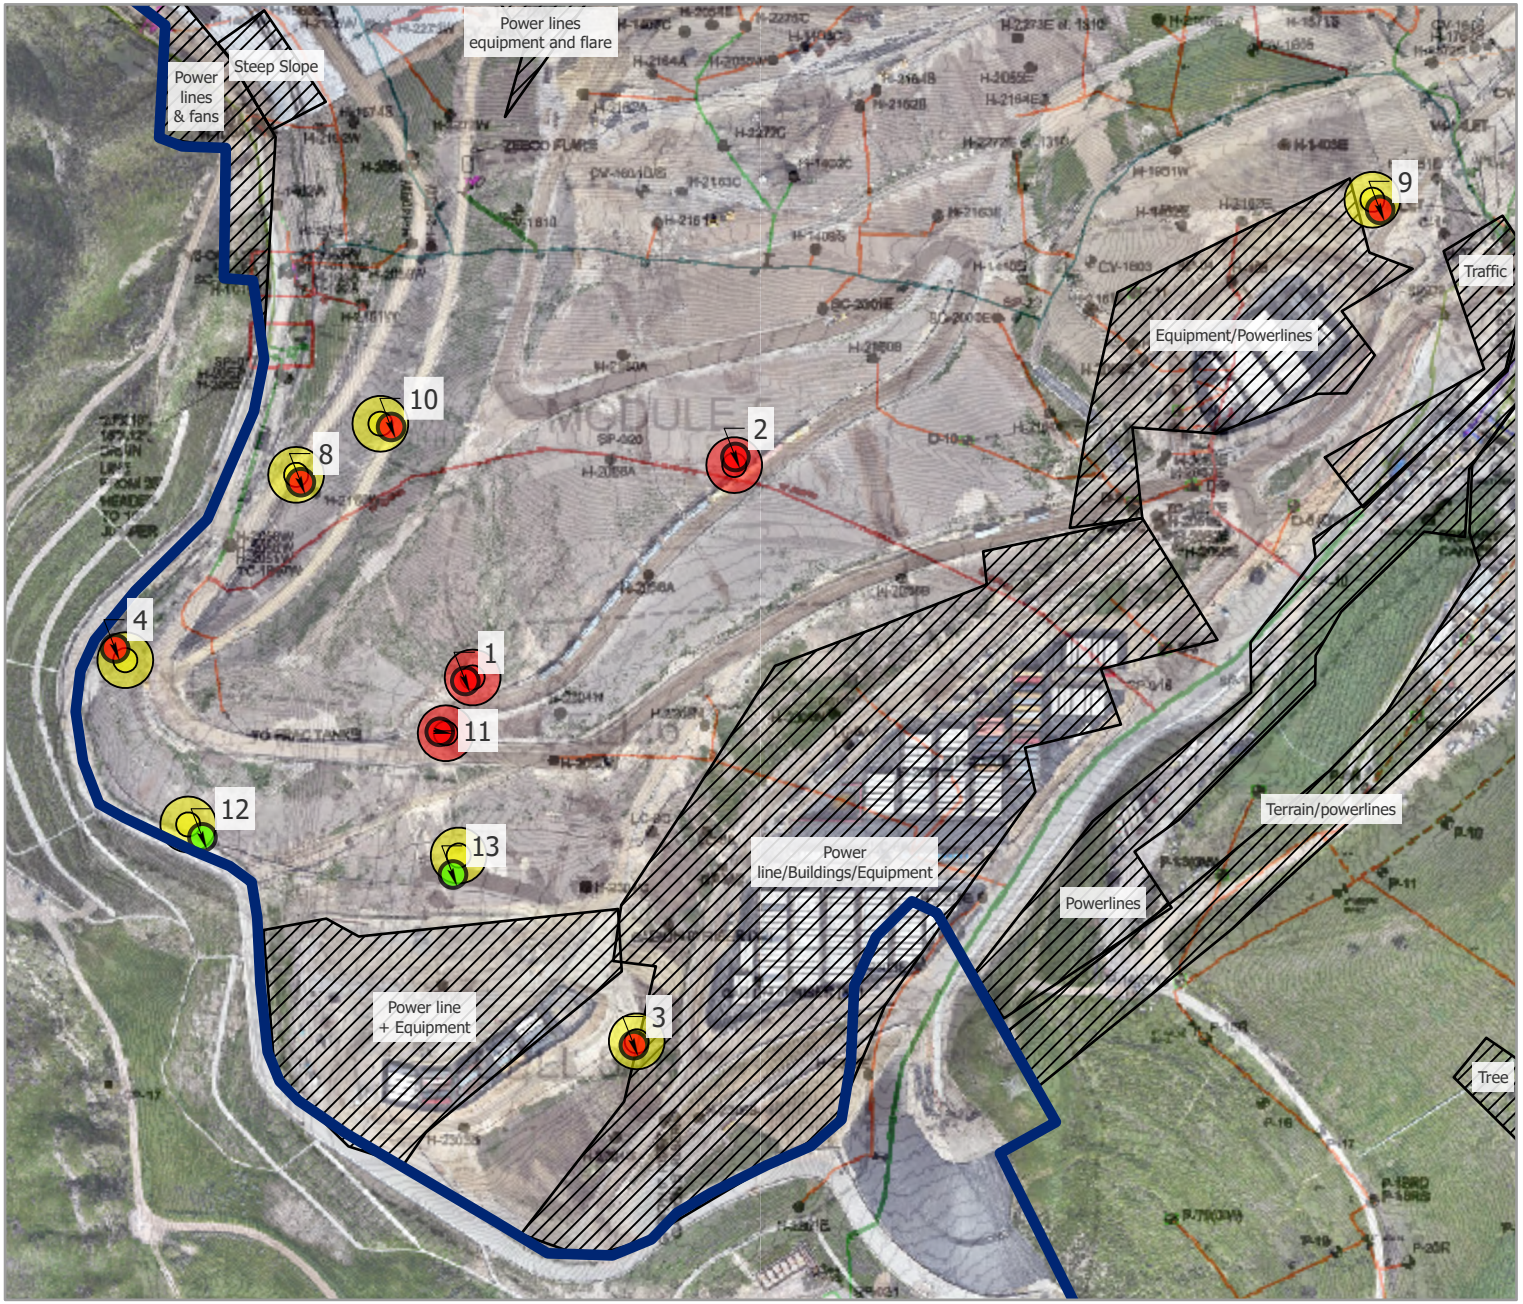

Vantor

Peak Verification Map

Project: 2026 02 Week 06 Emission Study
Job: Emission Study
Report Submitted Feb 05, 2026

Legend

Peak Verification	Drone Flight Peaks
0 – 499 PPM	200 - 499 PPM
500+ PPM	500 + PPM

Notes:
1. Basemap: As-built drawing provided by SCS Engineers, dated Dec 2023; high resolution RGB imagery provided by Waste Connections, dated Jan 2026.
2. Projected Coordinate System: WGS 1984 UTM Zone 11N

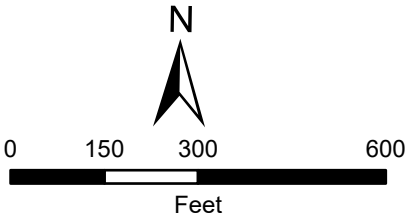

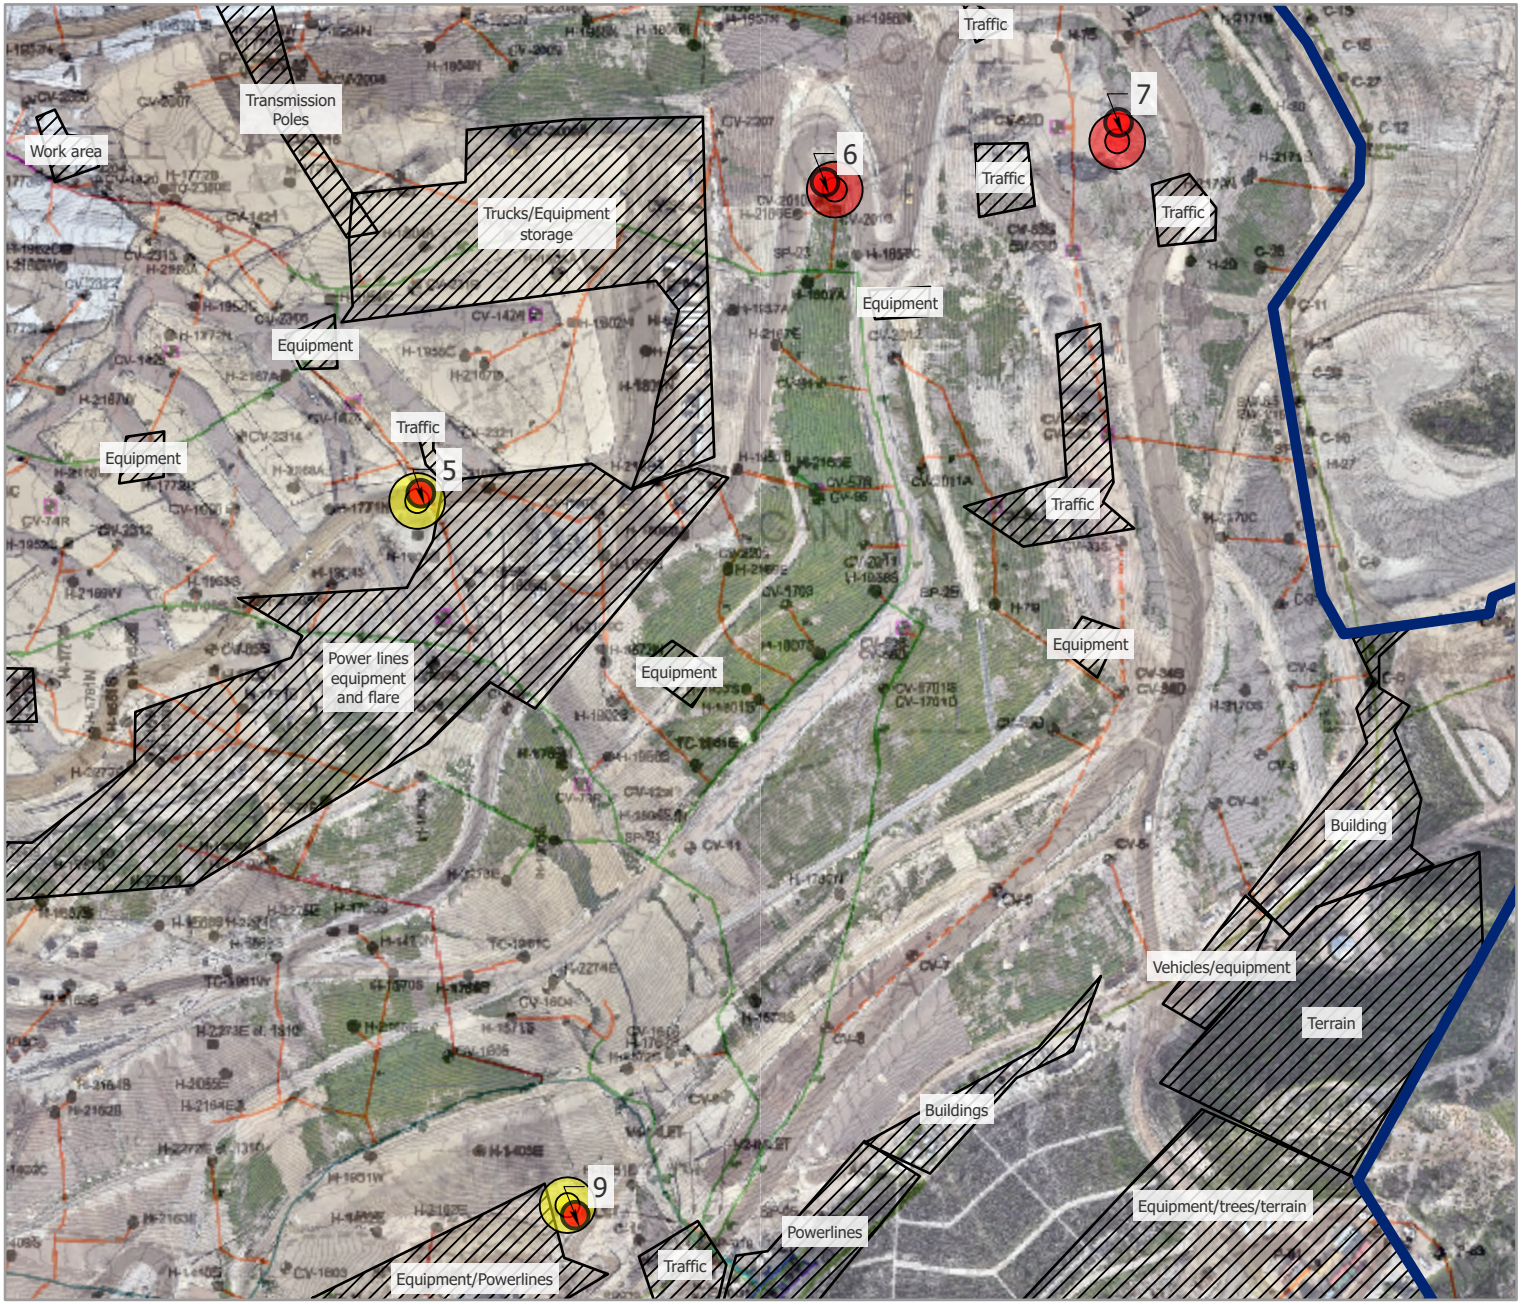

Vantor

1. SnifferDRONE Verification

2.SnifferDRONE Verification

3. SnifferDRONE Verification

4. SnifferDRONE Verification

5. SnifferDRONE Verification

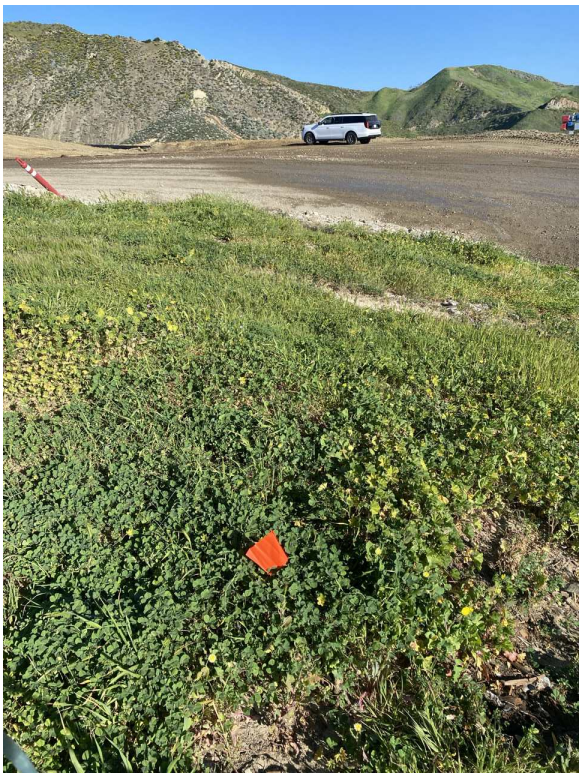

6. SnifferDRONE Verification

7. SnifferDRONE Verification

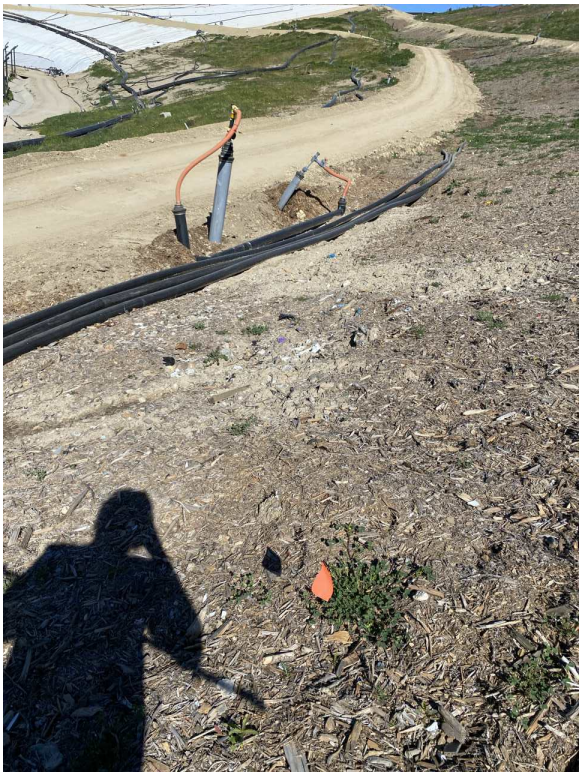

8. SnifferDRONE Verification

9. SnifferDRONE Verification

10. SnifferDRONE Verification

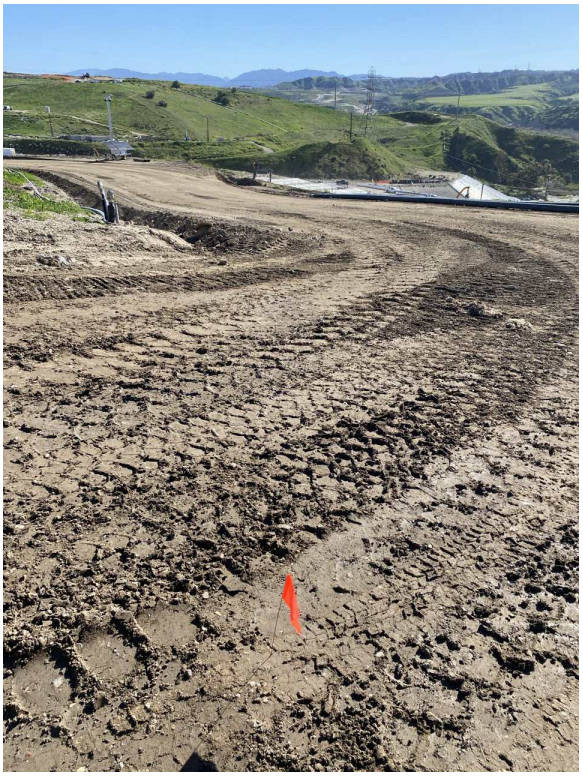

11. SnifferDRONE Verification

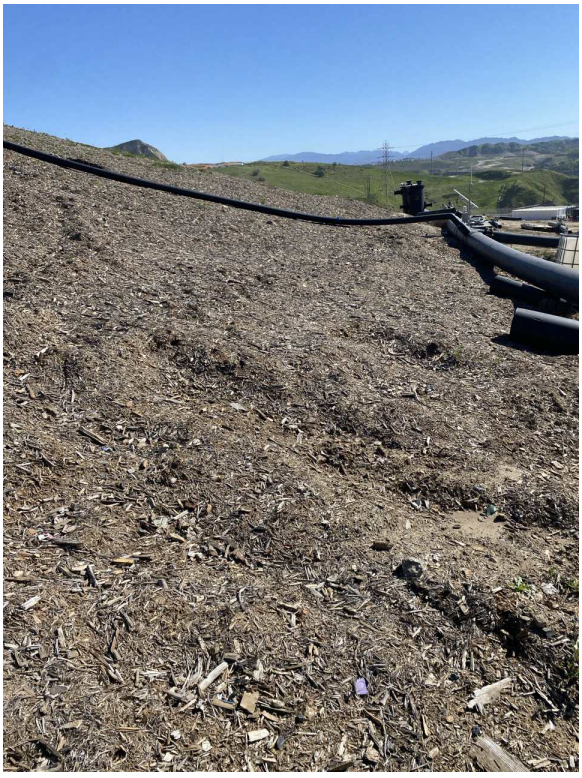

12. SnifferDRONE Verification

13. SnifferDRONE Verification

Date	Condition	Temp	Wind Speed	Wind Direction	Humidity	Barometric Pressure
3-Feb	Clear Sky	80 °F	11 MPH	NE	15%	30.75"
4-Feb	Clear Sky	80 °F	3 MPH	N	15%	30.72"

Chiquita Canyon Landfill Interpolated Methane Emissions Change as Recorded by the SnifferDRONE™, Jan 2026 to Feb 2026

01/20/26 - 02/04/26

Notes:
1. Basemap: As-built drawing provided by SCS Engineers, dated Dec 2023; high resolution RGB imagery provided by Waste Connections dated Jan 2026.
2. Projected Coordinate System: WGS 1984 UTM Zone 11N
3. Mean change from Jan. 2026 to Feb. 2026 was a 10.28 PPM decrease. Colors represent standard deviations from the mean. PPMs within one standard deviation are not shown.

Legend

- 3,111 - 78 PPM Decrease
- 77 - 51 PPM Decrease
- 50 - 24 PPM Decrease
- 23 PPM Decrease - 3 PPM Increase
- 4 - 30 PPM Increase
- 31 - 219 PPM Increase

Chiquita Canyon Landfill Interpolated Methane Emissions as Recorded by the SnifferDRONE™, over As-Built Drawing

Feb 3-4, 2026

Notes:
1. Basemap: As-built drawing provided by SCS Engineers, dated Dec 2023; high resolution RGB imagery provided by Waste Connections dated Jan 2026.
2. Projected Coordinate System: WGS 1984 UTM Zone 11N

N

0 200 400 800
Feet

Legend

CH4 PPM

200
156.64
117.58
78.52
39.45
0

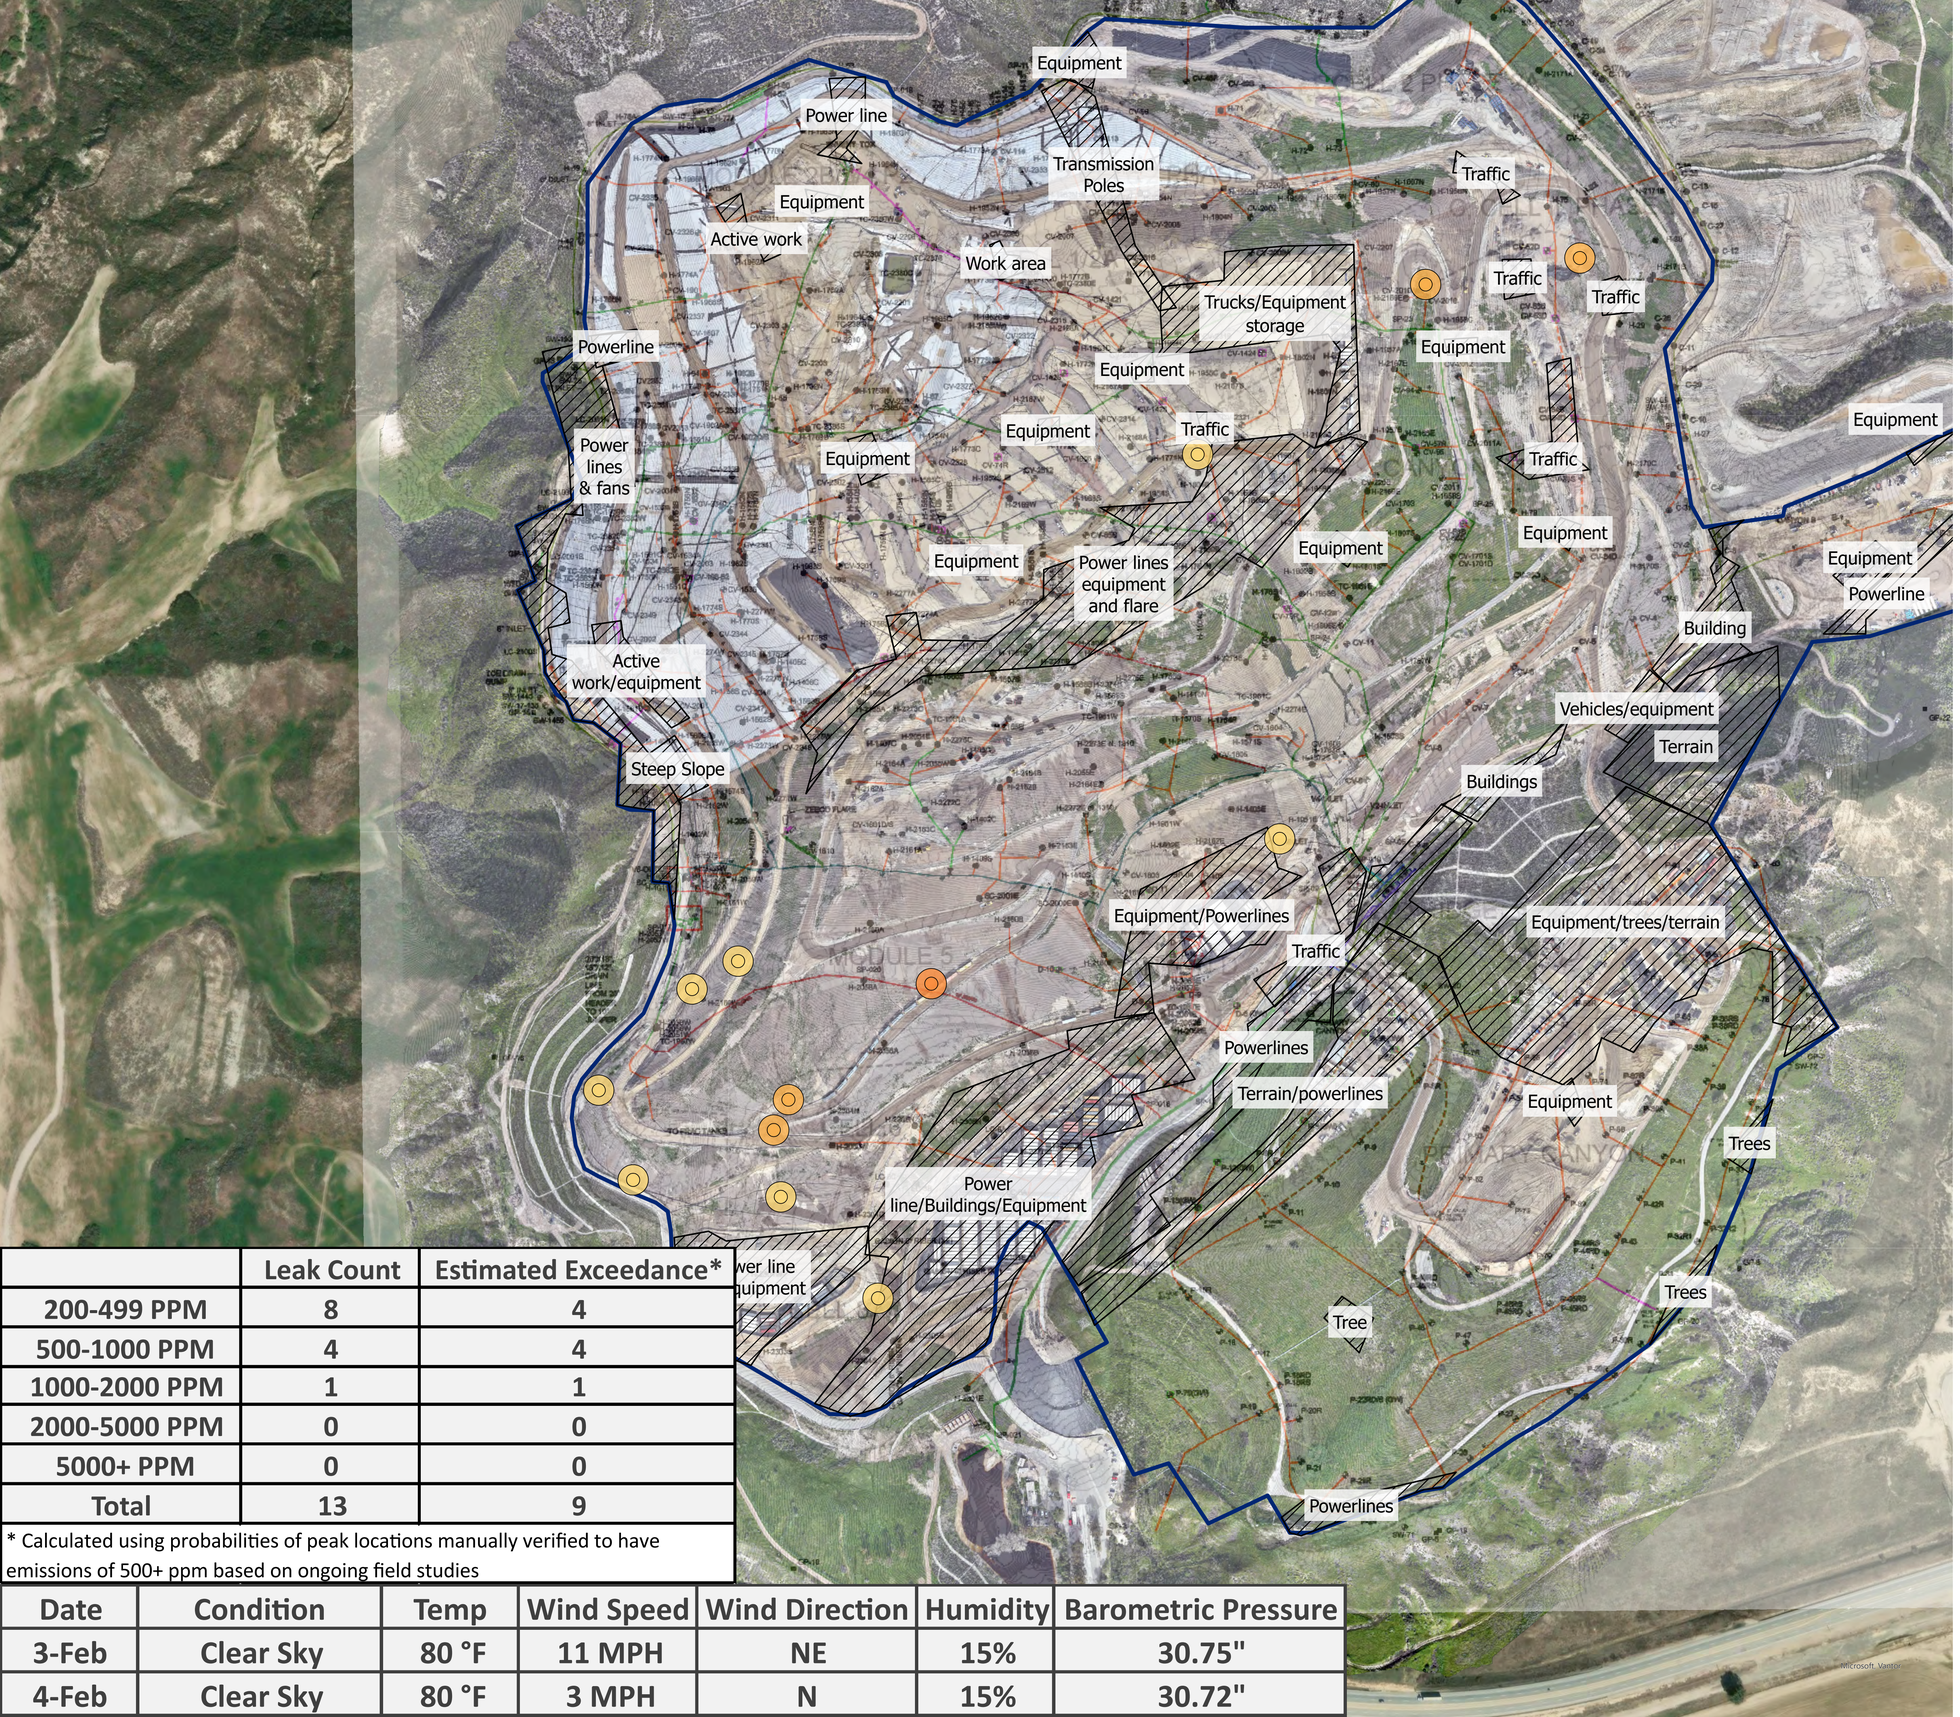

	Leak Count	Estimated Exceedance*
200-499 PPM	8	4
500-1000 PPM	4	4
1000-2000 PPM	1	1
2000-5000 PPM	0	0
5000+ PPM	0	0
Total	13	9

* Calculated using probabilities of peak locations manually verified to have emissions of 500+ ppm based on ongoing field studies

Date	Condition	Temp	Wind Speed	Wind Direction	Humidity	Barometric Pressure
3-Feb	Clear Sky	80 °F	11 MPH	NE	15%	30.75"
4-Feb	Clear Sky	80 °F	3 MPH	N	15%	30.72"

Chiquita Canyon Landfill Methane Emissions Local Peak Values as Recorded by the SnifferDRONE™, over As-Built Drawing

Feb 3-4, 2026

Notes:
1. Basemap: As-built drawing provided by SCS Engineers, dated Dec 2023; high resolution RGB imagery provided by Waste Connections, dated Jan 2026.
2. Projected Coordinate System: WGS 1984 UTM Zone 11N

Legend

- < 200 PPM
- 200 - 499 PPM
- 500 - 999 PPM
- 1,000 - 1,999 PPM
- 2,000 - 4,999 PPM
- 5000 + PPM

N

0 200 400 800

Feet

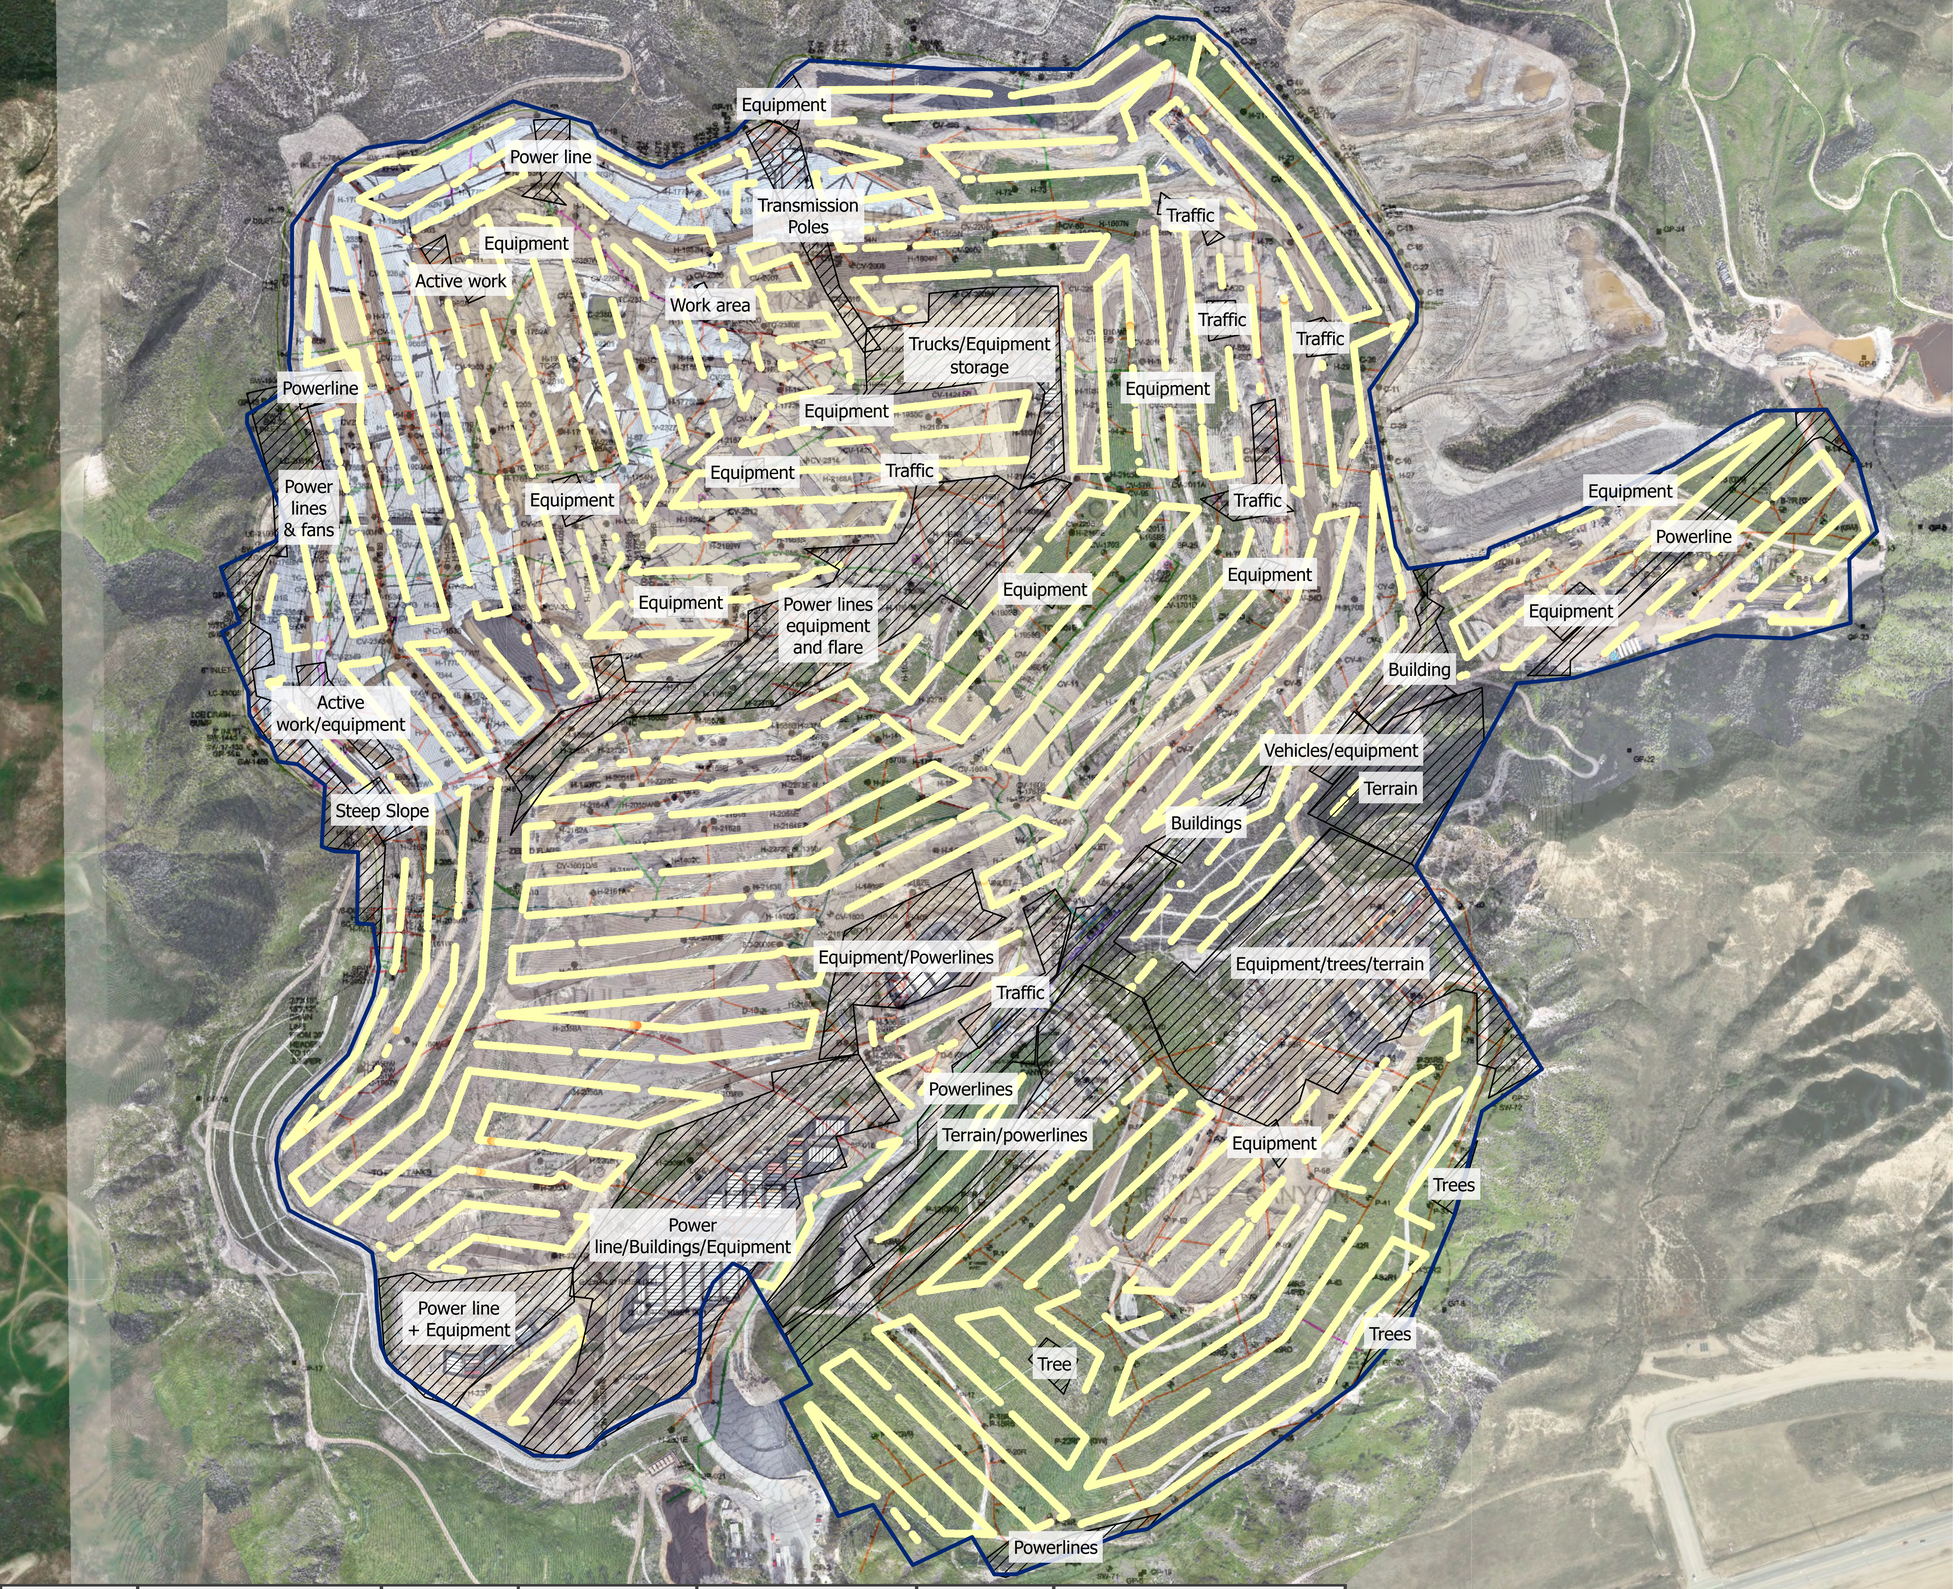

Date	Condition	Temp	Wind Speed	Wind Direction	Humidity	Barometric Pressure
3-Feb	Clear Sky	80 °F	11 MPH	NE	15%	30.75"
4-Feb	Clear Sky	80 °F	3 MPH	N	15%	30.72"

Chiquita Canyon Landfill Point Methane Emissions as Recorded by the SnifferDRONE™, over As-Built Drawing

Feb 3-4, 2026

Notes:
1. Basemap: As-built drawing provided by SCS Engineers, dated Dec 2023; high resolution RGB imagery provided by Waste Connections, dated Jan 2026.
2. Projected Coordinate System: WGS 1984 UTM Zone 11N

N

0 200 400 800
Feet

Legend

- < 200 PPM
- 200 - 499 PPM
- 500 - 999 PPM
- 1,000 - 1,999 PPM
- 2,000 - 5,000 PPM
- 5,000 + PPM

Week 7 (February 10, 2026)

Waste Connections Chiquita Canyon Landfill
Project: 2026 02 Week 07 Emission Study
Job: Emission Study
Report Submitted Feb 11, 2026

Emission Study Daily Peaks Verification Report

Information presented within provides results from the emissions monitoring inspection performed by technicians with Sniffer Robotics, Inc. associated with the emission study site and date listed herein. Following the inspection, this report will be updated and disseminated by no later than 12:00 PM local time the next morning.

This report provides details of methane leak locations as determined by the SnifferDRONE™ and manual verification of those leak locations as determined by handheld methane detectors. When an aerial surveillance reading reaches or exceeds 200 PPM methane, a follow-up ground-based surface emissions monitoring field inspection is conducted according to the procedures of OTM-51 and U.S. EPA Method 21, except in the case(s) that the site is unable to monitor the locations due to inaccessibility or dangerous conditions. Report details include: coordinate locations of SnifferDRONE leaks and manual verifications, associated location descriptions (where applicable), date and time of verified readings, SnifferDRONE identified and manually verified PPM values, additional notes, map(s) displaying locations of leaks, and photographic documentation of leaks.

Key

Manual Verification ≥ 500 ppm
Manual Verification < 500 ppm

This daily report is not meant for compliance purposes and only intended for customer review.

WEATHER CONDITIONS	
Date:	**10-Feb**
Sky:	Overcast Clouds
Ground:	Dry
Temperature:	61 °F
Wind Direction:	N
Wind Speed:	3 MPH
Barometric Pressure:	30.45"
Humidity:	68%

LOCATION DETAILS						INSPECTION RESULTS						
Ref	**SnifferDRONE Lat**	**SnifferDRONE Long**	**Verified Lat**	**Verified Long**	**Location Description**	**SnifferDRONE Date (UTC)**	**SnifferDRONE Time (UTC)**	**SnifferDRONE PPM**	**Verified Date (UTC)**	**Verified Time (UTC)**	**Verified PPM**	**Notes**
1	34.433783	-118.64965	34.4338326	-118.64963		2/10/2026	17:16	210	2/10/2026	17:59	***20,000***	
2	34.434283	-118.64983	34.43429289	-118.64987		2/10/2026	17:16	227	2/10/2026	17:50	***2,000***	
3	34.43268	-118.64754	34.43266612	-118.64752		2/10/2026	18:57	614	2/10/2026	19:12	***1,000***	
4	34.43413	-118.64977	34.43417439	-118.64983		2/10/2026	17:16	207	2/10/2026	17:48	***980***	Liner seam
5	34.43261	-118.64781	34.4326131	-118.64783		2/10/2026	18:57	219	2/10/2026	19:15	***760***	
6	34.43469	-118.64997	34.43474326	-118.65003		2/10/2026	17:16	383	2/10/2026	17:53	430	
7	34.43247	-118.64835	34.43242693	-118.64834		2/10/2026	18:57	208	2/10/2026	19:19	380	

Peak Verification Map

Project: 2026 02 Week 07 Emission Study
Job: Emission Study
Report Submitted Feb 11, 2026

Legend

Peak Verification
- 0 – 499 PPM
- 500+ PPM

Drone Flight Peaks
- 200 - 499 PPM
- 500 + PPM

Notes:
1. Basemap: As-built drawing provided by SCS Engineers, dated Dec 2023; high resolution RGB imagery provided by Waste Connections, dated Jan 2026.
2. Projected Coordinate System: WGS 1984 UTM Zone 11N

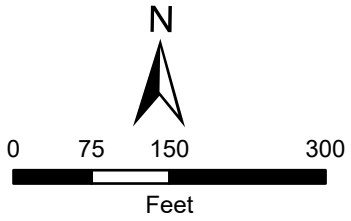

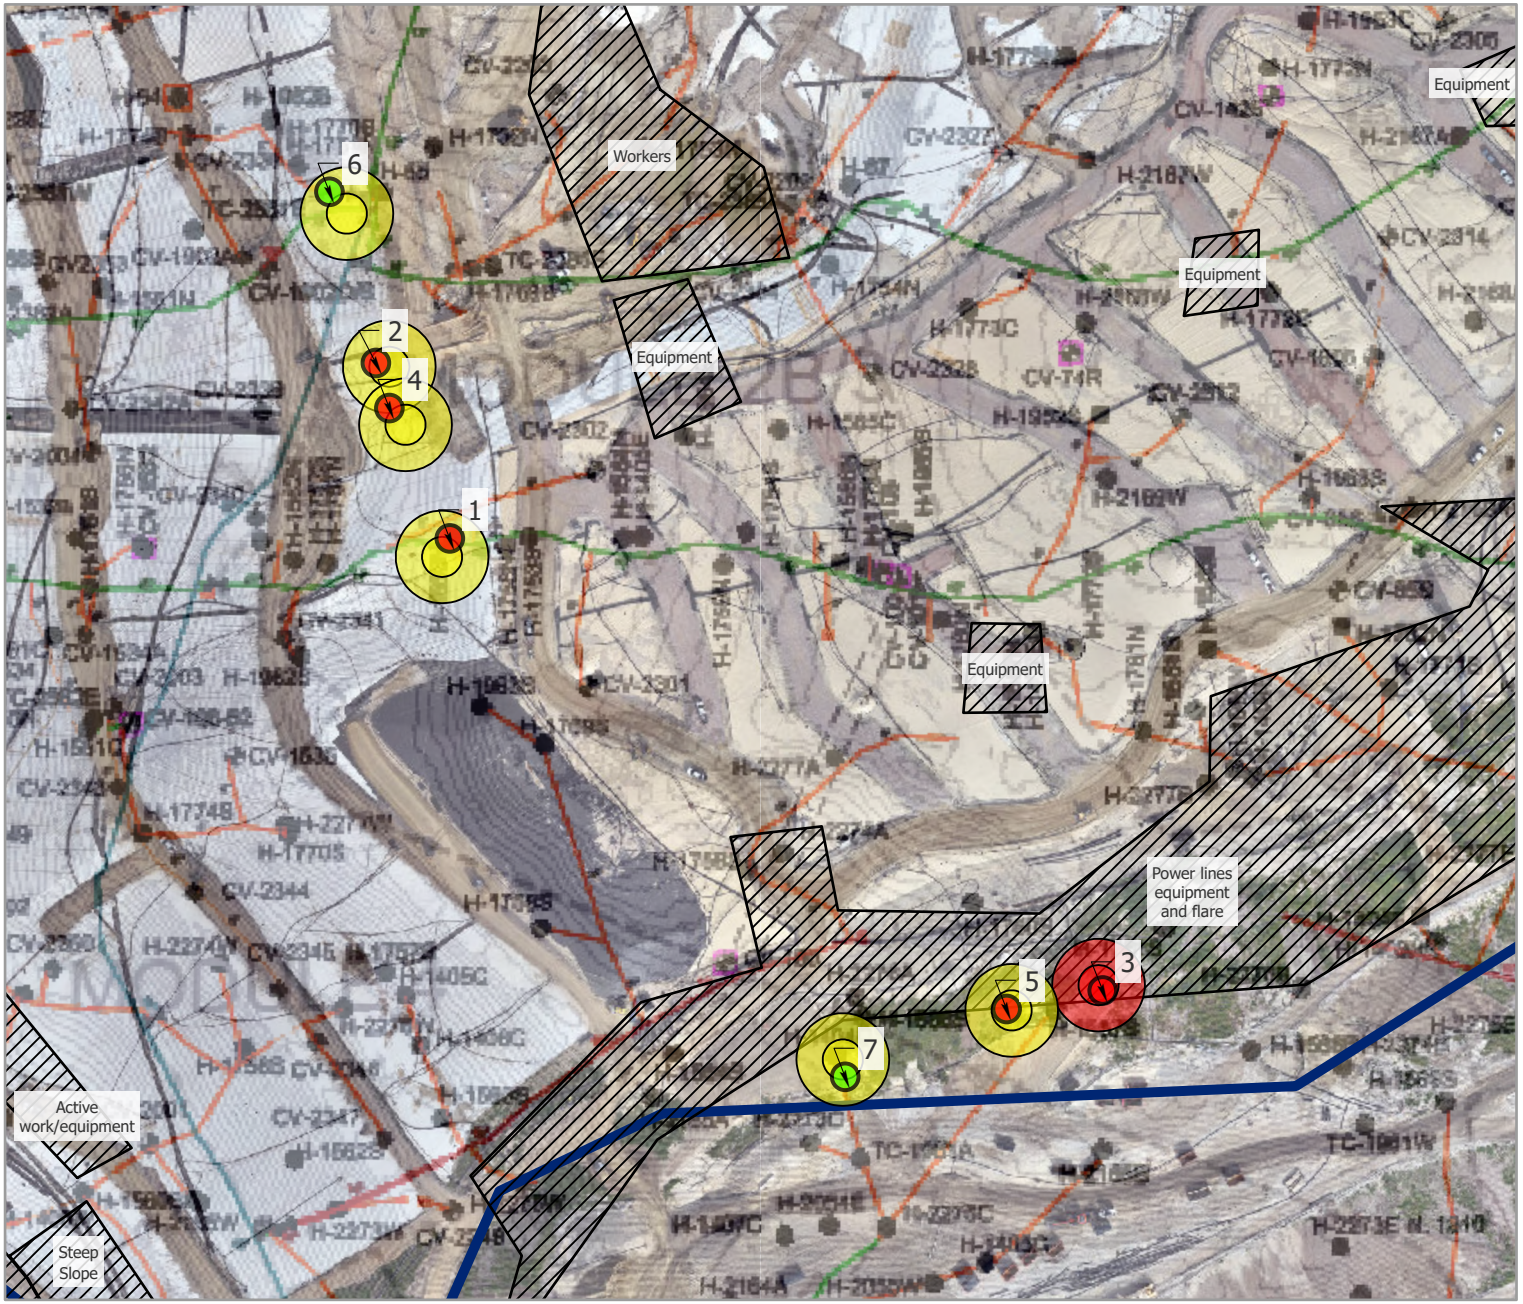

Microsoft, Vantor, Vantor

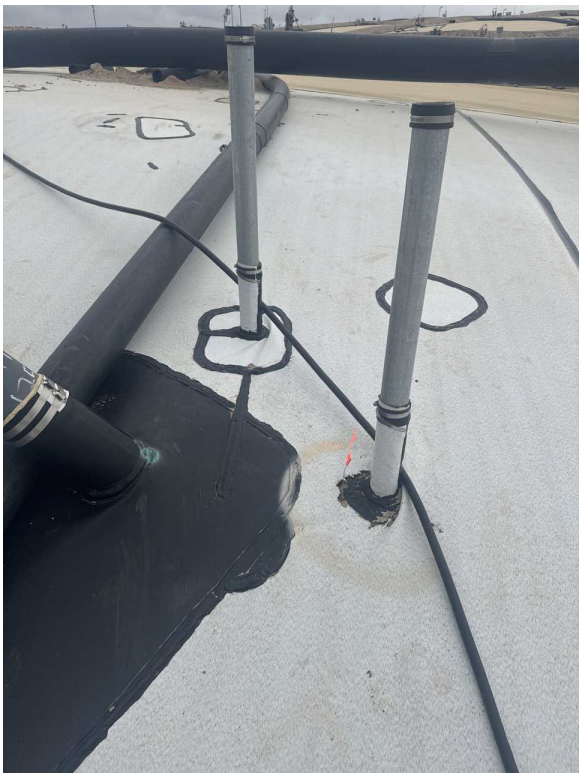

1. SnifferDRONE Verification

2. SnifferDRONE Verification

3. SnifferDRONE Verification

4. SnifferDRONE Verification

5. SnifferDRONE Verification

6. SnifferDRONE Verification

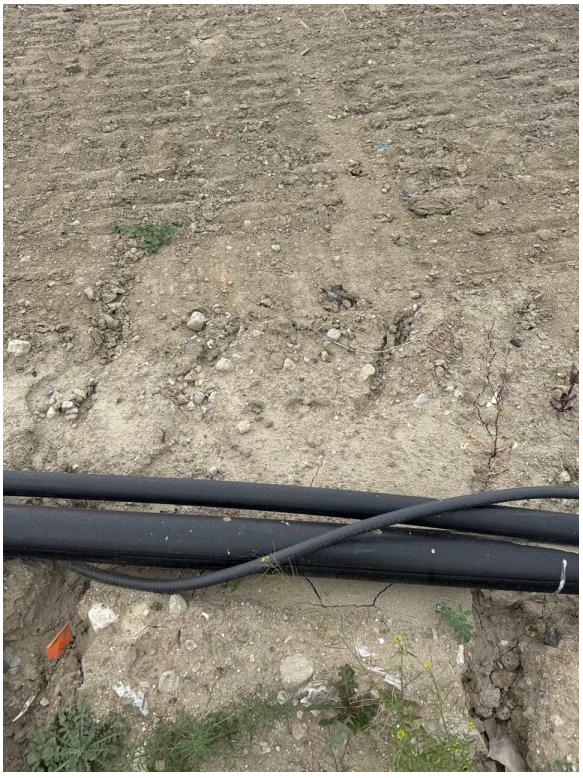

7. SnifferDRONE Verification

Date	Condition	Temp	Wind Speed	Wind Direction	Humidity	Barometric Pressure
10-Feb	Overcast Clouds	61 °F	3 MPH	N	68%	30.45"

Chiquita Canyon Landfill Interpolated Methane Emissions Change as Recorded by the SnifferDRONE™, Feb 2026 to Feb 2026

02/03/26 - 02/10/26

Notes:
1. Basemap: As-built drawing provided by SCS Engineers, dated Dec 2023; high resolution RGB imagery provided by Waste Connections dated Jan 2026.
2. Projected Coordinate System: WGS 1984 UTM Zone 11N
3. Mean change from Feb. 2026 to Feb. 2026 was a 2.18 PPM increase. Colors represent standard deviations from the mean. PPMs within one standard deviation are not shown.

Legend

- 276 - 22 PPM Decrease
- 21 - 13 PPM Decrease
- 12 - 3 PPM Decrease
- 2 PPM Decrease - 7 PPM Increase
- 8 - 17 PPM Increase
- 18 - 548 PPM Increase

Chiquita Canyon Landfill Interpolated Methane Emissions as Recorded by the SnifferDRONE™, over As-Built Drawing

Feb 10, 2026

Notes:
1. Basemap: As-built drawing provided by SCS Engineers, dated Dec 2023; high resolution RGB imagery provided by Waste Connections dated Jan 2026.
2. Projected Coordinate System: WGS 1984 UTM Zone 11N

Legend

CH4 PPM

- 200
- 156.64
- 117.58
- 78.52
- 39.45
- 0

N

0 125 250 500

Feet

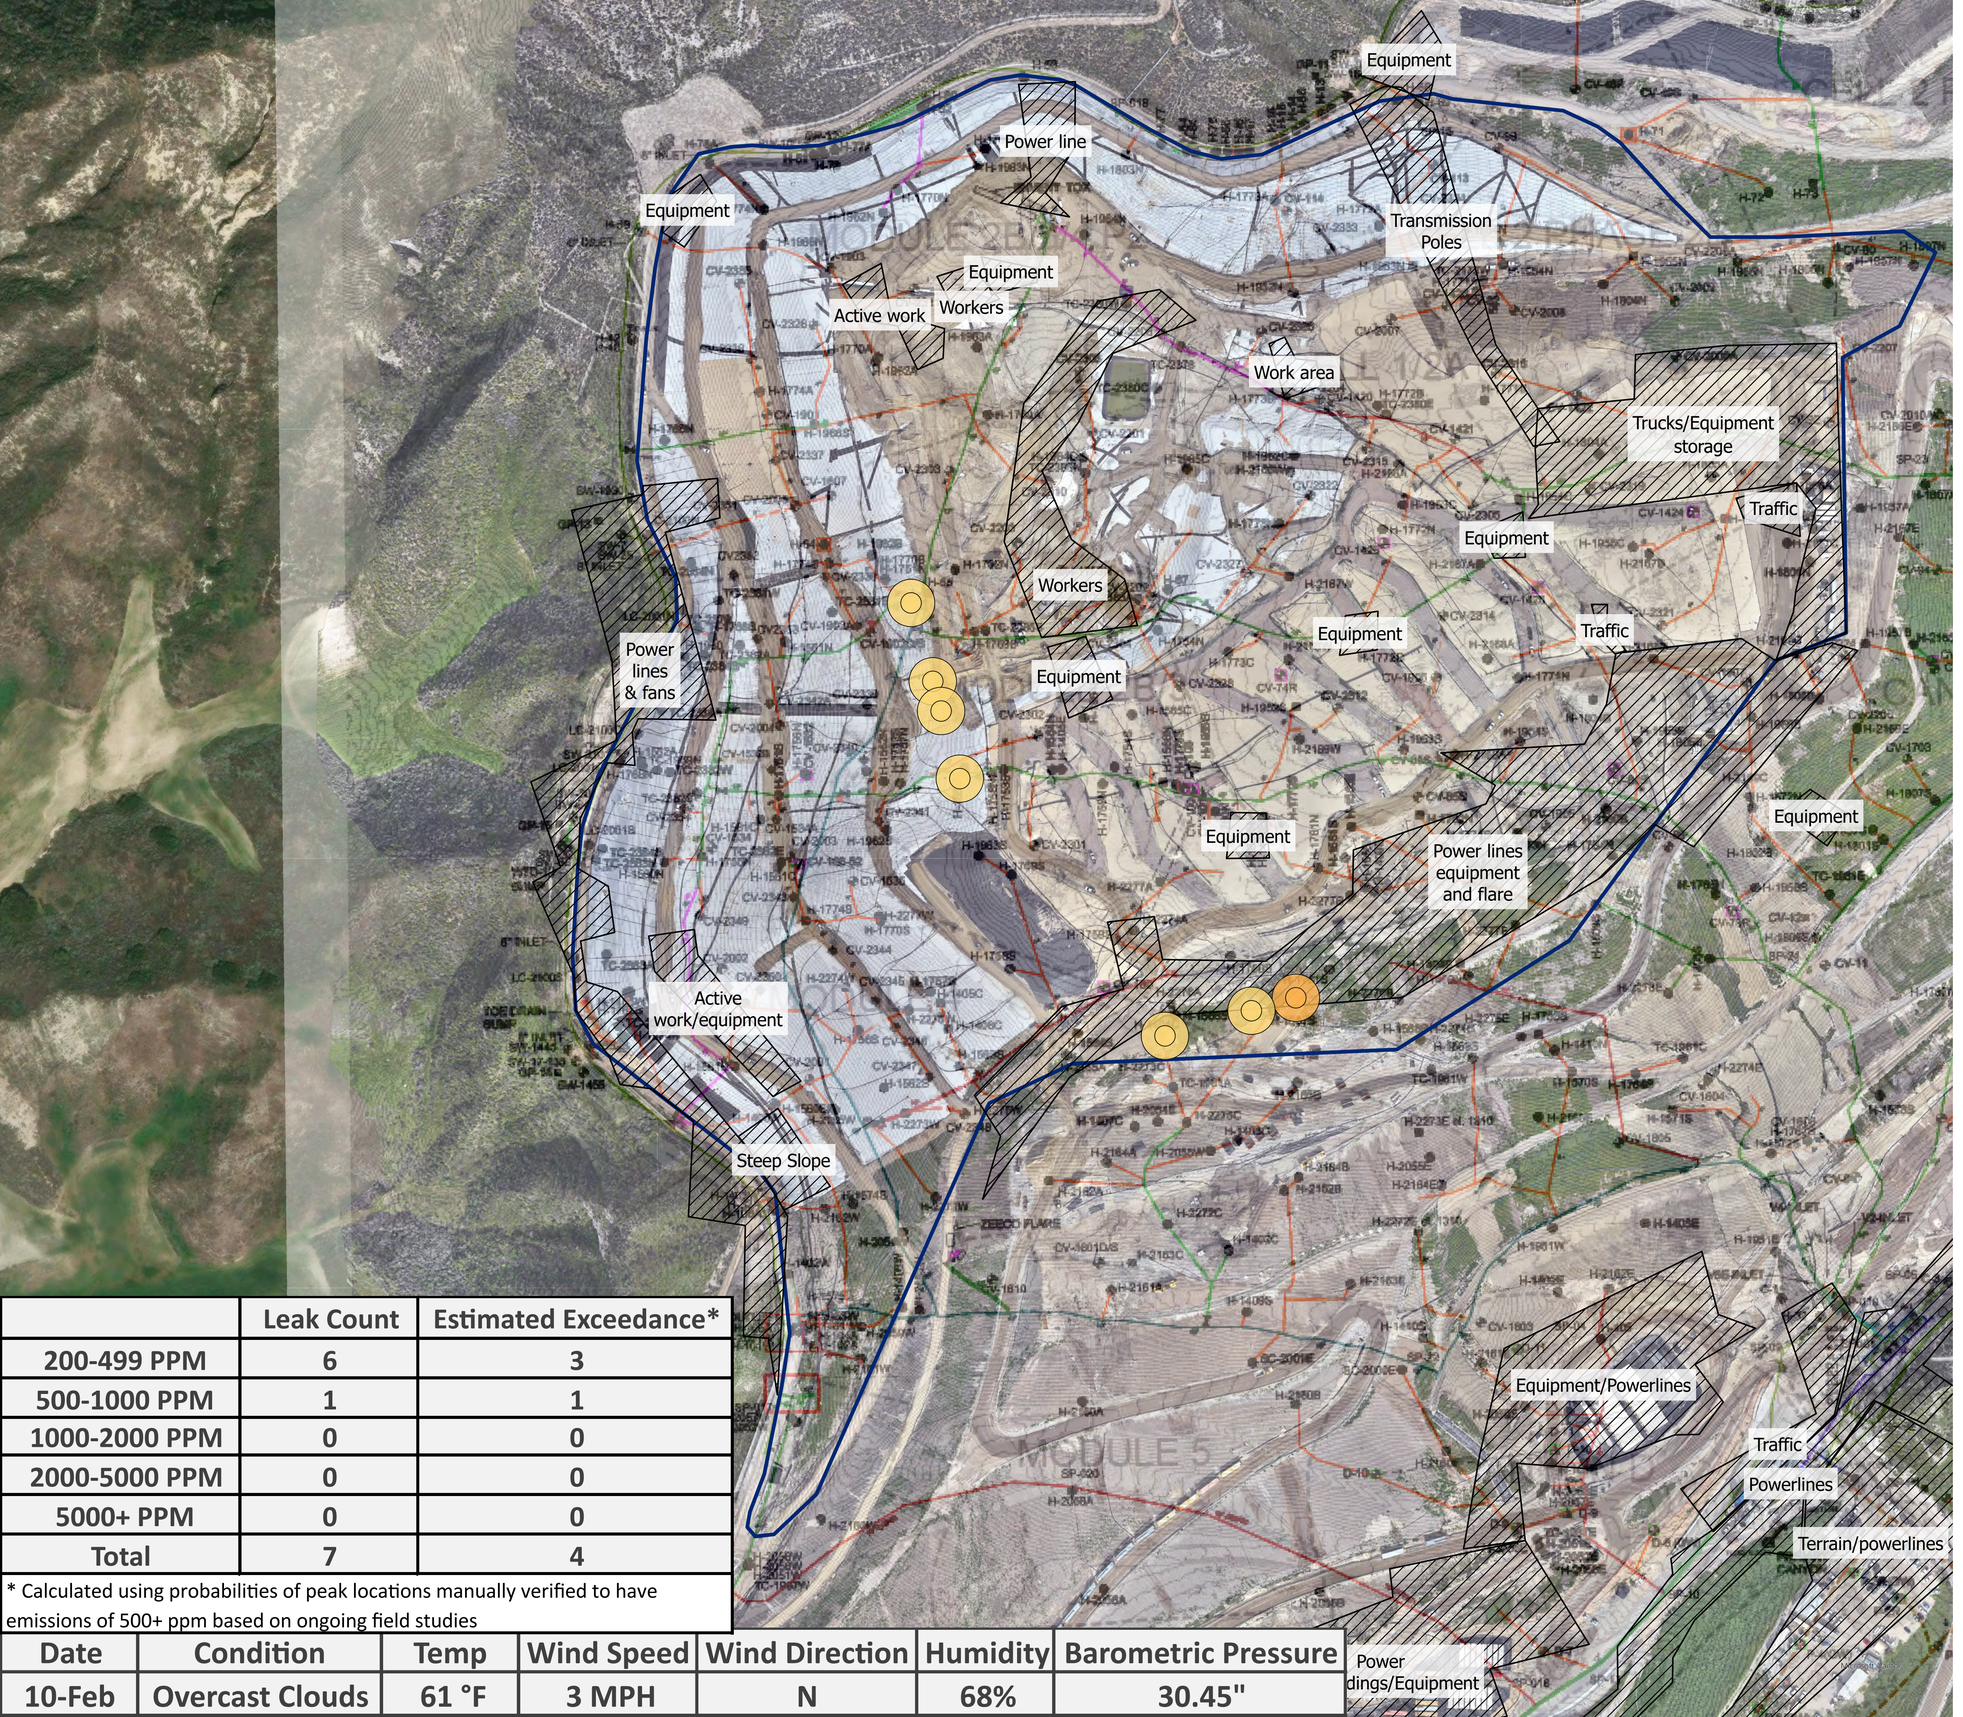

	Leak Count	Estimated Exceedance*
200-499 PPM	6	3
500-1000 PPM	1	1
1000-2000 PPM	0	0
2000-5000 PPM	0	0
5000+ PPM	0	0
Total	7	4

* Calculated using probabilities of peak locations manually verified to have emissions of 500+ ppm based on ongoing field studies

Date	Condition	Temp	Wind Speed	Wind Direction	Humidity	Barometric Pressure
10-Feb	Overcast Clouds	61 °F	3 MPH	N	68%	30.45"

sniffer

Chiquita Canyon Landfill Methane Emissions Local Peak Values as Recorded by the SnifferDRONE™, over As-Built Drawing

Feb 10, 2026

Notes:
1. Basemap: As-built drawing provided by SCS Engineers, dated Dec 2023; high resolution RGB imagery provided by Waste Connections, dated Jan 2026.
2. Projected Coordinate System: WGS 1984 UTM Zone 11N

Legend

- < 200 PPM
- 200 - 499 PPM
- 500 - 999 PPM
- 1,000 - 1,999 PPM
- 2,000 - 4,999 PPM
- 5000 + PPM

N

0 125 250 500

Feet

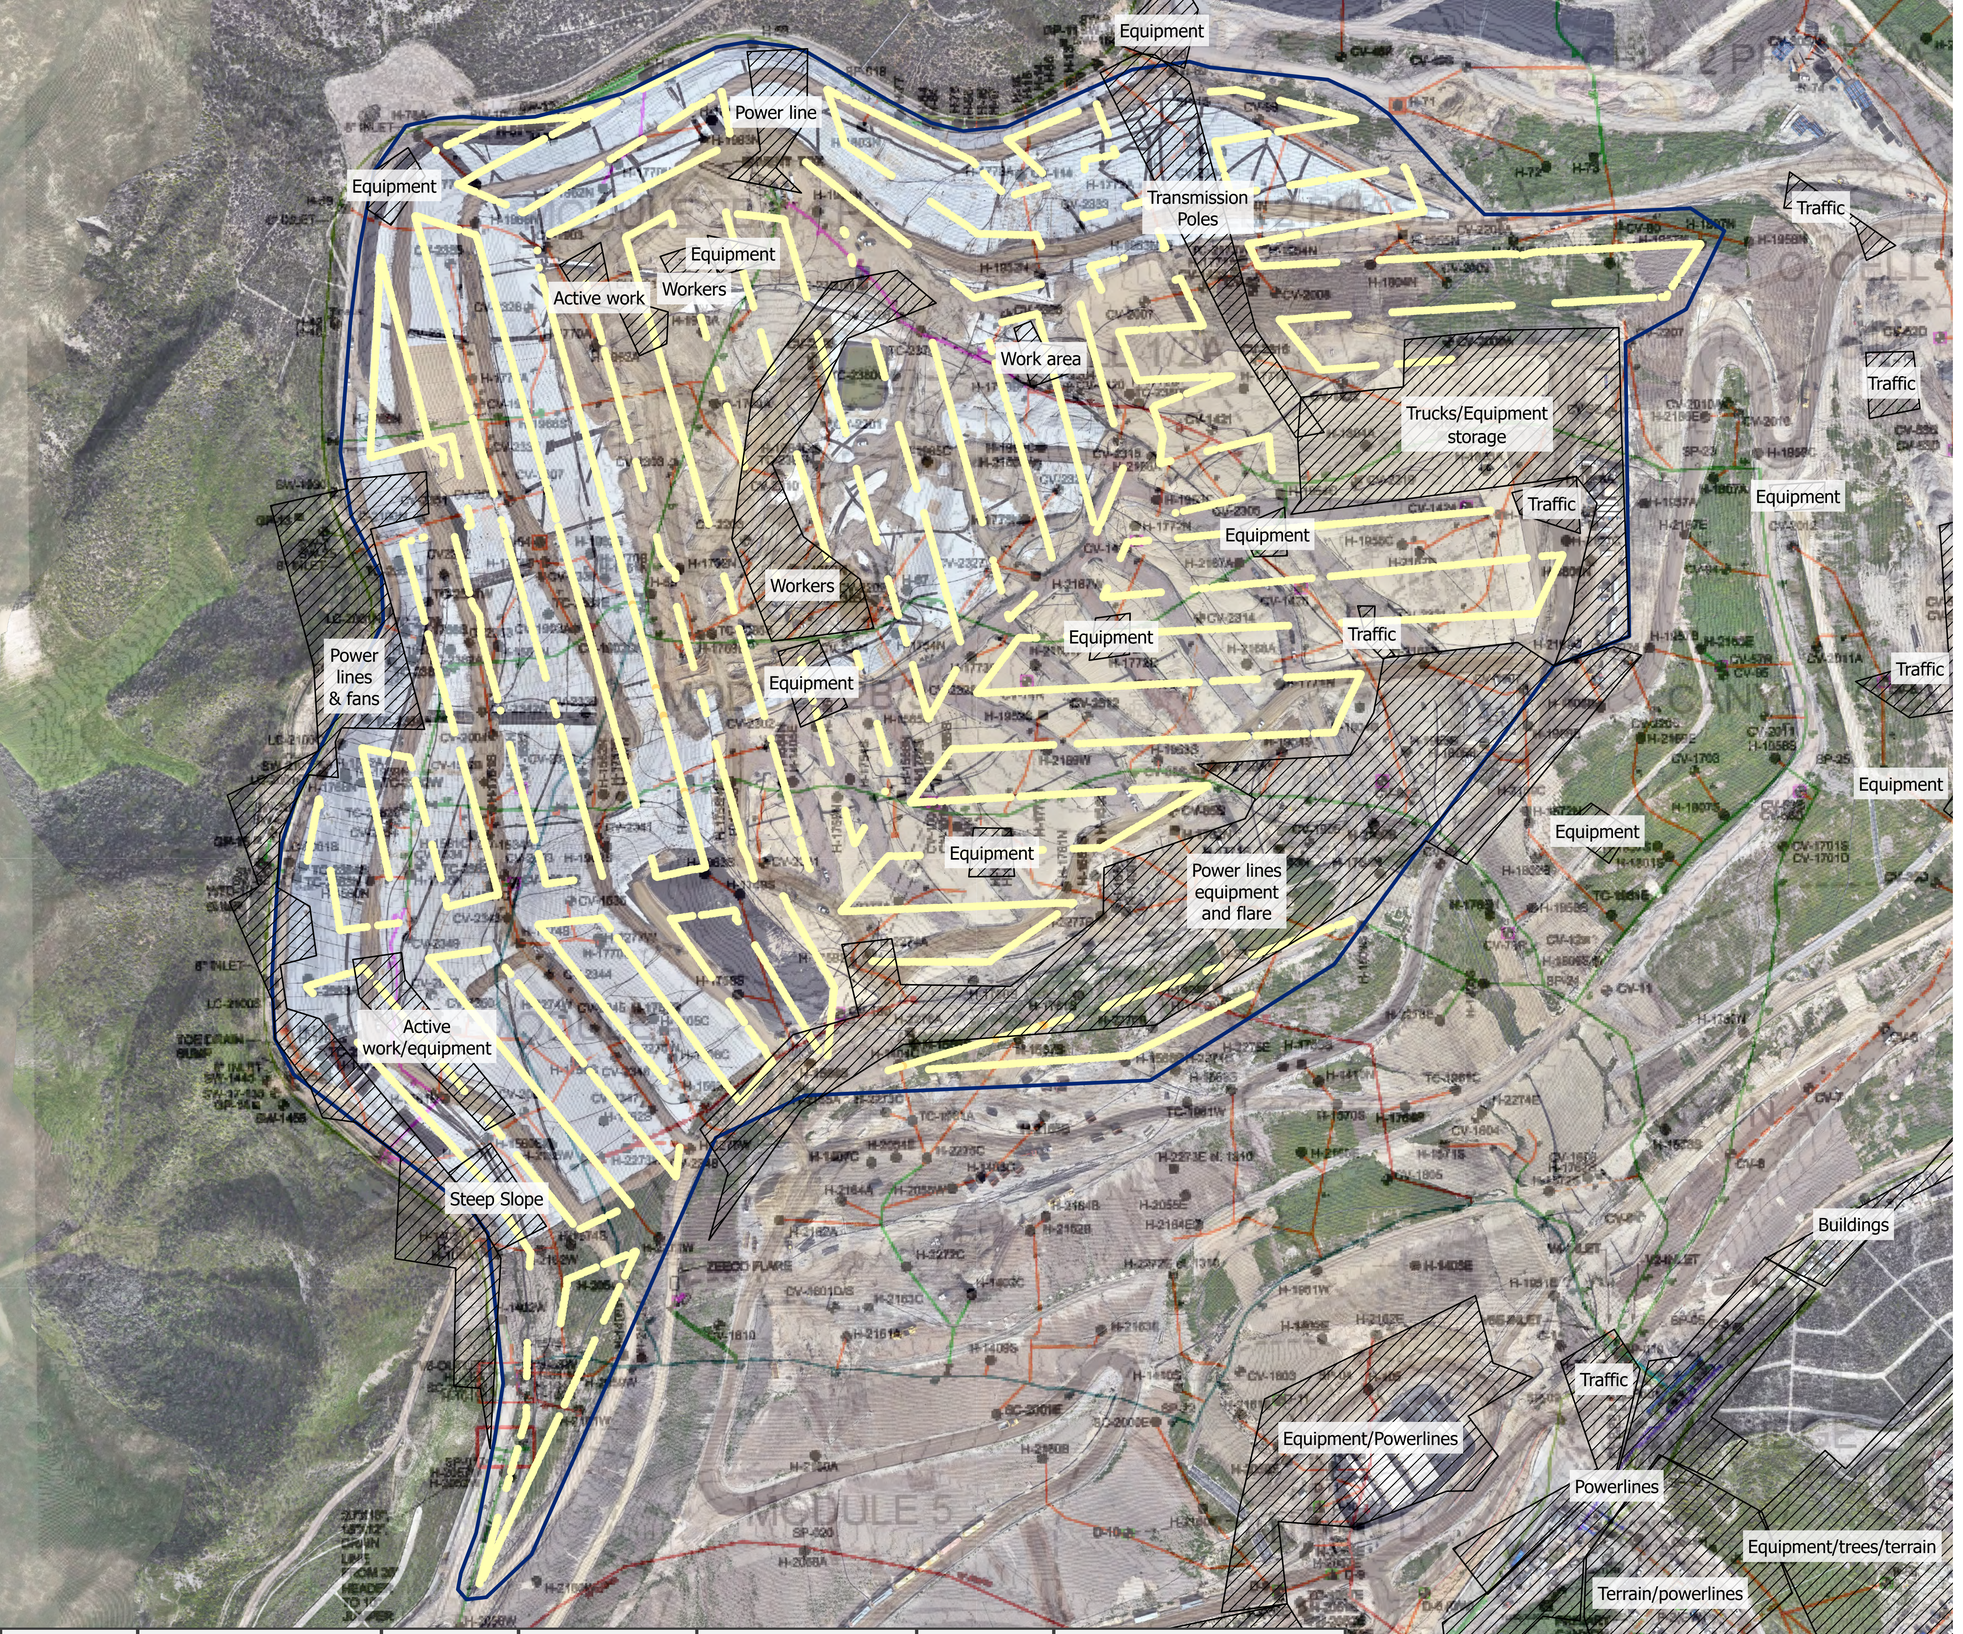

Date	Condition	Temp	Wind Speed	Wind Direction	Humidity	Barometric Pressure
10-Feb	Overcast Clouds	61 °F	3 MPH	N	68%	30.45"

Chiquita Canyon Landfill Point Methane Emissions as Recorded by the SnifferDRONE™, over As-Built Drawing

Feb 10, 2026

Notes:
1. Basemap: As-built drawing provided by SCS Engineers, dated Dec 2023; high resolution RGB imagery provided by Waste Connections, dated Jan 2026.
2. Projected Coordinate System: WGS 1984 UTM Zone 11N

N

0 125 250 500
Feet

Legend

- < 200 PPM
- 200 - 499 PPM
- 500 - 999 PPM
- 1,000 - 1,999 PPM
- 2,000 - 5,000 PPM
- 5,000 + PPM

Week 8 (February 19, 2026)

Waste Connections Chiquita Canyon Landfill
Project: 2026 02 Week 08 Emission Study
Job: Emission Study
Report Submitted Feb 20, 2026

Emission Study Daily Peaks Verification Report

Information presented within provides results from the emissions monitoring inspection performed by technicians with Sniffer Robotics, Inc. associated with the emission study site and date listed herein. Following the inspection, this report will be updated and disseminated by no later than 12:00 PM local time the next morning.

This report provides details of methane leak locations as determined by the SnifferDRONE™ and manual verification of those leak locations as determined by handheld methane detectors. When an aerial surveillance reading reaches or exceeds 200 PPM methane, a follow-up ground-based surface emissions monitoring field inspection is conducted according to the procedures of OTM-51 and U.S. EPA Method 21, except in the case(s) that the site is unable to monitor the locations due to inaccessibility or dangerous conditions. Report details include: coordinate locations of SnifferDRONE leaks and manual verifications, associated location descriptions (where applicable), date and time of verified readings, SnifferDRONE identified and manually verified PPM values, additional notes, map(s) displaying locations of leaks, and photographic documentation of leaks.

Key

Manual Verification ≥ 500 ppm
Manual Verification < 500 ppm

This daily report is not meant for compliance purposes and only intended for customer review.

WEATHER CONDITIONS	
Date:	**19-Feb**
Sky:	Overcast Clouds
Ground:	Dry
Temperature:	49 °F
Wind Direction:	NE
Wind Speed:	5 MPH
Barometric Pressure:	30.30"
Humidity:	78%

LOCATION DETAILS						**INSPECTION RESULTS**						
Ref	**SnifferDRONE Lat**	**SnifferDRONE Long**	**Verified Lat**	**Verified Long**	**Location Description**	**SnifferDRONE Date (UTC)**	**SnifferDRONE Time (UTC)**	**SnifferDRONE PPM**	**Verified Date (UTC)**	**Verified Time (UTC)**	**Verified PPM**	**Notes**
1	34.437151	-118.64611	34.43715764	-118.64607		2/19/2026	22:31	711	2/19/2026	22:50	***990***	
2	34.431034	-118.65017	34.43104376	-118.65012		2/19/2026	21:19	358	2/19/2026	21:43	***940***	

Peak Verification Map

Project: 2026 02 Week 08 Emission Study
Job: Emission Study
Report Submitted Feb 20, 2026

Legend

Peak Verification	Drone Flight Peaks
0 – 499 PPM	200 - 499 PPM
500+ PPM	500 + PPM

Notes:
1. Basemap: As-built drawing provided by SCS Engineers, dated Dec 2023; high resolution RGB imagery provided by Waste Connections, dated Jan 2026.
2. Projected Coordinate System: WGS 1984 UTM Zone 11N

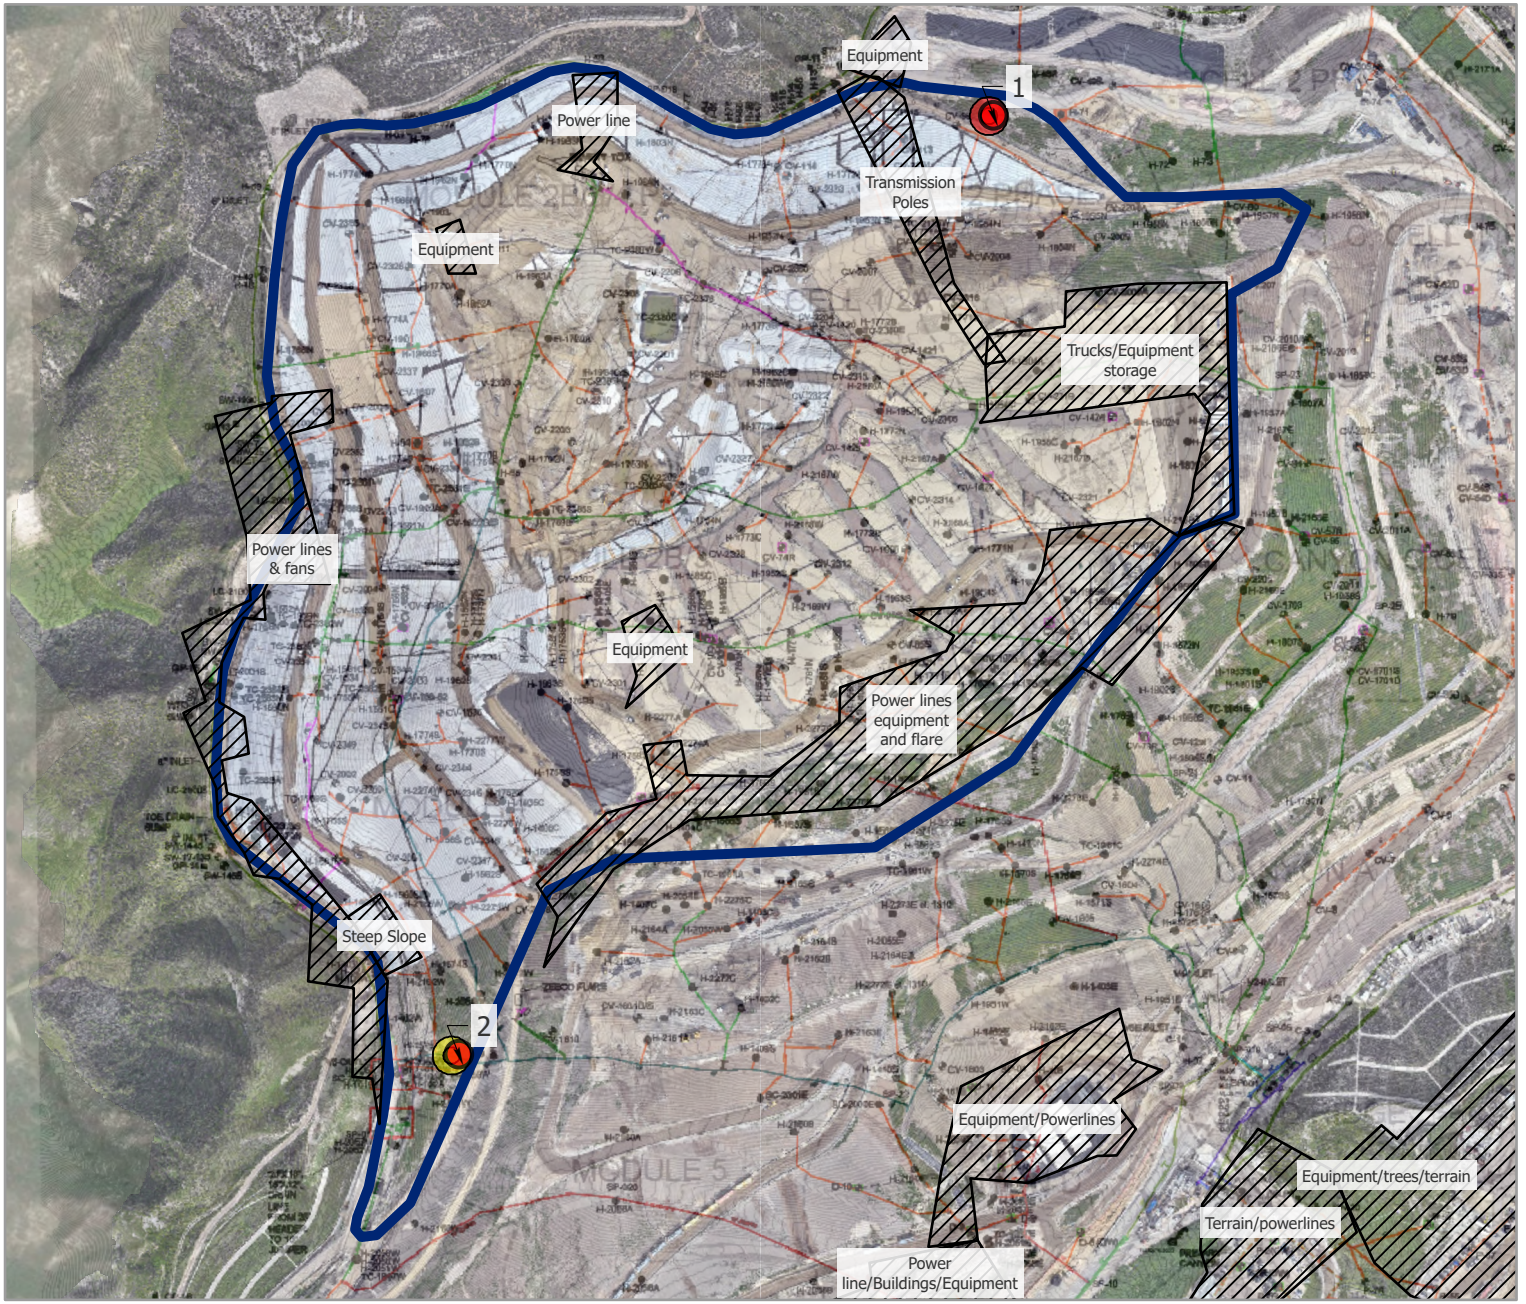

N

0 150 300 600

Feet

Vantor

1. SnifferDRONE Verification

2. SnifferDRONE Verification

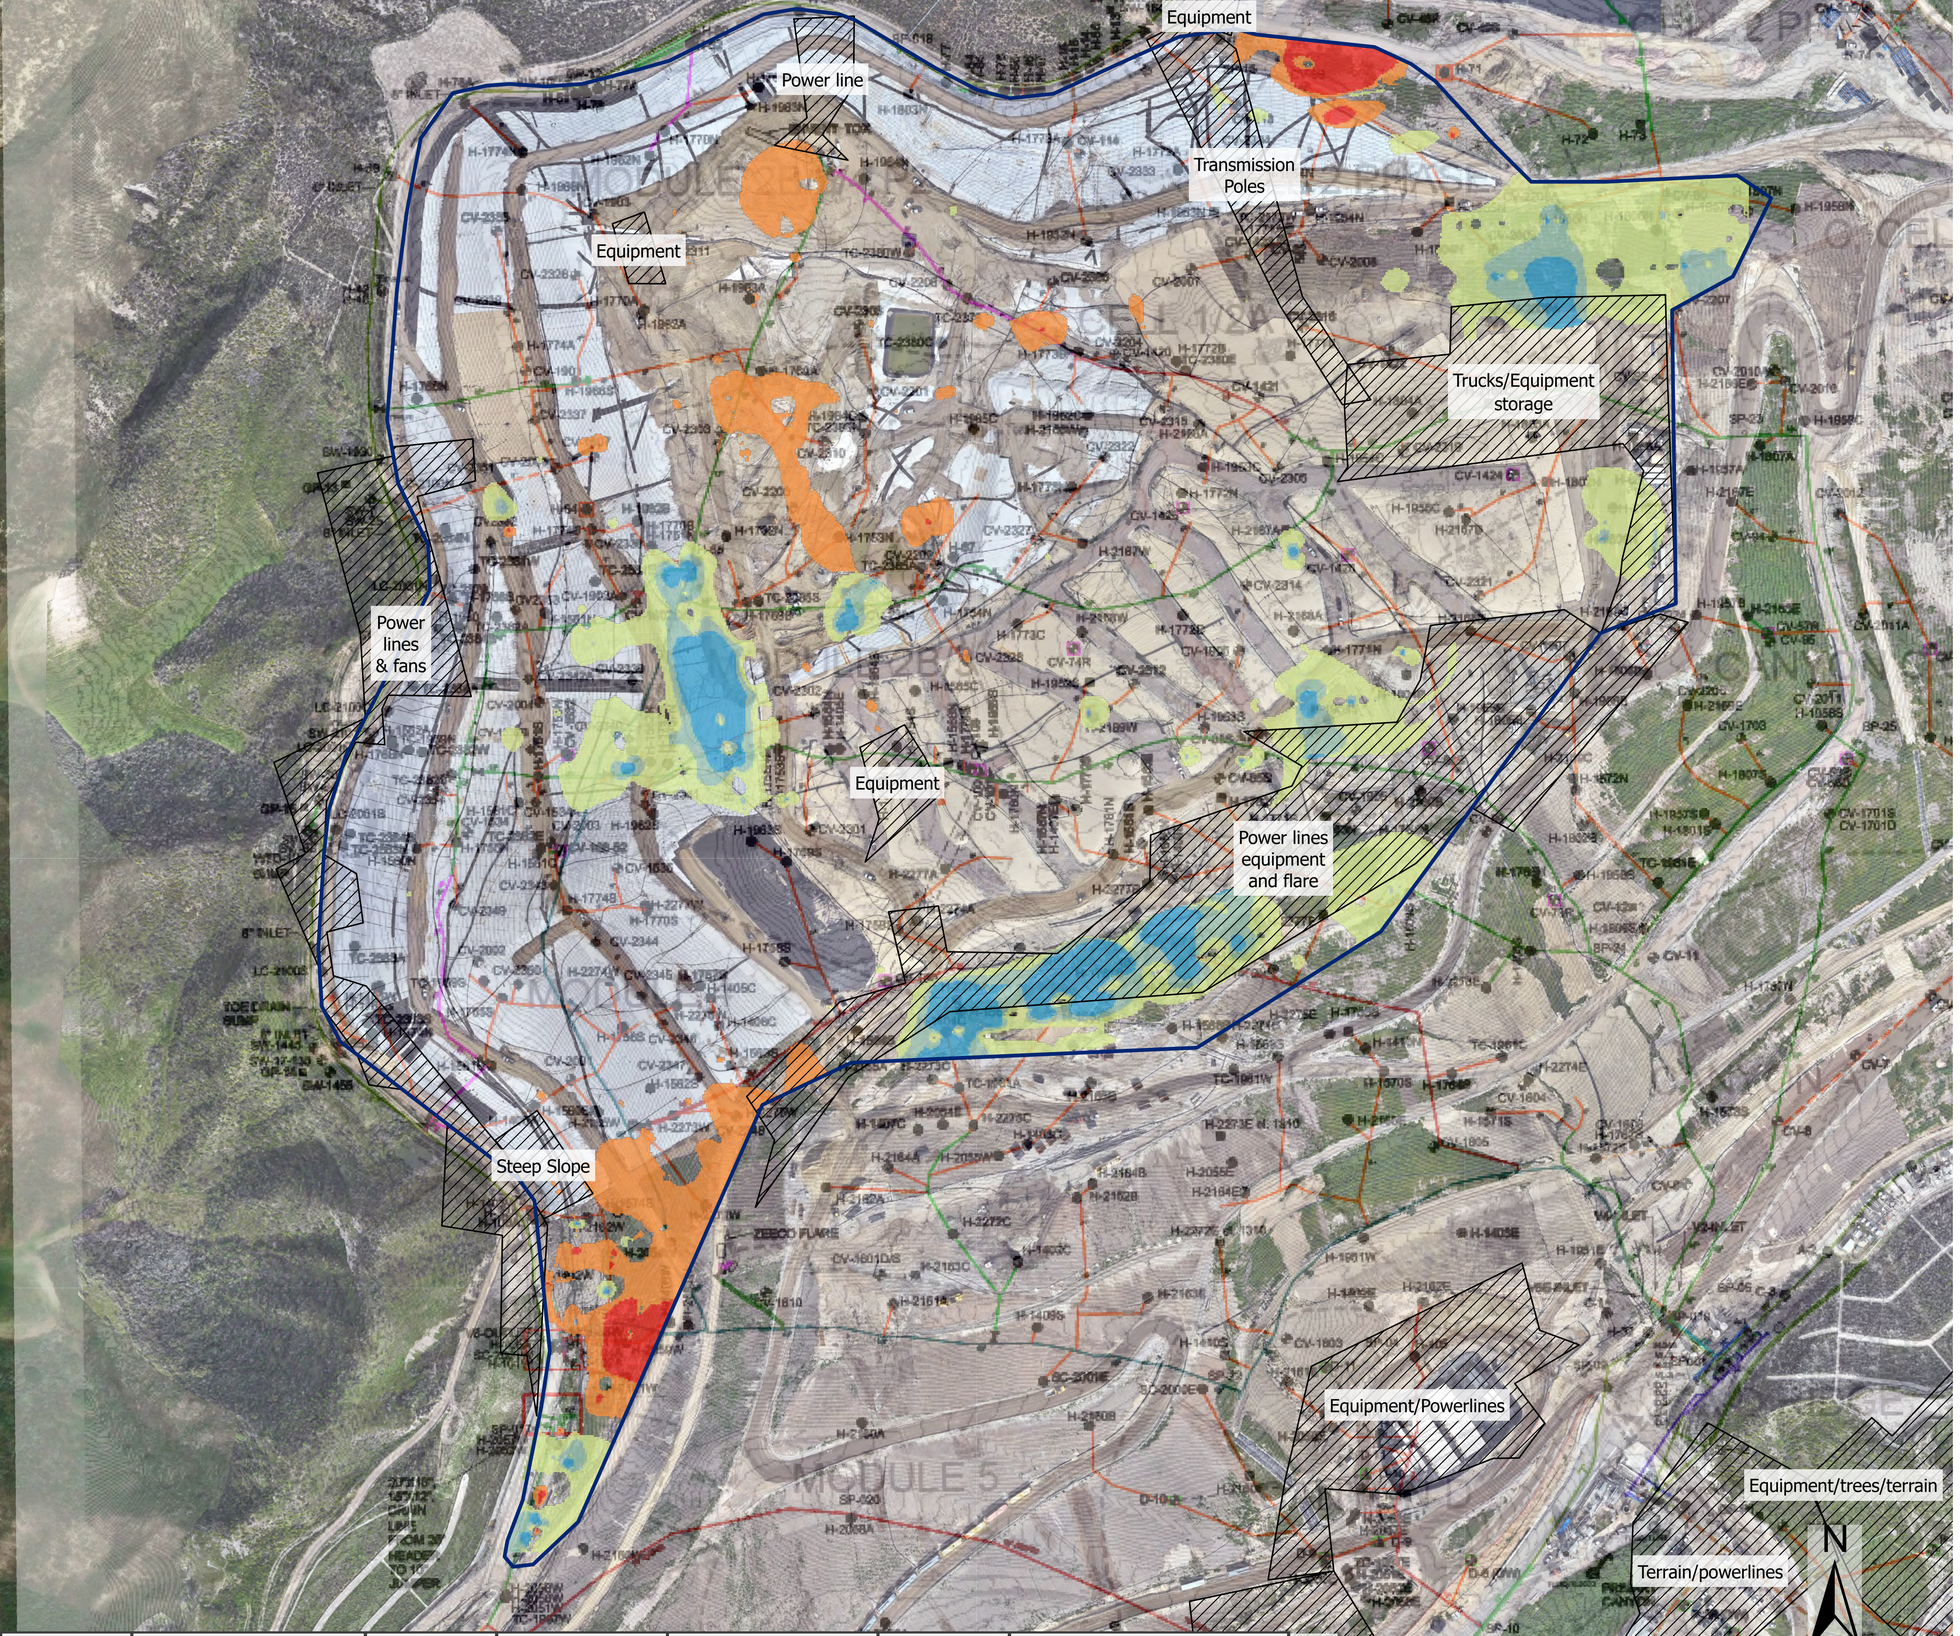

Date	Condition	Temp	Wind Speed	Wind Direction	Humidity	Barometric Pressure
19-Feb	Overcast Clouds	49 °F	5 MPH	NE	78%	30.30"

Chiquita Canyon Landfill Interpolated Methane Emissions Change as Recorded by the SnifferDRONE™, Feb 2026 to Feb 2026

02/10/26 - 02/19/26

Notes:
1. Basemap: As-built drawing provided by SCS Engineers, dated Dec 2023; high resolution RGB imagery provided by Waste Connections dated Jan 2026.
2. Projected Coordinate System: WGS 1984 UTM Zone 11N
3. Mean change from Feb. 2026 to Feb. 2026 was a 3.33 PPM decrease. Colors represent standard deviations from the mean. PPMs within one standard deviation are not shown.

Legend

- 548 - 33 PPM Decrease
- 32 - 21 PPM Decrease
- 20 - 9 PPM Decrease
- 8 PPM Decrease - 3 PPM Increase
- 4 - 14 PPM Increase
- 15 - 605 PPM Increase

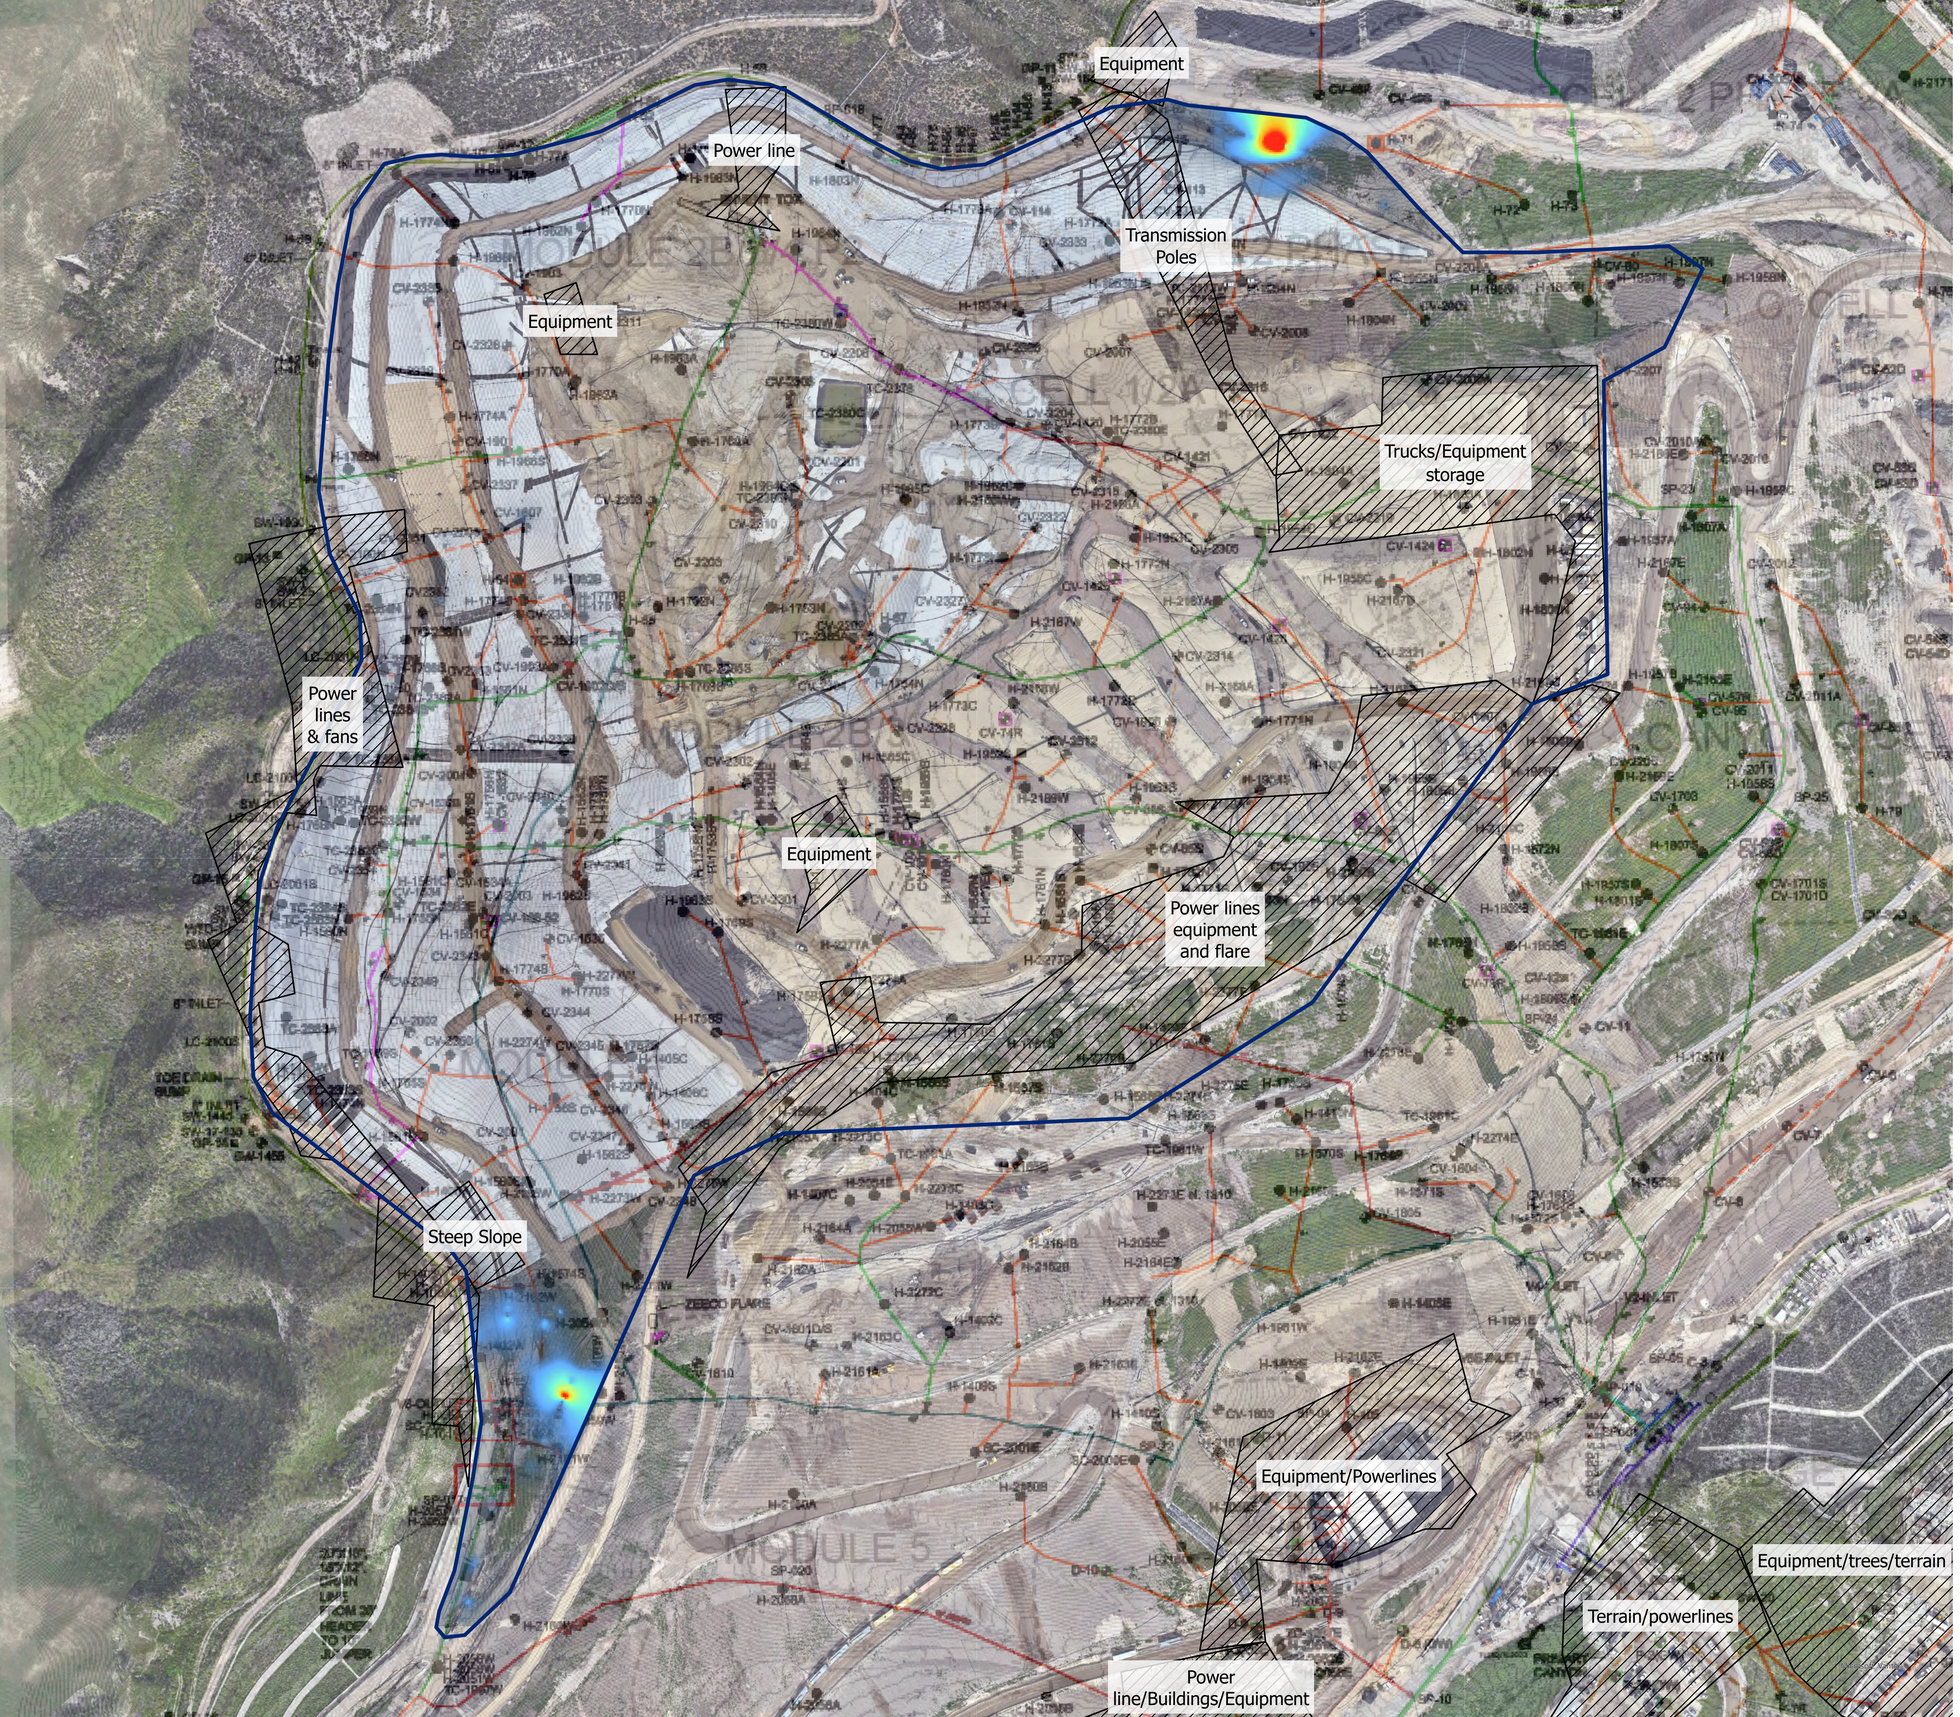

Chiquita Canyon Landfill Interpolated Methane Emissions as Recorded by the SnifferDRONE™, over As-Built Drawing

Feb 19, 2026

Notes:
1. Basemap: As-built drawing provided by SCS Engineers, dated Dec 2023; high resolution RGB imagery provided by Waste Connections dated Jan 2026.
2. Projected Coordinate System: WGS 1984 UTM Zone 11N

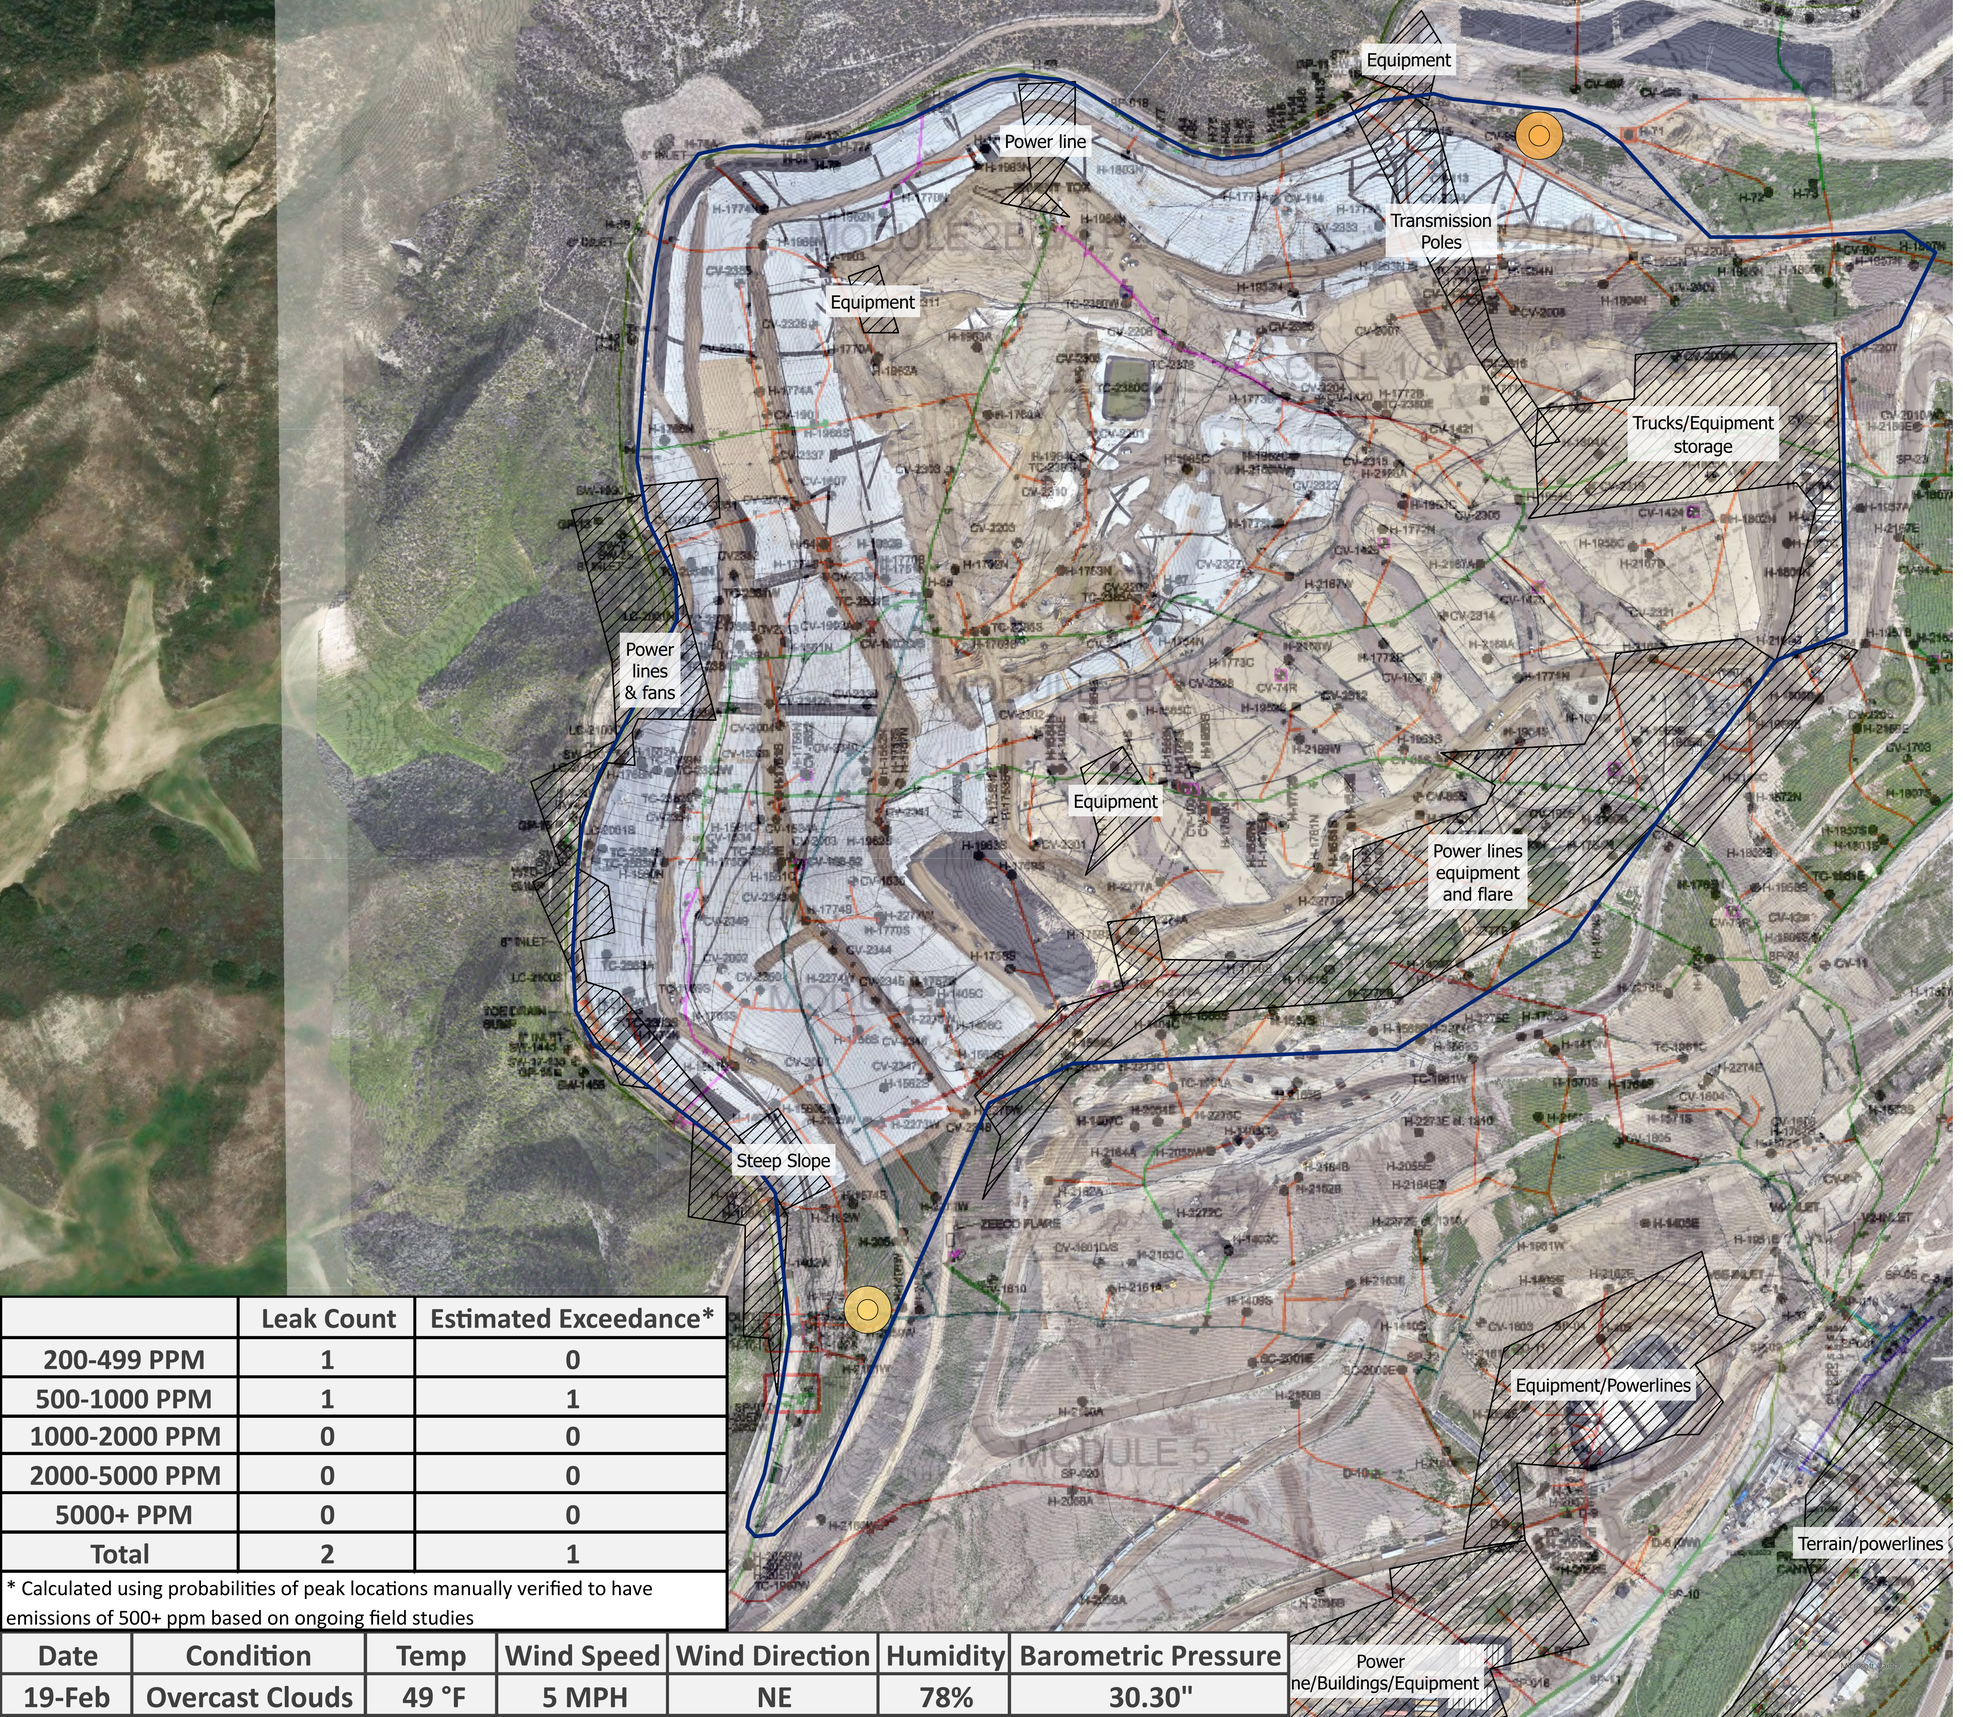

	Leak Count	Estimated Exceedance*
200-499 PPM	1	0
500-1000 PPM	1	1
1000-2000 PPM	0	0
2000-5000 PPM	0	0
5000+ PPM	0	0
Total	2	1

* Calculated using probabilities of peak locations manually verified to have emissions of 500+ ppm based on ongoing field studies

Date	Condition	Temp	Wind Speed	Wind Direction	Humidity	Barometric Pressure
19-Feb	Overcast Clouds	49 °F	5 MPH	NE	78%	30.30"

Chiquita Canyon Landfill Methane Emissions Local Peak Values as Recorded by the SnifferDRONE™, over As-Built Drawing

Feb 19, 2026

Notes:
1. Basemap: As-built drawing provided by SCS Engineers, dated Dec 2023; high resolution RGB imagery provided by Waste Connections, dated Jan 2026.
2. Projected Coordinate System: WGS 1984 UTM Zone 11N

Legend
- < 200 PPM
- 200 - 499 PPM
- 500 - 999 PPM
- 1,000 - 1,999 PPM
- 2,000 - 4,999 PPM
- 5000 + PPM

N

0 125 250 500
Feet

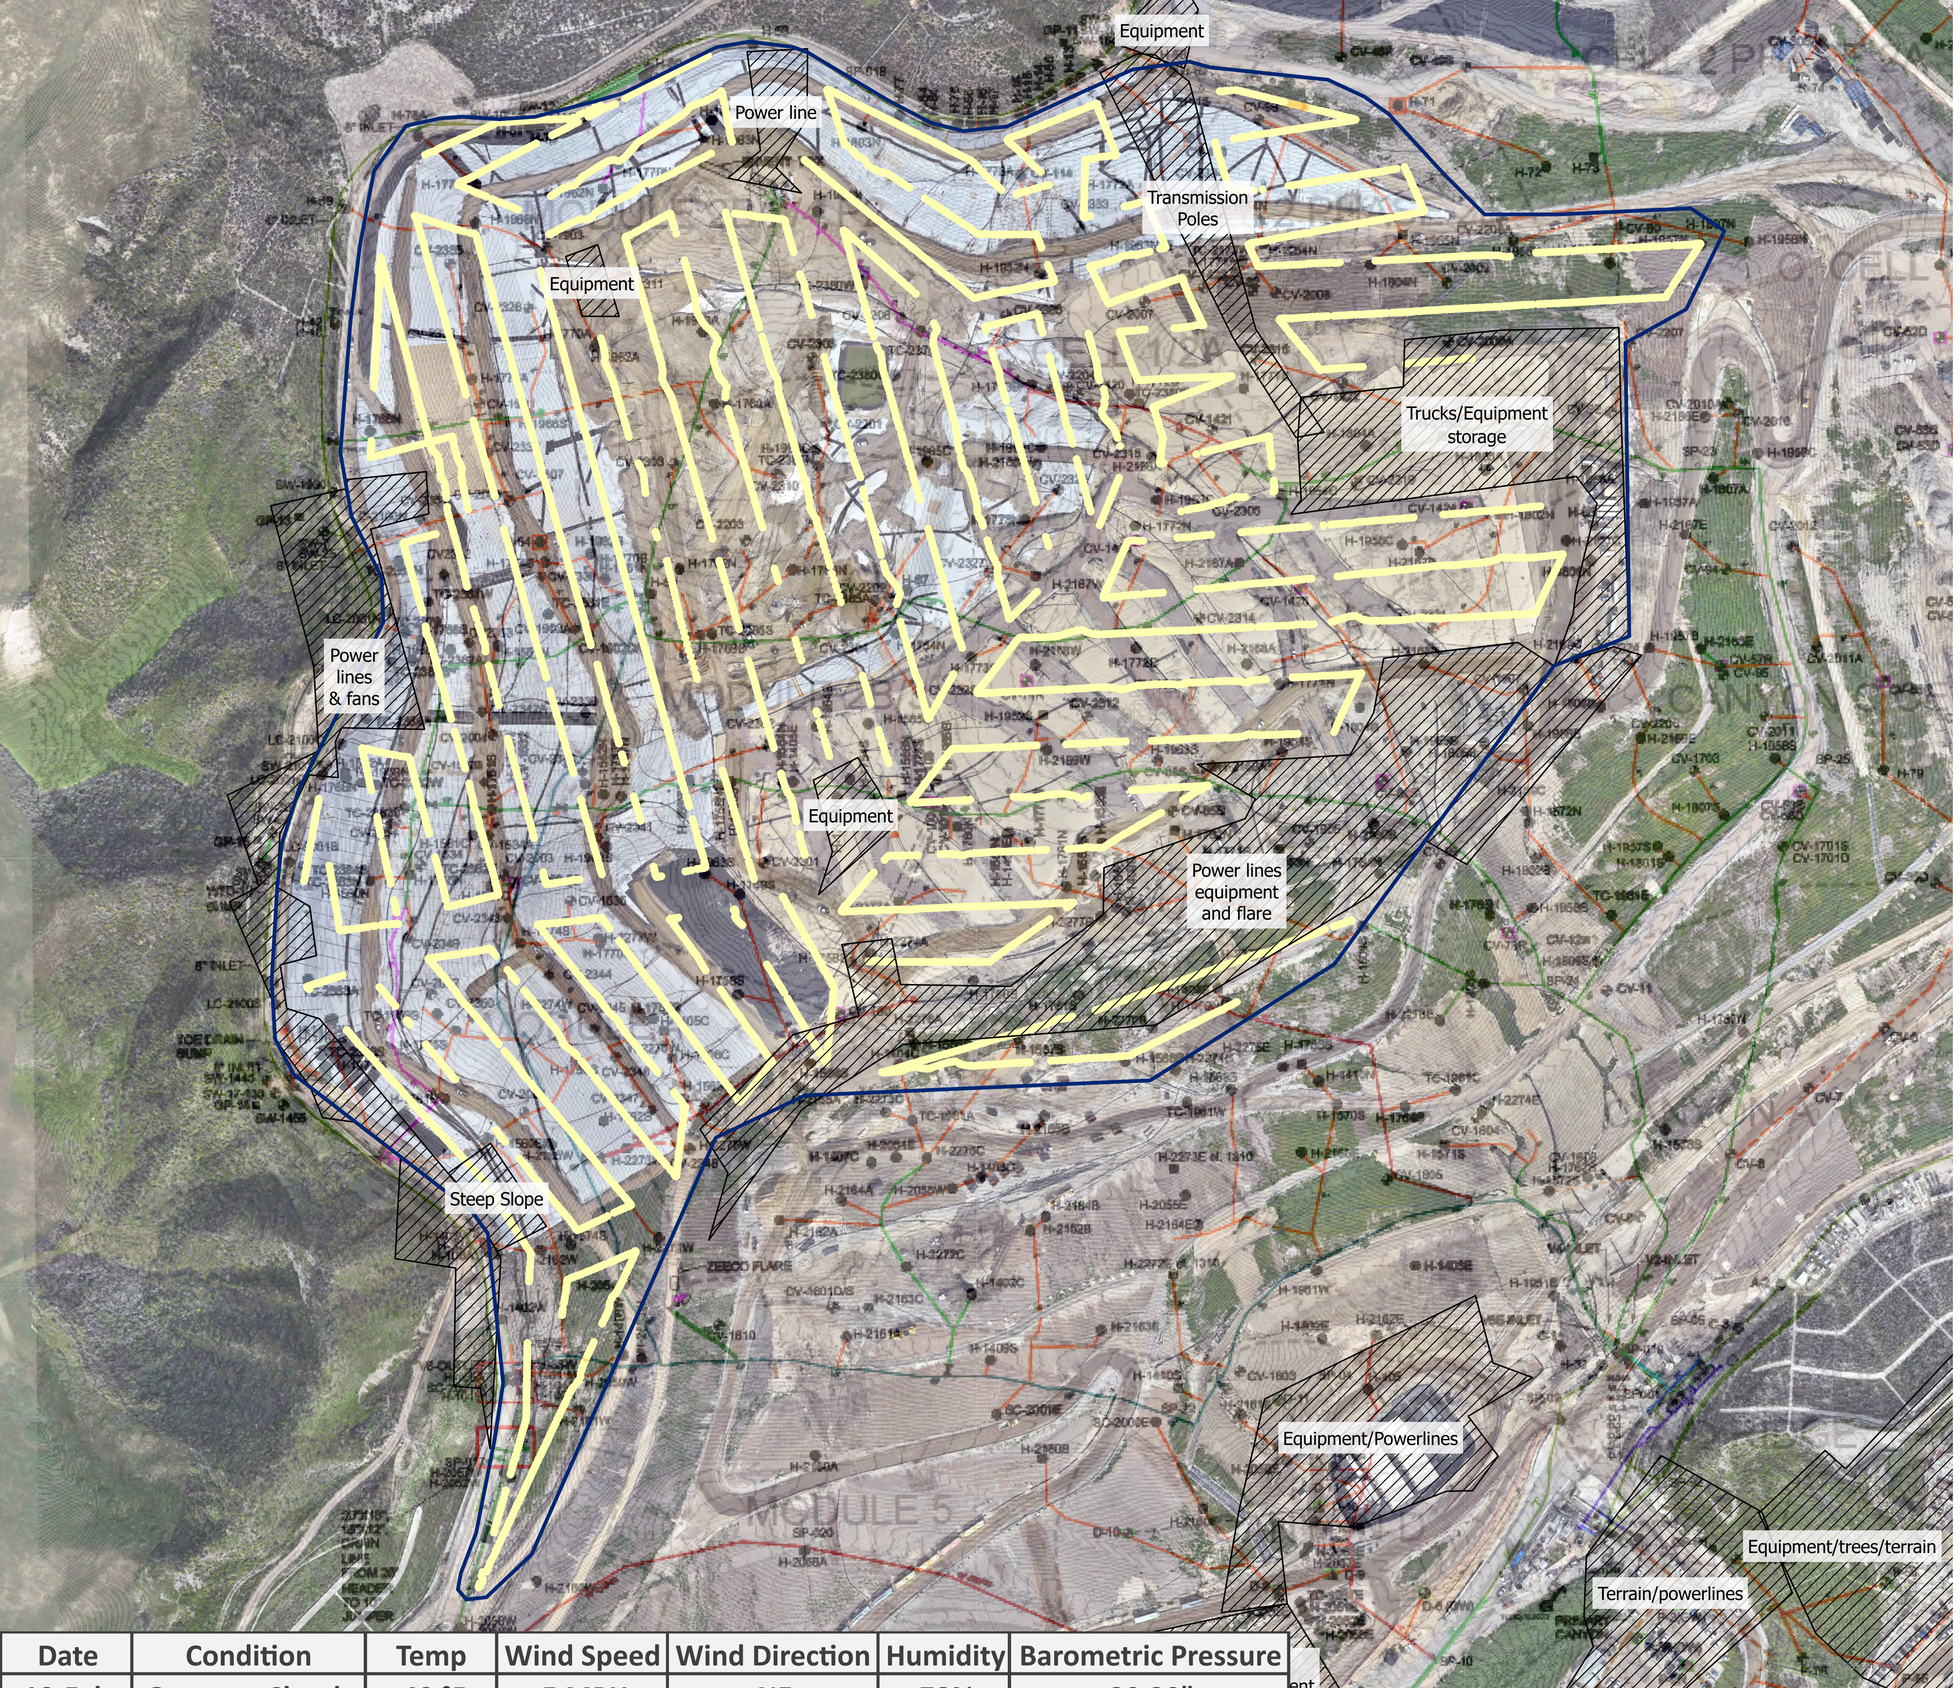

Date	Condition	Temp	Wind Speed	Wind Direction	Humidity	Barometric Pressure
19-Feb	Overcast Clouds	49 °F	5 MPH	NE	78%	30.30"

Chiquita Canyon Landfill Point Methane Emissions as Recorded by the SnifferDRONE™, over As-Built Drawing

Feb 19, 2026

Notes:
1. Basemap: As-built drawing provided by SCS Engineers, dated Dec 2023; high resolution RGB imagery provided by Waste Connections, dated Jan 2026.
2. Projected Coordinate System: WGS 1984 UTM Zone 11N

N

0 125 250 500
Feet

Legend

- < 200 PPM
- 200 - 499 PPM
- 500 - 999 PPM
- 1,000 - 1,999 PPM
- 2,000 - 5,000 PPM
- 5,000 + PPM

Week 9 (February 24, 2026)

Waste Connections Chiquita Canyon Landfill
Project: 2026 02 Week 09 Emission Study
Job: Emission Study
Report Submitted Feb 25, 2026

Emission Study Daily Peaks Verification Report

Information presented within provides results from the emissions monitoring inspection performed by technicians with Sniffer Robotics, Inc. associated with the emission study site and date listed herein. Following the inspection, this report will be updated and disseminated by no later than 12:00 PM local time the next morning.

This report provides details of methane leak locations as determined by the SnifferDRONE™ and manual verification of those leak locations as determined by handheld methane detectors. When an aerial surveillance reading reaches or exceeds 200 PPM methane, a follow-up ground-based surface emissions monitoring field inspection is conducted according to the procedures of OTM-51 and U.S. EPA Method 21, except in the case(s) that the site is unable to monitor the locations due to inaccessibility or dangerous conditions. Report details include: coordinate locations of SnifferDRONE leaks and manual verifications, associated location descriptions (where applicable), date and time of verified readings, SnifferDRONE identified and manually verified PPM values, additional notes, map(s) displaying locations of leaks, and photographic documentation of leaks.

Key

Manual Verification ≥ 500 ppm
Manual Verification < 500 ppm

This daily report is not meant for compliance purposes and only intended for customer review.

WEATHER CONDITIONS	
Date:	**24-Feb**
Sky:	Broken Clouds
Ground:	Dry
Temperature:	77 °F
Wind Direction:	SW
Wind Speed:	6 MPH
Barometric Pressure:	30.51"
Humidity:	33%

LOCATION DETAILS						**INSPECTION RESULTS**						
Ref	**SnifferDRONE Lat**	**SnifferDRONE Long**	**Verified Lat**	**Verified Long**	**Location Description**	**SnifferDRONE Date (UTC)**	**SnifferDRONE Time (UTC)**	**SnifferDRONE PPM**	**Verified Date (UTC)**	**Verified Time (UTC)**	**Verified PPM**	**Notes**
1	34.437141	-118.64605	34.43715724	-118.64606		2/24/2026	19:00	387	2/24/2026	19:13	***5,000***	
2	34.433189	-118.64577	34.43321479	-118.64571		2/24/2026	19:38	368	2/24/2026	19:51	***2,000***	
3	34.434456	-118.64899	34.43437217	-118.64896		2/24/2026	16:38	952	2/24/2026	17:00	***1,000***	
4	34.437089	-118.64728	34.43703709	-118.64722		2/24/2026	18:17	312	2/24/2026	18:38	***1,000***	
5	34.431682	-118.65016	34.43167962	-118.65025		2/24/2026	20:07	347	2/24/2026	20:33	***820***	
6	34.431559	-118.65052	34.43150381	-118.65051		2/24/2026	20:09	392	2/24/2026	20:37	***650***	
7	34.437168	-118.64619	34.43714298	-118.64616		2/24/2026	19:00	211	2/24/2026	19:14	***630***	
8	34.434602	-118.64994	34.43459339	-118.64993		2/24/2026	15:57	221	2/24/2026	16:24	***580***	

Peak Verification Map

Project: 2026 02 Week 09 Emission Study
Job: Emission Study
Report Submitted Feb 25, 2026

Legend

Peak Verification	Drone Flight Peaks
0 – 499 PPM	200 - 499 PPM
500+ PPM	500 + PPM

Notes:
1. Basemap: As-built drawing provided by SCS Engineers, dated Dec 2023; high resolution RGB imagery provided by Waste Connections, dated Jan 2026.
2. Projected Coordinate System: WGS 1984 UTM Zone 11N

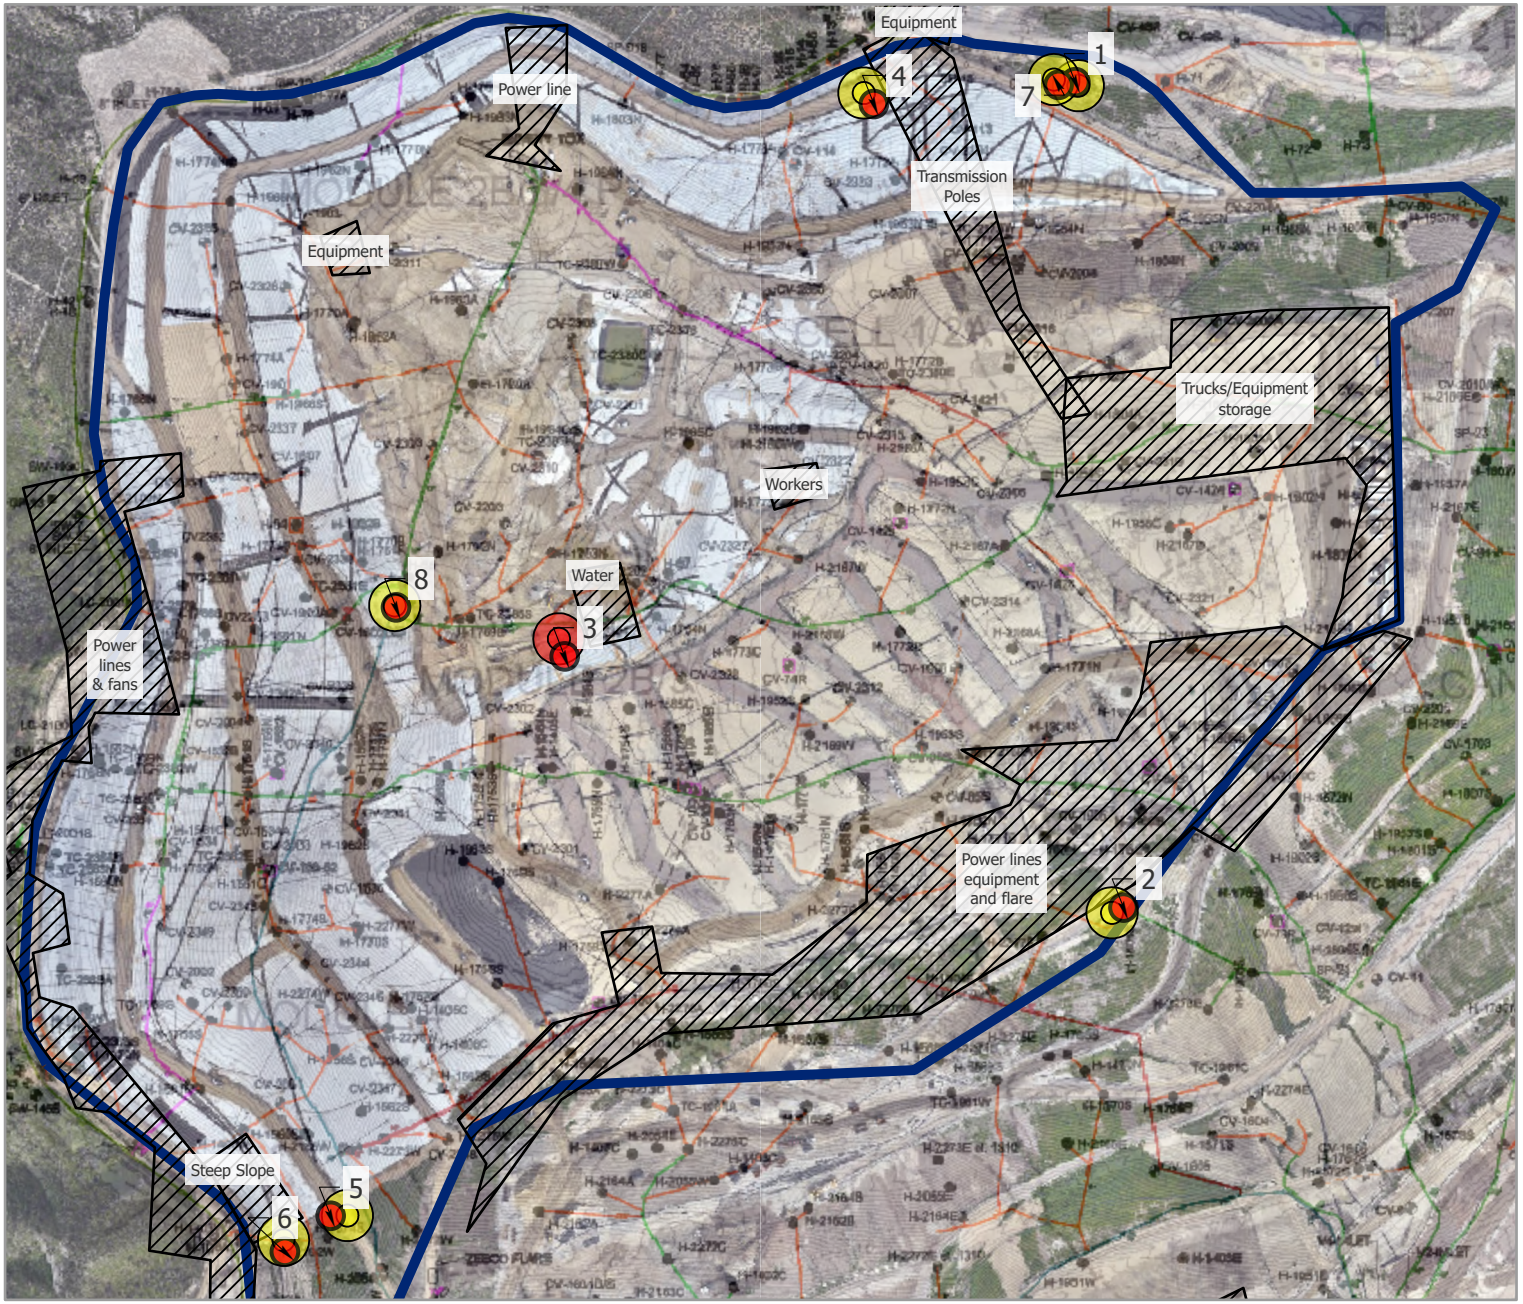

Vantor

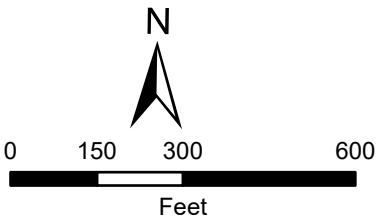

1. SnifferDRONE Verification

2. SnifferDRONE Verification

3. SnifferDRONE Verification

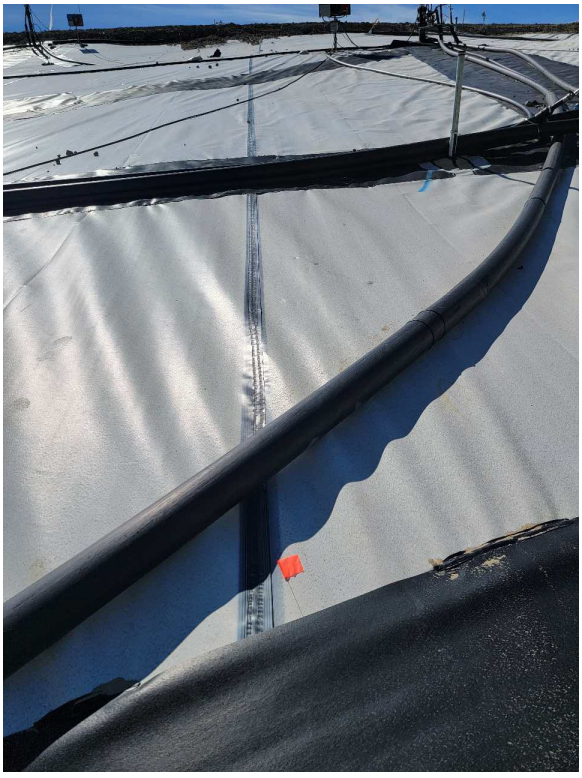

4. SnifferDRONE Verification

5. SnifferDRONE Verification

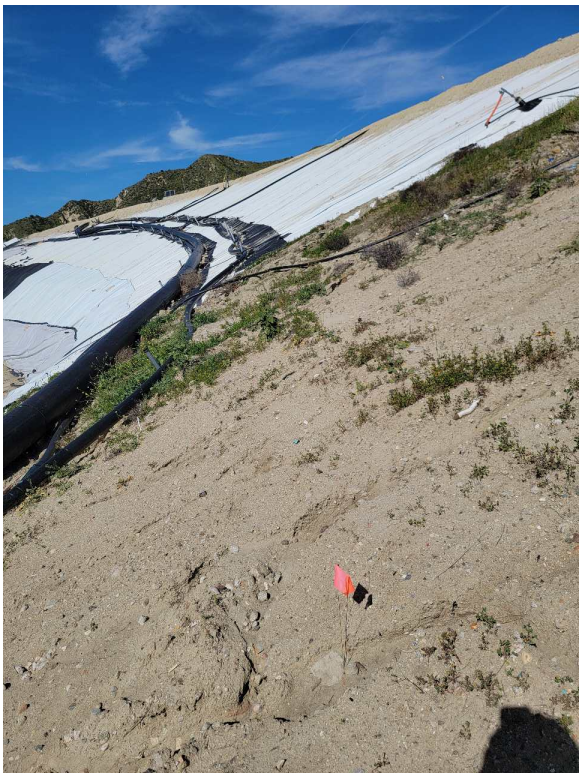

6. SnifferDRONE Verification

7. SnifferDRONE Verification

8. SnifferDRONE Verification

Date	Condition	Temp	Wind Speed	Wind Direction	Humidity	Barometric Pressure
24-Feb	Broken Clouds	77 °F	6 MPH	SW	33%	30.51"

Chiquita Canyon Landfill Interpolated Methane Emissions Change as Recorded by the SnifferDRONE™, Feb 2026 to Feb 2026

02/19/26 - 02/24/26

Notes:
1. Basemap: As-built drawing provided by SCS Engineers, dated Dec 2023; high resolution RGB imagery provided by Waste Connections dated Jan 2026.
2. Projected Coordinate System: WGS 1984 UTM Zone 11N
3. Mean change from Feb. 2026 to Feb. 2026 was a 2.95 PPM increase. Colors represent standard deviations from the mean. PPMs within one standard deviation are not shown.

Legend

- 466 - 40 PPM Decrease
- 39 - 23 PPM Decrease
- 22 - 6 PPM Decrease
- 5 PPM Decrease - 11 PPM Increase
- 12 - 29 PPM Increase
- 30 - 46 PPM Increase
- 47 - 940 PPM Increase

Chiquita Canyon Landfill Interpolated Methane Emissions as Recorded by the SnifferDRONE™, over As-Built Drawing

Feb 24, 2026

Notes:
1. Basemap: As-built drawing provided by SCS Engineers, dated Dec 2023; high resolution RGB imagery provided by Waste Connections dated Jan 2026.
2. Projected Coordinate System: WGS 1984 UTM Zone 11N

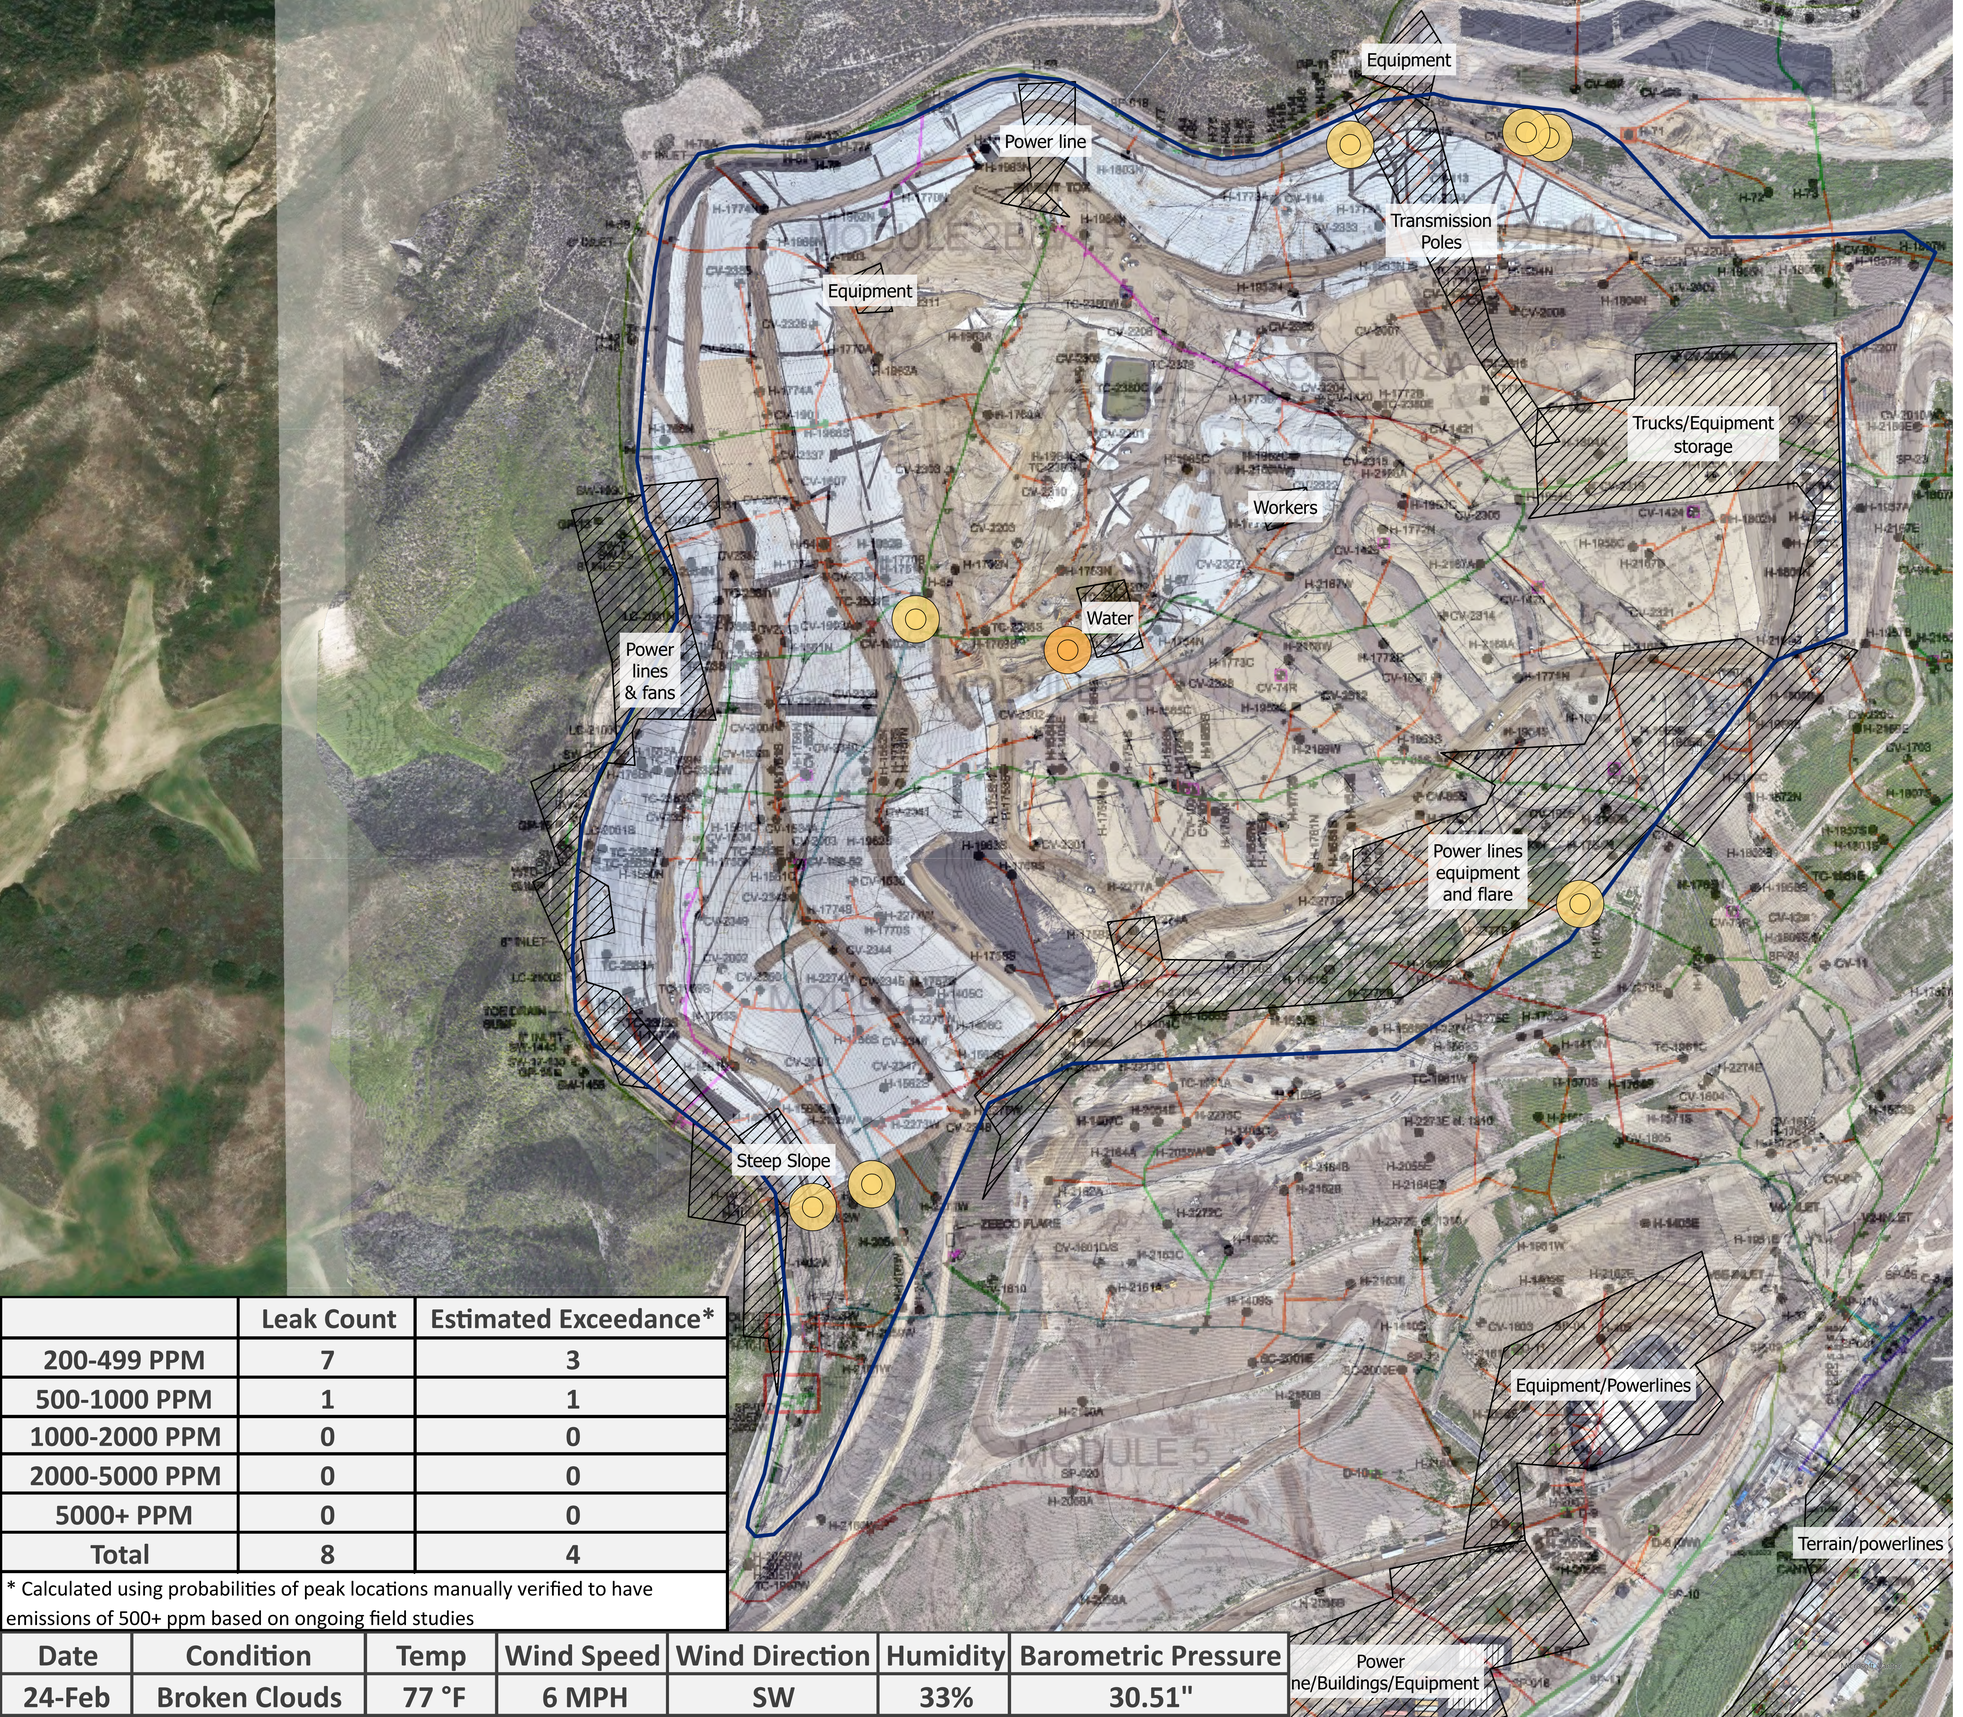

	Leak Count	Estimated Exceedance*
200-499 PPM	7	3
500-1000 PPM	1	1
1000-2000 PPM	0	0
2000-5000 PPM	0	0
5000+ PPM	0	0
Total	8	4

* Calculated using probabilities of peak locations manually verified to have emissions of 500+ ppm based on ongoing field studies

Date	Condition	Temp	Wind Speed	Wind Direction	Humidity	Barometric Pressure
24-Feb	Broken Clouds	77 °F	6 MPH	SW	33%	30.51"

Chiquita Canyon Landfill Methane Emissions Local Peak Values as Recorded by the SnifferDRONE™, over As-Built Drawing

Feb 24, 2026

Notes:
1. Basemap: As-built drawing provided by SCS Engineers, dated Dec 2023; high resolution RGB imagery provided by Waste Connections, dated Jan 2026.
2. Projected Coordinate System: WGS 1984 UTM Zone 11N

Legend
- < 200 PPM
- 200 - 499 PPM
- 500 - 999 PPM
- 1,000 - 1,999 PPM
- 2,000 - 4,999 PPM
- 5000 + PPM

N

0 125 250 500
Feet

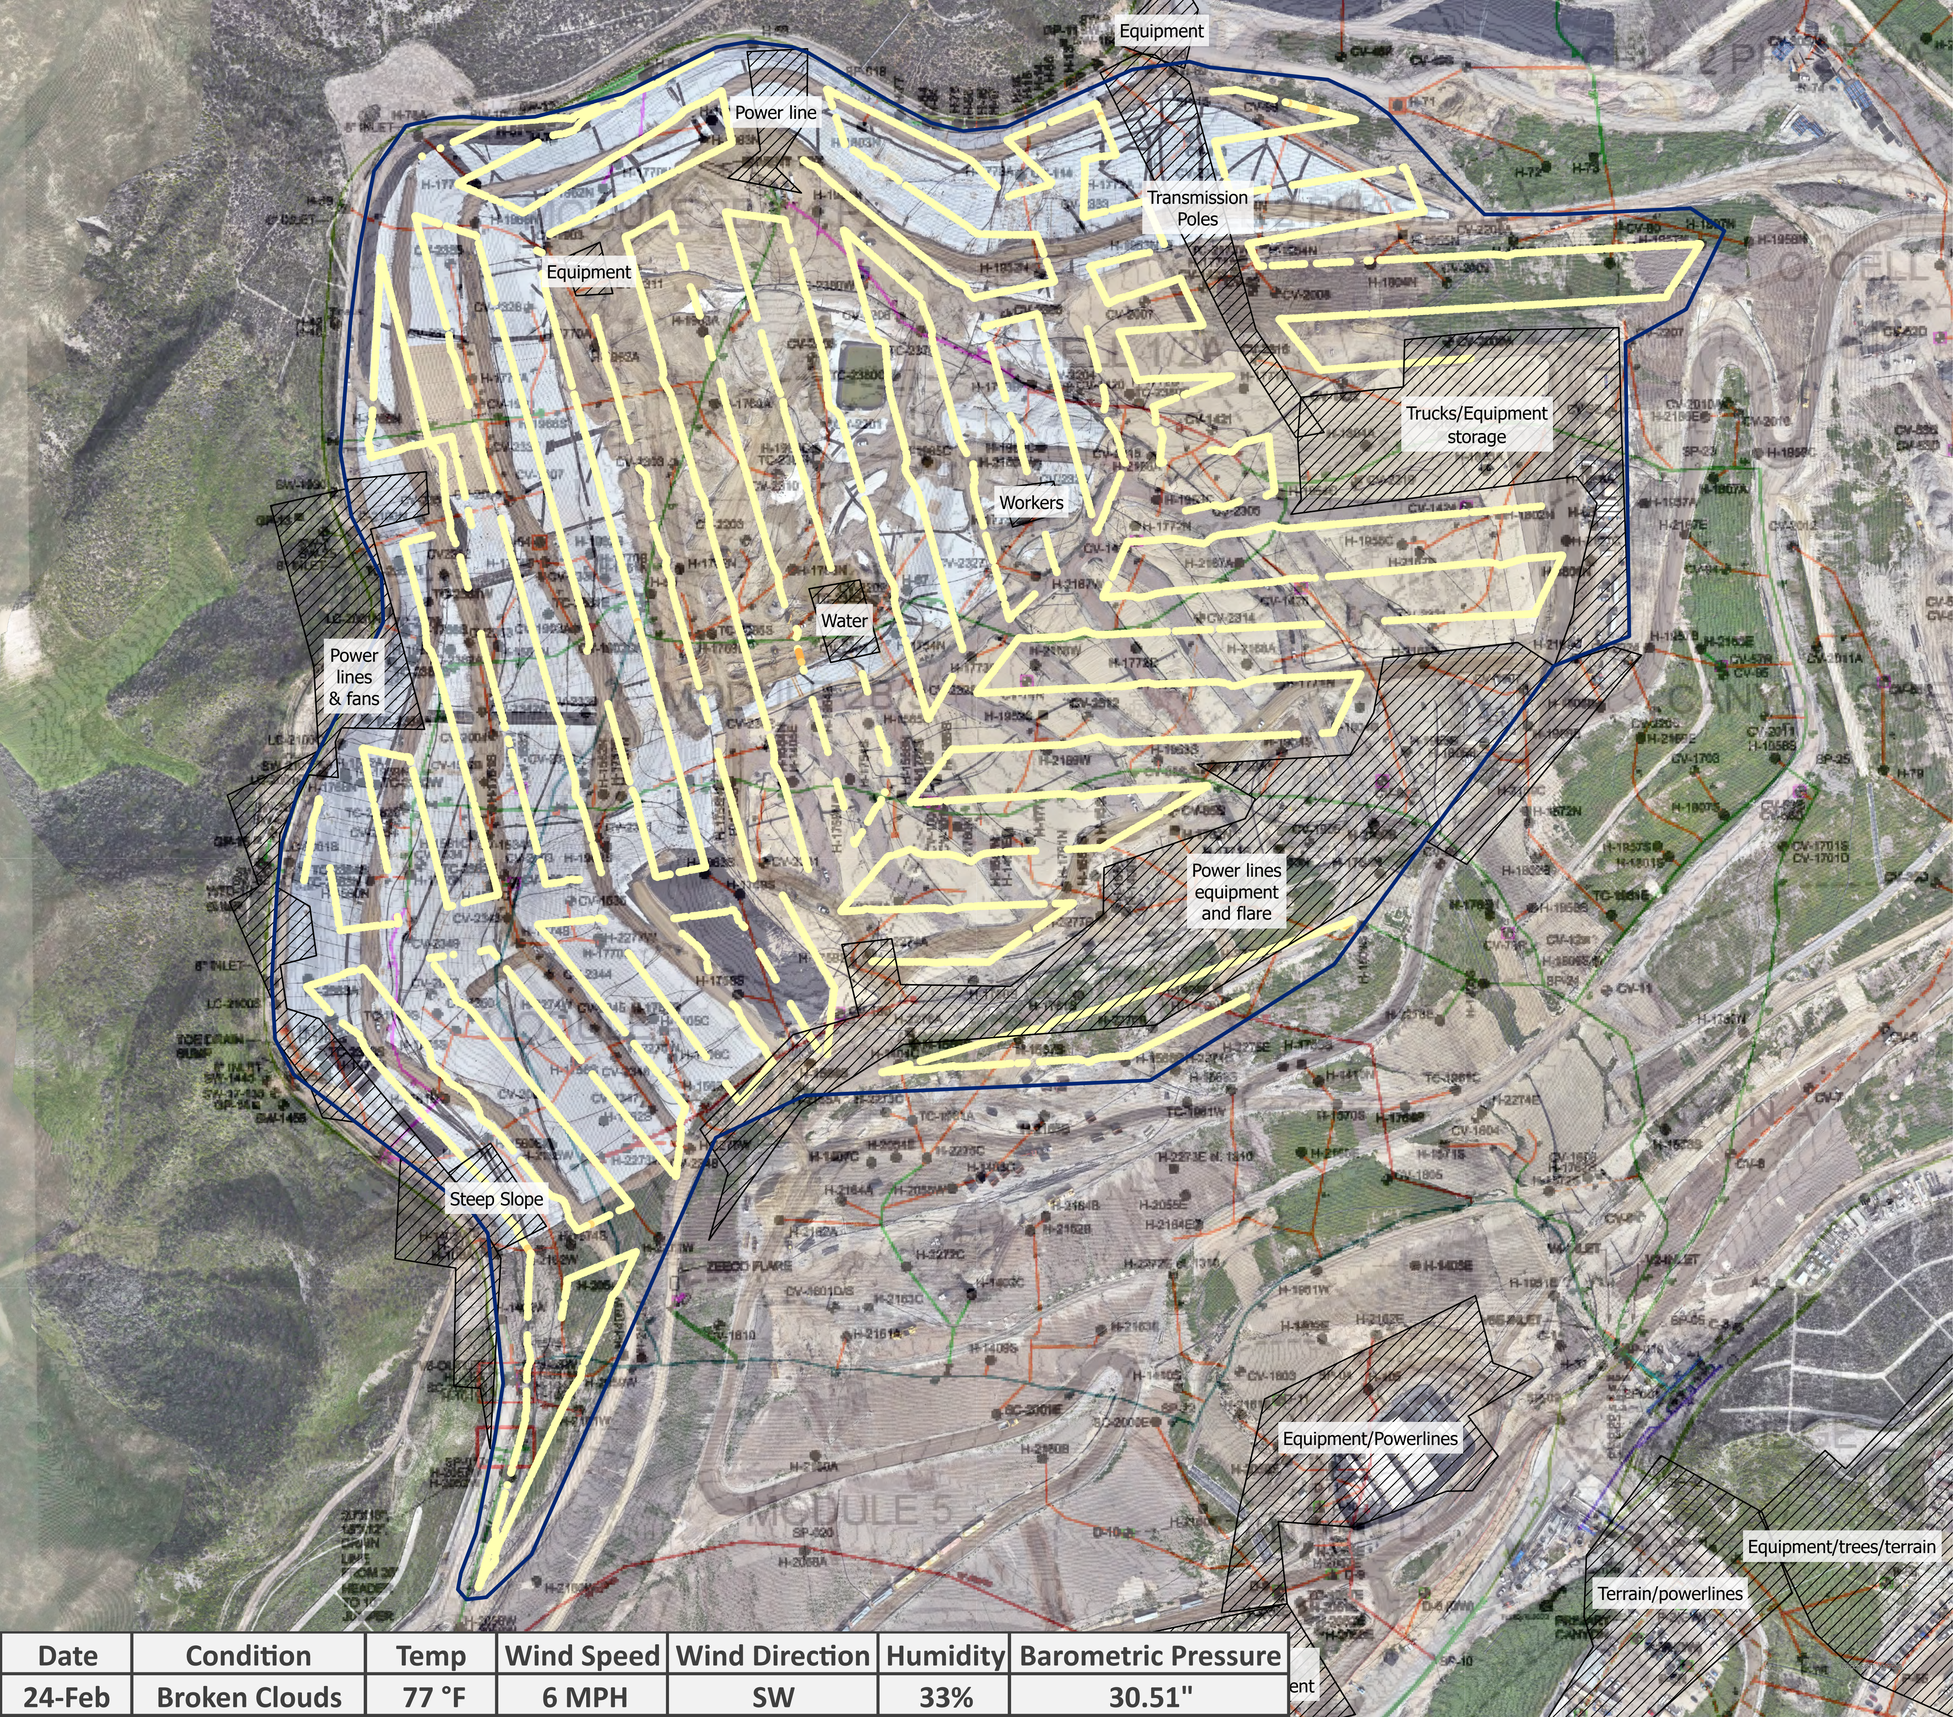

Date	Condition	Temp	Wind Speed	Wind Direction	Humidity	Barometric Pressure
24-Feb	Broken Clouds	77 °F	6 MPH	SW	33%	30.51"

Chiquita Canyon Landfill Point Methane Emissions as Recorded by the SnifferDRONE™, over As-Built Drawing

Feb 24, 2026

Notes:
1. Basemap: As-built drawing provided by SCS Engineers, dated Dec 2023; high resolution RGB imagery provided by Waste Connections, dated Jan 2026.
2. Projected Coordinate System: WGS 1984 UTM Zone 11N

N

0 125 250 500
Feet

Legend

- < 200 PPM
- 200 - 499 PPM
- 500 - 999 PPM
- 1,000 - 1,999 PPM
- 2,000 - 5,000 PPM
- 5,000 + PPM

Attachment D

Daily Inlet Temperatures

Attachment D - LFGTS Vessel Inlet Temperatures

February 2026

	Inlet Temperature (F)			
Date Time	ST-1	ST-2	ST-3	ST-4
02/01/26 14:00	114	91	102	96
02/02/26 10:12	100	55	60	102
02/03/26 12:50	111	83	88	92
02/04/26 12:24	112	85	82	92
02/05/26 09:54	96	56	57	90
02/06/26 09:21	95	54	53	92
02/07/26 09:17	101	52	52	92
02/08/26 12:23	122	83	86	91
02/09/26 11:44	118	74	73	96
02/10/26 09:57	100	61	59	94
02/11/26 14:29	100	71	73	85
02/12/26 14:29	105	78	82	86
02/13/26 10:25	96	54	56	80
02/14/26 07:52	77	42	40	65
02/15/26 08:15	81	49	48	70
02/16/26 07:25	78	53	52	70
02/17/26 10:20	80	50	50	70
02/18/26 14:34	90	67	71	80
02/19/26 13:05	75	52	51	68
02/20/26 07:21	68	36	35	59
02/21/26 11:01	83	56	57	75
02/22/26 08:44	78	45	45	68
02/23/26 14:09	98	83	85	84
02/24/26 07:31	77	50	48	66
02/25/26 10:25	98	62	64	82
02/26/26 09:44	93	65	67	82
02/27/26 13:48	110	99	101	101
02/28/26 08:13	80	52	55	74

Attachment E

Well Temperature and CO Concentration Data

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHIWA001	A-01	2/6/2026 2:26:27 PM	60.1	39.1	0.0	0.8			83.7	83.7	1.5
CHIWA002	A-02	2/10/2026 9:22:14 AM	58.6	41.4	0.0	0.0			88.3	88.4	1.4
CHIWA003	A-03	2/10/2026 9:31:06 AM	56.1	41.6	0.2	2.1			76.6	74.8	1.3
CHIWA004	A-04	2/10/2026 9:35:14 AM	58.0	42.0	0.0	0.0			84.2	86.6	1.4
CHIWB001	B-01	2/2/2026 12:19:05 PM	10.6	23.8	0.0	65.6			91.8	92.3	0.4
CHIWB02R	B-02R	2/2/2026 12:14:54 PM	34.1	29.4	1.1	35.4			79.2	79.6	1.2
CHIWB03R	B-03R	2/2/2026 12:27:28 PM	26.2	28.5	0.0	45.3			86.7	87.3	0.9
CHIWB005	B-05	2/2/2026 12:46:39 PM	23.1	29.0	0.0	47.9			87.8	87.8	0.8
CHIWB006	B-06	2/2/2026 12:54:09 PM	22.5	27.3	0.0	50.2			80.2	80.4	0.8
CHIWB07R	B-07R	2/2/2026 1:39:08 PM	47.3	36.6	0.0	16.1			83.9	85.5	1.3
CHIWB07R	B-07R	2/2/2026 1:40:27 PM	47.6	36.8	0.0	15.6			85.9	86.0	1.3
CHIWB008	B-08	2/2/2026 1:01:05 PM	17.9	25.9	0.3	55.9			81.5	81.6	0.7
CHIWB009	B-09	2/2/2026 1:31:23 PM	35.2	32.6	0.0	32.2			96.2	97.0	1.1
CHIWB010	B-10	2/2/2026 1:21:50 PM	27.2	29.5	0.0	43.3			86.0	87.6	0.9
CHIWB010	B-10	2/2/2026 1:22:55 PM	27.3	29.9	0.0	42.8			88.0	88.0	0.9
CHIWB011	B-11	2/25/2026 1:05:18 PM	37.9	31.6	0.0	30.5			102.9	102.9	1.2
CHIWB012	B-12	2/2/2026 12:31:17 PM	20.6	27.6	0.0	51.8			90.1	90.1	0.7
CHIWB013	B-13	2/2/2026 1:44:55 PM	28.2	31.2	0.0	40.6			89.4	89.5	0.9
CHIWB014	B-14	2/25/2026 1:09:49 PM	28.0	27.1	0.0	44.9			94.4	97.6	1.0
CHIWC003	C-03	2/10/2026 9:09:04 AM	56.3	40.2	0.0	3.5			58.8	60.3	1.4
CHIWC008	C-08	2/25/2026 11:12:35 AM	55.7	43.3	0.0	1.0			92.1	92.5	1.3
CHIWC010	C-10	2/25/2026 10:15:18 AM	56.4	39.0	0.0	4.6			90.0	90.7	1.4
CHIWC011	C-11	2/10/2026 9:49:37 AM	61.2	38.8	0.0	0.0			86.9	86.9	1.6
CHIWC012	C-12	2/10/2026 9:58:43 AM	60.0	40.0	0.0	0.0			66.2	66.5	1.5
CHIWC015	C-15	2/10/2026 10:04:37 AM	53.2	39.1	1.1	6.6			64.1	64.1	1.4
CHIWC17B	C-17B	2/10/2026 10:45:25 AM	58.3	41.7	0.0	0.0			108.9	108.9	1.4
CHIWC018	C-18	2/21/2026 10:06:18 AM	56.6	39.5	0.0	3.9			82.2	82.4	1.4
CHIWC019	C-19	2/21/2026 10:19:34 AM	54.3	41.5	0.0	4.2			82.2	80.7	1.3
CHIWC020	C-20	2/21/2026 10:14:14 AM	52.4	39.1	0.1	8.4			76.0	76.2	1.3

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHIWC023	C-23	2/21/2026 10:08:58 AM	52.9	39.8	0.1	7.2			80.7	80.9	1.3
CHIWC024	C-24	2/25/2026 9:41:15 AM	57.2	41.4	0.0	1.4			63.7	97.1	1.4
CHIWC024	C-24	2/25/2026 9:43:34 AM	55.9	42.9	0.0	1.2			97.3	97.4	1.3
CHIWC025	C-25	2/10/2026 10:25:38 AM	54.1	40.6	0.0	5.3			118.8	118.8	1.3
CHIWC026	C-26	2/10/2026 10:19:03 AM	65.5	30.6	0.6	3.3			63.7	63.9	2.1
CHIWC027	C-27	2/10/2026 10:01:41 AM	59.0	40.5	0.0	0.5			92.9	92.9	1.5
CHIWC028	C-28	2/10/2026 9:53:41 AM	57.1	42.9	0.0	0.0			99.6	99.7	1.3
CHIWC029	C-29	2/25/2026 10:05:25 AM	45.9	44.8	0.0	9.3			101.6	101.5	1.0
CHIWC030	C-30	2/25/2026 10:26:47 AM	52.1	44.2	0.0	3.7			122.8	123.1	1.2
CHIWCV02	CV-02	2/5/2026 8:22:37 AM	54.3	38.8	0.0	6.9			124.3	124.8	1.4
CHIWCV03	CV-03	2/5/2026 8:20:25 AM	53.8	39.7	0.0	6.5			119.0	119.0	1.4
CHIWCV04	CV-04	2/5/2026 8:17:56 AM	51.3	37.8	0.0	10.9			108.2	108.4	1.4
CHIWCV05	CV-05	2/5/2026 8:11:21 AM	58.0	39.8	0.0	2.2			96.9	97.0	1.5
CHIWCV06	CV-06	2/5/2026 2:22:54 PM	55.3	39.0	0.0	5.7			92.6	92.9	1.4
CHIWCV09	CV-09	2/5/2026 3:15:47 PM	54.4	43.1	0.0	2.5			82.7	89.5	1.3
CHIWCV09	CV-09	2/5/2026 3:22:08 PM	47.8	39.3	1.7	11.2			88.8	87.4	1.2
CV108-52	CV-108-52	2/6/2026 9:05:15 AM	49.1	50.9	0.0	0.0			100.4	99.8	1.0
CV108-52	CV-108-52	2/6/2026 9:10:37 AM	14.2	78.1	0.0	7.7			113.2	113.2	0.2
CV108-52	CV-108-52	2/13/2026 9:00:00 AM					40				
CV108-52	CV-108-52	2/13/2026 9:00:00 AM						3100			
CV108-52	CV-108-52	2/21/2026 10:16:13 AM	44.1	54.9	0.0	1.0			100.4	100.4	0.8
CHWCV113	CV-113	2/2/2026 8:05:00 AM						2200			
CHWCV113	CV-113	2/2/2026 8:05:00 AM					15				
CHWCV113	CV-113	2/12/2026 8:26:26 AM	23.0	42.2	7.3	27.5			59.3	59.4	0.5
CHWCV113	CV-113	2/15/2026 2:19:51 PM	23.6	40.2	7.5	28.8			67.3	67.3	0.6
CHWCV113	CV-113	2/15/2026 2:25:06 PM	7.4	15.4	16.5	60.7			66.3	66.2	0.5
CHWCV113	CV-113	2/15/2026 2:28:35 PM	0.4	3.2	20.0	76.4			66.1	66.1	0.1
CHWCV114	CV-114	2/2/2026 8:30:00 AM						160000			
CHWCV114	CV-114	2/2/2026 8:30:00 AM					2700				

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHWCV114	CV-114	2/2/2026 8:35:00 AM					4220				
CHWCV114	CV-114	2/2/2026 8:35:08 AM	2.3	83.1	0.6	14.0			189.7	189.8	0.0
CHWCV114	CV-114	2/9/2026 9:53:00 AM	0.7	87.2	0.0	12.1			189.2	188.2	0.0
CHWCV114	CV-114	2/9/2026 9:55:00 AM					3540				
CHWCV114	CV-114	2/9/2026 9:55:00 AM						135000			
CHWCV114	CV-114	2/17/2026 7:50:00 AM					4460				
CHWCV114	CV-114	2/17/2026 7:52:38 AM	0.6	69.0	4.8	25.6			190.5	190.5	0.0
CHWCV114	CV-114	2/23/2026 8:44:01 AM	1.1	76.2	2.9	19.8			190.3	190.3	0.0
CHWCV114	CV-114	2/23/2026 8:50:00 AM					4770				
CHCV1424	CV-1424	2/9/2026 1:57:15 PM	53.1	43.6	0.0	3.3			112.6	113.4	1.2
CCV1532A	CV-1532A	2/4/2026 8:06:20 AM	1.3	84.4	0.0	14.3			150.7	164.2	0.0
CCV1532A	CV-1532A	2/4/2026 8:10:00 AM					2580				
CCV1532A	CV-1532A	2/4/2026 8:10:00 AM						153200			
CCV1532A	CV-1532A	2/5/2026 7:30:00 AM					1500				
CCV1532A	CV-1532A	2/5/2026 7:30:00 AM						180000			
CCV1532A	CV-1532A	2/9/2026 7:45:00 AM						140900			
CCV1532A	CV-1532A	2/9/2026 7:45:00 AM					1420				
CCV1532A	CV-1532A	2/9/2026 7:46:11 AM	0.8	81.5	3.2	14.5			183.3	187.4	0.0
CCV1532A	CV-1532A	2/17/2026 12:24:00 PM	1.1	76.0	1.1	21.8			147.7	155.8	0.0
CCV1532A	CV-1532A	2/17/2026 12:25:00 PM					1650				
CCV1532A	CV-1532A	2/25/2026 12:57:58 PM	12.8	77.3	1.3	8.6			150.6	150.5	0.2
CCV1532A	CV-1532A	2/25/2026 1:00:00 PM					1990				
CCV1534A	CV-1534A-PLR	2/4/2026 8:14:41 AM	1.5	78.1	2.8	17.6			184.0	182.5	0.0
CCV1534A	CV-1534A-PLR	2/4/2026 8:15:00 AM					2320				
CCV1534A	CV-1534A-PLR	2/4/2026 8:15:00 AM						119500			
CCV1534A	CV-1534A-PLR	2/9/2026 7:50:00 AM					2710				
CCV1534A	CV-1534A-PLR	2/9/2026 7:50:00 AM						119500			
CCV1534A	CV-1534A-PLR	2/9/2026 7:54:59 AM	1.0	73.8	3.8	21.4			186.3	185.7	0.0
CCV1534A	CV-1534A-PLR	2/25/2026 10:23:10 AM	11.3	76.2	1.4	11.1			186.2	186.6	0.1

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CCV1534A	CV-1534A-PLR	2/25/2026 10:30:00 AM					2430				
CHCV1535	CV-1535	2/5/2026 7:40:00 AM					150				
CHCV1535	CV-1535	2/5/2026 7:40:00 AM						9100			
CHCV1535	CV-1535	2/13/2026 12:54:31 PM	42.5	57.5	0.0	0.0			120.2	120.4	0.7
CHCV1535	CV-1535	2/21/2026 10:04:49 AM	45.6	54.2	0.0	0.2			120.4	120.4	0.8
CCV1601D	CV-1601D	2/2/2026 1:42:03 PM	47.2	47.1	0.0	5.7			110.1	110.4	1.0
CCV1601D	CV-1601D	2/23/2026 10:28:37 AM	50.4	47.7	0.0	1.9			103.7	103.8	1.1
CCV1601S	CV-1601S	2/2/2026 1:38:11 PM	44.0	50.4	0.1	5.5			110.5	110.5	0.9
CCV1601S	CV-1601S	2/23/2026 10:24:46 AM	47.5	49.4	0.0	3.1			98.9	99.0	1.0
CHCV1604	CV-1604	2/2/2026 11:32:40 AM	54.5	45.5	0.0	0.0			129.4	129.4	1.2
CHCV1605	CV-1605	2/2/2026 10:58:03 AM	52.4	46.6	0.3	0.7			86.1	86.2	1.1
CCV1701D	CV-1701D	2/5/2026 9:27:54 AM	41.0	37.8	4.2	17.0			65.5	65.4	1.1
CCV1701S	CV-1701S	2/5/2026 9:14:23 AM	24.0	56.3	2.2	17.5			142.7	122.7	0.4
CCV1701S	CV-1701S	2/5/2026 9:21:11 AM	22.3	57.5	1.8	18.4			123.6	126.4	0.4
CHCV1901	CV-1901	2/13/2026 3:22:18 PM	13.0	74.8	0.1	12.1			103.9	104.2	0.2
CHCV1901	CV-1901	2/21/2026 9:40:39 AM	12.7	75.2	1.1	11.0			86.9	88.0	0.2
CHCV1901	CV-1901	2/21/2026 9:43:49 AM	11.7	72.0	0.4	15.9			86.8	87.2	0.2
CCV1902A	CV-1902A	2/4/2026 9:12:02 AM	3.1	79.6	0.0	17.3			157.1	160.8	0.0
CCV1902A	CV-1902A	2/4/2026 9:15:00 AM					1690				
CCV1902A	CV-1902A	2/4/2026 9:15:00 AM						163000			
CCV1902A	CV-1902A	2/5/2026 8:15:00 AM					980				
CCV1902A	CV-1902A	2/5/2026 8:15:00 AM						180000			
CCV1902A	CV-1902A	2/9/2026 8:45:00 AM						163200			
CCV1902A	CV-1902A	2/9/2026 8:45:00 AM					1550				
CCV1902A	CV-1902A	2/9/2026 8:45:18 AM	1.9	84.9	0.0	13.2			163.4	163.0	0.0
CCV1902A	CV-1902A	2/17/2026 9:05:00 AM					1830				
CCV1902A	CV-1902A	2/17/2026 9:08:48 AM	1.9	80.9	0.0	17.2			162.5	162.5	0.0
CCV1902A	CV-1902A	2/17/2026 9:10:10 AM	2.1	85.2	0.0	12.7			162.5	162.5	0.0
CCV1902A	CV-1902A	2/25/2026 9:24:12 AM	7.0	82.5	0.0	10.5			176.7	175.7	0.1

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CCV1902A	CV-1902A	2/25/2026 9:25:00 AM					1150				
CHCV1905	CV-1905	2/2/2026 12:37:17 PM	53.5	43.1	0.0	3.4			110.7	110.7	1.2
CHCV1905	CV-1905	2/23/2026 12:22:37 PM	53.6	46.0	0.0	0.4			103.6	104.0	1.2
CHCV2001	CV-2001	2/4/2026 8:10:00 AM					140				
CHCV2001	CV-2001	2/4/2026 8:10:00 AM						13000			
CHCV2001	CV-2001	2/5/2026 1:50:56 PM	4.2	25.2	14.1	56.5			90.4	90.7	0.2
CHCV2001	CV-2001	2/24/2026 9:54:00 AM	3.4	25.2	15.3	56.1			89.0	88.8	0.1
CHCV2001	CV-2001	2/24/2026 11:41:41 AM	10.9	62.2	4.6	22.3			92.9	95.4	0.2
CHCV2002	CV-2002	2/4/2026 8:30:00 AM					1500				
CHCV2002	CV-2002	2/4/2026 8:30:00 AM						72000			
CHCV2002	CV-2002	2/5/2026 2:02:01 PM	7.2	73.8	0.7	18.3			129.3	121.6	0.1
CHCV2002	CV-2002	2/15/2026 11:11:39 AM	11.8	66.5	0.0	21.7			139.4	139.3	0.2
CHCV2002	CV-2002	2/15/2026 11:22:56 AM	9.4	67.6	0.1	22.8			137.8	137.8	0.1
CHCV2003	CV-2003	2/13/2026 12:51:24 PM	13.4	78.1	0.0	8.5			111.1	111.2	0.2
CHCV2003	CV-2003	2/21/2026 10:10:41 AM	17.1	78.0	0.0	4.9			99.5	99.9	0.2
CHCV2006	CV-2006	2/4/2026 8:56:15 AM	1.2	85.6	0.0	13.2			185.6	185.8	0.0
CHCV2006	CV-2006	2/4/2026 9:00:00 AM						106100			
CHCV2006	CV-2006	2/4/2026 9:00:00 AM					2900				
CHCV2006	CV-2006	2/9/2026 8:33:47 AM	1.0	84.1	0.0	14.9			186.2	186.2	0.0
CHCV2006	CV-2006	2/9/2026 8:35:00 AM						158600			
CHCV2006	CV-2006	2/9/2026 8:35:00 AM					3640				
CHCV2006	CV-2006	2/17/2026 8:50:00 AM					2630				
CHCV2006	CV-2006	2/17/2026 8:51:19 AM	1.0	86.5	0.0	12.5			185.4	185.4	0.0
CHCV2006	CV-2006	2/17/2026 8:52:23 AM	1.0	85.7	0.0	13.3			185.6	185.3	0.0
CHCV2006	CV-2006	2/25/2026 9:32:58 AM	8.6	81.8	0.0	9.6			183.3	185.6	0.1
CHCV2006	CV-2006	2/25/2026 9:34:01 AM	8.0	83.8	0.0	8.2			185.8	185.9	0.1
CHCV2006	CV-2006	2/25/2026 9:35:00 AM					3130				
CHCV2007	CV-2007	2/5/2026 10:05:37 AM	18.4	65.2	3.8	12.6			107.2	107.2	0.3
CHCV2007	CV-2007	2/12/2026 9:47:00 AM					540				

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHCV2007	CV-2007	2/12/2026 9:47:00 AM						26000			
CHCV2007	CV-2007	2/24/2026 1:27:24 PM	13.6	74.1	0.2	12.1			155.7	151.7	0.2
CHCV2007	CV-2007	2/24/2026 1:31:43 PM	13.6	74.9	0.1	11.4			151.3	151.3	0.2
CHCV2008	CV-2008	2/10/2026 12:04:59 PM	19.3	80.7	0.0	0.0			96.9	96.8	0.2
CHCV2009	CV-2009	2/10/2026 11:37:29 AM	41.6	57.9	0.0	0.5			121.4	133.8	0.7
CHCV2009	CV-2009	2/10/2026 11:40:05 AM	41.4	58.6	0.0	0.0			133.8	133.9	0.7
CHCV2009	CV-2009	2/10/2026 11:42:53 AM	41.3	58.7	0.0	0.0			133.9	133.9	0.7
CCV2009A	CV-2009A	2/13/2026 3:35:47 PM	38.8	61.2	0.0	0.0			127.3	127.4	0.6
CHCV2010	CV-2010	2/9/2026 9:55:44 AM	28.7	64.4	0.0	6.9			92.5	97.3	0.4
CHCV2010	CV-2010	2/9/2026 9:56:07 AM	27.4	67.8	0.0	4.8			97.3	97.2	0.4
CCV2010A	CV-2010A	2/9/2026 2:47:50 PM	33.5	56.1	0.0	10.4			136.1	141.6	0.6
CCV2010A	CV-2010A	2/9/2026 2:54:13 PM	44.0	50.9	0.0	5.1			141.2	141.2	0.9
CHCV2011	CV-2011	2/9/2026 9:03:16 AM	49.6	49.0	0.0	1.4			106.0	106.5	1.0
CCV2011A	CV-2011A	2/9/2026 2:25:44 PM	21.2	60.8	0.0	18.0			145.2	145.2	0.3
CCV2011A	CV-2011A	2/9/2026 2:26:14 PM	20.9	62.2	0.0	16.9			145.2	145.3	0.3
CCV2011A	CV-2011A	2/17/2026 10:10:46 AM	18.4	54.7	1.8	25.1			146.0	145.9	0.3
CCV2011A	CV-2011A	2/17/2026 10:15:00 AM					913				
CCV2011A	CV-2011A	2/25/2026 2:00:00 PM					636				
CCV2011A	CV-2011A	2/25/2026 2:01:41 PM	38.9	56.4	0.0	4.7			146.5	146.6	0.7
CHCV2012	CV-2012	2/6/2026 2:37:13 PM	34.1	59.4	0.0	6.5			140.4	140.3	0.6
CHCV2201	CV-2201-PLR	2/2/2026 1:25:00 PM					1420				
CHCV2201	CV-2201-PLR	2/2/2026 1:25:00 PM						66200			
CHCV2201	CV-2201-PLR	2/2/2026 1:25:38 PM	21.4	78.6	0.0	0.0			144.9	141.1	0.3
CHCV2201	CV-2201-PLR	2/2/2026 1:26:49 PM	21.7	78.3	0.0	0.0			140.0	140.0	0.3
CHCV2201	CV-2201-PLR	2/12/2026 1:00:59 PM	2.2	82.0	0.1	15.7			195.5	194.9	0.0
CHCV2201	CV-2201-PLR	2/12/2026 2:00:00 PM					2260				
CHCV2201	CV-2201-PLR	2/12/2026 2:00:00 PM						123800			
CHCV2201	CV-2201-PLR	2/20/2026 8:27:48 AM	2.3	81.3	0.9	15.5			191.7	191.4	0.0
CHCV2201	CV-2201-PLR	2/20/2026 8:30:00 AM					1620				

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHCV2201	CV-2201-PLR	2/24/2026 9:32:07 AM	38.3	60.8	0.9	0.0			116.9	115.5	0.6
CHCV2201	CV-2201-PLR	2/24/2026 9:33:29 AM	29.5	68.7	1.8	0.0			115.2	114.3	0.4
CHCV2204	CV-2204-PLR	2/2/2026 10:25:00 AM					2050				
CHCV2204	CV-2204-PLR	2/2/2026 10:25:00 AM						64500			
CHCV2204	CV-2204-PLR	2/2/2026 10:25:24 AM	12.3	83.8	0.0	3.9			189.6	189.6	0.1
CHCV2204	CV-2204-PLR	2/2/2026 10:26:05 AM	13.9	85.6	0.0	0.5			189.6	189.6	0.2
CHCV2204	CV-2204-PLR	2/11/2026 12:50:00 PM						110800			
CHCV2204	CV-2204-PLR	2/11/2026 12:50:00 PM					3730				
CHCV2204	CV-2204-PLR	2/11/2026 12:50:04 PM	2.3	87.6	0.0	10.1			189.2	189.7	0.0
CHCV2204	CV-2204-PLR	2/19/2026 7:10:00 AM					3085				
CHCV2204	CV-2204-PLR	2/19/2026 7:18:55 AM	1.5	80.3	2.5	15.7			190.0	189.3	0.0
CHCV2204	CV-2204-PLR	2/23/2026 12:52:26 PM	11.3	69.5	3.2	16.0			191.4	191.4	0.2
CHCV2204	CV-2204-PLR	2/23/2026 1:10:00 PM					2940				
CHCV2205	CV-2205	2/9/2026 9:16:37 AM	44.0	50.8	0.0	5.2			125.3	124.9	0.9
CHCV2205	CV-2205	2/9/2026 9:17:55 AM	42.9	52.3	0.0	4.8			124.7	125.1	0.8
CHCV2206	CV-2206-PLR	2/12/2026 9:44:40 AM	1.0	54.2	8.9	35.9			74.0	74.6	0.0
CHCV2206	CV-2206-PLR	2/19/2026 7:30:00 AM					2540				
CHCV2206	CV-2206-PLR	2/24/2026 2:28:47 PM	0.3	7.8	18.8	73.1			88.1	88.2	0.0
CHCV2207	CV-2207	2/4/2026 8:39:28 AM	45.4	52.7	0.0	1.9			121.6	122.8	0.9
CCV2208A	CV-2208A	2/13/2026 2:56:11 PM	31.0	65.1	0.1	3.8			123.2	123.3	0.5
CCV2208A	CV-2208A	2/13/2026 2:57:44 PM	30.2	65.4	0.0	4.4			123.8	123.9	0.5
CCV2208A	CV-2208A	2/20/2026 10:44:45 AM	34.2	61.6	0.0	4.2			119.6	107.8	0.6
CCV2208A	CV-2208A	2/20/2026 10:48:10 AM	32.8	62.0	0.0	5.2			116.7	122.7	0.5
CCV2208A	CV-2208A	2/20/2026 10:49:42 AM	33.0	62.2	0.0	4.8			123.1	122.6	0.5
CHCV2301	CV-2301	2/3/2026 10:13:58 AM	35.1	63.3	0.0	1.6			178.5	178.5	0.6
CHCV2301	CV-2301	2/3/2026 10:15:00 AM						82000			
CHCV2301	CV-2301	2/3/2026 10:15:00 AM					1002				
CHCV2301	CV-2301	2/3/2026 10:16:01 AM	32.4	66.1	0.2	1.3			175.0	175.0	0.5
CHCV2301	CV-2301	2/10/2026 10:09:00 AM					2390				

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHCV2301	CV-2301	2/10/2026 10:09:00 AM						113600			
CHCV2301	CV-2301	2/10/2026 10:11:22 AM	8.3	72.0	1.1	18.6			176.1	176.0	0.1
CHCV2301	CV-2301	2/13/2026 7:25:00 AM					1500				
CHCV2301	CV-2301	2/13/2026 7:25:00 AM						120000			
CHCV2301	CV-2301	2/18/2026 10:02:16 AM	9.4	75.0	0.4	15.2			175.5	175.8	0.1
CHCV2301	CV-2301	2/18/2026 10:05:00 AM					2250				
CHCV2301	CV-2301	2/25/2026 9:05:32 AM	2.0	88.8	0.0	9.2			82.9	83.6	0.0
CHCV2301	CV-2301	2/25/2026 9:06:19 AM	2.0	89.1	0.0	8.9			83.9	84.0	0.0
CHCV2302	CV-2302	2/3/2026 9:04:43 AM	46.6	47.6	0.7	5.1			114.9	114.6	1.0
CHCV2302	CV-2302	2/13/2026 7:30:00 AM					120				
CHCV2302	CV-2302	2/13/2026 7:30:00 AM						18000			
CHCV2302	CV-2302	2/21/2026 8:29:42 AM	44.5	44.5	1.7	9.3			69.4	69.4	1.0
CHCV2303	CV-2303	2/3/2026 12:50:00 PM						106850			
CHCV2303	CV-2303	2/3/2026 12:50:00 PM					1896.5				
CHCV2303	CV-2303	2/3/2026 12:54:32 PM	11.5	70.7	1.5	16.3			179.4	178.9	0.2
CHCV2303	CV-2303	2/3/2026 12:55:38 PM	16.0	77.1	0.2	6.7			178.5	178.5	0.2
CHCV2303	CV-2303	2/9/2026 7:50:00 AM					2000				
CHCV2303	CV-2303	2/9/2026 7:50:00 AM						160000			
CHCV2303	CV-2303	2/11/2026 8:35:00 AM					400				
CHCV2303	CV-2303	2/11/2026 10:39:43 AM	1.0	83.8	0.1	15.1			189.5	190.1	0.0
CHCV2303	CV-2303	2/11/2026 10:40:00 AM						140200			
CHCV2303	CV-2303	2/11/2026 10:40:00 AM					3710				
CHCV2303	CV-2303	2/20/2026 9:24:13 AM	1.2	78.4	0.0	20.4			191.4	191.1	0.0
CHCV2303	CV-2303	2/20/2026 9:25:00 AM					2200				
CHCV2303	CV-2303	2/20/2026 9:25:11 AM	1.2	88.7	0.0	10.1			191.9	192.2	0.0
CHCV2303	CV-2303	2/23/2026 12:42:28 PM	1.3	84.3	0.0	14.4			188.4	189.5	0.0
CHCV2303	CV-2303	2/23/2026 12:43:25 PM	1.3	88.1	0.0	10.6			189.3	190.0	0.0
CHCV2303	CV-2303	2/24/2026 8:10:45 AM	6.0	88.1	0.4	5.5			193.1	192.2	0.1
CHCV2303	CV-2303	2/24/2026 8:12:25 AM	7.1	84.5	0.0	8.4			193.1	193.5	0.1

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHCV2303	CV-2303	2/24/2026 8:15:00 AM					2390				
CHCV2304	CV-2304	2/13/2026 2:23:29 PM	7.8	60.4	4.7	27.1			84.3	84.4	0.1
CHCV2304	CV-2304	2/13/2026 2:24:02 PM	7.8	59.7	4.7	27.8			86.1	86.2	0.1
CHCV2304	CV-2304	2/20/2026 9:54:10 AM	5.6	30.3	11.5	52.6			62.3	61.9	0.2
CHCV2304	CV-2304	2/20/2026 9:54:49 AM	6.0	26.8	11.3	55.9			60.3	60.1	0.2
CHCV2304	CV-2304	2/23/2026 9:57:36 AM	5.9	29.2	10.3	54.6			79.5	79.6	0.2
CHCV2304	CV-2304	2/23/2026 9:59:50 AM	6.1	31.8	9.9	52.2			80.0	80.0	0.2
CHCV2304	CV-2304	2/25/2026 12:59:41 PM	1.0	77.3	0.0	21.7			109.8	139.1	0.0
CHCV2304	CV-2304	2/25/2026 1:01:22 PM	2.0	73.2	0.0	24.9			147.2	149.2	0.0
CHCV2304	CV-2304	2/25/2026 1:03:35 PM	2.3	74.6	0.0	23.2			152.7	153.5	0.0
CHCV2305	CV-2305	2/9/2026 9:10:00 AM					1900				
CHCV2305	CV-2305	2/9/2026 9:10:00 AM						82000			
CHCV2305	CV-2305	2/12/2026 2:44:33 PM	19.2	74.4	0.1	6.3			159.2	158.8	0.3
CHCV2305	CV-2305	2/12/2026 2:46:45 PM	19.4	73.1	0.2	7.3			158.7	158.5	0.3
CHCV2305	CV-2305	2/12/2026 3:00:00 PM					1920				
CHCV2305	CV-2305	2/12/2026 3:00:00 PM						54700			
CHCV2305	CV-2305	2/18/2026 7:58:07 AM	13.0	79.3	0.3	7.4			156.8	156.9	0.2
CHCV2305	CV-2305	2/18/2026 8:00:00 AM					3130				
CHCV2305	CV-2305	2/24/2026 1:30:00 PM					2650				
CHCV2305	CV-2305	2/24/2026 1:31:29 PM	13.1	66.6	2.5	17.8			157.6	158.2	0.2
CHCV2306	CV-2306	2/2/2026 10:30:00 AM						58700			
CHCV2306	CV-2306	2/2/2026 10:30:00 AM					1030				
CHCV2306	CV-2306	2/2/2026 10:33:44 AM	14.2	60.4	0.0	25.4			177.2	177.2	0.2
CHCV2306	CV-2306	2/2/2026 10:36:13 AM	16.7	82.2	0.5	0.6			177.1	91.2	0.2
CHCV2306	CV-2306	2/11/2026 12:45:00 PM						146300			
CHCV2306	CV-2306	2/11/2026 12:45:00 PM					2190				
CHCV2306	CV-2306	2/11/2026 12:45:30 PM	2.6	74.7	0.4	22.3			183.0	183.0	0.0
CHCV2306	CV-2306	2/11/2026 12:46:33 PM	1.7	80.7	0.0	17.6			183.0	183.0	0.0
CHCV2306	CV-2306	2/19/2026 7:28:56 AM	1.7	93.8	0.1	4.4			185.0	185.0	0.0

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHCV2306	CV-2306	2/23/2026 12:45:00 PM	8.7	25.1	14.2	52.0			170.0	170.0	0.3
CHCV2306	CV-2306	2/23/2026 12:46:45 PM	9.5	31.2	11.3	48.0			170.0	170.0	0.3
CHCV2306	CV-2306	2/23/2026 1:00:00 PM					1600				
CHCV2308	CV-2308-PLR	2/12/2026 1:05:19 PM	2.0	78.7	0.3	19.0			167.1	166.1	0.0
CHCV2308	CV-2308-PLR	2/12/2026 1:55:00 PM					1300				
CHCV2308	CV-2308-PLR	2/12/2026 1:55:00 PM						128400			
CHCV2308	CV-2308-PLR	2/20/2026 8:21:49 AM	1.8	84.8	0.0	13.4			148.4	151.3	0.0
CHCV2308	CV-2308-PLR	2/20/2026 8:25:00 AM					1880				
CHCV2308	CV-2308-PLR	2/24/2026 9:39:50 AM	16.4	71.7	1.6	10.3			166.1	165.9	0.2
CHCV2308	CV-2308-PLR	2/24/2026 9:45:00 AM					1560				
CHCV2310	CV-2310-PLR	2/3/2026 10:38:54 AM	13.8	82.4	0.0	3.8			177.7	178.0	0.2
CHCV2310	CV-2310-PLR	2/3/2026 10:40:00 AM						64600			
CHCV2310	CV-2310-PLR	2/3/2026 10:40:00 AM					683				
CHCV2310	CV-2310-PLR	2/20/2026 9:05:00 AM					1570				
CHCV2310	CV-2310-PLR	2/20/2026 9:07:03 AM	0.3	16.0	19.3	64.4			190.8	191.9	0.0
CHCV2310	CV-2310-PLR	2/20/2026 9:09:01 AM	0.4	23.0	19.4	57.2			191.2	191.5	0.0
CHCV2310	CV-2310-PLR	2/24/2026 9:05:00 AM					1950				
CHCV2310	CV-2310-PLR	2/24/2026 9:09:15 AM	0.2	2.4	20.2	77.2			196.8	197.3	0.1
CHCV2310	CV-2310-PLR	2/24/2026 9:12:41 AM	0.3	7.2	19.1	73.4			196.8	68.9	0.0
CHCV2311	CV-2311	2/4/2026 12:48:18 PM	1.3	69.7	0.0	29.0			85.7	85.8	0.0
CHCV2311	CV-2311	2/4/2026 12:49:18 PM	1.3	69.7	0.0	29.0			85.7	85.6	0.0
CHCV2311	CV-2311	2/21/2026 8:27:53 AM	1.4	63.5	0.0	35.1			62.2	61.8	0.0
CHCV2311	CV-2311	2/21/2026 8:28:22 AM	1.3	81.7	0.0	17.0			61.4	60.9	0.0
CHCV2311	CV-2311	2/26/2026 3:07:04 PM	1.1	77.9	0.0	21.0			163.6	164.1	0.0
CHCV2311	CV-2311	2/26/2026 3:11:39 PM	1.1	80.3	0.0	18.6			166.8	166.0	0.0
CHCV2311	CV-2311	2/26/2026 3:15:40 PM	1.1	81.0	0.0	17.9			168.7	166.5	0.0
CHCV2311	CV-2311	2/26/2026 3:21:46 PM	1.1	80.8	0.0	18.1			167.6	164.6	0.0
CHCV2312	CV-2312	2/10/2026 7:20:00 AM					2500				
CHCV2312	CV-2312	2/13/2026 7:40:00 AM					2700				

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHCV2312	CV-2312	2/13/2026 7:40:00 AM						160000			
CHCV2312	CV-2312	2/18/2026 12:45:00 PM					3710				
CHCV2312	CV-2312	2/18/2026 12:45:31 PM	1.8	86.6	0.7	10.9			163.9	163.9	0.0
CHCV2312	CV-2312	2/24/2026 2:40:00 PM					2720				
CHCV2312	CV-2312	2/24/2026 2:42:09 PM	2.4	78.5	0.0	19.1			164.0	163.6	0.0
CHCV2314	CV-2314	2/4/2026 12:50:00 PM					4120				
CHCV2314	CV-2314	2/4/2026 12:50:00 PM						112600			
CHCV2314	CV-2314	2/4/2026 12:50:07 PM	2.5	81.1	0.0	16.4			150.3	150.5	0.0
CHCV2314	CV-2314	2/9/2026 9:00:00 AM					3300				
CHCV2314	CV-2314	2/9/2026 9:00:00 AM						140000			
CHCV2314	CV-2314	2/13/2026 1:50:00 PM					4209.5				
CHCV2314	CV-2314	2/13/2026 1:51:54 PM	1.5	82.7	0.0	15.8			152.3	152.6	0.0
CHCV2314	CV-2314	2/13/2026 1:52:21 PM	1.0	85.5	0.0	13.5			152.2	152.3	0.0
CHCV2314	CV-2314	2/20/2026 10:10:00 AM					4800				
CHCV2314	CV-2314	2/20/2026 10:10:25 AM	0.8	87.7	0.4	11.1			153.5	153.5	0.0
CHCV2314	CV-2314	2/26/2026 9:09:14 AM	2.7	88.9	0.0	8.4			155.9	156.0	0.0
CHCV2314	CV-2314	2/26/2026 9:10:00 AM					3760				
CHCV2315	CV-2315	2/6/2026 8:44:05 AM	6.7	89.8	0.0	3.5			151.7	151.6	0.1
CHCV2315	CV-2315	2/6/2026 8:44:41 AM	7.1	86.4	0.0	6.5			151.7	151.6	0.1
CHCV2315	CV-2315	2/10/2026 7:25:00 AM					2600				
CHCV2315	CV-2315	2/10/2026 7:50:00 AM					2400				
CHCV2315	CV-2315	2/13/2026 7:50:00 AM						91000			
CHCV2315	CV-2315	2/13/2026 7:50:00 AM					2400				
CHCV2315	CV-2315	2/13/2026 2:03:37 PM	4.9	85.0	0.0	10.1			160.5	160.6	0.1
CHCV2315	CV-2315	2/13/2026 2:05:00 PM					3279				
CHCV2315	CV-2315	2/17/2026 9:35:44 AM	7.5	83.8	0.3	8.4			153.7	153.9	0.1
CHCV2315	CV-2315	2/17/2026 9:40:00 AM					3110				
CHCV2315	CV-2315	2/24/2026 1:50:29 PM	7.9	83.1	1.0	8.0			147.1	147.0	0.1
CHCV2315	CV-2315	2/24/2026 1:55:00 PM					3240				

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHCV2316	CV-2316	2/10/2026 12:17:29 PM	10.1	70.2	1.5	18.2			138.9	132.6	0.1
CHCV2316	CV-2316	2/10/2026 12:20:20 PM	6.1	71.3	1.7	20.9			132.6	132.6	0.1
CHCV2319	CV-2319	2/12/2026 2:23:38 PM	2.4	85.8	0.0	11.8			129.9	129.7	0.0
CHCV2319	CV-2319	2/12/2026 2:24:11 PM	2.4	84.4	0.0	13.2			129.9	129.7	0.0
CHCV2319	CV-2319	2/18/2026 1:56:55 PM	7.7	78.6	0.0	13.7			142.9	143.0	0.1
CHCV2319	CV-2319	2/18/2026 1:58:01 PM	7.0	83.0	0.0	10.0			143.1	143.2	0.1
CHCV2321	CV-2321	2/9/2026 2:09:14 PM	12.8	75.0	0.0	12.2			144.4	144.7	0.2
CHCV2321	CV-2321	2/9/2026 2:09:54 PM	12.1	78.2	0.0	9.7			144.7	144.7	0.2
CHCV2322	CV-2322	2/4/2026 10:15:00 AM					2560				
CHCV2322	CV-2322	2/4/2026 10:15:00 AM						101500			
CHCV2322	CV-2322	2/4/2026 10:15:02 AM	2.0	86.2	0.0	11.8			158.0	158.6	0.0
CHCV2322	CV-2322	2/11/2026 9:08:21 AM	1.5	82.4	0.1	16.0			140.6	136.7	0.0
CHCV2322	CV-2322	2/18/2026 9:20:00 AM					3290				
CHCV2322	CV-2322	2/18/2026 9:20:51 AM	1.1	90.9	0.0	8.0			145.8	145.6	0.0
CHCV2322	CV-2322	2/24/2026 2:01:18 PM	1.5	77.1	2.0	19.4			162.5	161.3	0.0
CHCV2322	CV-2322	2/24/2026 2:05:00 PM					3000				
CHCV2322	CV-2322	2/24/2026 2:07:49 PM	1.7	86.8	0.0	11.5			160.4	160.5	0.0
CHCV2324	CV-2324	2/9/2026 9:12:45 AM	49.3	45.7	0.0	5.0			108.3	108.8	1.1
CHCV2326	CV-2326	2/12/2026 2:35:05 PM	10.8	69.8	0.8	18.7			70.0	70.1	0.2
CHCV2326	CV-2326	2/21/2026 8:52:26 AM	8.9	61.2	4.6	25.3			104.9	104.8	0.1
CHCV2327	CV-2327	2/3/2026 8:41:55 AM	3.6	84.4	0.0	12.0			174.2	178.2	0.0
CHCV2327	CV-2327	2/3/2026 8:42:45 AM	3.9	87.6	0.0	8.5			179.5	179.7	0.0
CHCV2327	CV-2327	2/3/2026 8:45:00 AM						121900			
CHCV2327	CV-2327	2/3/2026 8:45:00 AM					2582				
CHCV2327	CV-2327	2/10/2026 2:18:55 PM	0.8	83.7	0.0	15.5			176.9	176.8	0.0
CHCV2327	CV-2327	2/10/2026 2:20:00 PM						110600			
CHCV2327	CV-2327	2/10/2026 2:40:00 PM					2940				
CHCV2327	CV-2327	2/18/2026 9:33:14 AM	1.6	91.9	0.0	6.5			177.7	178.4	0.0
CHCV2327	CV-2327	2/18/2026 9:35:00 AM					3170				

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHCV2327	CV-2327	2/24/2026 2:16:44 PM	1.3	87.5	0.0	11.2			147.2	143.7	0.0
CHCV2327	CV-2327	2/24/2026 2:17:46 PM	1.3	90.4	0.0	8.3			142.4	142.3	0.0
CHCV2328	CV-2328	2/3/2026 8:54:23 AM	21.2	78.8	0.0	0.0			165.1	165.9	0.3
CHCV2328	CV-2328	2/3/2026 8:55:00 AM						88750			
CHCV2328	CV-2328	2/3/2026 8:55:00 AM					924.5				
CHCV2328	CV-2328	2/9/2026 8:35:00 AM					890				
CHCV2328	CV-2328	2/9/2026 8:35:00 AM						90000			
CHCV2328	CV-2328	2/10/2026 8:40:00 AM					1140				
CHCV2328	CV-2328	2/10/2026 8:40:00 AM						72000			
CHCV2328	CV-2328	2/10/2026 8:41:42 AM	11.7	83.0	0.0	5.3			170.3	170.5	0.1
CHCV2328	CV-2328	2/18/2026 9:45:33 AM	31.0	59.0	0.1	9.9			138.6	139.8	0.5
CHCV2333	CV-2333	2/2/2026 8:27:07 AM	1.6	84.8	0.6	13.0			182.4	182.3	0.0
CHCV2333	CV-2333	2/2/2026 8:28:36 AM	1.5	82.3	0.4	15.8			182.5	182.3	0.0
CHCV2333	CV-2333	2/2/2026 8:30:00 AM					4070				
CHCV2333	CV-2333	2/2/2026 8:40:00 AM					3800				
CHCV2333	CV-2333	2/2/2026 8:40:00 AM						180000			
CHCV2333	CV-2333	2/9/2026 9:47:16 AM	0.6	89.1	0.0	10.3			159.9	161.2	0.0
CHCV2333	CV-2333	2/9/2026 9:50:00 AM					5360				
CHCV2333	CV-2333	2/9/2026 9:50:00 AM						149400			
CHCV2333	CV-2333	2/17/2026 7:40:00 AM					3875				
CHCV2333	CV-2333	2/17/2026 7:40:44 AM	0.4	82.1	1.6	15.9			185.1	185.1	0.0
CHCV2333	CV-2333	2/23/2026 8:39:20 AM	0.8	84.6	1.6	13.0			185.3	184.8	0.0
CHCV2333	CV-2333	2/23/2026 8:40:00 AM					4510				
CHCV2334	CV-2334	2/2/2026 8:45:00 AM						26000			
CHCV2334	CV-2334	2/2/2026 8:45:00 AM					390				
CHCV2334	CV-2334	2/12/2026 9:32:50 AM	30.5	69.3	0.0	0.2			127.4	127.5	0.4
CHCV2335	CV-2335	2/12/2026 2:24:13 PM	47.5	49.7	0.1	2.7			96.1	94.4	1.0
CHCV2335	CV-2335	2/21/2026 9:28:13 AM	44.4	50.4	0.6	4.6			82.8	83.5	0.9
CHCV2335	CV-2335	2/21/2026 9:29:13 AM	44.3	50.2	0.7	4.8			81.6	81.6	0.9

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHCV2336	CV-2336	2/6/2026 3:46:42 PM	1.1	0.1	21.4	77.4			78.0	76.8	11.0
CHCV2336	CV-2336	2/6/2026 3:47:03 PM	1.2	0.5	21.1	77.2			75.9	75.9	2.4
CHCV2336	CV-2336	2/21/2026 9:33:31 AM	0.5	7.9	20.2	71.4			56.3	56.2	0.1
CHCV2336	CV-2336	2/21/2026 9:35:42 AM	0.2	1.3	21.4	77.1			55.2	55.2	0.2
CHCV2337	CV-2337	2/12/2026 8:50:00 AM					15				
CHCV2337	CV-2337	2/12/2026 8:50:00 AM						3900			
CHCV2337	CV-2337	2/13/2026 3:26:07 PM	6.6	66.6	2.5	24.3			111.5	111.4	0.1
CHCV2337	CV-2337	2/27/2026 10:22:06 AM	3.9	50.6	7.8	37.7			89.5	89.5	0.1
CHCV2337	CV-2337	2/27/2026 10:23:08 AM	3.9	51.2	7.6	37.3			89.7	89.6	0.1
CHCV2338	CV-2338	2/4/2026 9:05:00 AM					1380				
CHCV2338	CV-2338	2/4/2026 9:05:00 AM						135200			
CHCV2338	CV-2338	2/4/2026 9:06:09 AM	2.0	84.3	0.4	13.3			152.1	154.2	0.0
CHCV2338	CV-2338	2/4/2026 9:09:00 AM	2.5	76.2	1.3	20.0			155.2	155.5	0.0
CHCV2338	CV-2338	2/9/2026 8:39:02 AM	1.4	82.0	0.4	16.2			153.6	155.2	0.0
CHCV2338	CV-2338	2/9/2026 8:40:00 AM						156350			
CHCV2338	CV-2338	2/9/2026 8:40:00 AM					1505				
CHCV2338	CV-2338	2/17/2026 8:55:00 AM					1530				
CHCV2338	CV-2338	2/17/2026 8:59:05 AM	1.5	80.2	1.2	17.1			168.8	168.8	0.0
CHCV2338	CV-2338	2/17/2026 9:01:39 AM	1.5	79.6	0.8	18.1			168.8	168.8	0.0
CHCV2338	CV-2338	2/25/2026 9:27:52 AM	10.8	79.7	0.2	9.3			176.8	177.8	0.1
CHCV2338	CV-2338	2/25/2026 9:30:00 AM					1300				
CHCV2339	CV-2339	2/6/2026 1:53:56 PM	0.5	11.8	16.7	71.0			89.7	89.7	0.0
CHCV2339	CV-2339	2/6/2026 1:57:42 PM	0.5	7.6	18.5	73.4			89.4	88.0	0.1
CHCV2339	CV-2339	2/24/2026 4:01:50 PM	5.1	6.9	19.9	68.1			83.2	83.4	0.7
CHCV2339	CV-2339	2/24/2026 4:04:12 PM	4.5	6.7	19.8	69.0			83.9	84.0	0.7
CHCV2341	CV-2341	2/4/2026 2:28:30 PM	22.8	60.3	0.4	16.5			102.2	100.6	0.4
CHCV2341	CV-2341	2/6/2026 1:48:54 PM	28.8	58.5	0.4	12.3			109.3	109.3	0.5
CHCV2341	CV-2341	2/9/2026 8:30:00 AM					640				
CHCV2341	CV-2341	2/9/2026 8:30:00 AM						110000			

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHCV2341	CV-2341	2/24/2026 3:38:10 PM	30.6	55.4	1.4	12.6			90.6	88.5	0.6
CCV2342A	CV-2342A-PLR	2/4/2026 7:53:04 AM	3.2	75.5	0.0	21.3			151.7	154.8	0.0
CCV2342A	CV-2342A-PLR	2/4/2026 7:55:00 AM					589				
CCV2342A	CV-2342A-PLR	2/4/2026 7:55:00 AM						136100			
CCV2342A	CV-2342A-PLR	2/9/2026 7:35:00 AM						183700			
CCV2342A	CV-2342A-PLR	2/9/2026 7:35:00 AM					597				
CCV2342A	CV-2342A-PLR	2/9/2026 7:38:39 AM	2.9	78.4	0.0	18.7			169.2	170.2	0.0
CCV2342A	CV-2342A-PLR	2/17/2026 11:41:38 AM	2.9	76.5	0.0	20.6			184.8	184.8	0.0
CCV2342A	CV-2342A-PLR	2/17/2026 12:15:00 PM					730				
CCV2342A	CV-2342A-PLR	2/25/2026 1:00:28 PM	14.3	74.2	0.0	11.5			190.4	190.2	0.2
CCV2342A	CV-2342A-PLR	2/25/2026 1:05:00 PM					795				
CHCV2343	CV-2343	2/4/2026 8:19:36 AM	0.7	88.3	0.0	11.0			128.8	128.6	0.0
CHCV2343	CV-2343	2/9/2026 7:05:00 AM						163700			
CHCV2343	CV-2343	2/9/2026 7:05:00 AM					4750				
CHCV2343	CV-2343	2/9/2026 7:57:27 AM	0.6	84.5	0.0	14.9			157.6	158.0	0.0
CHCV2343	CV-2343	2/17/2026 12:30:00 PM					5590				
CHCV2343	CV-2343	2/17/2026 12:33:43 PM	0.5	80.9	0.0	18.6			189.9	184.6	0.0
CHCV2343	CV-2343	2/25/2026 10:16:50 AM	6.3	80.6	0.0	13.1			181.8	180.9	0.1
CHCV2343	CV-2343	2/25/2026 10:17:50 AM	7.0	56.1	0.0	36.9			176.1	177.6	0.1
CHCV2343	CV-2343	2/25/2026 10:20:00 AM					4420				
CHCV2344	CV-2344	2/5/2026 7:55:00 AM					2400				
CHCV2344	CV-2344	2/5/2026 7:55:00 AM						130000			
CHCV2344	CV-2344	2/6/2026 9:17:17 AM	4.0	86.6	0.0	9.4			153.9	156.1	0.0
CHCV2344	CV-2344	2/6/2026 9:18:30 AM	4.4	88.0	0.0	7.6			155.9	155.7	0.1
CHCV2344	CV-2344	2/9/2026 8:02:34 AM	4.4	89.8	0.0	5.8			151.8	152.4	0.0
CHCV2344	CV-2344	2/9/2026 8:05:00 AM						104200			
CHCV2344	CV-2344	2/9/2026 8:05:00 AM					3770				
CHCV2344	CV-2344	2/17/2026 12:39:40 PM	13.0	75.6	0.1	11.3			160.6	160.8	0.2
CHCV2344	CV-2344	2/17/2026 12:40:00 PM					3060				

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHCV2344	CV-2344	2/25/2026 10:13:28 AM	24.7	67.4	0.0	7.9			165.1	165.7	0.4
CHCV2344	CV-2344	2/25/2026 10:15:00 AM					2210				
CHCV2345	CV-2345	2/5/2026 8:00:00 AM					510				
CHCV2345	CV-2345	2/5/2026 8:00:00 AM						28000			
CHCV2345	CV-2345	2/6/2026 9:21:31 AM	22.9	77.1	0.0	0.0			114.0	114.1	0.3
CHCV2345	CV-2345	2/21/2026 9:48:59 AM	18.7	68.5	0.4	12.4			107.6	108.2	0.3
CHCV2346	CV-2346	2/5/2026 8:05:00 AM					3300				
CHCV2346	CV-2346	2/5/2026 8:05:00 AM						140000			
CHCV2346	CV-2346	2/13/2026 12:46:33 PM	1.5	82.2	1.1	15.2			177.2	177.1	0.0
CHCV2346	CV-2346	2/17/2026 12:44:12 PM	1.6	87.5	0.0	10.9			177.3	177.1	0.0
CHCV2346	CV-2346	2/17/2026 12:45:00 PM					5180				
CHCV2346	CV-2346	2/25/2026 10:06:08 AM	10.0	84.1	0.0	5.9			177.8	178.1	0.1
CHCV2346	CV-2346	2/25/2026 10:10:00 AM					3930				
CHCV2347	CV-2347	2/5/2026 8:10:00 AM					2800				
CHCV2347	CV-2347	2/5/2026 8:10:00 AM						100000			
CHCV2347	CV-2347	2/6/2026 9:35:47 AM	7.7	86.9	0.0	5.4			116.5	115.7	0.1
CHCV2347	CV-2347	2/21/2026 9:25:20 AM	13.0	64.9	0.0	22.1			64.6	64.8	0.2
CHCV2348	CV-2348	2/9/2026 8:20:00 AM					200				
CHCV2348	CV-2348	2/9/2026 8:20:00 AM						14000			
CHCV2348	CV-2348	2/13/2026 11:00:52 AM	32.8	56.8	0.0	10.4			124.0	123.1	0.6
CHCV2348	CV-2348	2/24/2026 11:05:23 AM	31.1	43.4	0.1	25.4			123.3	124.0	0.7
CHCV2349	CV-2349	2/3/2026 7:25:00 AM					2700				
CHCV2349	CV-2349	2/3/2026 7:25:00 AM						120000			
CHCV2349	CV-2349	2/6/2026 7:40:27 AM	2.8	89.0	0.1	8.1			99.0	99.1	0.0
CHCV2349	CV-2349	2/21/2026 10:24:54 AM	2.6	78.8	1.5	17.1			98.1	98.0	0.0
CHCV2350	CV-2350	2/4/2026 8:20:00 AM					4000				
CHCV2350	CV-2350	2/4/2026 8:20:00 AM						150000			
CHCV2350	CV-2350	2/5/2026 1:55:46 PM	3.9	65.5	2.8	27.8			117.7	117.7	0.1
CHCV2350	CV-2350	2/21/2026 11:03:11 AM	6.1	73.8	1.2	18.9			96.9	97.0	0.1

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHCV2351	CV-2351	2/3/2026 6:50:00 AM					0				
CHCV2351	CV-2351	2/3/2026 6:50:00 AM						3100			
CHCV2351	CV-2351	2/6/2026 8:11:19 AM	0.0	4.0	20.8	75.2			61.1	61.1	0.0
CHCV2351	CV-2351	2/24/2026 10:23:27 AM	1.7	31.5	12.2	54.6			86.5	86.5	0.1
CHCV2352	CV-2352	2/3/2026 7:00:00 AM					1300				
CHCV2352	CV-2352	2/3/2026 7:00:00 AM						220000			
CHCV2352	CV-2352	2/6/2026 8:15:34 AM	1.8	69.6	3.4	25.2			84.6	84.3	0.0
CHCV2352	CV-2352	2/23/2026 1:45:34 PM	4.0	74.0	2.2	19.8			99.7	99.7	0.1
CHCV2353	CV-2353-PLR	2/4/2026 7:47:39 AM	3.0	72.4	1.7	22.9			110.1	109.3	0.0
CHCV2353	CV-2353-PLR	2/4/2026 7:50:34 AM	2.3	69.1	3.3	25.3			108.5	108.5	0.0
CHCV2353	CV-2353-PLR	2/5/2026 7:50:00 AM					920				
CHCV2353	CV-2353-PLR	2/5/2026 7:50:00 AM						200000			
CHCV2353	CV-2353-PLR	2/6/2026 8:22:35 AM	2.6	68.9	2.3	26.2			96.2	96.2	0.0
CHCV2353	CV-2353-PLR	2/24/2026 10:30:11 AM	2.4	75.0	1.1	21.5			154.3	155.7	0.0
CHCV2353	CV-2353-PLR	2/24/2026 10:30:47 AM	2.5	75.9	0.4	21.2			159.0	158.4	0.0
CHCV2354	CV-2354	2/3/2026 7:20:00 AM					2500				
CHCV2354	CV-2354	2/3/2026 7:20:00 AM						150000			
CHCV2354	CV-2354	2/24/2026 9:59:42 AM	6.6	80.0	0.0	13.4			189.4	189.2	0.1
CHCV2354	CV-2354	2/24/2026 10:01:03 AM	6.1	82.0	0.0	11.9			189.1	189.4	0.1
CCV24001	CV-24001	2/4/2026 8:05:00 AM						6500			
CCV24001	CV-24001	2/12/2026 2:14:22 PM	45.8	52.3	0.0	1.9			86.5	86.6	0.9
CCV24001	CV-24001	2/21/2026 9:21:28 AM	41.3	49.6	1.3	7.8			77.2	78.1	0.8
CCV24002	CV-24002	2/12/2026 2:07:25 PM	44.3	53.6	0.0	2.1			108.0	107.4	0.8
CCV24002	CV-24002	2/21/2026 9:16:48 AM	39.2	50.8	1.8	8.2			99.2	99.3	0.8
CCV24003	CV-24003	2/12/2026 10:29:22 AM	44.1	54.8	0.0	1.1			111.5	111.2	0.8
CCV24003	CV-24003	2/21/2026 9:07:32 AM	38.9	52.9	1.2	7.0			102.6	102.4	0.7
CCV24004	CV-24004	2/12/2026 10:11:14 AM	45.1	53.9	0.0	0.9			109.6	109.5	0.8
CCV24004	CV-24004	2/12/2026 10:18:43 AM	47.2	52.2	0.0	0.7			109.5	109.6	0.9
CCV24004	CV-24004	2/21/2026 9:12:17 AM	41.7	48.6	1.5	8.2			104.6	104.6	0.9

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CCV24006	CV-24006	2/12/2026 1:35:51 PM	13.4	75.3	0.0	11.3			88.8	110.1	0.2
CCV24006	CV-24006	2/12/2026 1:37:10 PM	14.7	75.0	0.0	10.3			114.9	114.6	0.2
CCV24006	CV-24006	2/21/2026 8:56:06 AM	21.6	74.4	0.6	3.4			129.3	129.0	0.3
CCV24006	CV-24006	2/21/2026 8:56:53 AM	21.8	74.1	0.5	3.6			128.6	128.7	0.3
CCV24007	CV-24007	2/9/2026 7:40:00 AM					430				
CCV24007	CV-24007	2/9/2026 7:40:00 AM						36000			
CCV24007	CV-24007	2/11/2026 8:30:00 AM					520				
CCV24007	CV-24007	2/12/2026 1:52:48 PM	17.9	66.9	0.0	15.2			112.3	112.4	0.3
CCV24007	CV-24007	2/21/2026 8:31:22 AM	19.8	63.6	0.9	15.7			110.7	110.1	0.3
CCV24009	CV-24009	2/2/2026 1:10:00 PM					1350				
CCV24009	CV-24009	2/2/2026 1:10:00 PM						92600			
CCV24009	CV-24009	2/2/2026 1:11:53 PM	23.0	76.8	0.2	0.0			159.8	159.8	0.3
CCV24009	CV-24009	2/10/2026 1:53:00 PM					998				
CCV24009	CV-24009	2/10/2026 1:53:00 PM						110600			
CCV24009	CV-24009	2/10/2026 1:54:24 PM	10.9	77.9	0.1	11.1			156.3	156.2	0.1
CCV24009	CV-24009	2/20/2026 7:53:06 AM	9.7	77.1	1.0	12.2			155.9	155.8	0.1
CCV24009	CV-24009	2/20/2026 7:55:00 AM					1190				
CCV24009	CV-24009	2/23/2026 1:26:03 PM	19.1	69.0	2.1	9.8			158.4	158.5	0.3
CCV24009	CV-24009	2/23/2026 1:30:00 PM					1700				
CCV24010	CV-24010	2/12/2026 9:52:10 AM	21.3	46.3	0.0	32.5			77.0	77.0	0.5
CCV24010	CV-24010	2/21/2026 8:09:11 AM	19.7	43.7	1.5	35.1			53.1	54.1	0.5
CCV24011	CV-24011	2/10/2026 10:23:13 AM	3.8	76.8	0.0	19.4			65.9	64.3	0.0
CCV24011	CV-24011	2/10/2026 10:23:56 AM	3.1	81.1	0.0	15.8			63.6	63.4	0.0
CCV24011	CV-24011	2/21/2026 8:34:32 AM	4.2	70.7	0.0	25.1			60.6	60.9	0.1
CCV24011	CV-24011	2/21/2026 8:34:55 AM	3.3	80.0	0.0	16.7			60.6	60.3	0.0
CCV24011	CV-24011	2/26/2026 3:54:25 PM	3.5	78.7	0.0	17.8			101.8	101.2	0.0
CCV24011	CV-24011	2/26/2026 4:06:07 PM	3.7	77.9	0.0	18.4			99.6	99.2	0.0
CCV24012	CV-24012	2/10/2026 1:30:00 PM					1750				
CCV24012	CV-24012	2/10/2026 1:30:00 PM						155500			

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CCV24012	CV-24012	2/10/2026 1:30:09 PM	1.9	85.1	0.0	13.0			180.1	182.9	0.0
CCV24012	CV-24012	2/20/2026 8:15:00 AM					1590				
CCV24012	CV-24012	2/20/2026 8:16:50 AM	1.4	83.6	0.2	14.8			183.0	182.6	0.0
CCV24012	CV-24012	2/23/2026 1:39:49 PM	10.2	62.8	4.5	22.5			183.9	182.9	0.2
CCV24012	CV-24012	2/23/2026 2:00:00 PM					2250				
CCV24013	CV-24013	2/6/2026 2:51:33 PM	0.0	12.3	17.7	70.0			108.1	106.4	0.0
CCV24013	CV-24013	2/6/2026 2:52:10 PM	1.4	13.0	17.4	68.2			110.5	111.5	0.1
CCV24013	CV-24013	2/24/2026 2:15:34 PM	0.3	10.4	18.1	71.2			104.6	107.3	0.0
CCV24014	CV-24014	2/2/2026 1:05:00 PM					2190				
CCV24014	CV-24014	2/2/2026 1:05:00 PM						149000			
CCV24014	CV-24014	2/2/2026 1:05:29 PM	17.0	78.0	0.3	4.7			178.1	179.1	0.2
CCV24014	CV-24014	2/2/2026 1:06:30 PM	16.2	77.0	0.3	6.5			179.1	178.9	0.2
CCV24014	CV-24014	2/10/2026 1:47:00 PM					1540				
CCV24014	CV-24014	2/10/2026 1:47:00 PM						165100			
CCV24014	CV-24014	2/10/2026 1:47:08 PM	3.5	78.0	0.0	18.5			178.3	178.1	0.0
CCV24014	CV-24014	2/20/2026 7:43:02 AM	4.3	78.7	0.4	16.6			177.2	177.3	0.1
CCV24014	CV-24014	2/20/2026 7:45:00 AM					1250				
CCV24014	CV-24014	2/23/2026 1:07:33 PM	14.1	71.8	1.4	12.7			178.1	178.0	0.2
CCV24014	CV-24014	2/23/2026 1:20:00 PM					1990				
CCV24014	CV-24014	2/24/2026 2:19:36 PM	19.4	79.3	0.0	1.3			96.7	100.3	0.2
CCV24015	CV-24015	2/2/2026 9:24:54 AM	7.6	76.3	0.0	16.1			185.4	183.1	0.1
CCV24015	CV-24015	2/2/2026 9:25:00 AM					3510				
CCV24015	CV-24015	2/2/2026 9:25:00 AM						199800			
CCV24015	CV-24015	2/2/2026 9:25:28 AM	7.9	79.9	0.0	12.2			183.0	183.1	0.1
CCV24015	CV-24015	2/9/2026 10:15:00 AM						189200			
CCV24015	CV-24015	2/9/2026 10:15:00 AM					2310				
CCV24015	CV-24015	2/9/2026 10:15:34 AM	1.8	77.5	0.4	20.3			186.2	186.1	0.0
CCV24015	CV-24015	2/17/2026 8:27:48 AM	10.5	71.3	1.9	16.3			184.7	184.7	0.1
CCV24015	CV-24015	2/17/2026 8:30:00 AM					2250				

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CCV24015	CV-24015	2/23/2026 9:06:41 AM	3.1	75.1	1.9	19.9			184.7	184.8	0.0
CCV24015	CV-24015	2/23/2026 9:27:00 AM					2220				
CCV24016	CV-24016	2/3/2026 1:30:00 PM						165100			
CCV24016	CV-24016	2/3/2026 1:30:00 PM					2919				
CCV24016	CV-24016	2/10/2026 1:19:27 PM	1.7	81.3	0.0	17.0			68.8	68.3	0.0
CCV24016	CV-24016	2/10/2026 1:19:56 PM	1.3	83.0	0.0	15.7			68.1	68.0	0.0
CCV24016	CV-24016	2/21/2026 8:43:05 AM	1.0	80.1	0.0	18.9			84.2	83.1	0.0
CCV24016	CV-24016	2/21/2026 8:43:29 AM	1.7	81.5	0.0	16.8			82.4	81.8	0.0
CCV24017	CV-24017	2/4/2026 1:10:39 PM	2.2	83.2	0.0	14.6			94.6	146.3	0.0
CCV24017	CV-24017	2/4/2026 1:13:19 PM	2.3	81.3	0.0	16.4			161.1	169.0	0.0
CCV24017	CV-24017	2/4/2026 1:15:00 PM					3420				
CCV24017	CV-24017	2/4/2026 1:15:00 PM						177300			
CCV24017	CV-24017	2/9/2026 7:45:00 AM					1500				
CCV24017	CV-24017	2/9/2026 7:45:00 AM						150000			
CCV24017	CV-24017	2/10/2026 10:29:06 AM	7.7	81.9	0.0	10.4			170.9	170.1	0.1
CCV24017	CV-24017	2/10/2026 10:30:00 AM						130400			
CCV24017	CV-24017	2/10/2026 10:30:00 AM					2020				
CCV24017	CV-24017	2/12/2026 8:00:00 AM					1400				
CCV24017	CV-24017	2/12/2026 8:00:00 AM						140000			
CCV24017	CV-24017	2/20/2026 8:02:01 AM	8.2	74.1	2.3	15.4			176.1	175.9	0.1
CCV24017	CV-24017	2/20/2026 8:05:00 AM					1710				
CCV24017	CV-24017	2/23/2026 1:32:29 PM	18.5	67.4	2.2	11.9			176.0	176.1	0.3
CCV24017	CV-24017	2/23/2026 1:40:00 PM					2230				
CCV24018	CV-24018	2/13/2026 2:34:55 PM	6.4	80.9	0.0	12.7			124.3	124.4	0.1
CCV24018	CV-24018	2/25/2026 11:03:55 AM	5.3	79.3	0.0	15.4			118.1	108.7	0.1
CCV24018	CV-24018	2/25/2026 11:05:14 AM	4.9	82.2	0.0	12.9			115.7	115.8	0.1
CCV24019	CV-24019	2/3/2026 1:20:00 AM					1982				
CCV24019	CV-24019	2/3/2026 1:20:00 PM						161400			
CCV24019	CV-24019	2/3/2026 1:22:30 PM	9.5	80.0	0.0	10.5			190.0	187.9	0.1

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CCV24019	CV-24019	2/3/2026 1:23:25 PM	9.6	70.5	0.0	19.9			186.1	184.7	0.1
CCV24019	CV-24019	2/10/2026 1:11:24 PM	1.0	82.0	0.0	17.0			198.1	198.9	0.0
CCV24019	CV-24019	2/10/2026 1:15:00 PM					2370				
CCV24019	CV-24019	2/10/2026 1:15:00 PM						153200			
CCV24019	CV-24019	2/20/2026 9:15:00 AM					1030				
CCV24019	CV-24019	2/20/2026 9:16:16 AM	1.4	77.6	2.7	18.3			185.7	185.3	0.0
CCV24019	CV-24019	2/24/2026 8:00:00 AM					1525				
CCV24019	CV-24019	2/24/2026 8:04:33 AM	3.7	65.5	6.2	24.6			185.1	185.1	0.1
CCV24019	CV-24019	2/24/2026 8:06:29 AM	4.4	69.3	4.6	21.7			185.3	185.1	0.1
CCV24020	CV-24020	2/12/2026 1:29:24 PM	0.2	11.6	16.1	72.1			80.1	80.3	0.0
CCV24020	CV-24020	2/24/2026 2:03:12 PM	0.2	52.4	7.9	39.5			89.3	89.2	0.0
CCV24021	CV-24021	2/12/2026 1:34:14 PM	0.4	7.4	17.9	74.3			85.8	85.8	0.1
CCV24021	CV-24021	2/24/2026 2:10:58 PM	0.1	9.6	19.0	71.3			93.7	93.6	0.0
CCV24022	CV-24022-PLR	2/2/2026 12:59:56 PM	10.3	85.6	0.0	4.1			178.4	195.7	0.1
CCV24022	CV-24022-PLR	2/2/2026 1:00:00 PM					2215				
CCV24022	CV-24022-PLR	2/2/2026 1:00:00 PM						208900			
CCV24022	CV-24022-PLR	2/2/2026 1:01:17 PM	13.4	83.4	0.5	2.7			194.5	194.1	0.2
CCV24022	CV-24022-PLR	2/10/2026 1:36:00 PM					2040				
CCV24022	CV-24022-PLR	2/10/2026 1:36:18 PM	1.2	69.7	2.8	26.3			189.5	189.7	0.0
CCV24022	CV-24022-PLR	2/19/2026 7:45:00 AM					2930				
CCV24022	CV-24022-PLR	2/19/2026 7:45:59 AM	1.5	70.0	3.5	25.0			191.9	192.6	0.0
CCV24022	CV-24022-PLR	2/23/2026 1:01:31 PM	9.1	62.8	4.1	24.0			193.1	192.9	0.1
CCV24022	CV-24022-PLR	2/23/2026 1:15:00 PM					2710				
CCV24023	CV-24023	2/2/2026 9:35:00 AM					1780				
CCV24023	CV-24023	2/2/2026 9:35:00 AM						109700			
CCV24023	CV-24023	2/2/2026 9:37:03 AM	8.6	73.3	0.8	17.3			186.9	185.6	0.1
CCV24023	CV-24023	2/2/2026 9:38:20 AM	9.2	74.4	0.0	16.4			185.8	185.6	0.1
CCV24023	CV-24023	2/9/2026 10:24:03 AM	1.5	80.9	0.0	17.6			195.0	195.2	0.0
CCV24023	CV-24023	2/9/2026 10:25:00 AM						188200			

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CCV24023	CV-24023	2/9/2026 10:25:00 AM					1810				
CCV24023	CV-24023	2/17/2026 8:42:23 AM	0.9	53.1	8.0	38.0			178.6	178.2	0.0
CCV24023	CV-24023	2/17/2026 8:43:31 AM	0.7	43.8	10.0	45.5			180.1	178.8	0.0
CCV24023	CV-24023	2/17/2026 8:45:00 AM					2710				
CCV24023	CV-24023	2/23/2026 9:26:06 AM	2.5	69.9	3.4	24.2			171.8	171.6	0.0
CCV24023	CV-24023	2/23/2026 9:42:00 AM					3575				
CCV24024	CV-24024-PLR	2/13/2026 3:16:51 PM	1.4	70.4	2.1	26.1			121.1	121.2	0.0
CCV24024	CV-24024-PLR	2/25/2026 2:06:57 PM	1.6	73.2	1.4	23.8			156.3	154.9	0.0
CCV24024	CV-24024-PLR	2/25/2026 2:35:00 PM					1550				
CCV24025	CV-24025	2/3/2026 1:02:31 PM	14.6	72.5	0.0	12.9			168.5	168.5	0.2
CCV24025	CV-24025	2/3/2026 1:03:47 PM	15.6	74.5	0.0	9.9			168.5	168.6	0.2
CCV24025	CV-24025	2/3/2026 1:05:00 PM						111000			
CCV24025	CV-24025	2/3/2026 1:05:00 PM					2059				
CCV24025	CV-24025	2/24/2026 8:35:00 AM					2380				
CCV24025	CV-24025	2/24/2026 8:37:39 AM	7.7	69.6	3.6	19.1			171.0	170.8	0.1
CCV24025	CV-24025	2/24/2026 8:38:55 AM	7.2	67.6	3.6	21.6			170.9	170.9	0.1
CCV24026	CV-24026	2/12/2026 1:13:24 PM	0.3	70.8	3.2	25.7			107.9	108.6	0.0
CCV24026	CV-24026	2/24/2026 2:07:08 PM	0.5	65.3	4.0	30.2			112.8	115.3	0.0
CCV24027	CV-24027	2/6/2026 3:05:35 PM	2.6	62.8	4.7	29.9			88.6	89.0	0.0
CCV24027	CV-24027	2/23/2026 1:01:19 PM	1.1	78.5	0.6	19.8			95.0	95.3	0.0
CCV24028	CV-24028	2/4/2026 10:30:00 AM					1600				
CCV24028	CV-24028	2/4/2026 10:30:00 AM						182500			
CCV24028	CV-24028	2/4/2026 10:33:24 AM	3.0	53.9	0.0	43.1			174.7	171.6	0.1
CCV24028	CV-24028	2/4/2026 10:34:31 AM	2.8	83.2	0.0	14.0			171.6	169.9	0.0
CCV24028	CV-24028	2/10/2026 1:41:00 PM					1160				
CCV24028	CV-24028	2/10/2026 1:41:00 PM						179350			
CCV24028	CV-24028	2/10/2026 1:42:12 PM	2.0	80.7	0.0	17.3			190.8	192.2	0.0
CCV24028	CV-24028	2/19/2026 7:40:00 AM					1620				
CCV24028	CV-24028	2/19/2026 7:41:53 AM	2.0	76.6	0.8	20.6			193.0	193.5	0.0

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CCV24028	CV-24028	2/23/2026 9:33:34 AM	10.8	77.0	1.8	10.4			194.3	194.1	0.1
CCV24028	CV-24028	2/23/2026 10:00:00 AM					1520				
CCV24029	CV-24029	2/12/2026 9:33:43 AM	1.7	68.1	2.0	28.2			76.4	77.0	0.0
CCV24029	CV-24029	2/27/2026 10:50:17 AM	1.3	55.0	7.7	36.0			95.9	93.8	0.0
CCV24029	CV-24029	2/27/2026 10:50:43 AM	1.3	54.5	8.1	36.1			96.1	96.0	0.0
CCV24030	CV-24030	2/12/2026 9:41:16 AM	1.6	72.8	0.7	24.9			192.1	192.1	0.0
CCV24030	CV-24030	2/12/2026 9:43:08 AM	1.7	73.7	0.4	24.2			192.1	192.3	0.0
CCV24030	CV-24030	2/17/2026 8:01:41 AM	0.5	39.1	12.3	48.1			143.5	143.1	0.0
CCV24030	CV-24030	2/17/2026 8:02:29 AM	0.4	25.6	13.8	60.2			143.1	143.5	0.0
CCV24031	CV-24031	2/12/2026 10:02:21 AM	20.2	76.5	0.0	3.3			127.3	125.6	0.3
CCV24031	CV-24031	2/24/2026 1:51:08 PM	24.6	70.4	0.0	5.0			141.2	140.0	0.3
CCV24031	CV-24031	2/24/2026 1:52:04 PM	24.2	70.9	0.0	4.9			139.3	139.4	0.3
CCV24032	CV-24032	2/3/2026 1:09:56 PM	11.2	76.0	0.0	12.8			162.6	168.5	0.1
CCV24032	CV-24032	2/3/2026 1:10:00 PM						155100			
CCV24032	CV-24032	2/3/2026 1:10:00 PM					1899				
CCV24032	CV-24032	2/12/2026 1:20:05 PM	1.4	82.9	0.0	15.7			140.8	141.6	0.0
CCV24032	CV-24032	2/12/2026 1:21:29 PM	1.6	83.3	0.0	15.1			152.1	150.6	0.0
CCV24032	CV-24032	2/12/2026 1:22:45 PM	1.8	83.5	0.0	14.7			160.5	161.6	0.0
CCV24032	CV-24032	2/12/2026 1:45:00 PM					1555				
CCV24032	CV-24032	2/12/2026 1:45:00 PM						129000			
CCV24032	CV-24032	2/20/2026 9:34:51 AM	1.2	71.6	0.0	27.2			191.5	191.2	0.0
CCV24032	CV-24032	2/20/2026 9:35:24 AM	1.4	88.0	0.0	10.6			191.4	191.0	0.0
CCV24032	CV-24032	2/20/2026 9:40:00 AM					2010				
CCV24032	CV-24032	2/24/2026 8:50:07 AM	6.5	77.6	2.4	13.5			189.1	188.4	0.1
CCV24032	CV-24032	2/24/2026 8:51:26 AM	7.4	80.3	2.0	10.3			188.2	189.6	0.1
CCV24032	CV-24032	2/24/2026 8:55:00 AM					2220				
CCV24033	CV-24033	2/12/2026 1:18:29 PM	0.9	81.2	0.0	17.9			125.5	122.8	0.0
CCV24033	CV-24033	2/20/2026 9:28:31 AM	1.5	68.4	0.0	30.1			185.3	186.0	0.0
CCV24033	CV-24033	2/20/2026 9:30:01 AM	1.2	85.1	0.0	13.7			186.2	185.9	0.0

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CCV24033	CV-24033	2/20/2026 9:35:00 AM					2980				
CCV24033	CV-24033	2/23/2026 12:36:44 PM	3.6	78.3	0.0	18.1			181.7	182.5	0.0
CCV24033	CV-24033	2/23/2026 12:37:47 PM	2.3	84.2	0.0	13.5			182.8	182.8	0.0
CCV24033	CV-24033	2/24/2026 8:57:33 AM	6.9	76.6	2.9	13.6			186.6	186.7	0.1
CCV24033	CV-24033	2/24/2026 8:58:20 AM	6.9	78.1	2.0	13.0			186.4	186.3	0.1
CCV24033	CV-24033	2/24/2026 9:00:00 AM					2600				
CCV24034	CV-24034	2/13/2026 2:45:53 PM	1.2	82.3	0.2	16.3			194.2	194.0	0.0
CCV24034	CV-24034	2/13/2026 2:48:45 PM	1.4	80.8	0.3	17.5			194.0	194.1	0.0
CCV24034	CV-24034	2/19/2026 7:34:44 AM	1.5	78.8	2.1	17.6			188.3	188.5	0.0
CCV24034	CV-24034	2/19/2026 7:35:00 AM					1860				
CCV24034	CV-24034	2/23/2026 12:38:54 PM	6.8	60.0	6.0	27.2			159.5	160.8	0.1
CCV24034	CV-24034	2/23/2026 12:40:00 PM					1820				
CCV24034	CV-24034	2/23/2026 12:40:27 PM	7.4	58.5	6.0	28.1			159.3	161.1	0.1
CCV24035	CV-24035	2/2/2026 9:50:00 AM					1395				
CCV24035	CV-24035	2/2/2026 9:50:00 AM						81950			
CCV24035	CV-24035	2/2/2026 9:51:13 AM	9.0	81.6	0.0	9.4			190.9	191.7	0.1
CCV24035	CV-24035	2/2/2026 9:56:56 AM	6.6	79.1	0.0	14.3			193.1	192.1	0.1
CCV24035	CV-24035	2/9/2026 10:29:22 AM	1.4	86.4	0.0	12.2			187.6	187.7	0.0
CCV24035	CV-24035	2/9/2026 10:30:00 AM						140100			
CCV24035	CV-24035	2/9/2026 10:30:00 AM					2540				
CCV24035	CV-24035	2/23/2026 8:30:00 AM					5860				
CCV24035	CV-24035	2/23/2026 8:31:37 AM	1.2	72.4	4.7	21.7			151.0	152.9	0.0
CCV24036	CV-24036	2/12/2026 10:12:51 AM	48.6	36.6	2.9	11.9			66.3	66.4	1.3
CCV24036	CV-24036	2/24/2026 1:44:03 PM	52.5	38.2	1.9	7.4			91.5	91.6	1.4
CCV24037	CV-24037	2/9/2026 1:06:14 PM	0.7	29.4	14.0	55.9			86.4	86.4	0.0
CCV24037	CV-24037	2/9/2026 1:08:21 PM	0.7	27.7	13.5	58.1			86.3	86.3	0.0
CCV24037	CV-24037	2/24/2026 1:47:09 PM	1.1	22.7	15.8	60.4			85.7	86.3	0.0
CCV24038	CV-24038	2/3/2026 10:34:00 AM	11.0	81.9	0.0	7.1			183.4	184.8	0.1
CCV24038	CV-24038	2/3/2026 10:34:38 AM	12.1	82.8	0.0	5.1			184.0	181.4	0.1

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CCV24038	CV-24038	2/3/2026 10:35:00 AM						181200			
CCV24038	CV-24038	2/3/2026 10:35:00 AM					1365				
CCV24038	CV-24038	2/11/2026 9:29:22 AM	3.8	47.4	0.0	48.8			186.8	184.4	0.1
CCV24038	CV-24038	2/11/2026 9:29:55 AM	2.1	81.2	0.0	16.7			184.1	185.8	0.0
CCV24038	CV-24038	2/11/2026 9:30:00 AM						154800			
CCV24038	CV-24038	2/11/2026 9:30:00 AM					2100				
CCV24038	CV-24038	2/20/2026 9:45:12 AM	1.8	63.2	0.0	35.0			185.5	186.7	0.0
CCV24038	CV-24038	2/20/2026 9:45:41 AM	2.1	85.8	0.0	12.1			187.3	187.2	0.0
CCV24038	CV-24038	2/20/2026 9:50:00 AM					1680				
CCV24038	CV-24038	2/24/2026 10:29:54 AM	17.1	79.3	0.0	3.6			186.2	187.4	0.2
CCV24038	CV-24038	2/24/2026 10:30:00 AM					1275				
CCV24038	CV-24038	2/24/2026 10:30:55 AM	15.6	68.2	3.6	12.6			188.9	188.3	0.2
CCV24038	CV-24038	2/25/2026 2:49:56 PM	5.9	74.0	0.0	20.1			184.1	183.8	0.1
CCV24038	CV-24038	2/25/2026 2:51:31 PM	4.4	75.5	0.0	20.0			183.0	182.7	0.1
CCV24039	CV-24039	2/12/2026 9:54:31 AM	0.0	5.4	20.8	73.8			69.7	69.7	0.0
CCV24039	CV-24039	2/23/2026 12:50:46 PM	0.3	18.3	16.0	65.4			79.9	79.7	0.0
CCV24039	CV-24039	2/23/2026 12:52:31 PM	0.3	18.7	15.9	65.1			79.8	79.8	0.0
CCV24040	CV-24040	2/27/2026 8:40:30 AM	0.3	80.0	0.0	19.7			82.0	82.0	0.0
CCV24041	CV-24041	2/12/2026 9:01:15 AM	6.1	55.4	8.0	30.5			61.7	59.9	0.1
CCV24041	CV-24041	2/24/2026 2:34:48 PM	9.1	54.9	7.0	29.0			91.7	91.7	0.2
CCV24042	CV-24042	2/17/2026 9:04:17 AM	1.0	78.8	2.3	17.9			185.9	182.8	0.0
CCV24042	CV-24042	2/17/2026 9:05:00 AM					3520				
CCV24042	CV-24042	2/17/2026 9:06:55 AM	1.1	72.0	2.5	24.4			189.8	189.6	0.0
CCV24042	CV-24042	2/23/2026 10:36:36 AM	11.9	76.0	2.6	9.5			190.9	190.7	0.2
CCV24042	CV-24042	2/23/2026 10:40:00 AM					3140				
CCV24043	CV-24043	2/13/2026 4:33:05 PM	44.6	52.6	0.3	2.5			101.4	101.9	0.8
CCV24043	CV-24043	2/24/2026 10:48:25 AM	44.8	55.2	0.0	0.0			106.7	105.4	0.8
CCV24044	CV-24044	2/24/2026 1:40:27 PM	25.4	70.1	0.0	4.5			95.1	94.8	0.4
CCV24045	CV-24045	2/3/2026 10:28:53 AM	7.1	76.5	0.0	16.4			161.0	156.2	0.1

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CCV24045	CV-24045	2/3/2026 10:29:37 AM	8.7	82.8	0.0	8.5			158.6	160.4	0.1
CCV24045	CV-24045	2/3/2026 10:30:00 AM					1683				
CCV24045	CV-24045	2/3/2026 10:30:00 AM						161800			
CCV24045	CV-24045	2/11/2026 9:32:40 AM	2.6	85.2	0.0	12.2			160.4	162.4	0.0
CCV24045	CV-24045	2/11/2026 9:33:22 AM	1.8	82.4	0.0	15.8			162.5	162.6	0.0
CCV24045	CV-24045	2/11/2026 9:35:00 AM						158500			
CCV24045	CV-24045	2/11/2026 9:35:00 AM					2590				
CCV24045	CV-24045	2/20/2026 9:48:35 AM	1.9	62.7	0.0	35.4			167.9	172.8	0.0
CCV24045	CV-24045	2/20/2026 9:49:03 AM	1.9	87.5	0.0	10.6			170.4	171.7	0.0
CCV24045	CV-24045	2/20/2026 9:50:00 AM					2000				
CCV24045	CV-24045	2/23/2026 10:03:58 AM	2.1	72.6	0.0	25.3			155.1	156.1	0.0
CCV24045	CV-24045	2/23/2026 10:04:55 AM	1.7	80.9	0.0	17.4			157.3	157.3	0.0
CCV24045	CV-24045	2/24/2026 10:37:24 AM	12.3	78.2	0.0	9.5			174.3	174.1	0.2
CCV24045	CV-24045	2/24/2026 10:38:21 AM	19.9	80.1	0.0	0.0			171.8	171.7	0.2
CCV24045	CV-24045	2/24/2026 10:40:00 AM					1690				
CCV24045	CV-24045	2/25/2026 3:13:41 PM	5.7	69.1	0.0	25.2			174.9	174.5	0.1
CCV24045	CV-24045	2/25/2026 3:17:24 PM	6.2	73.7	0.0	20.1			176.7	177.6	0.1
CCV24046	CV-24046	2/13/2026 2:12:25 PM	0.7	78.8	0.6	19.9			163.7	163.9	0.0
CCV24046	CV-24046	2/13/2026 2:13:14 PM	0.7	79.2	0.2	19.9			164.7	164.6	0.0
CCV24046	CV-24046	2/20/2026 12:56:53 PM	2.3	78.3	0.0	19.4			77.0	84.2	0.0
CCV24046	CV-24046	2/27/2026 10:39:50 AM	0.3	78.2	0.8	20.7			101.9	101.9	0.0
CCV24048	CV-24048	2/12/2026 8:54:20 AM	10.9	71.4	0.8	16.9			70.7	70.8	0.2
CCV24048	CV-24048	2/24/2026 2:39:36 PM	6.0	78.4	0.0	15.6			89.9	94.1	0.1
CCV24049	CV-24049	2/2/2026 10:12:35 AM	12.6	81.4	0.0	6.0			187.0	187.9	0.2
CCV24049	CV-24049	2/2/2026 10:15:00 AM						133200			
CCV24049	CV-24049	2/2/2026 10:15:00 AM					4870				
CCV24049	CV-24049	2/9/2026 1:08:02 PM	0.1	21.0	17.2	61.7			164.9	170.3	0.0
CCV24049	CV-24049	2/9/2026 1:09:04 PM	0.2	19.9	17.4	62.5			165.3	168.9	0.0
CCV24049	CV-24049	2/9/2026 1:10:00 PM						34200			

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CCV24049	CV-24049	2/9/2026 1:10:00 PM					1180				
CCV24049	CV-24049	2/12/2026 8:35:00 AM					470				
CCV24049	CV-24049	2/12/2026 8:35:00 AM						29000			
CCV24049	CV-24049	2/17/2026 9:28:41 AM	0.1	2.6	22.1	75.2			56.1	56.1	0.0
CCV24049	CV-24049	2/17/2026 9:29:26 AM	0.1	2.2	22.0	75.7			55.8	55.8	0.0
CCV24050	CV-24050	2/13/2026 4:25:00 PM	4.2	77.7	0.0	18.1			91.0	105.8	0.1
CCV24050	CV-24050	2/13/2026 4:26:59 PM	6.4	78.5	0.0	15.1			111.0	111.3	0.1
CCV24050	CV-24050	2/24/2026 3:46:52 PM	23.7	67.5	0.0	8.8			143.7	143.7	0.4
CCV24050	CV-24050	2/24/2026 3:46:57 PM	23.7	67.5	0.0	8.8			143.7	143.7	0.4
CCV24050	CV-24050	2/24/2026 3:48:49 PM	28.9	66.0	0.0	5.1			143.5	143.7	0.4
CCV24052	CV-24052	2/12/2026 8:39:54 AM	0.1	65.4	2.9	31.6			68.5	68.6	0.0
CCV24052	CV-24052	2/24/2026 2:48:47 PM	15.4	61.3	3.5	19.8			87.2	83.4	0.3
CCV24053	CV-24053	2/9/2026 9:15:00 AM					190				
CCV24053	CV-24053	2/9/2026 9:15:00 AM						13000			
CCV24053	CV-24053	2/12/2026 8:10:00 AM					16				
CCV24053	CV-24053	2/12/2026 8:10:00 AM						4700			
CCV24053	CV-24053	2/12/2026 8:45:26 AM	20.8	32.8	10.7	35.7			58.2	58.3	0.6
CCV24053	CV-24053	2/12/2026 8:47:03 AM	15.7	25.3	13.7	45.3			58.5	58.5	0.6
CCV24053	CV-24053	2/24/2026 2:43:04 PM	14.4	41.1	9.8	34.7			85.9	86.1	0.4
CCV24054	CV-24054	2/2/2026 10:19:51 AM	16.2	81.4	0.0	2.4			171.4	172.6	0.2
CCV24054	CV-24054	2/2/2026 10:20:00 AM						100800			
CCV24054	CV-24054	2/2/2026 10:20:00 AM					3280				
CCV24054	CV-24054	2/2/2026 10:20:37 AM	16.4	83.6	0.0	0.0			172.5	172.5	0.2
CCV24054	CV-24054	2/9/2026 1:13:53 PM	2.0	95.1	0.0	2.9			172.5	172.7	0.0
CCV24054	CV-24054	2/9/2026 1:15:00 PM						120100			
CCV24054	CV-24054	2/9/2026 1:15:00 PM					2990				
CCV24054	CV-24054	2/17/2026 9:32:14 AM	4.7	88.0	0.5	6.8			173.8	173.7	0.1
CCV24054	CV-24054	2/17/2026 9:35:00 AM					2868				
CCV24054	CV-24054	2/23/2026 10:28:09 AM	9.3	80.3	2.8	7.6			175.2	174.4	0.1

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CCV24054	CV-24054	2/23/2026 10:30:00 AM					3580				
CCV24055	CV-24055	2/5/2026 10:02:26 AM	9.6	53.8	4.7	31.9			114.4	114.6	0.2
CCV24055	CV-24055	2/12/2026 8:30:00 AM						31000			
CCV24055	CV-24055	2/12/2026 8:30:00 AM					470				
CCV24055	CV-24055	2/18/2026 2:11:46 PM	4.5	56.9	5.2	33.4			124.5	124.3	0.1
CCV24056	CV-24056	2/6/2026 1:42:00 PM	28.1	61.8	0.1	10.0			137.0	136.1	0.5
CCV24056	CV-24056	2/6/2026 1:43:11 PM	28.6	64.2	0.0	7.2			132.4	132.8	0.4
CCV24056	CV-24056	2/21/2026 9:58:53 AM	38.5	59.0	0.0	2.5			116.4	116.6	0.7
CCV24057	CV-24057	2/13/2026 10:23:18 AM	36.1	59.7	0.0	4.2			136.2	136.1	0.6
CCV24057	CV-24057	2/13/2026 10:24:11 AM	35.6	60.1	0.0	4.3			136.2	136.1	0.6
CCV24057	CV-24057	2/24/2026 12:54:47 PM	46.1	45.1	0.0	8.8			125.9	126.0	1.0
CCV24058	CV-24058	2/5/2026 8:30:59 AM	45.0	38.1	3.6	13.3			63.3	63.1	1.2
CCV24058	CV-24058	2/23/2026 12:28:15 PM	44.4	36.4	0.6	18.6			92.9	92.9	1.2
CCV24059	CV-24059	2/3/2026 10:05:00 AM						64700			
CCV24059	CV-24059	2/3/2026 10:05:00 AM					400				
CCV24059	CV-24059	2/3/2026 10:08:28 AM	44.5	55.5	0.0	0.0			161.0	160.2	0.8
CCV24059	CV-24059	2/3/2026 10:09:11 AM	43.4	56.3	0.0	0.3			160.0	160.2	0.8
CCV24059	CV-24059	2/5/2026 8:58:59 AM	41.9	57.4	0.0	0.7			128.9	128.9	0.7
CCV24059	CV-24059	2/18/2026 9:57:11 AM	29.8	59.5	0.2	10.5			158.1	157.9	0.5
CCV24059	CV-24059	2/18/2026 10:00:00 AM					539				
CCV24059	CV-24059	2/26/2026 8:47:51 AM	30.4	66.6	0.0	3.0			157.5	157.6	0.5
CCV24059	CV-24059	2/26/2026 8:50:00 AM					382				
CCV24060	CV-24060	2/3/2026 9:13:39 AM	28.2	64.3	0.0	7.5			100.3	100.7	0.4
CCV24060	CV-24060	2/25/2026 3:00:34 PM	32.3	65.1	0.0	2.6			105.9	105.9	0.5
CCV24061	CV-24061	2/3/2026 10:32:28 AM	20.9	74.0	0.0	5.1			124.8	126.0	0.3
CCV24061	CV-24061	2/23/2026 9:50:37 AM	24.6	68.1	0.0	7.3			105.7	106.8	0.4
CCV24062	CV-24062	2/3/2026 8:48:20 AM	40.1	59.9	0.0	0.0			140.9	141.6	0.7
CCV24062	CV-24062	2/3/2026 10:39:32 AM	30.9	66.6	0.0	2.5			142.0	139.8	0.5
CCV24062	CV-24062	2/11/2026 7:20:00 AM					600				

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CCV24062	CV-24062	2/18/2026 9:38:22 AM	18.1	76.7	0.1	5.1			147.2	146.5	0.2
CCV24062	CV-24062	2/18/2026 9:40:00 AM					1140				
CCV24062	CV-24062	2/24/2026 2:23:24 PM	33.4	64.7	0.0	1.9			126.8	129.3	0.5
CCV24063	CV-24063	2/10/2026 2:26:28 PM	5.1	87.3	0.0	7.6			185.4	184.1	0.1
CCV24063	CV-24063	2/10/2026 2:27:00 PM					3240				
CCV24063	CV-24063	2/10/2026 2:27:00 PM						104900			
CCV24063	CV-24063	2/11/2026 7:25:00 AM					1600				
CCV24063	CV-24063	2/18/2026 9:25:00 AM					2730				
CCV24063	CV-24063	2/18/2026 9:27:43 AM	3.0	88.9	0.9	7.2			183.3	182.5	0.0
CCV24063	CV-24063	2/24/2026 2:10:00 PM					2540				
CCV24063	CV-24063	2/24/2026 2:12:26 PM	3.7	76.4	2.7	17.2			169.7	175.7	0.0
CCV24063	CV-24063	2/24/2026 2:13:11 PM	3.7	83.2	1.6	11.5			173.8	174.9	0.0
CCV24064	CV-24064	2/3/2026 8:05:00 AM						104000			
CCV24064	CV-24064	2/3/2026 8:05:00 AM					2385				
CCV24064	CV-24064	2/3/2026 8:09:01 AM	8.3	85.6	0.0	6.1			193.4	193.4	0.1
CCV24064	CV-24064	2/11/2026 7:35:00 AM					1200				
CCV24064	CV-24064	2/11/2026 8:00:00 AM						71500			
CCV24064	CV-24064	2/11/2026 8:00:00 AM					1770				
CCV24064	CV-24064	2/11/2026 8:03:41 AM	1.4	81.4	0.2	17.0			193.7	193.3	0.0
CCV24064	CV-24064	2/18/2026 8:30:00 AM					1960				
CCV24064	CV-24064	2/18/2026 8:35:10 AM	1.6	81.3	2.1	15.0			192.9	192.7	0.0
CCV24064	CV-24064	2/25/2026 8:37:47 AM	3.6	82.2	1.0	13.2			193.9	193.9	0.0
CCV24064	CV-24064	2/25/2026 8:45:00 AM					2680				
CCV24065	CV-24065-TP17	2/10/2026 7:35:00 AM					180				
CCV24065	CV-24065-TP17	2/13/2026 8:00:00 AM					410				
CCV24065	CV-24065-TP17	2/13/2026 8:00:00 AM						7100			
CCV24065	CV-24065-TP17	2/13/2026 3:57:42 PM	12.7	86.0	0.2	1.1			102.2	102.0	0.1
CCV24065	CV-24065-TP17	2/18/2026 2:15:50 PM	10.7	86.3	0.3	2.7			105.9	105.8	0.1
CCV24066	CV-24066	2/6/2026 1:29:15 PM	33.5	63.5	0.0	3.0			109.4	109.5	0.5

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CCV24066	CV-24066	2/11/2026 7:50:00 AM					460				
CCV24066	CV-24066	2/24/2026 3:25:13 PM	21.6	56.2	0.0	22.2			114.9	114.9	0.4
CCV24067	CV-24067	2/22/2026 3:16:05 PM	10.2	70.6	0.0	19.2			139.6	139.6	0.1
CCV24067	CV-24067	2/22/2026 3:18:52 PM	11.7	70.1	0.0	18.2			139.7	139.9	0.2
CCV24068	CV-24068	2/3/2026 10:18:59 AM	12.6	79.1	0.0	8.3			160.5	161.6	0.2
CCV24068	CV-24068	2/3/2026 10:20:00 AM						133100			
CCV24068	CV-24068	2/3/2026 10:20:00 AM					2370				
CCV24068	CV-24068	2/11/2026 9:16:46 AM	6.9	84.4	0.0	8.7			114.9	116.1	0.1
CCV24068	CV-24068	2/11/2026 9:17:12 AM	8.5	82.4	0.0	9.1			116.5	116.2	0.1
CCV24068	CV-24068	2/18/2026 10:06:52 AM	21.5	69.1	0.1	9.3			154.1	153.6	0.3
CCV24068	CV-24068	2/18/2026 10:10:00 AM					771				
CCV24068	CV-24068	2/25/2026 9:11:00 AM	8.9	82.3	0.0	8.8			138.2	138.4	0.1
CCV24068	CV-24068	2/25/2026 9:11:25 AM	9.3	83.0	0.0	7.7			137.6	138.3	0.1
CCV24069	CV-24069	2/3/2026 8:40:42 AM	29.1	54.7	0.0	16.2			91.2	90.9	0.5
CCV24069	CV-24069	2/11/2026 8:00:00 AM					550				
CCV24069	CV-24069	2/22/2026 12:31:50 PM	39.3	46.0	0.1	14.7			92.6	92.5	0.9
CCV24070	CV-24070	2/3/2026 9:27:45 AM	14.4	79.7	0.0	5.9			137.8	138.1	0.2
CCV24070	CV-24070	2/10/2026 7:50:00 AM					670				
CCV24070	CV-24070	2/23/2026 12:35:19 PM	41.2	51.2	0.0	7.5			127.4	127.6	0.8
CCV24070	CV-24070	2/23/2026 12:37:07 PM	39.9	51.7	0.0	8.4			127.9	127.7	0.8
CCV24071	CV-24071	2/3/2026 9:19:02 AM	46.8	53.2	0.0	0.0			119.2	118.1	0.9
CCV24071	CV-24071	2/10/2026 7:55:00 AM					190				
CCV24071	CV-24071	2/25/2026 2:49:08 PM	30.8	68.0	0.0	1.2			138.2	138.2	0.5
CCV24071	CV-24071	2/25/2026 2:52:49 PM	30.9	67.6	0.0	1.5			137.8	137.8	0.5
CCV24072	CV-24072	2/3/2026 10:22:45 AM	39.7	60.3	0.0	0.0			115.1	115.2	0.7
CCV24072	CV-24072	2/19/2026 7:55:07 AM	39.6	51.2	0.0	9.2			53.1	52.8	0.8
CCV24073	CV-24073-TP13	2/3/2026 1:13:56 PM	1.9	79.5	1.5	17.1			119.1	117.9	0.0
CCV24073	CV-24073-TP13	2/17/2026 12:13:10 PM	32.9	64.0	0.0	3.1			150.1	148.3	0.5
CCV24073	CV-24073-TP13	2/17/2026 12:15:48 PM	27.6	69.1	0.0	3.3			148.4	148.9	0.4

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CCV24073	CV-24073-TP13	2/23/2026 9:23:30 AM	27.1	67.2	0.0	5.7			150.2	150.7	0.4
CCV24073	CV-24073-TP13	2/23/2026 9:24:41 AM	30.3	65.5	0.0	4.2			151.3	151.4	0.5
CCV24073	CV-24073-TP13	2/26/2026 9:26:13 AM	36.9	63.1	0.0	0.0			146.9	149.2	0.6
CCV24073	CV-24073-TP13	2/26/2026 9:30:00 AM					1300				
CCV24074	CV-24074	2/3/2026 1:18:53 PM	3.3	85.6	0.0	11.1			110.3	110.1	0.0
CCV24074	CV-24074	2/17/2026 11:59:08 AM	3.7	86.8	0.0	9.5			90.9	90.8	0.0
CCV24075	CV-24075-TP15	2/3/2026 7:53:51 AM	5.1	89.4	0.0	5.5			189.4	189.1	0.1
CCV24075	CV-24075-TP15	2/3/2026 7:55:00 AM						116300			
CCV24075	CV-24075-TP15	2/3/2026 7:55:00 AM					2684				
CCV24075	CV-24075-TP15	2/11/2026 8:09:49 AM	1.1	86.7	0.1	12.1			189.1	188.6	0.0
CCV24075	CV-24075-TP15	2/11/2026 8:10:00 AM					2285				
CCV24075	CV-24075-TP15	2/11/2026 8:10:00 AM						113550			
CCV24075	CV-24075-TP15	2/18/2026 8:44:06 AM	1.8	93.0	0.0	5.2			188.9	188.6	0.0
CCV24075	CV-24075-TP15	2/18/2026 8:44:56 AM	1.5	66.8	0.0	31.7			189.0	189.3	0.0
CCV24075	CV-24075-TP15	2/18/2026 8:50:00 AM					3800				
CCV24075	CV-24075-TP15	2/25/2026 8:47:25 AM	2.6	78.6	2.2	16.6			189.7	190.2	0.0
CCV24075	CV-24075-TP15	2/25/2026 8:55:00 AM					2490				
CCV24076	CV-24076	2/3/2026 8:15:00 AM						42700			
CCV24076	CV-24076	2/3/2026 8:15:00 AM					1159				
CCV24076	CV-24076	2/3/2026 8:15:33 AM	23.3	76.6	0.1	0.0			164.8	164.7	0.3
CCV24076	CV-24076	2/11/2026 7:55:00 AM						65400			
CCV24076	CV-24076	2/11/2026 7:55:00 AM					2060				
CCV24076	CV-24076	2/11/2026 7:55:53 AM	12.2	77.0	0.3	10.5			170.5	170.4	0.2
CCV24076	CV-24076	2/17/2026 9:39:12 AM	9.8	76.2	0.0	14.0			175.5	175.8	0.1
CCV24076	CV-24076	2/17/2026 9:45:00 AM					2100				
CCV24076	CV-24076	2/24/2026 1:40:00 PM					2000				
CCV24076	CV-24076	2/24/2026 1:45:16 PM	7.9	80.4	1.0	10.7			177.3	179.2	0.1
CCV24076	CV-24076	2/24/2026 1:46:18 PM	12.1	72.1	1.5	14.3			178.9	179.0	0.2
CCV24077	CV-24077	2/6/2026 1:21:05 PM	25.1	56.1	0.0	18.8			123.5	123.8	0.4

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CCV24077	CV-24077	2/22/2026 2:47:19 PM	9.1	67.3	0.0	23.7			132.8	130.8	0.1
CCV24077	CV-24077	2/22/2026 2:49:32 PM	11.4	56.1	0.0	32.5			128.5	127.3	0.2
CCV24078	CV-24078	2/6/2026 1:24:57 PM	25.1	69.1	0.3	5.5			121.9	123.8	0.4
CCV24078	CV-24078	2/22/2026 3:00:00 PM	31.9	45.4	0.0	22.7			130.7	129.2	0.7
CCV24078	CV-24078	2/22/2026 3:01:28 PM	31.1	46.5	0.0	22.4			129.0	129.5	0.7
CCV24078	CV-24078	2/22/2026 3:02:08 PM	31.0	47.1	0.0	21.9			129.6	129.6	0.7
CCV24079	CV-24079-TP8	2/3/2026 8:13:52 AM	16.4	74.6	0.0	9.0			136.9	137.4	0.2
CCV24079	CV-24079-TP8	2/22/2026 12:36:23 PM	42.9	45.6	0.0	11.5			126.9	127.3	0.9
CCV24080	CV-24080	2/3/2026 8:06:34 AM	37.3	61.3	0.0	1.4			123.6	123.6	0.6
CCV24080	CV-24080	2/22/2026 12:18:51 PM	40.0	52.9	0.0	7.1			121.0	121.1	0.8
CCV24081	CV-24081-TP10	2/3/2026 9:36:08 AM	47.9	52.1	0.0	0.0			112.6	112.2	0.9
CCV24081	CV-24081-TP10	2/19/2026 8:10:19 AM	47.1	50.3	0.0	2.6			75.8	75.9	0.9
CCV24082	CV-24082	2/3/2026 9:49:24 AM	38.3	59.9	0.0	1.8			120.2	120.2	0.6
CCV24082	CV-24082	2/22/2026 11:52:24 AM	43.3	50.7	0.0	6.0			102.7	102.8	0.9
CCV24083	CV-24083	2/3/2026 9:39:32 AM	45.1	49.4	0.5	5.0			132.5	133.3	0.9
CCV24083	CV-24083	2/19/2026 8:05:30 AM	52.0	45.9	0.0	2.1			85.6	85.6	1.1
CCV24084	CV-24084-TP11	2/3/2026 8:59:02 AM	19.7	80.3	0.0	0.0			175.1	175.8	0.2
CCV24084	CV-24084-TP11	2/3/2026 9:00:00 AM						87000			
CCV24084	CV-24084-TP11	2/3/2026 9:00:00 AM					1866				
CCV24084	CV-24084-TP11	2/3/2026 9:00:47 AM	20.1	79.9	0.0	0.0			176.0	176.0	0.3
CCV24084	CV-24084-TP11	2/10/2026 8:10:00 AM					1600				
CCV24084	CV-24084-TP11	2/10/2026 8:30:00 AM					1800				
CCV24084	CV-24084-TP11	2/10/2026 8:30:00 AM						78250			
CCV24084	CV-24084-TP11	2/10/2026 8:31:21 AM	8.8	87.2	0.0	4.0			175.9	175.9	0.1
CCV24084	CV-24084-TP11	2/18/2026 12:53:11 PM	8.1	83.0	0.6	8.3			176.0	175.9	0.1
CCV24084	CV-24084-TP11	2/18/2026 12:55:00 PM					2750				
CCV24084	CV-24084-TP11	2/24/2026 2:29:32 PM	11.7	83.2	0.0	5.1			175.4	175.7	0.1
CCV24084	CV-24084-TP11	2/24/2026 2:30:00 PM					1815				
CCV24085	CV-24085	2/2/2026 10:22:55 AM	43.7	50.8	0.2	5.3			123.6	123.6	0.9

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CCV24085	CV-24085	2/21/2026 8:46:49 AM	37.5	49.5	0.5	12.5			106.6	106.5	0.8
CCV24086	CV-24086	2/13/2026 9:33:44 AM	40.7	54.2	0.0	5.1			126.2	126.0	0.8
CCV24086	CV-24086	2/18/2026 1:31:47 PM	43.8	49.1	0.0	7.1			125.3	125.2	0.9
CCV24087	CV-24087	2/2/2026 1:35:55 PM	41.4	47.7	0.0	10.9			116.6	116.5	0.9
CCV24087	CV-24087	2/3/2026 1:52:48 PM	33.3	60.9	0.0	5.8			82.7	100.3	0.5
CCV24087	CV-24087	2/3/2026 1:58:46 PM	33.6	65.0	0.0	1.4			106.3	106.4	0.5
CCV24087	CV-24087	2/18/2026 10:05:29 AM	49.0	42.1	0.1	8.8			101.5	101.7	1.2
CCV24088	CV-24088	2/3/2026 10:02:42 AM	44.7	55.3	0.0	0.0			114.9	116.4	0.8
CCV24088	CV-24088	2/21/2026 10:23:49 AM	49.7	49.4	0.0	0.9			98.6	99.2	1.0
CCV24089	CV-24089	2/2/2026 2:27:02 PM	0.0	0.6	20.9	78.5			93.5	93.5	0.0
CCV24089	CV-24089	2/2/2026 2:28:22 PM	0.0	0.4	21.0	78.6			90.5	90.7	0.0
CCV24089	CV-24089	2/19/2026 8:58:52 AM	0.8	3.5	19.8	75.9			42.7	42.7	0.2
CCV24089	CV-24089	2/19/2026 9:02:18 AM	0.9	1.4	20.3	77.4			42.5	42.5	0.6
CCV24090	CV-24090	2/2/2026 1:26:46 PM	39.2	56.5	0.0	4.3			127.0	126.9	0.7
CCV24090	CV-24090	2/4/2026 10:27:35 AM	37.7	60.0	0.0	2.3			143.4	143.3	0.6
CCV24090	CV-24090	2/4/2026 10:29:10 AM	37.7	59.7	0.0	2.6			143.4	143.4	0.6
CCV24090	CV-24090	2/18/2026 9:49:00 AM	38.4	54.9	0.0	6.7			113.4	111.9	0.7
CCV24091	CV-24091	2/2/2026 1:05:53 PM	50.9	46.4	0.0	2.7			130.9	131.1	1.1
CCV24091	CV-24091	2/18/2026 8:57:52 AM	52.5	43.8	0.0	3.7			125.4	126.2	1.2
CCV24092	CV-24092	2/2/2026 12:40:53 PM	52.2	41.9	0.0	5.9			120.6	120.7	1.2
CCV24092	CV-24092	2/23/2026 12:18:02 PM	54.3	42.5	0.3	2.9			112.4	112.6	1.3
CCV24093	CV-24093	2/9/2026 11:18:56 AM	42.4	57.6	0.0	0.0			120.2	122.8	0.7
CCV24093	CV-24093	2/9/2026 11:22:06 AM	45.2	54.8	0.0	0.0			123.3	123.3	0.8
CCV24093	CV-24093	2/22/2026 9:37:46 AM	50.4	46.3	0.0	3.3			113.2	113.2	1.1
CCV24095	CV-24095	2/4/2026 8:25:00 AM						121750			
CCV24095	CV-24095	2/4/2026 8:25:00 AM					3225				
CCV24095	CV-24095	2/4/2026 8:26:07 AM	4.6	91.1	0.0	4.3			167.9	168.1	0.1
CCV24095	CV-24095	2/9/2026 8:09:52 AM	2.3	67.9	4.0	25.8			163.5	163.6	0.0
CCV24095	CV-24095	2/9/2026 8:10:00 AM						139300			

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CCV24095	CV-24095	2/9/2026 8:10:00 AM					4290				
CCV24095	CV-24095	2/13/2026 9:20:00 AM					3300				
CCV24095	CV-24095	2/13/2026 9:20:00 AM						150000			
CCV24095	CV-24095	2/20/2026 12:24:25 PM	3.7	74.3	2.6	19.4			162.8	162.8	0.0
CCV24095	CV-24095	2/20/2026 12:25:00 PM					2600				
CCV24095	CV-24095	2/25/2026 1:42:25 PM	9.6	74.3	1.7	14.4			164.0	164.0	0.1
CCV24095	CV-24095	2/25/2026 1:45:00 PM					2950				
CCV24096	CV-24096	2/27/2026 9:43:22 AM	38.9	59.5	0.0	1.6			105.8	105.5	0.7
CCV24097	CV-24097	2/5/2026 2:04:56 PM	39.9	59.8	0.0	0.3			122.7	121.9	0.7
CCV24097	CV-24097	2/21/2026 10:41:49 AM	30.2	19.2	9.9	40.7			56.4	56.4	1.6
CCV24097	CV-24097	2/21/2026 10:43:14 AM	20.5	14.0	13.6	51.9			56.4	56.4	1.5
CCV24098	CV-24098	2/5/2026 2:15:54 PM	41.4	52.4	0.4	5.8			86.9	89.0	0.8
CCV24098	CV-24098	2/21/2026 10:58:00 AM	42.4	54.4	0.1	3.1			79.4	79.3	0.8
CCV24099	CV-24099	2/5/2026 2:46:48 PM	17.3	74.7	0.0	8.0			94.8	94.8	0.2
CCV24099	CV-24099	2/21/2026 11:09:42 AM	13.5	82.5	0.4	3.6			69.8	69.9	0.2
CCV24100	CV-24100	2/4/2026 8:05:00 AM					53				
CCV24100	CV-24100	2/5/2026 1:44:15 PM	22.7	73.8	0.0	3.5			134.5	138.2	0.3
CCV24100	CV-24100	2/21/2026 11:29:01 AM	21.4	78.6	0.0	0.0			111.7	111.9	0.3
CCV24101	CV-24101	2/4/2026 7:50:00 AM					0				
CCV24101	CV-24101	2/4/2026 7:50:00 AM						1800			
CCV24101	CV-24101	2/5/2026 1:38:50 PM	39.4	54.1	0.4	6.1			110.9	110.4	0.7
CCV24101	CV-24101	2/24/2026 9:50:06 AM	37.0	59.0	0.0	4.0			110.7	110.4	0.6
CCV24101	CV-24101	2/24/2026 11:22:40 AM	36.6	60.1	0.3	3.0			110.5	110.5	0.6
CCV24102	CV-24102	2/4/2026 2:12:01 PM	46.1	48.5	0.0	5.4			98.4	98.9	1.0
CCV24102	CV-24102	2/22/2026 1:06:59 PM	48.2	46.2	0.0	5.7			102.2	102.2	1.0
CCV24103	CV-24103	2/2/2026 9:47:38 AM	51.8	46.5	0.0	1.7			108.4	108.4	1.1
CCV24103	CV-24103	2/17/2026 9:35:11 AM	51.1	48.0	0.0	0.9			101.3	101.3	1.1
CCV24104	CV-24104	2/2/2026 9:54:30 AM	44.7	51.1	0.0	4.2			102.1	102.1	0.9
CCV24104	CV-24104	2/17/2026 9:45:03 AM	42.2	54.5	0.0	3.3			84.4	84.4	0.8

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CCV24104	CV-24104	2/23/2026 2:08:42 PM	41.6	58.4	0.0	0.0			101.9	102.0	0.7
CCV24105	CV-24105	2/2/2026 3:42:28 PM	51.4	46.2	0.0	2.4			101.3	101.3	1.1
CCV24105	CV-24105	2/17/2026 8:53:18 AM	49.6	47.5	0.0	2.9			90.3	90.3	1.0
CCV24106	CV-24106	2/3/2026 11:03:01 AM	50.3	42.9	0.1	6.7			128.5	128.5	1.2
CCV24106	CV-24106	2/4/2026 10:00:20 AM	49.9	46.3	0.0	3.8			129.9	129.9	1.1
CCV24106	CV-24106	2/17/2026 8:21:58 AM	50.1	44.1	0.0	5.8			127.9	127.8	1.1
CCV24107	CV-24107	2/4/2026 9:51:42 AM	45.5	53.6	0.0	0.9			130.9	129.6	0.8
CCV24107	CV-24107	2/4/2026 9:52:52 AM	45.0	54.4	0.0	0.6			129.8	129.9	0.8
CCV24108	CV-24108	2/4/2026 9:23:32 AM	45.3	39.6	2.5	12.6			116.0	117.4	1.1
CCV24109	CV-24109	2/4/2026 9:00:37 AM	37.6	43.8	0.0	18.6			95.4	96.1	0.9
CCV24110	CV-24110	2/9/2026 2:15:49 PM	44.8	52.8	0.0	2.4			124.3	124.2	0.8
CCV24110	CV-24110	2/23/2026 8:07:38 AM	46.1	50.3	0.0	3.6			120.1	120.5	0.9
CCV24111	CV-24111	2/9/2026 2:05:21 PM	32.2	63.4	0.0	4.4			87.3	103.8	0.5
CCV24111	CV-24111	2/9/2026 2:05:50 PM	32.1	66.7	0.0	1.2			104.5	105.0	0.5
CCV24112	CV-24112	2/20/2026 12:19:48 PM	50.4	39.3	0.0	10.3			127.2	127.2	1.3
CCV24114	CV-24114	2/4/2026 12:17:30 PM	55.2	43.1	0.0	1.7			121.0	120.1	1.3
CCV24114	CV-24114	2/23/2026 2:32:53 PM	56.1	43.9	0.0	0.0			121.4	121.4	1.3
CCV24116	CV-24116	2/4/2026 10:03:57 AM	50.6	45.3	0.0	4.1			112.4	112.5	1.1
CCV24117	CV-24117	2/2/2026 11:16:22 AM	47.2	45.4	0.0	7.4			108.7	108.7	1.0
CCV24118	CV-24118	2/6/2026 2:28:14 PM	16.2	83.8	0.0	0.0			136.3	136.7	0.2
CCV24118	CV-24118	2/9/2026 8:09:43 AM	16.0	77.3	0.6	6.1			135.2	134.9	0.2
CCV24118	CV-24118	2/9/2026 8:10:22 AM	15.9	79.6	1.0	3.5			134.5	134.7	0.2
CCV24118	CV-24118	2/24/2026 8:42:49 AM	19.1	77.8	0.0	3.1			134.3	135.1	0.2
CCV24118	CV-24118	2/24/2026 8:44:38 AM	19.3	78.0	0.0	2.7			134.6	134.6	0.2
CCV24119	CV-24119	2/6/2026 4:29:46 PM	51.5	43.8	0.0	4.7			136.3	134.6	1.2
CCV24119	CV-24119	2/6/2026 4:32:43 PM	51.9	44.8	0.0	3.3			134.3	134.7	1.2
CCV24120	CV-24120	2/2/2026 8:25:00 AM						15000			
CCV24120	CV-24120	2/2/2026 8:25:00 AM					220				
CCV24120	CV-24120	2/12/2026 8:53:02 AM	7.6	73.3	0.7	18.4			89.4	89.0	0.1

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CCV24120	CV-24120	2/15/2026 2:10:21 PM	4.2	70.4	0.8	24.6			74.6	74.5	0.1
CCV24121	CV-24121	2/10/2026 8:30:00 AM					200				
CCV24121	CV-24121	2/12/2026 8:31:05 AM	31.3	61.4	0.3	7.0			120.8	121.7	0.5
CCV24121	CV-24121	2/15/2026 2:15:50 PM	19.7	66.6	0.7	13.0			115.0	114.1	0.3
CCV24122	CV-24122	2/2/2026 7:50:00 AM						2800			
CCV24122	CV-24122	2/12/2026 9:03:31 AM	47.6	42.1	1.8	8.6			67.0	67.0	1.1
CCV24122	CV-24122	2/12/2026 9:04:29 AM	47.7	42.8	0.9	8.5			67.1	67.0	1.1
CCV24122	CV-24122	2/15/2026 2:34:49 PM	53.8	42.4	0.0	3.8			70.3	70.4	1.3
CCV24123	CV-24123	2/4/2026 7:54:38 AM	52.2	43.8	0.0	4.0			114.1	114.3	1.2
CCV24124	CV-24124	2/12/2026 9:22:01 AM	10.9	78.1	0.0	11.0			106.2	106.7	0.1
CCV24125	CV-24125-TP20	2/2/2026 8:00:00 AM						4800			
CCV24125	CV-24125-TP20	2/2/2026 8:00:00 AM					110				
CCV24125	CV-24125-TP20	2/13/2026 3:44:21 PM	31.8	68.2	0.0	0.0			111.9	113.2	0.5
CCV24125	CV-24125-TP20	2/13/2026 3:46:54 PM	31.2	68.8	0.0	0.0			113.1	112.9	0.5
CCV24126	CV-24126	2/2/2026 10:00:00 AM					2650				
CCV24126	CV-24126	2/2/2026 10:00:00 AM						84500			
CCV24126	CV-24126	2/2/2026 10:00:53 AM	8.5	82.2	0.0	9.3			189.7	189.8	0.1
CCV24126	CV-24126	2/9/2026 12:52:55 PM	0.6	92.1	0.0	7.3			189.0	189.2	0.0
CCV24126	CV-24126	2/9/2026 12:55:00 PM						150500			
CCV24126	CV-24126	2/9/2026 12:55:00 PM					4440				
CCV24126	CV-24126	2/10/2026 8:20:00 AM					590				
CCV24126	CV-24126	2/17/2026 8:58:39 AM	0.8	79.8	1.2	18.2			187.8	188.6	0.0
CCV24126	CV-24126	2/17/2026 9:00:00 AM					4120				
CCV24126	CV-24126	2/23/2026 10:15:00 AM					3520				
CCV24126	CV-24126	2/23/2026 10:15:17 AM	3.7	86.3	0.0	10.0			174.5	174.3	0.0
CCV24126	CV-24126	2/23/2026 10:15:47 AM	3.9	88.4	0.0	7.7			172.5	171.1	0.0
CCV24127	CV-24127	2/10/2026 3:28:03 PM	2.4	82.7	0.3	14.6			100.1	96.7	0.0
CCV24127	CV-24127	2/12/2026 9:55:00 AM					2600				
CCV24127	CV-24127	2/12/2026 9:55:00 AM						150000			

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CCV24128	CV-24128	2/2/2026 8:55:00 AM						35000			
CCV24128	CV-24128	2/2/2026 8:55:00 AM					640				
CCV24128	CV-24128	2/10/2026 3:18:12 PM	23.0	50.3	1.2	25.5			111.0	112.7	0.5
CCV24129	CV-24129	2/10/2026 3:04:10 PM	38.5	58.7	0.0	2.8			122.5	119.2	0.7
CCV24130	CV-24130	2/13/2026 3:17:32 PM	22.7	64.4	0.2	12.7			123.9	119.8	0.4
CCV24131	CV-24131	2/10/2026 2:32:27 PM	38.1	49.0	1.9	11.0			118.2	116.8	0.8
CCV24132	CV-24132	2/4/2026 8:04:12 AM	52.1	43.3	0.0	4.6			127.9	128.1	1.2
CCV24133	CV-24133	2/4/2026 8:26:59 AM	55.2	41.5	0.0	3.3			122.0	122.1	1.3
CCV24134	CV-24134-TP19	2/13/2026 3:08:28 PM	31.8	61.6	0.1	6.5			134.6	134.2	0.5
CCV24134	CV-24134-TP19	2/13/2026 3:09:48 PM	28.0	65.6	0.0	6.4			133.6	133.7	0.4
CCV24135	CV-24135	2/10/2026 11:50:50 AM	29.4	70.6	0.0	0.0			133.3	135.4	0.4
CCV24135	CV-24135	2/10/2026 11:55:05 AM	24.6	75.4	0.0	0.0			133.3	134.3	0.3
CCV24136	CV-24136	2/10/2026 9:25:28 AM	28.7	60.5	0.0	10.8			134.3	137.6	0.5
CCV24136	CV-24136	2/10/2026 9:27:15 AM	29.2	62.9	0.0	7.9			138.0	138.3	0.5
CCV24137	CV-24137	2/9/2026 10:10:34 AM	30.5	58.1	0.0	11.4			101.1	102.1	0.5
CCV24137	CV-24137	2/9/2026 10:11:54 AM	29.8	58.3	0.0	11.9			102.7	103.1	0.5
CCV24138	CV-24138	2/3/2026 7:15:00 AM					720				
CCV24138	CV-24138	2/3/2026 7:15:00 AM						200000			
CCV24138	CV-24138	2/13/2026 1:10:03 PM	0.3	24.2	14.7	60.8			86.8	86.9	0.0
CCV24138	CV-24138	2/13/2026 1:10:33 PM	0.2	18.3	15.2	66.3			86.9	86.9	0.0
CCV24138	CV-24138	2/24/2026 10:08:13 AM	1.3	43.1	9.5	46.1			162.2	160.1	0.0
CCV24138	CV-24138	2/24/2026 10:08:53 AM	1.3	44.5	9.9	44.3			161.2	161.8	0.0
CCV24138	CV-24138	2/27/2026 1:39:56 PM	2.9	74.9	0.0	22.2			108.6	113.2	0.0
CCV24138	CV-24138	2/27/2026 1:46:59 PM	2.7	72.0	1.0	24.3			113.9	112.8	0.0
CCV24139	CV-24139	2/3/2026 7:10:00 AM					230				
CCV24139	CV-24139	2/3/2026 7:10:00 AM						48000			
CCV24139	CV-24139	2/6/2026 7:53:50 AM	0.6	15.5	16.6	67.3			69.0	69.0	0.0
CCV24139	CV-24139	2/24/2026 10:11:41 AM	0.5	18.5	10.5	70.5			105.2	104.7	0.0
CCV24140	CV-24140	2/3/2026 7:05:00 AM					1100				

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CCV24140	CV-24140	2/3/2026 7:05:00 AM						210000			
CCV24140	CV-24140	2/6/2026 7:58:43 AM	2.2	73.0	1.5	23.3			95.2	95.6	0.0
CCV24140	CV-24140	2/24/2026 10:14:59 AM	1.9	75.2	1.1	21.8			123.0	122.8	0.0
CCV24141	CV-24141	2/3/2026 6:45:00 AM					45				
CCV24141	CV-24141	2/3/2026 6:45:00 AM						2100			
CCV24141	CV-24141	2/6/2026 8:05:13 AM	0.1	4.7	20.7	74.5			55.4	55.4	0.0
CCV24141	CV-24141	2/24/2026 10:20:01 AM	0.1	5.5	20.0	74.4			85.1	85.3	0.0
CCV24142	CV-24142	2/4/2026 8:35:28 AM	3.2	83.2	0.0	13.6			116.6	117.3	0.0
CCV24142	CV-24142	2/5/2026 7:15:00 AM					1800				
CCV24142	CV-24142	2/5/2026 7:15:00 AM						230000			
CCV24142	CV-24142	2/9/2026 8:14:30 AM	2.8	76.8	0.0	20.4			167.0	167.4	0.0
CCV24142	CV-24142	2/9/2026 8:15:00 AM						193400			
CCV24142	CV-24142	2/9/2026 8:15:00 AM					2850				
CCV24142	CV-24142	2/20/2026 12:12:27 PM	3.2	77.1	0.9	18.8			166.6	167.1	0.0
CCV24142	CV-24142	2/20/2026 12:15:00 PM					1700				
CCV24142	CV-24142	2/25/2026 1:16:52 PM	11.9	73.4	0.0	14.7			145.2	150.7	0.2
CCV24142	CV-24142	2/25/2026 1:20:00 PM					2050				
CCV24143	CV-24143	2/3/2026 6:55:00 AM					1700				
CCV24143	CV-24143	2/3/2026 6:55:00 AM						170000			
CCV24143	CV-24143	2/13/2026 1:02:53 PM	1.7	74.3	1.2	22.8			166.8	168.1	0.0
CCV24143	CV-24143	2/13/2026 1:03:32 PM	2.5	77.0	1.2	19.3			168.4	168.6	0.0
CCV24143	CV-24143	2/20/2026 12:05:00 PM					2060				
CCV24143	CV-24143	2/20/2026 12:05:23 PM	2.0	62.0	4.5	31.5			174.1	174.3	0.0
CCV24143	CV-24143	2/26/2026 10:26:52 AM	10.2	80.8	0.5	8.5			153.7	154.7	0.1
CCV24143	CV-24143	2/26/2026 10:30:00 AM					2090				
CCV24144	CV-24144	2/5/2026 2:08:00 PM	55.5	41.1	0.0	3.4			97.8	97.8	1.4
CCV24144	CV-24144	2/21/2026 10:47:17 AM	59.3	40.2	0.0	0.5			66.4	66.4	1.5
CCV24145	CV-24145	2/4/2026 1:17:26 PM	6.5	76.3	1.6	15.6			181.5	180.7	0.1
CCV24145	CV-24145	2/4/2026 1:20:00 PM					1650				

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CCV24145	CV-24145	2/4/2026 1:20:00 PM						162100			
CCV24145	CV-24145	2/4/2026 1:20:03 PM	6.9	77.2	0.2	15.7			180.5	181.0	0.1
CCV24145	CV-24145	2/10/2026 1:24:51 PM	4.2	79.4	0.0	16.4			180.0	180.3	0.1
CCV24145	CV-24145	2/10/2026 1:26:00 PM					1710				
CCV24145	CV-24145	2/10/2026 1:26:00 PM						149200			
CCV24145	CV-24145	2/20/2026 8:10:00 AM					1110				
CCV24145	CV-24145	2/20/2026 8:10:24 AM	5.3	78.0	1.4	15.3			175.9	176.3	0.1
CCV24145	CV-24145	2/23/2026 1:36:29 PM	14.9	64.6	4.0	16.5			178.7	178.7	0.2
CCV24145	CV-24145	2/23/2026 1:50:00 PM					1640				
CCV24146	CV-24146	2/4/2026 7:51:53 AM	52.6	43.8	0.0	3.6			113.0	113.0	1.2
CCV24146	CV-24146	2/15/2026 1:57:06 PM	53.3	42.5	0.0	4.2			112.4	112.4	1.3
CCV24147	CV-24147	2/4/2026 7:59:23 AM	46.8	37.5	2.2	13.5			109.2	109.4	1.2
CCV24147	CV-24147	2/15/2026 3:32:43 PM	50.1	36.8	2.4	10.8			108.2	108.3	1.4
CCV24148	CV-24148	2/3/2026 7:45:00 AM						73800			
CCV24148	CV-24148	2/3/2026 7:45:00 AM					2094				
CCV24148	CV-24148	2/3/2026 7:46:18 AM	7.3	86.6	0.0	6.1			167.9	172.6	0.1
CCV24148	CV-24148	2/3/2026 7:46:42 AM	7.6	86.4	0.0	6.0			172.9	172.5	0.1
CCV24148	CV-24148	2/11/2026 8:14:50 AM	2.3	89.1	0.0	8.6			171.1	174.2	0.0
CCV24148	CV-24148	2/11/2026 8:15:00 AM					2530				
CCV24148	CV-24148	2/11/2026 8:15:00 AM						64800			
CCV24148	CV-24148	2/11/2026 8:15:29 AM	3.9	89.4	0.0	6.7			174.4	174.6	0.0
CCV24148	CV-24148	2/18/2026 8:20:00 AM					2370				
CCV24148	CV-24148	2/18/2026 8:23:40 AM	4.3	73.1	4.4	18.2			172.9	172.8	0.1
CCV24148	CV-24148	2/18/2026 8:25:11 AM	5.0	83.6	4.1	7.3			172.7	172.4	0.1
CCV24148	CV-24148	2/23/2026 8:51:06 AM	7.5	86.0	0.0	6.5			170.0	170.0	0.1
CCV24148	CV-24148	2/23/2026 8:51:52 AM	7.5	86.0	0.0	6.5			170.0	170.0	0.1
CCV24148	CV-24148	2/25/2026 8:31:09 AM	8.7	80.8	0.0	10.5			171.1	171.5	0.1
CCV24148	CV-24148	2/25/2026 8:40:00 AM					1630				
CCV24149	CV-24149	2/3/2026 1:42:26 PM	17.3	76.5	0.0	6.2			129.5	129.6	0.2

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CCV24149	CV-24149	2/17/2026 11:40:05 AM	28.6	69.5	0.0	1.9			121.7	121.1	0.4
CCV24149	CV-24149	2/23/2026 9:15:57 AM	20.9	74.5	0.0	4.6			123.6	123.6	0.3
CCV24150	CV-24150	2/9/2026 1:18:53 PM	35.6	59.3	0.0	5.1			112.5	115.0	0.6
CCV24150	CV-24150	2/9/2026 1:20:09 PM	36.5	62.2	0.0	1.3			114.2	114.4	0.6
CCV24150	CV-24150	2/20/2026 12:32:57 PM	45.7	52.0	0.0	2.3			100.2	101.9	0.9
CCV24150	CV-24150	2/20/2026 12:34:32 PM	43.9	52.7	0.0	3.4			99.7	100.1	0.8
CCV24151	CV-24151	2/3/2026 1:08:44 PM	42.1	57.9	0.0	0.0			106.3	107.8	0.7
CCV24151	CV-24151	2/17/2026 12:21:37 PM	41.3	58.0	0.0	0.7			90.9	89.5	0.7
CCV24152	CV-24152	2/3/2026 1:23:28 PM	25.2	69.9	0.0	4.9			131.9	132.0	0.4
CCV24152	CV-24152	2/17/2026 11:51:51 AM	27.7	68.1	0.0	4.2			124.0	124.1	0.4
CCV24152	CV-24152	2/23/2026 9:32:35 AM	26.4	66.9	0.0	6.7			124.7	124.9	0.4
CCV24153	CV-24153	2/3/2026 1:26:55 PM	21.9	65.5	0.0	12.6			120.7	121.1	0.3
CCV24153	CV-24153	2/22/2026 9:57:54 AM	3.0	77.6	0.0	19.4			80.7	81.0	0.0
CCV24154	CV-24154	2/9/2026 11:31:33 AM	50.0	48.6	0.0	1.4			103.2	103.6	1.0
CCV24154	CV-24154	2/24/2026 3:12:19 PM	42.4	54.4	0.7	2.5			108.9	108.1	0.8
CCV24155	CV-24155	2/3/2026 1:34:59 PM	36.2	52.3	0.0	11.5			124.2	124.5	0.7
CCV24155	CV-24155	2/17/2026 11:33:18 AM	32.1	66.7	0.0	1.2			127.9	124.4	0.5
CCV24156	CV-24156	2/3/2026 10:19:12 AM	31.9	66.1	0.0	2.0			129.6	129.7	0.5
CCV24156	CV-24156	2/19/2026 7:50:22 AM	26.4	66.6	0.0	7.0			129.1	128.9	0.4
CCV24157	CV-24157	2/3/2026 10:11:40 AM	47.1	52.9	0.0	0.0			125.0	123.9	0.9
CCV24157	CV-24157	2/21/2026 10:15:35 AM	43.3	50.4	0.9	5.4			114.5	114.9	0.9
CCV24158	CV-24158	2/9/2026 3:28:05 PM	48.2	51.8	0.0	0.0			125.3	126.0	0.9
CCV24158	CV-24158	2/9/2026 3:29:41 PM	47.7	52.3	0.0	0.0			126.8	126.9	0.9
CCV24158	CV-24158	2/17/2026 12:36:20 PM	45.6	54.4	0.0	0.0			122.2	121.1	0.8
CCV24159	CV-24159	2/2/2026 2:12:02 PM	52.8	43.8	0.0	3.4			113.9	113.9	1.2
CCV24159	CV-24159	2/18/2026 8:35:04 AM	53.5	44.6	0.0	1.9			110.4	110.6	1.2
CCV24160	CV-24160	2/9/2026 11:27:05 AM	50.1	47.5	0.2	2.2			114.9	115.0	1.1
CCV24160	CV-24160	2/22/2026 9:47:07 AM	44.2	47.2	1.2	7.5			115.3	115.6	0.9
CCV24160	CV-24160	2/22/2026 9:49:28 AM	44.0	47.3	1.1	7.7			115.6	115.1	0.9

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CCV24160	CV-24160	2/22/2026 9:50:51 AM	43.3	47.7	1.3	7.7			114.6	114.5	0.9
CCV24160	CV-24160	2/23/2026 12:26:26 PM	45.7	52.8	0.2	1.3			106.0	106.5	0.9
CCV24161	CV-24161	2/9/2026 3:06:31 PM	35.3	38.3	4.6	21.8			109.9	108.4	0.9
CCV24161	CV-24161	2/23/2026 8:37:20 AM	27.6	34.3	7.2	30.9			98.2	98.3	0.8
CCV24161	CV-24161	2/23/2026 8:39:10 AM	23.9	32.6	7.0	36.5			99.0	99.3	0.7
CCV24162	CV-24162	2/4/2026 9:15:39 AM	45.2	43.9	0.0	10.9			99.7	100.2	1.0
CCV24163	CV-24163	2/6/2026 4:05:06 PM	43.8	56.2	0.0	0.0			106.2	109.9	0.8
CCV24164	CV-24164	2/3/2026 9:55:43 AM	30.0	70.0	0.0	0.0			134.6	134.7	0.4
CCV24164	CV-24164	2/22/2026 10:35:39 AM	42.9	54.1	0.0	3.1			130.8	130.9	0.8
CCV24165	CV-24165	2/13/2026 8:00:09 AM	33.8	64.4	0.0	1.8			96.3	96.2	0.5
CCV24165	CV-24165	2/18/2026 10:16:33 AM	32.5	67.1	0.0	0.4			116.6	116.4	0.5
CCV24165	CV-24165	2/21/2026 10:31:43 AM	35.8	60.2	0.0	4.0			88.1	91.8	0.6
CCV24166	CV-24166	2/2/2026 2:08:19 PM	53.3	42.9	0.0	3.8			111.9	108.3	1.2
CCV24166	CV-24166	2/18/2026 8:39:31 AM	54.3	41.8	0.1	3.8			106.4	105.7	1.3
CCV24167	CV-24167	2/13/2026 8:10:00 AM	53.2	46.4	0.0	0.4			101.5	100.8	1.1
CCV24167	CV-24167	2/22/2026 9:25:47 AM	54.8	40.6	0.0	4.6			105.0	104.9	1.3
CCV24167	CV-24167	2/22/2026 9:28:09 AM	53.6	41.3	0.0	5.1			104.8	103.8	1.3
CCV24168	CV-24168	2/13/2026 7:52:32 AM	32.4	67.4	0.0	0.2			55.0	55.1	0.5
CCV24168	CV-24168	2/13/2026 7:53:12 AM	32.4	67.3	0.0	0.3			55.2	55.2	0.5
CCV24168	CV-24168	2/18/2026 10:11:35 AM	40.0	44.2	2.3	13.5			125.1	124.5	0.9
CCV24168	CV-24168	2/21/2026 10:28:45 AM	37.5	40.6	2.4	19.5			104.4	103.5	0.9
CCV24169	CV-24169	2/2/2026 1:39:42 PM	43.3	52.7	0.0	4.0			129.1	129.4	0.8
CCV24169	CV-24169	2/22/2026 10:20:30 AM	44.5	46.6	0.0	8.9			105.5	105.2	1.0
CCV24170	CV-24170	2/3/2026 7:55:45 AM	33.3	54.1	3.1	9.5			121.4	121.1	0.6
CCV24170	CV-24170	2/19/2026 8:15:16 AM	34.0	62.5	0.0	3.5			126.4	126.6	0.5
CCV24171	CV-24171	2/2/2026 12:44:28 PM	53.9	42.5	0.0	3.6			120.6	120.6	1.3
CCV24171	CV-24171	2/18/2026 8:48:22 AM	54.4	43.8	0.0	1.8			114.0	113.9	1.2
CCV24172	CV-24172	2/2/2026 1:18:26 PM	43.1	37.6	3.0	16.3			118.5	118.5	1.1
CCV24172	CV-24172	2/18/2026 9:10:27 AM	35.5	34.4	3.1	27.0			111.7	111.6	1.0

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CCV24173	CV-24173	2/2/2026 1:22:16 PM	37.5	56.7	0.4	5.4			130.7	130.7	0.7
CCV24173	CV-24173	2/18/2026 9:42:07 AM	42.0	50.3	0.8	6.9			122.4	122.4	0.8
CCV24174	CV-24174	2/3/2026 1:39:36 PM	23.7	71.1	0.0	5.2			116.9	118.0	0.3
CCV24174	CV-24174	2/3/2026 1:41:17 PM	25.4	70.5	0.0	4.1			118.6	118.6	0.4
CCV24174	CV-24174	2/22/2026 2:35:18 PM	37.8	47.5	0.0	14.7			103.2	103.4	0.8
CCV24175	CV-24175	2/3/2026 1:35:14 PM	41.2	48.6	0.1	10.1			115.8	115.8	0.8
CCV24175	CV-24175	2/22/2026 2:30:24 PM	41.4	45.4	0.0	13.3			113.9	114.0	0.9
CCV24176	CV-24176	2/2/2026 10:27:14 AM	35.1	60.7	0.0	4.2			118.8	118.8	0.6
CCV24176	CV-24176	2/21/2026 8:41:34 AM	22.2	77.8	0.0	0.0			81.9	82.2	0.3
CCV24177	CV-24177	2/13/2026 10:57:16 AM	31.6	43.2	2.6	22.6			102.6	102.8	0.7
CCV24177	CV-24177	2/21/2026 9:01:10 AM	25.5	38.7	3.7	32.1			59.6	59.7	0.7
CCV24178	CV-24178	2/2/2026 2:36:53 PM	39.7	58.4	0.0	1.9			125.6	125.8	0.7
CCV24178	CV-24178	2/19/2026 9:08:01 AM	47.8	48.0	0.0	4.2			121.7	121.9	1.0
CCV24179	CV-24179	2/2/2026 10:15:34 AM	36.6	61.0	0.0	2.4			126.1	124.8	0.6
CCV24179	CV-24179	2/17/2026 10:03:25 AM	15.7	83.4	0.0	0.9			77.2	77.3	0.2
CCV24180	CV-24180	2/2/2026 10:30:57 AM	42.5	52.9	0.0	4.6			120.1	120.3	0.8
CCV24180	CV-24180	2/22/2026 12:54:06 PM	39.2	54.9	0.0	6.0			107.8	112.3	0.7
CCV24180	CV-24180	2/22/2026 12:54:59 PM	40.8	51.9	0.0	7.4			112.6	112.5	0.8
CCV24182	CV-24182	2/2/2026 2:15:57 PM	44.7	51.2	0.0	4.1			105.9	105.5	0.9
CCV24182	CV-24182	2/19/2026 8:55:04 AM	48.9	48.0	0.0	3.1			54.9	54.9	1.0
CCV24183	CV-24183	2/2/2026 3:35:59 PM	49.0	47.8	0.1	3.1			99.1	96.5	1.0
CCV24183	CV-24183	2/17/2026 9:18:38 AM	47.0	45.6	0.5	6.9			57.1	48.9	1.0
CCV24184	CV-24184	2/4/2026 1:11:22 PM	48.9	44.0	0.0	7.1			113.4	140.2	1.1
CCV24184	CV-24184	2/4/2026 1:14:59 PM	42.0	42.7	0.0	15.3			143.5	144.7	1.0
CCV24184	CV-24184	2/4/2026 1:40:11 PM	33.8	35.4	0.0	30.7			148.1	148.1	1.0
CCV24184	CV-24184	2/4/2026 2:10:00 PM					498				
CCV24184	CV-24184	2/4/2026 2:10:00 PM						4500			
CCV24184	CV-24184	2/13/2026 1:42:48 PM	31.7	28.5	6.6	33.2			137.3	137.5	1.1
CCV24184	CV-24184	2/17/2026 9:35:05 AM	1.5	3.2	19.3	76.0			127.6	127.7	0.5

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CCV24184	CV-24184	2/17/2026 9:38:23 AM	1.5	2.6	19.4	76.5			127.3	121.4	0.6
CCV24185	CV-24185	2/3/2026 11:26:06 AM	50.3	46.3	0.0	3.4			114.4	114.5	1.1
CCV24185	CV-24185	2/4/2026 2:25:07 PM	49.8	43.7	0.0	6.6			117.6	117.5	1.1
CCV24185	CV-24185	2/4/2026 2:26:01 PM	49.9	43.9	0.0	6.2			117.3	117.4	1.1
CCV24185	CV-24185	2/17/2026 9:50:59 AM	50.6	44.1	0.0	5.3			110.0	109.9	1.1
CCV24186	CV-24186	2/3/2026 11:31:33 AM	46.7	42.5	0.0	10.8			126.2	125.8	1.1
CCV24186	CV-24186	2/23/2026 11:00:28 AM	45.7	48.1	0.0	6.2			123.9	123.9	1.0
CCV24187	CV-24187	2/4/2026 2:06:17 PM	44.3	53.1	0.0	2.6			125.0	125.6	0.8
CCV24187	CV-24187	2/17/2026 10:09:01 AM	38.2	51.3	0.0	10.5			122.1	121.9	0.7
CCV24188	CV-24188	2/4/2026 1:43:59 PM	50.8	42.8	0.0	6.4			116.5	116.7	1.2
CCV24188	CV-24188	2/22/2026 1:12:49 PM	52.8	44.2	0.0	3.0			114.6	115.3	1.2
CCV24188	CV-24188	2/22/2026 1:14:20 PM	52.4	44.3	0.0	3.3			115.6	115.7	1.2
CCV24189	CV-24189	2/4/2026 1:46:19 PM	51.1	42.1	0.0	6.8			115.1	116.5	1.2
CCV24189	CV-24189	2/24/2026 9:40:34 AM	51.6	40.4	0.5	7.5			115.0	115.6	1.3
CCV24189	CV-24189	2/24/2026 11:30:14 AM	49.0	42.2	0.2	8.6			115.3	114.7	1.2
CCV24190	CV-24190	2/4/2026 2:02:44 PM	53.2	44.1	0.0	2.7			123.2	123.3	1.2
CCV24190	CV-24190	2/17/2026 10:15:33 AM	53.5	46.4	0.0	0.1			120.1	120.4	1.2
CCV24192	CV-24192	2/4/2026 1:58:34 PM	53.6	40.8	0.0	5.6			116.5	116.7	1.3
CCV24192	CV-24192	2/17/2026 10:25:11 AM	56.4	43.2	0.0	0.4			105.2	108.5	1.3
CCV24193	CV-24193	2/2/2026 9:42:47 AM	52.2	42.9	0.0	4.9			112.4	112.4	1.2
CCV24193	CV-24193	2/17/2026 9:28:55 AM	54.7	44.3	0.1	0.9			111.0	110.9	1.2
CCV24194	CV-24194	2/2/2026 9:50:30 AM	52.2	44.6	0.0	3.2			112.8	112.8	1.2
CCV24194	CV-24194	2/17/2026 9:41:03 AM	53.2	45.5	0.0	1.3			109.1	109.1	1.2
CCV24195	CV-24195	2/2/2026 3:39:42 PM	49.5	48.6	0.0	1.9			113.7	113.8	1.0
CCV24195	CV-24195	2/17/2026 8:47:48 AM	48.5	48.1	0.0	3.4			110.1	110.1	1.0
CCV24195	CV-24195	2/23/2026 2:04:54 PM	49.9	50.1	0.0	0.0			114.5	114.8	1.0
CCV24196	CV-24196	2/2/2026 3:45:20 PM	51.3	45.4	0.0	3.3			120.7	120.7	1.1
CCV24196	CV-24196	2/17/2026 8:58:39 AM	49.8	46.7	0.0	3.5			116.9	116.9	1.1
CCV24197	CV-24197	2/4/2026 2:40:44 PM	52.5	41.6	0.0	5.9			116.6	116.2	1.3

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CCV24197	CV-24197	2/4/2026 2:44:27 PM	51.8	42.4	0.0	5.9			116.2	119.3	1.2
CCV24197	CV-24197	2/4/2026 2:47:24 PM	51.4	42.4	0.0	6.3			120.0	120.2	1.2
CCV24197	CV-24197	2/23/2026 10:54:34 AM	52.6	44.7	0.0	2.7			113.2	113.9	1.2
CCV24198	CV-24198	2/3/2026 11:11:33 AM	47.0	44.5	0.0	8.5			120.8	120.8	1.1
CCV24198	CV-24198	2/17/2026 8:31:54 AM	46.0	45.4	0.0	8.6			120.1	120.0	1.0
CCV24199	CV-24199	2/3/2026 11:06:56 AM	51.1	43.6	0.0	5.3			126.1	126.2	1.2
CCV24199	CV-24199	2/17/2026 8:36:53 AM	49.1	45.5	0.0	5.4			126.4	126.5	1.1
CCV24200	CV-24200	2/3/2026 2:50:09 PM	51.5	44.0	0.0	4.5			116.1	116.1	1.2
CCV24200	CV-24200	2/17/2026 7:47:37 AM	50.2	42.9	0.0	6.9			115.2	115.3	1.2
CCV24201	CV-24201	2/2/2026 10:45:16 AM	56.4	41.6	0.1	1.9			115.4	115.5	1.4
CCV24201	CV-24201	2/17/2026 7:54:57 AM	51.3	42.7	0.0	6.0			113.3	113.3	1.2
CCV24202	CV-24202	2/2/2026 10:52:48 AM	47.4	46.6	0.0	6.0			118.8	119.0	1.0
CCV24202	CV-24202	2/17/2026 8:06:33 AM	40.0	41.4	0.0	18.6			102.8	102.9	1.0
CCV24203	CV-24203	2/4/2026 9:59:43 AM	53.1	44.3	0.0	2.6			125.5	125.8	1.2
CCV24203	CV-24203	2/19/2026 9:48:11 AM	57.1	42.9	0.0	0.0			121.0	121.0	1.3
CCV24204	CV-24204	2/4/2026 9:53:49 AM	52.9	43.9	0.0	3.2			120.1	120.6	1.2
CCV24204	CV-24204	2/19/2026 9:53:29 AM	51.2	46.2	0.9	1.7			119.1	119.2	1.1
CCV24205	CV-24205	2/4/2026 9:50:46 AM	51.9	44.0	0.0	4.1			121.0	120.9	1.2
CCV24205	CV-24205	2/19/2026 10:00:31 AM	59.4	40.6	0.0	0.0			117.7	118.0	1.5
CCV24206	CV-24206	2/3/2026 2:56:54 PM	35.6	33.8	3.5	27.1			99.5	99.4	1.1
CCV24206	CV-24206	2/17/2026 7:37:53 AM	32.6	32.0	4.8	30.6			54.4	56.6	1.0
CCV24207	CV-24207	2/9/2026 11:06:51 AM	53.2	46.0	0.0	0.8			128.6	128.6	1.2
CCV24207	CV-24207	2/22/2026 10:10:56 AM	53.7	43.8	0.0	2.5			129.5	129.5	1.2
CCV24207	CV-24207	2/22/2026 10:13:05 AM	53.0	44.1	0.0	2.9			129.3	129.7	1.2
CCV24207	CV-24207	2/23/2026 12:05:25 PM	52.4	46.3	0.3	1.0			127.7	128.0	1.1
CCV24208	CV-24208	2/4/2026 10:11:59 AM	45.5	52.9	0.0	1.6			125.6	125.8	0.9
CCV24208	CV-24208	2/4/2026 10:14:37 AM	45.0	54.2	0.0	0.8			126.0	126.1	0.8
CCV24209	CV-24209	2/2/2026 11:09:35 AM	21.2	68.9	0.1	9.8			128.8	128.6	0.3
CCV24210	CV-24210	2/4/2026 9:39:29 AM	46.4	42.6	0.3	10.7			115.8	115.6	1.1

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CCV24211	CV-24211	2/21/2026 10:36:31 AM	19.3	77.8	0.1	2.8			130.7	130.4	0.2
CCV24212	CV-24212	2/17/2026 10:32:08 AM	8.6	69.1	0.5	21.8			85.0	85.0	0.1
CCV24213	CV-24213	2/5/2026 8:58:42 AM	49.9	43.3	0.0	6.8			121.8	123.7	1.2
CCV24214	CV-24214	2/10/2026 8:51:31 AM	41.1	47.5	0.1	11.3			115.4	115.5	0.9
CCV24215	CV-24215	2/13/2026 3:34:01 PM	46.2	46.9	0.0	6.9			90.8	91.0	1.0
CCV24215	CV-24215	2/13/2026 3:35:28 PM	46.1	47.6	0.0	6.3			91.1	91.1	1.0
CCV24216	CV-24216	2/5/2026 8:52:02 AM	46.3	43.1	0.0	10.6			118.1	117.9	1.1
CCV24217	CV-24217	2/4/2026 8:44:54 AM	32.0	66.4	0.0	1.6			95.7	96.2	0.5
CCV24218	CV-24218	2/12/2026 2:14:53 PM	43.8	56.2	0.0	0.0			120.8	120.0	0.8
CCV24218	CV-24218	2/17/2026 2:01:40 PM	44.9	51.3	0.0	3.8			118.8	117.3	0.9
CCV24218	CV-24218	2/17/2026 2:02:32 PM	44.6	51.2	0.0	4.2			116.7	117.5	0.9
CCV24219	CV-24219	2/3/2026 7:29:14 AM	9.1	88.2	0.0	2.7			178.2	178.2	0.1
CCV24219	CV-24219	2/3/2026 7:30:00 AM						90650			
CCV24219	CV-24219	2/3/2026 7:30:00 AM					2045.5				
CCV24219	CV-24219	2/11/2026 8:30:00 AM						86100			
CCV24219	CV-24219	2/11/2026 8:30:00 AM					3730				
CCV24219	CV-24219	2/11/2026 8:37:24 AM	6.8	84.2	0.5	8.5			174.9	174.6	0.1
CCV24219	CV-24219	2/18/2026 7:50:00 AM					2970				
CCV24219	CV-24219	2/18/2026 7:51:25 AM	7.9	83.3	0.9	7.9			177.5	177.6	0.1
CCV24219	CV-24219	2/24/2026 1:10:00 PM					3390				
CCV24219	CV-24219	2/24/2026 1:11:35 PM	7.8	65.2	4.0	23.0			178.4	178.8	0.1
CCV24219	CV-24219	2/24/2026 1:12:37 PM	4.9	70.6	2.7	21.8			179.1	179.1	0.1
CCV24220	CV-24220	2/9/2026 8:54:01 AM	22.2	66.1	0.0	11.7			126.7	126.9	0.3
CCV24221	CV-24221	2/9/2026 12:47:41 PM	44.1	46.2	0.6	9.1			114.5	114.5	1.0
CCV24222	CV-24222	2/9/2026 12:54:39 PM	55.4	43.9	0.0	0.7			121.5	122.1	1.3
CCV24223	CV-24223	2/21/2026 10:29:13 AM	34.5	62.5	0.0	3.0			126.3	126.6	0.6
CCV24224	CV-24224	2/9/2026 8:34:14 AM	48.6	44.8	0.6	6.0			109.6	113.7	1.1
CCV24224	CV-24224	2/9/2026 8:34:58 AM	48.8	45.3	0.6	5.3			116.2	115.7	1.1
CCV24224	CV-24224	2/17/2026 10:38:56 AM	33.7	63.5	0.0	2.8			88.9	89.4	0.5

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CCV24225	CV-24225	2/5/2026 10:15:29 AM	53.2	41.3	0.0	5.5			98.8	99.5	1.3
CCV24226	CV-24226	2/21/2026 10:44:58 AM	42.0	43.1	3.8	11.1			69.5	70.8	1.0
CCV24227	CV-24227	2/4/2026 1:55:07 PM	53.3	40.5	0.0	6.2			118.0	118.0	1.3
CCV24231	CV-24231	2/5/2026 11:15:42 AM	54.2	42.8	0.0	3.0			117.9	120.3	1.3
CCV24231	CV-24231	2/5/2026 11:18:36 AM	52.7	45.1	0.0	2.2			121.0	121.0	1.2
CCV24236	CV-24236	2/4/2026 1:33:20 PM	54.3	41.4	0.0	4.3			103.4	103.9	1.3
CCV24237	CV-24237	2/4/2026 1:40:19 PM	54.4	38.1	0.0	7.5			112.2	112.8	1.4
CCV24243	CV-24243	2/17/2026 11:21:34 AM	33.5	31.1	5.2	30.2			105.0	105.0	1.1
CCV24243	CV-24243	2/17/2026 11:23:33 AM	33.7	31.3	5.1	29.9			104.7	104.7	1.1
CCV24244	CV-24244	2/17/2026 11:05:56 AM	52.0	43.8	0.2	4.0			107.7	107.8	1.2
CCV24244	CV-24244	2/24/2026 1:33:58 PM	52.9	42.0	0.3	4.8			111.1	111.3	1.3
CCV24245	CV-24245	2/23/2026 10:09:36 AM	54.6	41.9	0.1	3.4			113.8	114.1	1.3
CCV24246	CV-24246	2/3/2026 1:09:32 PM	54.7	41.2	0.0	4.1			115.6	116.2	1.3
CCV24246	CV-24246	2/3/2026 1:17:27 PM	53.7	41.7	0.0	4.6			116.3	116.3	1.3
CCV24246	CV-24246	2/3/2026 1:19:50 PM	53.7	41.5	0.0	4.8			116.1	116.2	1.3
CCV24253	CV-24253	2/3/2026 11:45:01 AM	51.9	42.4	0.0	5.6			111.6	111.6	1.2
CCV24253	CV-24253	2/3/2026 11:47:22 AM	51.9	42.7	0.0	5.5			112.1	112.3	1.2
CCV24253	CV-24253	2/3/2026 11:48:17 AM	51.8	42.8	0.0	5.4			112.2	112.3	1.2
CHIWCV25	CV-25	2/10/2026 10:31:02 AM	44.5	46.3	0.0	9.2			66.2	68.5	1.0
CHIWCV25	CV-25	2/25/2026 9:01:42 AM	48.9	38.0	2.3	10.8			73.2	72.6	1.3
CHCV2501	CV-2501	2/2/2026 1:50:18 PM	49.9	46.1	0.0	4.0			121.1	121.9	1.1
CHCV2501	CV-2501	2/2/2026 1:52:20 PM	49.0	47.5	0.0	3.5			121.7	121.7	1.0
CHCV2502	CV-2502	2/2/2026 2:01:13 PM	49.2	45.3	0.0	5.5			118.8	118.9	1.1
CHCV2503	CV-2503	2/3/2026 2:39:54 PM	51.7	45.5	0.1	2.7			124.7	124.8	1.1
CHCV2504	CV-2504	2/4/2026 12:28:11 PM	52.6	44.8	0.0	2.6			121.9	122.3	1.2
CHCV2504	CV-2504	2/4/2026 12:30:19 PM	51.2	46.5	0.0	2.3			122.7	122.7	1.1
CHCV2505	CV-2505	2/4/2026 12:07:15 PM	54.8	43.1	0.0	2.1			117.6	117.7	1.3
CHCV2506	CV-2506	2/4/2026 11:59:22 AM	54.3	43.4	0.0	2.3			121.3	121.7	1.3
CHCV2507	CV-2507	2/4/2026 11:54:19 AM	54.4	42.5	0.0	3.1			119.5	119.7	1.3

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHCV2508	CV-2508	2/4/2026 11:48:07 AM	54.9	40.7	0.0	4.4			117.4	117.7	1.3
CHCV2509	CV-2509	2/3/2026 1:52:12 PM	54.9	41.1	0.0	4.0			113.5	113.6	1.3
CHCV2509	CV-2509	2/3/2026 1:53:58 PM	53.5	41.7	0.0	4.8			113.6	113.7	1.3
CHCV2510	CV-2510	2/3/2026 3:05:52 PM	54.7	41.7	0.0	3.6			111.4	111.6	1.3
CHCV2510	CV-2510	2/3/2026 3:07:38 PM	53.6	42.0	0.0	4.4			111.6	111.6	1.3
CHCV2510	CV-2510	2/6/2026 4:41:16 PM	56.0	38.2	0.0	5.8			111.4	111.3	1.5
CV25100D	CV-25100D	2/2/2026 10:05:00 AM					3390				
CV25100D	CV-25100D	2/2/2026 10:05:00 AM						90800			
CV25100D	CV-25100D	2/2/2026 10:05:37 AM	26.3	73.7	0.0	0.0			151.3	157.2	0.4
CV25100D	CV-25100D	2/2/2026 10:06:20 AM	22.7	77.3	0.0	0.0			157.4	157.1	0.3
CV25100D	CV-25100D	2/2/2026 10:10:00 AM						133600			
CV25100D	CV-25100D	2/9/2026 1:00:00 AM						79300			
CV25100D	CV-25100D	2/9/2026 12:57:30 PM	9.5	90.5	0.0	0.0			145.3	144.8	0.1
CV25100D	CV-25100D	2/9/2026 1:00:00 PM					1700				
CV25100D	CV-25100D	2/17/2026 9:19:05 AM	11.3	81.2	0.5	7.0			143.5	141.5	0.1
CV25100S	CV-25100S	2/2/2026 10:08:01 AM	9.8	78.6	0.0	11.6			170.6	172.3	0.1
CV25100S	CV-25100S	2/2/2026 10:08:35 AM	9.3	83.3	0.0	7.4			171.9	171.4	0.1
CV25100S	CV-25100S	2/2/2026 10:10:00 AM					4860				
CV25100S	CV-25100S	2/2/2026 10:10:00 AM						133600			
CV25100S	CV-25100S	2/9/2026 1:05:00 AM						125800			
CV25100S	CV-25100S	2/9/2026 12:59:03 PM	1.8	91.1	0.0	7.1			180.1	180.7	0.0
CV25100S	CV-25100S	2/9/2026 1:05:00 PM					3740				
CV25100S	CV-25100S	2/17/2026 9:20:00 AM					5380				
CV25100S	CV-25100S	2/17/2026 9:21:39 AM	2.6	84.7	0.7	12.0			175.8	175.2	0.0
CV25100S	CV-25100S	2/23/2026 10:20:00 AM					4880				
CV25100S	CV-25100S	2/23/2026 10:23:21 AM	4.6	66.2	3.7	25.5			176.6	176.0	0.1
CV25101D	CV-25101D	2/5/2026 9:20:27 AM	5.3	64.2	5.6	24.9			67.7	65.8	0.1
CV25101D	CV-25101D	2/18/2026 2:08:51 PM	5.7	61.7	4.0	28.6			64.6	65.0	0.1
CV25101S	CV-25101S	2/5/2026 9:14:08 AM	32.0	62.3	0.0	5.7			107.3	107.2	0.5

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CV25101S	CV-25101S	2/18/2026 2:07:05 PM	15.0	60.2	0.6	24.2			95.9	96.4	0.2
CV25102_	CV-25102_	2/5/2026 10:11:05 AM	6.8	49.2	9.4	34.6			82.8	82.9	0.1
CV25102_	CV-25102_	2/24/2026 12:51:41 PM	13.4	84.3	0.3	2.0			101.2	100.1	0.2
CV25103_	CV-25103	2/5/2026 9:57:53 AM	37.8	62.0	0.0	0.2			107.2	107.3	0.6
CV25103_	CV-25103	2/18/2026 2:21:12 PM	16.2	49.7	0.9	33.2			123.8	122.4	0.3
CV25104D	CV-25104D	2/6/2026 8:57:28 AM	0.4	13.2	18.5	67.9			65.0	63.9	0.0
CV25104D	CV-25104D	2/6/2026 9:03:55 AM	0.5	15.0	18.0	66.5			63.2	61.9	0.0
CV25104D	CV-25104D	2/6/2026 9:09:08 AM	3.0	76.4	3.6	17.0			62.5	63.0	0.0
CV25104D	CV-25104D	2/24/2026 1:12:47 PM	5.0	82.0	1.0	12.0			87.3	87.3	0.1
CV25104S	CV-25104S	2/6/2026 10:06:41 AM	4.3	91.9	0.0	3.8			86.1	89.9	0.0
CV25104S	CV-25104S	2/6/2026 10:07:09 AM	4.5	92.5	0.0	3.0			89.5	89.5	0.0
CV25104S	CV-25104S	2/6/2026 2:04:30 PM	5.3	81.1	0.0	13.6			79.1	79.3	0.1
CV25104S	CV-25104S	2/24/2026 1:00:47 PM	3.4	88.3	0.1	8.2			89.9	91.3	0.0
CV25104S	CV-25104S	2/24/2026 1:03:42 PM	3.5	86.9	0.3	9.3			90.9	91.0	0.0
CV25105D	CV-25105D	2/5/2026 10:19:07 AM	20.7	57.5	2.6	19.2			86.6	86.7	0.4
CV25105D	CV-25105D	2/18/2026 2:25:00 PM	15.6	48.7	2.7	33.0			59.1	58.4	0.3
CV25105S	CV-25105S	2/5/2026 10:20:52 AM	21.9	57.0	0.3	20.8			76.2	76.0	0.4
CV25105S	CV-25105S	2/18/2026 2:27:06 PM	14.0	45.3	2.0	38.7			59.9	59.3	0.3
CV25107D	CV-25107D	2/9/2026 1:37:12 PM	8.1	82.8	0.0	9.1			92.0	89.2	0.1
CV25107S	CV-25107S	2/9/2026 1:28:09 PM	47.4	50.4	0.0	2.2			90.1	92.4	0.9
CV25107S	CV-25107S	2/9/2026 1:30:47 PM	37.5	60.5	0.0	2.0			93.9	94.4	0.6
CHCV2511	CV-2511	2/5/2026 11:38:11 AM	53.8	44.5	0.0	1.7			116.5	118.8	1.2
CHCV2511	CV-2511	2/5/2026 11:40:34 AM	53.7	44.7	0.0	1.6			119.2	119.2	1.2
CHCV2512	CV-2512	2/5/2026 11:53:40 AM	51.6	45.3	0.0	3.1			120.4	120.4	1.1
CHCV2513	CV-2513	2/5/2026 10:10:26 AM	55.4	42.9	0.0	1.7			116.9	117.0	1.3
CHCV2514	CV-2514	2/5/2026 9:50:42 AM	55.0	42.0	0.0	3.0			118.8	119.1	1.3
CHCV2515	CV-2515	2/4/2026 8:20:09 AM	55.8	38.0	0.0	6.2			113.7	114.0	1.5
CHCV2516	CV-2516	2/4/2026 8:08:18 AM	52.9	43.3	0.0	3.8			125.8	125.7	1.2
CHCV2517	CV-2517	2/25/2026 1:13:03 PM	56.2	40.9	0.1	2.8			112.1	113.0	1.4

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHCV2517	CV-2517	2/25/2026 1:33:09 PM	55.2	41.8	0.0	3.0			115.3	115.5	1.3
CHCV2518	CV-2518	2/25/2026 9:20:58 AM	55.5	43.7	0.0	0.8			109.1	109.5	1.3
CHCV2519	CV-2519	2/9/2026 10:29:13 AM	50.0	46.1	0.0	3.9			129.2	129.1	1.1
CHCV2520	CV-2520	2/9/2026 2:31:53 PM	33.1	53.2	0.0	13.7			132.0	131.9	0.6
CHCV2520	CV-2520	2/9/2026 2:34:04 PM	33.1	53.6	0.0	13.3			132.5	132.4	0.6
CHCV2521	CV-2521	2/9/2026 12:42:33 PM	25.1	54.5	0.0	20.4			99.0	99.1	0.5
CHCV2521	CV-2521	2/9/2026 12:42:51 PM	25.1	54.0	0.0	20.9			99.2	99.2	0.5
CHCV2521	CV-2521	2/23/2026 1:19:16 PM	35.0	50.7	0.0	14.3			133.5	126.9	0.7
CHCV2521	CV-2521	2/23/2026 1:22:26 PM	35.3	50.6	0.0	14.1			124.4	123.1	0.7
CHCV2521	CV-2521	2/23/2026 1:24:30 PM	34.0	50.8	0.0	15.2			120.1	119.9	0.7
CHCV2522	CV-2522	2/9/2026 2:20:58 PM	39.7	47.5	0.1	12.7			127.0	126.8	0.8
CHCV2523	CV-2523	2/6/2026 1:22:16 PM	60.1	39.3	0.0	0.6			94.2	119.7	1.5
CHCV2523	CV-2523	2/6/2026 1:23:55 PM	60.0	39.0	0.0	1.0			120.3	120.5	1.5
CHCV2524	CV-2524	2/9/2026 12:40:47 PM	35.7	46.8	0.0	17.5			131.1	131.1	0.8
CHCV2524	CV-2524	2/9/2026 12:42:36 PM	34.6	49.4	0.0	16.0			130.8	130.9	0.7
CHCV2525	CV-2525	2/6/2026 1:33:49 PM	59.4	39.8	0.0	0.8			89.3	116.4	1.5
CHCV2525	CV-2525	2/6/2026 1:34:15 PM	59.1	40.7	0.0	0.2			117.2	117.3	1.5
CHCV2526	CV-2526	2/6/2026 1:52:29 PM	58.4	40.5	0.0	1.1			84.4	113.1	1.4
CHCV2526	CV-2526	2/6/2026 1:53:06 PM	58.2	41.0	0.0	0.8			114.2	114.7	1.4
CHCV2527	CV-2527	2/9/2026 12:34:46 PM	14.5	45.6	1.4	38.5			91.8	95.2	0.3
CHCV2527	CV-2527	2/9/2026 12:36:51 PM	13.8	47.9	0.0	38.3			96.4	96.5	0.3
CHCV2528	CV-2528	2/5/2026 8:26:42 AM	56.2	39.6	0.0	4.2			107.7	107.7	1.4
CHCV2529	CV-2529	2/5/2026 2:16:44 PM	18.9	14.9	13.7	52.5			89.2	89.1	1.3
CHCV2529	CV-2529	2/5/2026 2:17:55 PM	17.5	13.6	14.1	54.8			89.1	89.2	1.3
CHCV2530	CV-2530	2/5/2026 2:33:43 PM	42.6	48.7	0.0	8.7			135.8	133.7	0.9
CHCV2530	CV-2530	2/5/2026 2:35:14 PM	42.0	49.9	0.0	8.1			133.8	133.8	0.8
CHCV2531	CV-2531	2/5/2026 2:47:57 PM	49.1	43.5	0.0	7.4			90.0	90.1	1.1
CHCV2532	CV-2532	2/5/2026 2:52:46 PM	51.3	43.3	0.0	5.4			98.9	99.3	1.2
CHCV2533	CV-2533	2/5/2026 3:06:46 PM	51.9	41.6	0.0	6.5			129.7	130.1	1.2

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHCV2533	CV-2533	2/5/2026 3:10:56 PM	52.4	43.0	0.0	4.6			129.9	129.9	1.2
CHCV2534	CV-2534	2/10/2026 12:56:09 PM	52.4	43.3	0.0	4.4			74.6	75.0	1.2
CHCV2534	CV-2534	2/10/2026 12:58:51 PM	52.2	43.0	0.0	4.8			75.4	76.2	1.2
CHCV2534	CV-2534	2/10/2026 1:01:30 PM	51.6	43.7	0.0	4.7			76.4	76.6	1.2
CHCV2535	CV-2535	2/4/2026 9:16:55 AM	52.7	40.8	0.8	5.7			104.9	105.9	1.3
CHCV2536	CV-2536	2/5/2026 3:29:26 PM	50.5	48.6	0.0	0.9			87.0	87.0	1.0
CHCV2537	CV-2537	2/4/2026 9:45:41 AM	53.6	42.2	0.1	4.1			110.3	112.1	1.3
CHCV2538	CV-2538	2/4/2026 9:34:07 AM	54.6	42.4	0.0	3.0			104.5	106.4	1.3
CHCV2539	CV-2539	2/2/2026 10:03:12 AM	45.9	50.1	0.0	4.0			117.7	113.0	0.9
CHCV2539	CV-2539	2/17/2026 9:56:47 AM	43.0	52.0	0.0	5.0			94.2	94.6	0.8
CHCV2540	CV-2540	2/13/2026 9:12:16 AM	4.0	91.8	0.0	4.2			105.8	93.6	0.0
CHCV2540	CV-2540	2/25/2026 11:26:43 AM	2.7	80.3	0.0	17.0			101.7	102.5	0.0
CHCV2541	CV-2541	2/10/2026 8:14:43 AM	1.9	74.6	0.0	23.5			59.3	59.3	0.0
CHCV2541	CV-2541	2/10/2026 8:22:24 AM	2.1	75.3	0.0	22.6			59.5	59.6	0.0
CHCV2541	CV-2541	2/22/2026 12:26:12 PM	2.2	73.2	0.0	24.5			73.6	73.4	0.0
CHCV2542	CV-2542	2/3/2026 10:08:19 AM	48.4	51.6	0.0	0.0			80.0	80.0	0.9
CHCV2542	CV-2542	2/21/2026 10:12:07 AM	49.7	44.1	0.0	6.2			101.3	101.0	1.1
CHCV2543	CV-2543-PLR	2/13/2026 9:05:44 AM	34.3	54.2	0.9	10.6			94.1	94.1	0.6
CHCV2543	CV-2543-PLR	2/23/2026 12:51:09 PM	32.0	57.6	0.0	10.4			101.5	101.8	0.6
CHCV2544	CV-2544	2/3/2026 9:22:11 AM	17.8	72.9	0.3	9.0			121.3	122.5	0.2
CHCV2544	CV-2544	2/3/2026 1:04:15 PM	15.5	74.5	0.1	9.9			138.1	138.1	0.2
CHCV2544	CV-2544	2/17/2026 12:30:14 PM	15.4	79.8	0.0	4.8			133.4	130.5	0.2
CHCV2544	CV-2544	2/17/2026 12:31:54 PM	14.1	80.8	0.0	5.1			130.0	130.1	0.2
CHCV2544	CV-2544	2/23/2026 9:40:19 AM	16.0	75.0	0.0	9.0			133.4	134.5	0.2
CHCV2544	CV-2544	2/23/2026 9:42:08 AM	16.2	76.0	0.0	7.8			135.0	135.1	0.2
CHCV2545	CV-2545	2/3/2026 1:30:38 PM	29.4	61.1	0.1	9.4			126.0	126.1	0.5
CHCV2545	CV-2545	2/19/2026 8:31:10 AM	40.7	52.8	0.0	6.5			97.3	97.7	0.8
CHCV2546	CV-2546	2/3/2026 8:03:07 AM	35.9	59.7	0.0	4.4			121.1	120.6	0.6
CHCV2546	CV-2546	2/13/2026 9:30:25 AM	41.8	57.4	0.0	0.8			106.1	106.2	0.7

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHCV2546	CV-2546	2/17/2026 12:41:02 PM	26.6	71.3	0.0	2.1			114.8	113.5	0.4
CHCV2547	CV-2547	2/12/2026 1:14:27 PM	53.6	41.8	0.0	4.5			76.5	76.1	1.3
CHCV2547	CV-2547	2/12/2026 1:15:12 PM	54.6	41.4	0.0	4.0			76.1	76.1	1.3
CHCV2548	CV-2548	2/9/2026 9:36:26 AM	6.3	87.8	0.0	5.9			67.1	67.6	0.1
CHCV2548	CV-2548	2/9/2026 9:36:55 AM	5.4	90.4	0.0	4.2			67.9	68.1	0.1
CHCV2548	CV-2548	2/12/2026 2:54:02 PM	10.4	75.9	0.0	13.6			99.9	100.3	0.1
CHCV2548	CV-2548	2/12/2026 2:54:50 PM	10.4	74.0	0.0	15.6			99.9	99.8	0.1
CHCV2548	CV-2548	2/23/2026 8:20:51 AM	7.6	82.7	0.0	9.7			93.4	95.1	0.1
CHCV2549	CV-2549	2/9/2026 9:32:36 AM	34.6	64.3	0.0	1.1			85.8	86.4	0.5
CHCV2549	CV-2549	2/23/2026 8:14:23 AM	42.7	55.3	0.0	2.0			78.8	80.8	0.8
CHCV2550	CV-2550	2/26/2026 10:04:15 AM	7.7	85.4	0.0	6.9			156.3	157.6	0.1
CHCV2550	CV-2550	2/26/2026 10:07:52 AM	6.5	90.8	0.0	2.7			155.8	156.0	0.1
CHCV2550	CV-2550	2/26/2026 10:10:00 AM					2350				
CHCV2551	CV-2551	2/9/2026 1:47:25 PM	1.6	88.4	0.0	10.0			91.9	94.1	0.0
CHCV2551	CV-2551	2/9/2026 1:49:02 PM	1.6	87.9	0.0	10.5			94.7	97.0	0.0
CHCV2552	CV-2552	2/4/2026 1:47:30 PM	34.4	64.1	0.0	1.5			151.5	152.4	0.5
CHCV2552	CV-2552	2/4/2026 1:50:00 PM					982				
CHCV2552	CV-2552	2/4/2026 1:50:00 PM						39000			
CHCV2552	CV-2552	2/4/2026 1:50:55 PM	36.1	63.9	0.0	0.0			151.8	152.3	0.6
CHCV2552	CV-2552	2/13/2026 1:56:37 PM	20.6	70.9	0.0	8.5			89.2	92.3	0.3
CHCV2552	CV-2552	2/13/2026 1:57:06 PM	20.3	71.9	0.0	7.8			94.6	94.7	0.3
CHCV2552	CV-2552	2/20/2026 1:03:12 PM	22.2	68.4	0.0	9.4			76.2	76.8	0.3
CHCV2552	CV-2552	2/20/2026 1:04:42 PM	21.4	69.9	0.0	8.7			83.3	83.3	0.3
CHCV2553	CV-2553	2/3/2026 9:07:48 AM	46.8	51.7	0.0	1.5			104.0	104.1	0.9
CHCV2553	CV-2553	2/25/2026 3:08:34 PM	45.8	53.9	0.1	0.2			95.5	95.5	0.8
CHCV2554	CV-2554	2/3/2026 8:51:19 AM	45.2	54.8	0.0	0.0			139.8	137.9	0.8
CHCV2554	CV-2554	2/3/2026 8:51:58 AM	45.2	54.8	0.0	0.0			137.2	138.4	0.8
CHCV2554	CV-2554	2/25/2026 2:36:30 PM	29.8	67.4	0.0	2.8			164.1	162.3	0.4
CHCV2554	CV-2554	2/25/2026 2:38:32 PM	28.0	70.7	0.0	1.3			162.3	162.0	0.4

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHCV2554	CV-2554	2/26/2026 9:47:44 AM	36.0	64.0	0.0	0.0			143.3	134.1	0.6
CHCV2555	CV-2555	2/6/2026 10:33:42 AM	10.6	13.7	15.6	60.1			74.2	74.3	0.8
CHCV2555	CV-2555	2/6/2026 10:34:10 AM	10.9	14.1	15.4	59.6			74.3	74.1	0.8
CHCV2555	CV-2555	2/6/2026 10:35:51 AM	12.9	17.3	14.3	55.5			74.6	74.8	0.7
CHCV2555	CV-2555	2/9/2026 12:51:31 PM	28.6	46.2	4.2	21.0			91.1	91.8	0.6
CHCV2555	CV-2555	2/25/2026 3:14:12 PM	31.4	53.7	3.0	11.9			97.1	97.0	0.6
CHCV2556	CV-2556	2/3/2026 7:58:25 AM	6.2	84.9	0.0	8.9			169.7	169.6	0.1
CHCV2556	CV-2556	2/3/2026 8:00:00 AM						119800			
CHCV2556	CV-2556	2/3/2026 8:00:00 AM					2302				
CHCV2556	CV-2556	2/11/2026 8:05:00 AM						118650			
CHCV2556	CV-2556	2/11/2026 8:05:00 AM					3005				
CHCV2556	CV-2556	2/11/2026 8:06:46 AM	1.4	86.8	0.1	11.7			171.2	171.4	0.0
CHCV2556	CV-2556	2/18/2026 8:40:00 AM					3410				
CHCV2556	CV-2556	2/18/2026 8:40:07 AM	1.9	95.8	0.0	2.3			169.4	169.4	0.0
CHCV2556	CV-2556	2/25/2026 8:44:22 AM	3.3	84.1	0.0	12.6			171.0	172.4	0.0
CHCV2556	CV-2556	2/25/2026 8:50:00 AM					2620				
CHCV2557	CV-2557	2/5/2026 9:50:37 AM	1.4	88.4	0.0	10.2			119.6	122.0	0.0
CHCV2557	CV-2557	2/18/2026 2:31:16 PM	0.4	19.6	12.7	67.3			68.9	69.1	0.0
CHCV2558	CV-2558	2/3/2026 7:35:00 AM						100200			
CHCV2558	CV-2558	2/3/2026 7:35:00 AM					3125				
CHCV2558	CV-2558	2/3/2026 7:37:52 AM	7.7	89.7	0.0	2.6			176.3	76.4	0.1
CHCV2558	CV-2558	2/3/2026 7:40:27 AM	8.4	89.9	0.0	1.7			175.1	175.3	0.1
CHCV2558	CV-2558	2/11/2026 8:25:00 AM						96300			
CHCV2558	CV-2558	2/11/2026 8:25:00 AM					3000				
CHCV2558	CV-2558	2/11/2026 8:30:03 AM	1.8	78.0	2.9	17.3			186.0	186.0	0.0
CHCV2558	CV-2558	2/11/2026 8:31:04 AM	2.0	81.6	1.3	15.1			186.0	186.0	0.0
CHCV2558	CV-2558	2/18/2026 7:45:00 AM					2580				
CHCV2558	CV-2558	2/18/2026 7:46:34 AM	2.4	85.3	1.2	11.1			186.0	186.0	0.0
CHCV2558	CV-2558	2/24/2026 1:20:00 PM					2910				

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHCV2558	CV-2558	2/24/2026 1:22:09 PM	2.2	65.6	4.7	27.5			180.1	180.0	0.0
CHCV2560	CV-2560	2/5/2026 9:07:57 AM	33.8	55.5	0.1	10.6			110.9	111.1	0.6
CHCV2560	CV-2560	2/18/2026 2:04:13 PM	15.0	42.3	0.6	42.1			122.6	122.3	0.4
CHCV2561	CV-2561	2/10/2026 12:28:32 PM	24.2	45.3	0.0	30.5			113.9	111.6	0.5
CHCV2563	CV-2563	2/4/2026 7:44:50 AM	52.2	43.9	0.0	3.9			121.4	121.4	1.2
CHCV2563	CV-2563	2/21/2026 9:53:34 AM	42.2	44.4	1.0	12.4			117.5	117.6	1.0
CHCV2564	CV-2564	2/22/2026 12:12:45 PM	24.4	65.0	0.0	10.6			73.8	73.7	0.4
CHCV2564	CV-2564	2/26/2026 1:34:16 PM	23.4	74.8	0.2	1.6			88.6	88.6	0.3
CHCV2565	CV-2565	2/2/2026 10:08:30 AM	46.9	48.1	0.0	5.0			111.7	111.1	1.0
CHCV2565	CV-2565	2/17/2026 9:59:54 AM	47.5	49.8	0.1	2.6			95.3	95.7	1.0
CHCV2565	CV-2565	2/23/2026 2:18:22 PM	50.8	49.2	0.0	0.0			103.9	103.8	1.0
CHCV2566	CV-2566	2/2/2026 10:33:28 AM	46.6	49.2	0.0	4.2			88.8	88.7	0.9
CHCV2566	CV-2566	2/19/2026 10:35:56 AM	49.5	50.5	0.0	0.0			49.3	49.3	1.0
CHCV2566	CV-2566	2/19/2026 10:37:45 AM	46.6	46.3	0.0	7.1			50.3	50.4	1.0
CHCV2567	CV-2567	2/2/2026 2:08:53 PM	49.4	47.0	0.0	3.6			93.8	93.9	1.1
CHCV2567	CV-2567	2/4/2026 10:11:41 AM	50.0	48.6	0.0	1.4			94.4	94.8	1.0
CHCV2567	CV-2567	2/23/2026 10:44:40 AM	49.9	49.6	0.0	0.5			86.1	86.3	1.0
CHCV2567	CV-2567	2/23/2026 10:46:38 AM	49.8	49.4	0.0	0.8			86.5	86.5	1.0
CHCV2568	CV-2568	2/2/2026 2:41:19 PM	47.1	49.2	0.0	3.7			102.7	102.8	1.0
CHCV2568	CV-2568	2/17/2026 9:08:43 AM	47.7	48.0	0.0	4.3			66.3	67.5	1.0
CHCV2569	CV-2569	2/2/2026 3:32:20 PM	47.8	49.5	0.0	2.7			101.7	101.7	1.0
CHCV2569	CV-2569	2/17/2026 9:22:50 AM	47.9	47.3	0.0	4.8			68.0	68.3	1.0
CHCV2570	CV-2570	2/2/2026 3:29:34 PM	51.2	46.6	0.0	2.2			105.9	106.0	1.1
CHCV2570	CV-2570	2/17/2026 9:28:38 AM	51.2	44.7	0.0	4.1			77.0	77.2	1.1
CHCV2572	CV-2572	2/5/2026 9:36:17 AM	56.6	42.0	0.0	1.4			118.6	119.6	1.3
CHCV2572	CV-2572	2/5/2026 9:38:59 AM	56.2	42.8	0.0	1.0			119.8	119.8	1.3
CHWCV48R	CV-48R	2/4/2026 7:47:58 AM	53.6	42.6	0.0	3.8			119.7	120.0	1.3
CHWCV48R	CV-48R	2/21/2026 9:58:04 AM	49.3	39.6	1.1	10.0			116.9	117.0	1.2
CHWCV52D	CV-52D	2/9/2026 2:25:31 PM	37.8	50.7	0.0	11.5			89.2	91.1	0.7

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHWCV52D	CV-52D	2/9/2026 2:28:00 PM	33.7	51.4	0.0	14.9			94.3	94.5	0.7
CHWCV55R	CV-55R	2/4/2026 10:45:00 AM					261.5				
CHWCV55R	CV-55R	2/4/2026 10:45:00 AM						140850			
CHWCV55R	CV-55R	2/4/2026 10:46:17 AM	26.5	51.7	0.0	21.8			151.1	151.1	0.5
CHWCV55R	CV-55R	2/4/2026 10:48:06 AM	35.8	50.5	0.0	13.7			151.2	151.0	0.7
CHWCV55R	CV-55R	2/11/2026 1:25:00 PM						136700			
CHWCV55R	CV-55R	2/11/2026 1:25:00 PM					710				
CHWCV55R	CV-55R	2/11/2026 1:26:01 PM	26.2	58.2	0.3	15.3			152.4	150.9	0.5
CHWCV55R	CV-55R	2/18/2026 1:07:46 PM	30.8	50.6	0.5	18.1			145.3	145.6	0.6
CHWCV55R	CV-55R	2/18/2026 1:10:00 PM					489				
CHWCV55R	CV-55R	2/25/2026 2:12:48 PM	39.2	49.3	0.0	11.5			147.5	147.8	0.8
CHWCV55R	CV-55R	2/25/2026 2:15:00 PM					240.5				
CHWCV56D	CV-56D	2/5/2026 9:38:23 AM	49.2	45.2	0.0	5.6			116.0	116.1	1.1
CHWCV56S	CV-56S	2/5/2026 9:36:36 AM	51.7	45.7	0.0	2.6			114.5	115.0	1.1
CHWCV57R	CV-57R	2/9/2026 9:00:00 AM	52.4	46.5	0.0	1.1			96.3	96.3	1.1
CHWCV79R	CV-79R	2/9/2026 8:41:30 AM	51.9	45.2	0.0	2.9			93.3	112.2	1.1
CHWCV79R	CV-79R	2/9/2026 8:42:49 AM	51.4	46.8	0.0	1.8			113.6	115.7	1.1
CHIWCV94	CV-94	2/6/2026 2:42:18 PM	53.6	44.7	0.0	1.7			102.9	104.8	1.2
CHIWCV94	CV-94	2/9/2026 10:03:47 AM	52.1	43.9	0.0	4.0			106.8	107.3	1.2
CHIWCV95	CV-95	2/9/2026 8:57:22 AM	53.8	45.0	0.0	1.2			106.5	107.4	1.2
CHIWCV99	CV-99	2/2/2026 7:55:00 AM						1900			
CHIWCV99	CV-99	2/2/2026 7:55:00 AM					0				
CHIWCV99	CV-99	2/13/2026 3:24:02 PM	25.7	71.1	0.0	3.2			80.1	79.5	0.4
CHIWD002	D-02	2/21/2026 11:23:15 AM	56.3	39.9	0.0	3.8			66.6	66.9	1.4
CHIWD003	D-03	2/21/2026 11:27:29 AM	53.8	40.3	1.1	4.8			69.5	69.3	1.3
CHIWD004	D-04	2/21/2026 11:30:52 AM	56.4	39.9	0.0	3.7			63.6	63.5	1.4
CHIWD009	D-09	2/5/2026 9:10:07 AM	58.6	40.3	0.0	1.1			109.8	110.1	1.5
CHIWD010	D-10	2/5/2026 3:18:40 PM	58.0	41.1	0.0	0.9			98.8	101.3	1.4
CHIWD010	D-10	2/5/2026 3:20:38 PM	57.2	42.1	0.0	0.7			102.5	102.6	1.4

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHIFP001	FP-001	2/10/2026 2:43:19 PM	7.1	16.0	12.0	64.9			63.8	63.6	0.4
CHIFP001	FP-001	2/10/2026 2:47:32 PM	4.8	13.0	8.8	73.4			63.6	63.6	0.4
CHIFP002	FP-002	2/10/2026 2:53:16 PM	14.5	20.7	9.4	55.4			69.9	69.3	0.7
CHIFP002	FP-002	2/10/2026 2:56:14 PM	14.9	21.9	7.5	55.7			68.8	68.9	0.7
CHIFP003	FP-003	2/10/2026 3:11:21 PM	28.1	42.5	4.8	24.6			70.1	70.1	0.7
CHIFP005	FP-005	2/25/2026 1:48:40 PM	20.4	59.2	0.5	19.9			88.2	87.9	0.3
CHIFP006	FP-006	2/25/2026 1:54:15 PM	1.5	51.7	8.1	38.7			100.7	104.0	0.0
CHIFP008	FP-008	2/12/2026 9:06:40 AM	3.3	17.1	17.3	62.3			63.3	63.2	0.2
CHIFP009	FP-009	2/24/2026 2:22:34 PM	15.3	75.6	0.0	9.1			86.7	86.8	0.2
CHIFP010	FP-010	2/27/2026 8:34:50 AM	18.2	79.5	0.0	2.3			102.1	102.0	0.2
CHIFP012	FP-012	2/21/2026 8:24:03 AM	0.5	10.2	19.3	70.0			61.1	61.1	0.0
CHIFP013	FP-013	2/21/2026 8:58:54 AM	2.4	21.3	16.3	60.0			55.2	53.5	0.1
CHIFP014	FP-014	2/2/2026 1:48:49 PM	0.5	2.0	21.0	76.5			85.5	87.4	0.2
CHIFP014	FP-014	2/2/2026 1:51:53 PM	12.6	62.5	3.1	21.8			85.8	85.7	0.2
CHIFP014	FP-014	2/2/2026 2:10:45 PM	13.6	59.6	3.6	23.2			84.2	84.3	0.2
CHIFP014	FP-014	2/2/2026 2:12:20 PM	12.2	60.8	3.4	23.6			82.9	83.0	0.2
CHIFP015	FP-015	2/25/2026 1:57:28 PM	3.9	36.6	10.9	48.6			95.8	97.0	0.1
CHIFP016	FP-016	2/2/2026 1:56:48 PM	0.7	10.7	19.8	68.8			86.7	86.9	0.1
CHIFP016	FP-016	2/2/2026 1:58:35 PM	21.5	41.9	6.5	30.2			82.2	81.9	0.5
CHIFP016	FP-016	2/12/2026 9:11:36 AM	12.9	30.6	10.9	45.6			58.5	58.5	0.4
CHIFP017	FP-017	2/12/2026 10:21:15 AM	55.6	42.2	0.0	2.2			64.8	65.7	1.3
CHIFP018	FP-018	2/27/2026 1:35:49 PM	41.8	58.2	0.0	0.0			95.8	96.0	0.7
CHIFP019	FP-019	2/4/2026 2:40:36 PM	2.2	81.8	0.0	16.0			97.3	97.1	0.0
CHIFP020	FP-020	2/27/2026 7:48:44 AM	9.6	30.3	11.6	48.5			70.8	70.8	0.3
CHIFP021	FP-021	2/27/2026 7:56:01 AM	0.0	1.1	21.2	77.7			75.8	75.8	0.0
CHIFP022	FP-022	2/27/2026 7:51:46 AM	3.1	13.0	16.5	67.4			75.9	76.0	0.2
CHIFP023	FP-023	2/27/2026 8:10:59 AM	12.0	37.4	9.6	41.0			71.1	71.1	0.3
CHIFP024	FP-024	2/12/2026 8:51:36 AM	13.2	42.3	9.3	35.2			50.4	50.6	0.3
CHIFP026	FP-026	2/12/2026 10:33:54 AM	16.3	66.2	1.6	15.9			90.1	90.8	0.2

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHIFP027	FP-027	2/12/2026 10:27:46 AM	30.5	55.7	1.2	12.6			80.8	80.8	0.5
CHIFP028	FP-028	2/12/2026 10:25:16 AM	25.1	35.0	5.9	34.0			73.7	73.7	0.7
CHIFP029	FP-029	2/12/2026 10:16:35 AM	49.2	35.0	4.2	11.6			71.4	80.6	1.4
CHIFP030	FP-030	2/12/2026 10:06:25 AM	42.7	57.3	0.0	0.0			69.6	69.5	0.7
CHIFP031	FP-031	2/26/2026 10:32:14 AM	38.5	39.0	3.8	18.7			85.4	85.4	1.0
CHIFP032	FP-032	2/27/2026 8:01:09 AM	9.3	28.6	12.7	49.4			70.6	70.5	0.3
CHIFP033	FP-033	2/27/2026 8:06:58 AM	1.9	22.5	13.8	61.8			75.6	75.6	0.1
CHIFP034	FP-034	2/27/2026 8:18:33 AM	2.0	13.2	13.8	71.0			79.1	79.1	0.2
CHIFP035	FP-035	2/21/2026 8:40:48 AM	1.5	79.3	1.5	17.7			57.5	55.0	0.0
CHIFP036	FP-036	2/26/2026 4:17:53 PM	19.3	39.2	2.0	39.5			73.8	73.8	0.5
CHIFP036	FP-036	2/27/2026 8:24:50 AM	16.9	45.9	1.1	36.1			69.4	69.1	0.4
CHIFP037	FP-037	2/27/2026 8:28:03 AM	6.9	20.1	12.6	60.4			72.9	72.9	0.3
CHIFP038	FP-038	2/3/2026 8:25:42 AM	40.1	40.9	2.2	16.8			58.9	57.5	1.0
CHIFP038	FP-038	2/6/2026 8:19:14 AM	13.1	75.5	0.7	10.7			63.4	63.4	0.2
CHIFP039	FP-039	2/3/2026 8:29:01 AM	52.3	42.8	0.2	4.7			62.6	61.5	1.2
CHIFP040	FP-040	2/6/2026 8:07:53 AM	13.9	79.1	0.0	7.0			83.2	83.2	0.2
CHIFP041	FP-041	2/6/2026 8:35:54 AM	29.1	35.8	4.7	30.4			57.8	57.7	0.8
CHIFP042	FP-042	2/6/2026 7:43:10 AM	4.6	21.4	16.1	57.9			53.4	53.4	0.2
CHIFP043	FP-043	2/6/2026 8:28:53 AM	22.0	50.6	2.5	24.9			62.8	62.9	0.4
CHIFP044	FP-044	2/6/2026 8:25:03 AM	9.1	62.1	3.2	25.6			61.6	61.6	0.1
CHIFP046	FP-046	2/12/2026 9:16:11 AM	13.2	25.0	9.8	52.0			65.0	65.4	0.5
CHIFP047	FP-047	2/12/2026 9:27:50 AM	6.4	13.5	17.0	63.1			59.7	59.4	0.5
CHIFP050	FP-050	2/3/2026 1:47:08 PM	20.1	68.3	1.1	10.5			81.1	81.1	0.3
CHIFP050	FP-050	2/23/2026 9:03:43 AM	25.6	46.5	4.2	23.7			67.2	66.4	0.6
CHIFP051	FP-051	2/3/2026 1:39:44 PM	4.4	5.7	18.6	71.3			91.3	91.7	0.8
CHIFP052	FP-052	2/3/2026 10:25:02 AM	31.9	33.6	4.2	30.3			73.5	73.5	0.9
CHIFP053	FP-053	2/19/2026 7:39:35 AM	27.6	27.6	6.7	38.1			50.1	49.9	1.0
CHIFP053	FP-053	2/19/2026 7:45:07 AM	35.3	33.6	3.5	27.6			46.6	46.6	1.1
CHIFP054	FP-054	2/9/2026 1:41:15 PM	51.3	38.1	0.0	10.6			78.7	78.6	1.3

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHIFP055	FP-055	2/3/2026 9:44:42 AM	38.7	37.3	2.6	21.4			71.9	72.0	1.0
CHIFP056	FP-056	2/3/2026 9:32:35 AM	30.6	35.4	4.5	29.5			64.9	65.7	0.9
CHIFP057	FP-057	2/4/2026 2:52:02 PM	50.7	46.3	0.0	3.0			81.4	80.2	1.1
CHIWH001	H-01 (EXP-01)	2/9/2026 2:05:43 PM	9.5	44.3	0.0	46.3			88.8	93.2	0.2
CHIWH001	H-01 (EXP-01)	2/9/2026 2:06:57 PM	8.8	44.2	0.8	46.2			92.7	92.7	0.2
CHIWH001	H-01 (EXP-01)	2/15/2026 3:01:42 PM	4.9	20.6	11.4	63.1			70.2	71.2	0.2
CHIWH001	H-01 (EXP-01)	2/15/2026 3:04:00 PM	4.9	23.3	11.1	60.7			71.4	71.3	0.2
CHIWH001	H-01 (EXP-01)	2/15/2026 3:18:30 PM	10.1	42.0	2.0	45.9			71.5	69.9	0.2
CHIWH001	H-01 (EXP-01)	2/15/2026 3:21:21 PM	10.8	43.8	0.5	44.9			73.0	72.7	0.2
CHIWH001	H-01 (EXP-01)	2/15/2026 3:22:06 PM	10.8	44.8	1.0	43.4			71.6	71.6	0.2
CHIWH001	H-01 (EXP-01)	2/23/2026 7:49:56 AM	17.3	39.0	2.9	40.8			51.1	50.9	0.4
CHIWH002	H-02 (EXP-02)	2/9/2026 1:57:17 PM	17.3	44.4	0.0	38.3			103.5	103.6	0.4
CHIWH002	H-02 (EXP-02)	2/15/2026 3:25:48 PM	16.6	45.4	0.0	38.0			90.1	90.2	0.4
CHIWH003	H-03 (EXP-03)	2/9/2026 1:53:46 PM	49.4	45.6	0.0	5.0			118.4	118.4	1.1
CHIWH003	H-03 (EXP-03)	2/15/2026 2:56:20 PM	52.9	42.8	0.0	4.3			116.4	116.5	1.2
CHIWH004	H-04 (EXP-04)	2/9/2026 1:50:49 PM	2.2	48.2	0.0	49.6			127.1	127.1	0.0
CHIWH004	H-04 (EXP-04)	2/15/2026 2:50:33 PM	2.2	49.5	0.0	48.3			122.6	122.7	0.0
CHIWH008	H-08 (EXP-08)	2/9/2026 1:37:31 PM	51.2	44.4	0.0	4.3			117.4	117.5	1.2
CHIWH008	H-08 (EXP-08)	2/9/2026 1:38:39 PM	50.5	44.3	0.0	5.2			117.5	117.5	1.1
CHIWH008	H-08 (EXP-08)	2/15/2026 2:42:33 PM	51.6	45.0	0.0	3.5			116.2	116.2	1.1
CHIWH010	H-10 (EXP-10)	2/9/2026 1:31:05 PM	13.5	62.7	0.0	23.8			129.9	129.9	0.2
CHIWH010	H-10 (EXP-10)	2/15/2026 2:03:16 PM	13.6	63.5	0.0	22.9			129.9	129.9	0.2
CHIWH010	H-10 (EXP-10)	2/15/2026 2:03:56 PM	13.2	63.9	0.0	22.9			129.8	129.8	0.2
CHIH101W	H-101W	2/4/2026 12:43:39 PM	57.1	39.5	0.0	3.4			88.8	90.5	1.4
CHIH101W	H-101W	2/4/2026 12:54:46 PM	47.7	32.6	3.5	16.2			91.4	90.8	1.5
CHWH102A	H-102A	2/4/2026 12:59:55 PM	57.5	33.7	0.0	8.8			85.1	85.7	1.7
CHH1401W	H-1401W	2/4/2026 1:03:07 PM	57.3	33.1	0.0	9.6			87.1	85.1	1.7
CHH1401W	H-1401W	2/4/2026 1:07:33 PM	58.3	34.3	0.0	7.4			84.3	84.0	1.7
CHH1404C	H-1404C	2/2/2026 2:32:18 PM	48.2	45.6	0.1	6.1			110.8	110.8	1.1

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHH1404C	H-1404C	2/19/2026 9:12:21 AM	46.2	40.3	0.0	13.5			92.4	92.4	1.1
CHH1405C	H-1405C	2/6/2026 9:42:19 AM	37.4	50.1	2.3	10.2			79.4	79.8	0.7
CHH1405C	H-1405C	2/21/2026 9:10:53 AM	25.8	50.3	4.0	19.9			60.4	60.4	0.5
CHH1406W	H-1406W	2/5/2026 1:34:47 PM	42.0	54.4	0.0	3.6			85.6	87.3	0.8
CHH1406W	H-1406W	2/21/2026 11:15:57 AM	37.1	53.3	1.6	8.0			61.7	62.2	0.7
CH1408CR	H-1408CR	2/3/2026 2:46:10 PM	32.6	42.2	0.4	24.8			112.3	112.3	0.8
CHH1408E	H-1408E	2/13/2026 7:57:18 AM	48.8	43.3	0.0	7.9			83.8	83.8	1.1
CHH1408E	H-1408E	2/18/2026 10:27:51 AM	28.0	32.1	2.0	37.9			78.4	78.2	0.9
CHH1408E	H-1408E	2/23/2026 12:10:36 PM	35.0	35.3	0.5	29.2			85.3	85.4	1.0
CHH1408W	H-1408W	2/4/2026 1:48:14 PM	53.1	39.3	0.0	7.6			100.2	101.5	1.4
CHH1409N	H-1409N	2/2/2026 1:14:48 PM	55.0	41.5	0.0	3.5			101.0	98.1	1.3
CHH1409N	H-1409N	2/2/2026 1:58:38 PM	50.8	46.2	0.0	3.0			97.0	94.3	1.1
CHH1409N	H-1409N	2/18/2026 9:03:20 AM	54.7	42.4	0.0	2.9			82.3	82.4	1.3
CHH1410S	H-1410S	2/4/2026 9:27:59 AM	53.0	43.2	0.1	3.7			80.9	80.9	1.2
CHH1563N	H-1563N	2/3/2026 8:21:01 AM	51.2	48.8	0.0	0.0			113.4	113.7	1.0
CHH1563N	H-1563N	2/21/2026 8:21:39 AM	48.4	45.1	0.0	6.5			97.5	97.9	1.1
CHH1563S	H-1563S	2/6/2026 9:38:29 AM	49.8	50.2	0.0	0.0			80.1	80.2	1.0
CHH1563S	H-1563S	2/21/2026 9:05:29 AM	38.6	42.5	0.0	18.9			68.0	68.1	0.9
CHH1565E	H-1565E	2/2/2026 1:50:35 PM	35.0	38.8	0.0	26.2			97.7	97.8	0.9
CHH1565E	H-1565E	2/18/2026 10:19:16 AM	35.1	40.5	0.0	24.4			94.8	95.1	0.9
CHH1568N	H-1568N	2/2/2026 1:54:47 PM	50.5	46.9	0.0	2.6			93.1	93.9	1.1
CHH1568N	H-1568N	2/18/2026 10:23:53 AM	50.0	43.3	0.0	6.7			81.6	81.8	1.2
CHH1571S	H-1571S	2/2/2026 11:37:37 AM	55.2	43.9	0.0	0.9			94.8	94.9	1.3
CHH1572N	H-1572N	2/9/2026 8:17:43 AM	36.0	44.2	0.3	19.5			120.1	120.5	0.8
CHH1572S	H-1572S	2/2/2026 11:27:52 AM	55.9	43.6	0.0	0.5			108.3	108.5	1.3
CHH1574N	H-1574N	2/5/2026 2:10:29 PM	42.0	53.9	0.0	4.1			96.9	97.3	0.8
CHH1574N	H-1574N	2/21/2026 10:52:13 AM	44.5	54.4	0.0	1.1			89.7	89.7	0.8
CHH1753S	H-1753S	2/3/2026 8:32:49 AM	54.8	42.3	0.0	2.9			99.9	99.9	1.3
CHH1753S	H-1753S	2/21/2026 8:16:24 AM	51.1	41.2	0.0	7.7			101.1	101.5	1.2

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHH1756S	H-1756S	2/6/2026 10:03:24 AM	33.4	66.6	0.0	0.0			123.2	123.4	0.5
CHH1756S	H-1756S	2/21/2026 9:34:30 AM	32.2	67.8	0.0	0.0			101.1	101.0	0.5
CHH1757S	H-1757S	2/6/2026 9:50:07 AM	53.1	46.9	0.0	0.0			81.5	81.6	1.1
CHH1757S	H-1757S	2/21/2026 9:14:39 AM	37.5	51.5	0.0	11.0			66.6	66.8	0.7
CHH1760S	H-1760S	2/2/2026 1:32:57 PM	41.6	52.8	0.0	5.6			107.1	107.6	0.8
CHH1760S	H-1760S	2/18/2026 9:54:09 AM	42.3	49.7	0.0	8.0			100.2	100.3	0.9
CHH1760S	H-1760S	2/23/2026 1:21:55 PM	41.0	54.1	0.0	4.9			103.3	104.6	0.8
CHH1762N	H-1762N	2/2/2026 2:02:41 PM	52.2	44.2	0.0	3.6			100.8	100.9	1.2
CHH1762N	H-1762N	2/18/2026 8:42:47 AM	52.9	42.7	0.0	4.4			89.6	89.8	1.2
CHH1763N	H-1763N	2/2/2026 12:33:02 PM	54.6	38.9	0.0	6.5			98.2	101.7	1.4
CHH1763S	H-1763S	2/4/2026 9:48:02 AM	52.0	43.0	0.0	5.0			96.2	97.7	1.2
CHH1764N	H-1764N	2/4/2026 9:27:13 AM	55.3	42.5	0.0	2.2			116.5	117.3	1.3
CHH1764S	H-1764S	2/2/2026 11:42:10 AM	52.1	45.9	0.0	2.0			83.5	83.5	1.1
CHH1767N	H-1767N	2/21/2026 10:49:59 AM	44.6	54.0	0.0	1.4			96.0	96.0	0.8
CHH1769N	H-1769N	2/12/2026 10:06:08 AM	10.3	40.3	1.6	47.9			87.0	87.2	0.3
CHH1769N	H-1769N	2/21/2026 8:15:34 AM	12.8	42.7	2.2	42.3			68.9	70.8	0.3
CHH1770A	H-1770A	2/15/2026 12:06:59 PM	1.7	73.0	0.0	25.3			64.3	64.4	0.0
CHH1770A	H-1770A	2/15/2026 12:08:56 PM	1.6	73.4	0.0	25.1			64.6	64.5	0.0
CHH1770N	H-1770N	2/9/2026 7:30:00 AM						6200			
CHH1770N	H-1770N	2/12/2026 8:20:00 AM					140				
CHH1770N	H-1770N	2/12/2026 8:20:00 AM						11000			
CHH1770N	H-1770N	2/12/2026 1:58:05 PM	42.4	53.2	0.0	4.4			107.6	107.8	0.8
CHH1770N	H-1770N	2/21/2026 9:05:30 AM	37.2	54.7	1.5	6.6			103.0	103.2	0.7
CHH1770S	H-1770S	2/6/2026 1:37:05 PM	47.5	52.5	0.0	0.0			92.9	93.0	0.9
CHH1770S	H-1770S	2/21/2026 9:54:44 AM	7.3	32.6	0.8	59.3			73.6	72.7	0.2
CHH1771A	H-1771A	2/10/2026 11:57:10 AM	51.4	44.0	0.0	4.6			111.7	111.8	1.2
CHH1771B	H-1771B	2/5/2026 9:54:39 AM	35.0	63.4	0.4	1.2			76.4	76.5	0.6
CHH1774N	H-1774N	2/12/2026 2:11:15 PM	36.4	59.4	0.0	4.2			115.3	115.1	0.6
CHH1774N	H-1774N	2/21/2026 9:24:25 AM	31.4	66.8	0.2	1.6			114.0	110.9	0.5

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHH1801S	H-1801S	2/9/2026 8:46:20 AM	50.5	44.8	0.0	4.7			66.3	66.4	1.1
CHH1802S	H-1802S	2/9/2026 8:26:42 AM	52.8	43.1	0.4	3.7			76.5	78.3	1.2
CHH1803N	H-1803N	2/2/2026 9:20:00 AM					1410				
CHH1803N	H-1803N	2/2/2026 9:20:42 AM	6.9	74.9	1.5	16.7			194.9	194.9	0.1
CHH1803N	H-1803N	2/9/2026 10:05:00 AM						98800			
CHH1803N	H-1803N	2/9/2026 10:05:00 AM					1340				
CHH1803N	H-1803N	2/9/2026 10:06:41 AM	0.9	54.5	7.2	37.4			195.4	195.4	0.0
CHH1803N	H-1803N	2/17/2026 8:15:00 AM					2060				
CHH1803N	H-1803N	2/17/2026 8:17:57 AM	1.1	63.1	4.8	31.0			195.3	195.2	0.0
CHH1803N	H-1803N	2/23/2026 9:02:57 AM	2.7	71.7	4.3	21.3			195.8	195.9	0.0
CHH1803N	H-1803N	2/23/2026 9:20:00 AM					2080				
CHH1804B	H-1804B	2/9/2026 9:44:35 AM	44.8	55.2	0.0	0.0			103.4	103.5	0.8
CHH1804B	H-1804B	2/23/2026 8:28:48 AM	53.2	44.5	0.0	2.3			101.0	101.2	1.2
CHH1804N	H-1804N	2/10/2026 11:30:32 AM	43.8	38.2	1.0	17.0			82.4	82.5	1.1
CHH1804S	H-1804S	2/4/2026 9:29:38 AM	55.0	43.3	0.0	1.7			98.1	98.7	1.3
CHH1805A	H-1805A	2/9/2026 2:00:38 PM	43.6	52.3	0.0	4.1			120.4	121.4	0.8
CHH1805B	H-1805B	2/4/2026 9:11:46 AM	42.0	37.4	3.1	17.5			78.9	79.1	1.1
CHH1805S	H-1805S	2/4/2026 9:33:59 AM	54.0	44.4	0.0	1.6			127.1	127.2	1.2
CHH1806A	H-1806A	2/20/2026 11:58:54 AM	53.8	42.4	0.0	3.8			114.5	113.6	1.3
CHH1806A	H-1806A	2/20/2026 12:02:15 PM	52.7	42.7	0.0	4.6			115.6	116.2	1.2
CHH1806A	H-1806A	2/20/2026 12:04:29 PM	52.4	43.0	0.0	4.6			116.5	116.5	1.2
CHH1806B	H-1806B	2/9/2026 8:22:57 AM	30.7	34.0	1.1	34.2			59.7	59.4	0.9
CHH1806N	H-1806N	2/10/2026 9:38:27 AM	43.1	56.9	0.0	0.0			122.8	126.4	0.8
CHH1806N	H-1806N	2/10/2026 9:42:02 AM	41.7	58.3	0.0	0.0			126.5	126.4	0.7
CHH1806S	H-1806S	2/5/2026 10:07:48 AM	13.3	79.4	0.0	7.3			129.3	107.9	0.2
CHH1807A	H-1807A	2/6/2026 2:47:14 PM	52.0	42.4	5.6	0.0			90.1	92.6	1.2
CHH1807A	H-1807A	2/9/2026 10:01:15 AM	54.6	44.3	0.0	1.1			90.5	93.1	1.2
CHH1807N	H-1807N	2/10/2026 9:01:27 AM	56.9	42.3	0.0	0.8			63.3	69.0	1.3
CHH1807N	H-1807N	2/10/2026 9:03:02 AM	53.6	42.8	0.0	3.6			71.5	71.6	1.3

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHH1807S	H-1807S	2/5/2026 9:54:15 AM	45.5	52.1	0.0	2.4			73.7	73.5	0.9
CHH1952S	H-1952S	2/3/2026 10:15:07 AM	54.7	45.3	0.0	0.0			109.7	112.3	1.2
CHH1952S	H-1952S	2/21/2026 10:19:59 AM	56.4	43.1	0.0	0.5			111.8	111.9	1.3
CHH1953N	H-1953N	2/10/2026 3:38:16 PM	0.3	4.8	15.5	79.4			111.9	106.6	0.1
CHH1953N	H-1953N	2/10/2026 3:40:27 PM	0.0	2.7	19.2	78.1			98.7	98.6	0.0
CHH1955C	H-1955C	2/9/2026 1:53:44 PM	51.5	48.5	0.0	0.0			88.1	97.7	1.1
CHH1955C	H-1955C	2/9/2026 1:54:21 PM	52.0	45.5	0.0	2.5			98.7	99.7	1.1
CHH1955N	H-1955N	2/10/2026 11:25:46 AM	46.7	44.3	0.2	8.8			89.8	88.0	1.1
CHH1956B	H-1956B	2/4/2026 8:55:24 AM	16.4	70.1	0.0	13.5			114.6	113.3	0.2
CHH1956N	H-1956N	2/10/2026 10:33:48 AM	56.1	43.3	0.0	0.6			106.6	108.7	1.3
CHH1956N	H-1956N	2/20/2026 10:57:12 AM	54.5	42.8	0.0	2.7			57.3	84.1	1.3
CHH1956N	H-1956N	2/20/2026 11:00:49 AM	53.4	42.0	0.0	4.6			87.3	91.2	1.3
CHH1956N	H-1956N	2/20/2026 11:02:03 AM	53.4	43.1	0.0	3.5			93.8	93.9	1.2
CHH1956S	H-1956S	2/9/2026 8:38:23 AM	53.7	42.8	0.1	3.4			74.6	74.6	1.3
CHH1957B	H-1957B	2/9/2026 9:10:29 AM	49.0	45.3	0.0	5.7			109.8	109.7	1.1
CHH1957N	H-1957N	2/10/2026 10:01:28 AM	53.3	46.5	0.0	0.2			98.1	98.4	1.1
CHH1957S	H-1957S	2/9/2026 8:48:55 AM	44.7	45.9	1.4	8.0			65.3	65.2	1.0
CHH1958C	H-1958C	2/9/2026 9:58:34 AM	53.1	43.1	0.0	3.8			123.5	123.8	1.2
CHH1958N	H-1958N	2/10/2026 9:13:40 AM	54.0	42.3	0.0	3.7			89.7	99.1	1.3
CHH1958N	H-1958N	2/10/2026 9:17:44 AM	54.4	42.8	0.0	2.8			109.5	97.4	1.3
CHH1958S	H-1958S	2/5/2026 9:49:05 AM	50.6	33.5	0.0	15.9			120.8	120.7	1.5
CHH1962N	H-1962N	2/12/2026 2:03:30 PM	21.0	62.7	1.0	15.3			129.5	129.1	0.3
CHH1962N	H-1962N	2/21/2026 9:03:15 AM	18.5	58.0	3.2	20.3			129.3	128.9	0.3
CHH1963N	H-1963N	2/10/2026 8:44:59 AM	32.0	57.6	0.0	10.4			130.2	130.4	0.6
CHH1963N	H-1963N	2/10/2026 8:46:51 AM	31.9	58.1	0.0	10.0			130.6	130.5	0.5
CHH1963N	H-1963N	2/21/2026 8:20:21 AM	25.4	53.5	1.6	19.5			124.5	124.5	0.5
CHH1966N	H-1966N	2/12/2026 2:18:10 PM	38.6	58.4	0.0	3.1			106.5	106.4	0.7
CHH1966N	H-1966N	2/21/2026 9:18:49 AM	33.8	58.2	0.5	7.5			101.2	102.5	0.6
CHH1967E	H-1967E	2/5/2026 3:01:18 PM	56.6	42.2	0.0	1.2			93.5	96.4	1.3

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHH1967E	H-1967E	2/5/2026 3:01:24 PM	56.6	42.2	0.0	1.2			93.5	96.4	1.3
CHH1967E	H-1967E	2/5/2026 3:03:34 PM	56.0	42.9	0.0	1.1			96.6	96.7	1.3
CHH1967W	H-1967W	2/4/2026 1:22:41 PM	55.6	39.2	0.0	5.2			96.1	98.0	1.4
CHH2050E	H-2050E	2/23/2026 2:06:17 PM	56.4	41.4	0.1	2.1			98.0	97.6	1.4
CHH2050W	H-2050W	2/3/2026 1:37:27 PM	53.6	41.7	0.0	4.7			97.5	97.6	1.3
CHH2050W	H-2050W	2/3/2026 1:41:25 PM	52.1	42.7	0.0	5.1			97.4	97.6	1.2
CHH2050W	H-2050W	2/3/2026 1:42:23 PM	51.8	42.7	0.0	5.4			97.8	97.8	1.2
CHH2051W	H-2051W	2/4/2026 1:29:35 PM	55.7	41.1	0.0	3.2			89.0	91.7	1.4
CHH2053E	H-2053E	2/5/2026 3:09:03 PM	51.8	40.8	0.0	7.4			118.0	118.0	1.3
CHH2053W	H-2053W	2/4/2026 12:57:33 PM	56.4	34.9	0.0	8.7			94.8	95.0	1.6
CHH2055E	H-2055E	2/2/2026 10:49:01 AM	34.3	37.0	0.0	28.7			107.4	107.4	0.9
CHH2055E	H-2055E	2/17/2026 7:58:46 AM	21.0	31.6	0.1	47.3			100.8	100.7	0.7
CHH2056B	H-2056B	2/5/2026 9:46:12 AM	27.8	32.9	0.0	39.3			70.2	70.4	0.8
CHH2056W	H-2056W	2/4/2026 1:24:35 PM	54.0	39.1	0.0	6.9			90.1	90.2	1.4
CHH2057E	H-2057E	2/5/2026 3:06:45 PM	57.2	41.3	0.0	1.5			126.7	126.9	1.4
CHH2057W	H-2057W	2/4/2026 1:12:57 PM	52.9	35.4	0.8	10.9			101.0	100.9	1.5
CHH2058E	H-2058E	2/5/2026 9:31:04 AM	56.7	41.5	0.0	1.8			110.1	110.2	1.4
CHH2058W	H-2058W	2/4/2026 1:26:42 PM	54.7	41.9	0.0	3.4			96.3	96.2	1.3
CHH2059E	H-2059E	2/4/2026 10:29:06 AM	54.7	42.8	0.0	2.5			112.2	113.7	1.3
CHH2059W	H-2059W	2/4/2026 1:50:20 PM	50.1	44.0	0.0	5.9			126.6	126.7	1.1
CHH2059W	H-2059W	2/23/2026 2:52:11 PM	53.3	46.6	0.0	0.1			121.0	125.8	1.1
CHH2161E	H-2161E	2/4/2026 10:21:02 AM	50.9	44.7	0.0	4.4			122.4	122.7	1.1
CHH2161W	H-2161W	2/4/2026 1:52:21 PM	55.0	39.2	0.0	5.8			107.6	107.6	1.4
CHH2163C	H-2163C	2/2/2026 1:45:31 PM	45.1	50.3	0.0	4.6			87.6	87.7	0.9
CHH2163C	H-2163C	2/23/2026 10:31:18 AM	48.9	47.0	0.0	4.1			92.5	92.6	1.0
CHH2163W	H-2163W	2/4/2026 2:14:58 PM	42.7	53.3	0.0	4.0			122.0	122.6	0.8
CHH2164E	H-2164E	2/2/2026 11:02:10 AM	45.2	49.9	0.0	4.9			121.8	121.9	0.9
CHH2164E	H-2164E	2/19/2026 10:08:46 AM	47.6	42.3	0.0	10.1			120.1	120.1	1.1
CHH2165E	H-2165E	2/4/2026 10:08:45 AM	49.8	48.1	0.0	2.1			106.5	105.4	1.0

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHH2165W	H-2165W	2/4/2026 8:00:00 AM					390				
CHH2165W	H-2165W	2/4/2026 8:00:00 AM						27000			
CHH2165W	H-2165W	2/5/2026 1:46:05 PM	19.0	72.7	0.0	8.3			93.1	91.5	0.3
CHH2165W	H-2165W	2/5/2026 1:48:05 PM	17.3	76.2	0.0	6.5			121.7	121.6	0.2
CHH2165W	H-2165W	2/21/2026 11:24:42 AM	18.4	79.5	0.0	2.1			107.1	108.0	0.2
CHH2166E	H-2166E	2/9/2026 9:49:56 AM	44.5	54.4	0.0	1.1			77.7	77.5	0.8
CHH2166E	H-2166E	2/9/2026 9:50:24 AM	44.5	54.6	0.0	0.9			77.8	77.8	0.8
CHH2166E	H-2166E	2/20/2026 11:31:37 AM	52.5	42.0	0.0	5.5			89.8	90.2	1.3
CHH2166E	H-2166E	2/20/2026 11:33:42 AM	51.8	42.5	0.0	5.7			90.5	90.5	1.2
CHH2168C	H-2168C	2/4/2026 8:53:16 AM	47.9	39.7	2.0	10.4			77.4	77.4	1.2
CHH2168E	H-2168E	2/9/2026 9:07:42 AM	35.9	60.5	0.0	3.6			115.6	116.4	0.6
CHH2168E	H-2168E	2/24/2026 8:28:41 AM	29.8	34.6	0.0	35.6			113.7	115.5	0.9
CHH2169C	H-2169C	2/4/2026 8:58:02 AM	51.5	47.8	0.0	0.7			97.6	99.4	1.1
CHH2169E	H-2169E	2/9/2026 9:20:05 AM	50.4	45.1	0.0	4.5			103.6	104.9	1.1
CHH2170N	H-2170N	2/5/2026 8:44:58 AM	55.2	41.0	0.0	3.8			120.0	120.0	1.3
CHH2170S	H-2170S	2/5/2026 8:28:50 AM	52.3	37.2	0.5	10.0			99.6	99.7	1.4
CHH2171A	H-2171A	2/25/2026 8:36:44 AM	59.0	40.2	0.0	0.8			76.8	78.1	1.5
CHH2171B	H-2171B	2/25/2026 9:15:41 AM	56.0	42.6	0.0	1.4			94.3	97.4	1.3
CHH2171N	H-2171N	2/4/2026 8:22:24 AM	39.6	35.0	0.0	25.4			120.6	121.1	1.1
CHH2171S	H-2171S	2/5/2026 8:42:50 AM	55.2	42.2	0.0	2.6			121.5	121.5	1.3
CHH2272W	H-2272W	2/4/2026 2:09:37 PM	45.7	47.8	0.0	6.5			118.7	123.0	1.0
CHH2272W	H-2272W	2/22/2026 1:03:48 PM	44.2	44.0	0.0	11.9			117.5	117.6	1.0
CHH2273W	H-2273W	2/4/2026 7:55:00 AM					120				
CHH2273W	H-2273W	2/4/2026 7:55:00 AM						8900			
CHH2273W	H-2273W	2/6/2026 9:59:01 AM	23.6	51.8	0.0	24.6			102.4	106.1	0.5
CHH2273W	H-2273W	2/21/2026 9:30:02 AM	22.9	56.5	0.0	20.6			114.4	114.6	0.4
CHH2274B	H-2274B	2/3/2026 11:18:39 AM	50.8	45.2	0.0	4.0			77.4	77.4	1.1
CHH2274B	H-2274B	2/4/2026 2:18:15 PM	51.8	43.1	0.0	5.1			83.3	83.1	1.2
CHH2274B	H-2274B	2/4/2026 2:20:00 PM	51.5	43.5	0.0	5.1			82.9	83.0	1.2

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHH2274B	H-2274B	2/17/2026 9:55:02 AM	51.2	45.3	0.0	3.5			53.3	53.4	1.1
CHH2274W	H-2274W	2/6/2026 10:06:40 AM	29.7	70.3	0.0	0.0			86.6	87.1	0.4
CHH2274W	H-2274W	2/21/2026 9:39:37 AM	12.9	37.0	1.0	49.1			67.0	67.0	0.3
CHH2275E	H-2275E	2/4/2026 9:45:37 AM	43.4	44.0	0.0	12.6			121.3	121.0	1.0
CHH2275E	H-2275E	2/23/2026 1:14:06 PM	41.9	45.8	0.0	12.3			121.0	121.4	0.9
CHH2275W	H-2275W	2/13/2026 10:54:45 AM	6.9	8.7	17.5	66.9			74.9	75.1	0.8
CHH2275W	H-2275W	2/21/2026 8:57:55 AM	19.4	26.4	2.7	51.5			62.6	63.2	0.7
CHH2276A	H-2276A	2/3/2026 1:46:03 PM	44.2	40.4	0.0	15.4			91.8	91.9	1.1
CHH2276A	H-2276A	2/18/2026 10:02:47 AM	46.6	43.0	0.0	10.4			90.1	90.2	1.1
CHH2276B	H-2276B	2/2/2026 1:09:47 PM	54.2	44.2	0.0	1.6			112.0	112.3	1.2
CHH2276B	H-2276B	2/18/2026 8:59:55 AM	54.2	42.8	0.0	3.0			103.3	103.3	1.3
CHH2276E	H-2276E	2/4/2026 9:36:32 AM	49.8	45.5	0.0	4.7			122.2	122.4	1.1
CHH2276W	H-2276W	2/6/2026 9:52:27 AM	18.2	77.6	0.0	4.2			73.6	74.3	0.2
CHH2276W	H-2276W	2/21/2026 9:21:12 AM	16.1	75.7	0.0	8.2			62.6	62.6	0.2
CHH2277A	H-2277A	2/3/2026 8:00:17 AM	46.3	50.6	0.1	3.0			62.3	62.4	0.9
CHH2277A	H-2277A	2/22/2026 12:07:21 PM	51.1	45.4	0.0	3.5			72.3	72.6	1.1
CHH2277B	H-2277B	2/2/2026 1:01:55 PM	53.8	42.4	0.0	3.8			112.8	112.9	1.3
CHH2277B	H-2277B	2/18/2026 8:52:34 AM	52.6	43.1	0.0	4.3			102.7	103.3	1.2
CHIWH023	H-23 (EXP-23)	2/25/2026 8:54:28 AM	63.1	30.4	0.5	6.0			77.0	79.3	2.1
CHH2301E	H-2301E	2/24/2026 9:58:02 AM	53.2	43.6	0.1	3.1			102.3	102.3	1.2
CHH2301W	H-2301W	2/24/2026 1:43:47 PM	15.4	12.6	13.7	58.3			96.0	96.0	1.2
CHH2301W	H-2301W	2/24/2026 1:45:31 PM	13.0	12.2	14.1	60.7			96.9	96.9	1.1
CHH2302C	H-2302C	2/3/2026 10:28:42 AM	57.7	39.4	0.0	3.0			111.9	112.0	1.5
CHH2302C	H-2302C	2/3/2026 10:34:29 AM	56.9	40.1	0.0	2.9			112.0	112.1	1.4
CHH2302C	H-2302C	2/3/2026 10:38:00 AM	54.9	41.1	0.0	4.0			112.0	112.0	1.3
CHH2302E	H-2302E	2/24/2026 10:07:01 AM	54.0	42.8	0.0	3.2			97.6	97.6	1.3
CHH2303E	H-2303E	2/24/2026 10:09:34 AM	53.1	42.6	0.0	4.3			82.2	82.2	1.2
CHH2303N	H-2303N	2/5/2026 10:17:19 AM	56.1	41.9	0.0	2.0			97.7	99.7	1.3
CHH2303N	H-2303N	2/5/2026 10:19:56 AM	55.2	42.9	0.0	1.9			100.3	100.3	1.3

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHH2304S	H-2304S	2/24/2026 10:25:33 AM	52.0	44.4	0.0	3.6			121.0	121.0	1.2
CHH2305N	H-2305N	2/5/2026 10:05:44 AM	45.2	40.0	0.0	14.8			88.2	85.9	1.1
CHH2305S	H-2305S	2/24/2026 10:19:59 AM	52.5	43.9	0.0	3.6			121.0	126.5	1.2
CHH2305S	H-2305S	2/24/2026 10:22:09 AM	52.7	43.8	0.0	3.5			126.7	126.7	1.2
CHH2306N	H-2306N	2/23/2026 2:27:18 PM	55.7	43.1	0.0	1.2			114.3	114.9	1.3
CHH2306N	H-2306N	2/23/2026 2:29:18 PM	53.9	45.0	0.0	1.1			115.1	115.1	1.2
CHH2306S	H-2306S	2/23/2026 3:58:56 PM	18.1	15.9	13.5	52.5			84.1	84.2	1.1
CHH2306S	H-2306S	2/23/2026 4:01:56 PM	17.4	13.1	14.1	55.4			83.0	83.0	1.3
CHH2307S	H-2307S	2/3/2026 11:34:16 AM	52.3	40.8	0.0	6.9			100.4	100.4	1.3
CHH2307S	H-2307S	2/3/2026 11:36:31 AM	52.3	40.9	0.0	6.9			100.7	100.7	1.3
CHH2308S	H-2308S	2/3/2026 11:20:54 AM	54.9	41.1	0.0	4.0			111.8	111.1	1.3
CHH2308S	H-2308S	2/3/2026 11:23:27 AM	53.8	41.4	0.0	4.8			111.6	111.8	1.3
CHH2308S	H-2308S	2/3/2026 11:25:07 AM	53.1	41.9	0.0	5.0			112.0	112.1	1.3
CHH2309N	H-2309N	2/4/2026 12:22:58 PM	45.4	43.2	1.6	9.8			89.1	89.1	1.1
CHH2309S	H-2309S	2/3/2026 10:44:04 AM	53.4	42.2	0.0	4.4			116.1	116.1	1.3
CHH2309S	H-2309S	2/3/2026 10:45:55 AM	52.9	42.3	0.0	4.8			116.0	116.2	1.2
CHH2309S	H-2309S	2/3/2026 10:47:43 AM	52.3	43.2	0.0	4.6			116.1	116.1	1.2
CHH2401S	H-2401S	2/17/2026 11:12:23 AM	55.4	42.2	0.0	2.4			105.7	106.2	1.3
CHH2401S	H-2401S	2/17/2026 11:14:39 AM	55.2	42.5	0.0	2.3			106.4	106.5	1.3
CHH2401S	H-2401S	2/24/2026 1:29:33 PM	58.4	40.4	0.0	1.2			108.8	108.9	1.4
CHH2402N	H-2402N	2/3/2026 2:31:05 PM	51.4	43.8	0.0	4.8			111.2	108.4	1.2
CHH2402N	H-2402N	2/3/2026 2:55:39 PM	50.0	45.2	0.0	4.8			112.7	112.8	1.1
CHH2402S	H-2402S	2/17/2026 11:30:13 AM	53.6	42.2	0.0	4.2			105.0	105.7	1.3
CHH2403N	H-2403N	2/3/2026 2:22:28 PM	51.6	43.9	0.0	4.6			113.1	113.3	1.2
CHH2403N	H-2403N	2/3/2026 2:24:18 PM	51.1	43.7	0.0	5.2			113.5	113.3	1.2
CHH2403S	H-2403S	2/3/2026 3:19:30 PM	15.7	10.2	14.3	59.9			84.6	86.9	1.5
CHH2403S	H-2403S	2/3/2026 3:21:05 PM	15.7	10.1	14.4	59.8			89.0	89.5	1.5
CHH2404N	H-2404N	2/3/2026 2:06:12 PM	53.2	42.1	0.0	4.8			108.9	109.1	1.3
CHH2404N	H-2404N	2/3/2026 2:11:02 PM	52.5	42.8	0.0	4.8			109.3	109.5	1.2

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHH2404S	H-2404S	2/3/2026 1:26:00 PM	55.7	40.4	0.0	3.9			110.9	110.9	1.4
CHH2405N	H-2405N	2/5/2026 11:25:04 AM	43.3	50.5	0.0	6.2			109.1	110.4	0.9
CHH2405N	H-2405N	2/5/2026 11:28:27 AM	39.4	53.9	0.0	6.7			110.2	110.2	0.7
CHIWH029	H-29	2/5/2026 8:37:56 AM	33.2	41.5	0.3	25.0			126.8	126.2	0.8
CHIWH072	H-72	2/13/2026 3:30:27 PM	31.0	67.2	0.0	1.8			76.5	76.6	0.5
CHIWH074	H-74	2/4/2026 8:11:30 AM	55.0	42.7	0.0	2.3			105.9	106.3	1.3
CHIWH075	H-75	2/9/2026 10:23:17 AM	48.7	50.4	0.0	0.9			88.2	88.8	1.0
CHIWH079	H-79	2/5/2026 9:41:55 AM	43.7	51.8	0.0	4.5			128.4	128.6	0.8
CHIWP02R	P-02R	2/9/2026 12:41:09 PM	37.5	33.3	0.2	29.0			85.9	85.9	1.1
CHIWP03R	P-03R	2/21/2026 11:43:47 AM	46.5	37.2	0.0	16.3			71.2	71.9	1.3
CHIWP004	P-04	2/21/2026 11:41:02 AM	28.1	35.9	0.0	36.0			70.7	72.1	0.8
CHIWP005	P-05	2/9/2026 12:30:19 PM	49.4	39.4	0.0	11.2			100.7	104.2	1.3
CHIWP005	P-05	2/9/2026 12:32:16 PM	43.8	37.4	0.0	18.8			105.4	105.4	1.2
CHIWP06R	P-06R	2/9/2026 12:21:26 PM	50.8	36.9	0.1	12.2			107.1	108.5	1.4
CHIWP07R	P-07R	2/21/2026 11:10:55 AM	32.1	25.8	0.0	42.1			78.2	78.2	1.2
CHIWP08R	P-08R	2/9/2026 12:48:48 PM	55.0	37.0	0.0	8.0			97.9	97.9	1.5
CHIWP009	P-09	2/21/2026 11:47:36 AM	53.8	37.5	0.0	8.7			89.9	89.9	1.4
CHIWP010	P-10	2/21/2026 11:37:28 AM	36.2	30.0	0.0	33.8			85.6	85.9	1.2
CHIWP011	P-11	2/21/2026 11:33:05 AM	46.5	37.1	0.0	16.4			93.2	93.1	1.3
CHIWP012	P-12	2/10/2026 7:21:33 AM	58.3	41.7	0.0	0.0			61.8	62.0	1.4
CHIWP013	P-13	2/10/2026 7:27:11 AM	59.2	37.7	0.0	3.1			70.5	71.5	1.6
CHIWP014	P-14	2/10/2026 7:42:16 AM	33.3	28.0	0.3	38.4			53.7	55.1	1.2
CHIWP15R	P-15R	2/10/2026 8:55:27 AM	52.8	35.5	0.0	11.7			63.8	64.3	1.5
CHIWP016	P-16	2/10/2026 8:36:28 AM	53.5	36.0	0.0	10.5			85.1	85.6	1.5
CHIWP017	P-17	2/10/2026 8:46:04 AM	50.1	36.3	0.0	13.6			100.1	101.9	1.4
CHIP18RD	P-18RD	2/10/2026 8:18:45 AM	57.3	39.0	0.0	3.7			68.5	69.0	1.5
CHIP18RS	P-18RS	2/10/2026 8:02:03 AM	50.7	35.6	0.0	13.7			73.2	74.1	1.4
CHIWP019	P-19	2/10/2026 8:28:52 AM	36.1	31.0	0.0	32.9			79.8	80.1	1.2
CHIWP20R	P-20R	2/10/2026 8:25:01 AM	53.8	35.7	0.0	10.5			88.6	90.7	1.5

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHIWP021	P-21	2/10/2026 7:55:23 AM	48.2	34.1	0.0	17.7			86.1	86.1	1.4
CHIP21RD	P-21RD	2/5/2026 8:51:32 AM	45.3	36.8	0.0	17.9			94.2	95.2	1.2
CHIP21RD	P-21RD	2/9/2026 7:58:20 AM	45.0	36.2	0.0	18.8			95.6	96.1	1.2
CHIP21RS	P-21RS	2/5/2026 8:56:28 AM	57.3	42.7	0.0	0.0			96.2	98.3	1.3
CHIP21RS	P-21RS	2/9/2026 7:53:57 AM	58.0	41.5	0.0	0.5			101.0	103.3	1.4
CHIP22RD	P-22RD	2/5/2026 7:31:12 AM	53.2	41.6	0.0	5.2			112.5	112.3	1.3
CHIP22RS	P-22RS	2/5/2026 7:25:44 AM	28.5	27.4	0.0	44.1			118.3	118.6	1.0
CHIWP023	P-23	2/5/2026 9:01:17 AM	19.3	27.4	0.0	53.3			62.5	63.0	0.7
CHIWP024	P-24	2/5/2026 8:40:56 AM	34.1	32.7	0.0	33.2			81.7	82.3	1.0
CHIWP026	P-26	2/5/2026 8:28:19 AM	47.8	37.5	0.0	14.7			74.5	75.9	1.3
CHIWP027	P-27	2/5/2026 9:26:52 AM	17.9	25.3	0.0	56.8			63.7	63.7	0.7
CHIWP028	P-28	2/5/2026 9:40:13 AM	39.4	31.4	0.0	29.2			74.7	92.9	1.3
CHIWP29R	P-29R	2/5/2026 9:48:14 AM	35.4	32.0	0.0	32.6			70.8	71.2	1.1
CHIWP29R	P-29R	2/23/2026 7:28:16 AM	35.0	30.1	0.0	34.9			61.3	62.0	1.2
CHIWP30R	P-30R	2/5/2026 8:20:49 AM	35.3	33.1	0.0	31.6			70.9	72.5	1.1
CHIWP30R	P-30R	2/23/2026 7:34:05 AM	29.6	29.9	0.0	40.5			70.9	71.1	1.0
CHIP32R1	P-32R1	2/5/2026 8:14:14 AM	41.8	33.2	0.0	25.0			79.1	83.7	1.3
CHIP32R1	P-32R1	2/23/2026 7:44:23 AM	45.7	36.3	0.0	18.0			84.7	85.6	1.3
CHIP32R2	P-32R2	2/5/2026 9:58:11 AM	48.8	38.0	0.0	13.2			97.5	99.6	1.3
CHIP32R2	P-32R2	2/23/2026 7:49:04 AM	38.1	34.5	0.3	27.1			104.8	106.4	1.1
CHIWP033	P-33	2/5/2026 10:05:40 AM	43.4	37.3	0.0	19.3			81.5	82.6	1.2
CHIWP036	P-36	2/5/2026 10:20:39 AM	26.9	30.9	0.0	42.2			78.8	79.1	0.9
CHIWP037	P-37	2/9/2026 8:07:10 AM	16.2	25.5	0.0	58.3			70.2	70.3	0.6
CHIP38RD	P-38RD	2/9/2026 8:13:26 AM	45.1	36.2	0.0	18.7			105.0	105.2	1.2
CHIP38RS	P-38RS	2/9/2026 8:18:01 AM	40.3	34.8	0.0	24.9			99.6	100.5	1.2
CHIWP039	P-39	2/9/2026 8:28:49 AM	55.7	41.4	0.0	2.9			61.7	61.8	1.3
CHIWP041	P-41	2/9/2026 8:33:07 AM	43.7	35.9	0.6	19.8			110.4	110.3	1.2
CHIWP42R	P-42R	2/9/2026 8:40:56 AM	53.0	41.1	0.0	5.9			103.1	102.9	1.3
CHIWP42R	P-42R	2/23/2026 8:02:53 AM	56.0	42.0	0.0	2.0			95.8	96.1	1.3

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHIWP043	P-43	2/5/2026 8:01:19 AM	25.2	28.1	0.5	46.2			114.6	114.8	0.9
CHIWP043	P-43	2/23/2026 8:07:48 AM	25.2	27.3	0.5	47.0			112.1	112.1	0.9
CHIP44RD	P-44RD	2/5/2026 7:52:05 AM	47.1	34.9	0.0	18.0			73.4	74.6	1.3
CHIP44RD	P-44RD	2/23/2026 8:13:15 AM	51.8	35.3	0.0	12.9			65.0	65.0	1.5
CHIP44RS	P-44RS	2/5/2026 7:56:46 AM	26.0	29.8	0.0	44.2			120.0	120.4	0.9
CHIP44RS	P-44RS	2/23/2026 8:16:51 AM	25.1	28.7	0.0	46.2			118.2	118.4	0.9
CHIP45RD	P-45RD	2/5/2026 7:44:07 AM	43.9	37.6	0.0	18.5			103.1	105.4	1.2
CHIP45RD	P-45RD	2/23/2026 8:29:29 AM	47.7	36.4	0.0	15.9			101.3	102.0	1.3
CHIP45RS	P-45RS	2/5/2026 7:40:05 AM	2.4	20.4	0.0	77.2			91.9	92.3	0.1
CHIP45RS	P-45RS	2/23/2026 8:26:35 AM	2.8	17.9	0.0	79.3			83.3	83.4	0.2
CHIP46RD	P-46RD	2/9/2026 8:50:52 AM	48.7	36.1	0.1	15.1			94.5	94.6	1.3
CHIP46RS	P-46RS	2/9/2026 8:47:57 AM	18.2	23.7	0.0	58.1			119.2	119.4	0.8
CHIWP047	P-47	2/9/2026 9:07:16 AM	13.6	23.7	0.9	61.8			132.6	132.6	0.6
CHIWP047	P-47	2/9/2026 9:12:05 AM	13.0	23.0	1.0	63.0			132.6	130.7	0.6
CHIWP048	P-48	2/9/2026 8:58:49 AM	18.0	25.7	0.0	56.3			109.2	109.3	0.7
CHIP49RD	P-49RD	2/9/2026 9:39:05 AM	53.2	39.0	0.0	7.8			113.4	113.5	1.4
CHIP49RS	P-49RS	2/9/2026 9:36:00 AM	29.4	28.1	0.0	42.5			113.9	114.0	1.0
CHIWP052	P-52	2/9/2026 10:32:38 AM	31.8	32.1	0.0	36.1			114.6	114.6	1.0
CHIWP053	P-53	2/9/2026 10:12:34 AM	25.5	27.9	0.0	46.6			114.8	114.8	0.9
CHIWP054	P-54	2/9/2026 10:15:52 AM	40.8	33.6	0.0	25.6			96.8	96.9	1.2
CHIWP055	P-55	2/9/2026 10:06:54 AM	34.3	31.5	0.0	34.2			95.5	95.5	1.1
CHIWP056	P-56	2/9/2026 10:03:25 AM	21.5	23.5	0.0	55.0			103.3	103.3	0.9
CHIWP057	P-57	2/9/2026 10:00:04 AM	39.0	29.9	0.9	30.2			72.5	72.5	1.3
CHIWP60R	P-60R	2/21/2026 11:23:27 AM	52.9	33.9	0.5	12.7			62.9	63.3	1.6
CHIWP061	P-61	2/21/2026 11:19:35 AM	46.9	34.6	0.0	18.5			79.3	79.3	1.4
CHIWP065	P-65	2/5/2026 10:26:16 AM	37.5	31.2	0.0	31.3			78.7	78.8	1.2
CHIWP071	P-71	2/9/2026 9:29:19 AM	27.9	26.3	1.2	44.6			65.5	65.6	1.1
CHIWP075	P-75	2/21/2026 11:16:24 AM	53.2	35.2	0.0	11.6			90.5	90.5	1.5
CHIWP076	P-76	2/9/2026 8:22:17 AM	28.4	30.0	0.2	41.4			91.4	91.8	0.9

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CSC2000E	SC-2000E	2/4/2026 9:37:26 AM	53.2	40.7	0.0	6.1			116.6	116.7	1.3
CSC2501E	SC-2501E	2/2/2026 9:00:00 AM					1120				
CSC2501E	SC-2501E	2/2/2026 9:08:11 AM	13.7	51.7	7.2	27.4			174.9	170.1	0.3
CSC2501E	SC-2501E	2/2/2026 9:11:19 AM	14.3	50.8	7.8	27.1			167.9	164.4	0.3
CSC2501E	SC-2501E	2/9/2026 9:59:58 AM	4.1	72.8	2.1	21.0			101.4	100.2	0.1
CSC2501E	SC-2501E	2/17/2026 8:06:16 AM	3.1	67.6	4.1	25.2			157.3	159.8	0.0
CSC2501E	SC-2501E	2/17/2026 8:10:00 AM					1180				
CSC2501E	SC-2501E	2/23/2026 8:52:18 AM	3.2	76.4	1.9	18.5			182.7	182.4	0.0
CSC2501E	SC-2501E	2/23/2026 9:10:00 AM					2340				
CSC2501W	SC-2501W	2/2/2026 9:29:56 AM	12.1	67.6	2.0	18.3			177.7	176.5	0.2
CSC2501W	SC-2501W	2/2/2026 9:30:00 AM					1730				
CSC2501W	SC-2501W	2/2/2026 9:30:00 AM						149700			
CSC2501W	SC-2501W	2/2/2026 9:30:53 AM	12.3	69.5	1.8	16.4			175.5	175.3	0.2
CSC2501W	SC-2501W	2/9/2026 10:19:51 AM	2.5	80.3	0.0	17.2			181.8	181.6	0.0
CSC2501W	SC-2501W	2/9/2026 10:20:00 AM					1140				
CSC2501W	SC-2501W	2/17/2026 8:36:47 AM	2.0	63.8	4.8	29.4			179.9	179.9	0.0
CSC2501W	SC-2501W	2/17/2026 8:40:00 AM					1330				
CSC2501W	SC-2501W	2/23/2026 9:11:35 AM	4.1	79.4	1.1	15.4			179.3	181.1	0.1
CSC2501W	SC-2501W	2/23/2026 9:35:00 AM					1490				
CHISW010	SW-10	2/23/2026 1:36:27 PM	22.3	31.1	0.9	45.7			80.4	80.3	0.7
CHISW115	SW-115	2/25/2026 10:12:04 AM	49.7	38.4	0.0	11.9			82.1	82.1	1.3
CHSW1445	SW-1445	2/10/2026 10:02:08 AM	6.3	12.4	8.3	73.0			64.3	64.3	0.5
CHSW1445	SW-1445	2/12/2026 12:00:10 PM	7.7	12.8	8.5	71.0			74.6	74.7	0.6
CHSW1445	SW-1445	2/13/2026 12:50:05 PM	8.5	11.8	8.3	71.4			75.7	75.7	0.7
CHSW1445	SW-1445	2/20/2026 12:31:22 PM	10.3	15.5	7.1	67.1			61.6	62.2	0.7
CHSW1445	SW-1445	2/20/2026 12:33:32 PM	10.1	13.9	7.2	68.8			62.6	62.7	0.7
CHSW1445	SW-1445	2/20/2026 12:57:49 PM	9.9	13.6	7.2	69.3			60.4	60.8	0.7
CHSW1445	SW-1445	2/23/2026 10:03:50 AM	6.2	10.5	8.8	74.5			77.2	77.3	0.6
CHSW1445	SW-1445	2/24/2026 8:32:59 AM	10.6	12.3	7.4	69.7			68.5	68.5	0.9

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHSW1445	SW-1445	2/25/2026 10:05:51 AM	10.5	14.5	5.1	70.0			85.4	86.2	0.7
CHSW1445	SW-1445	2/26/2026 12:23:24 PM	12.7	15.3	5.2	66.8			81.3	81.4	0.8
CHSW1445	SW-1445	2/26/2026 12:25:02 PM	12.3	15.5	5.2	67.0			81.5	81.9	0.8
CHSW1445	SW-1445	2/27/2026 9:51:02 AM	8.9	11.8	9.6	69.7			84.2	84.1	0.8
CHSW1455	SW-1455	2/10/2026 9:56:51 AM	21.1	20.8	5.4	52.7			66.3	66.3	1.0
CHSW1455	SW-1455	2/12/2026 11:55:45 AM	20.7	20.0	5.8	53.5			76.6	77.0	1.0
CHSW1455	SW-1455	2/13/2026 12:44:51 PM	22.0	20.1	5.6	52.3			79.5	79.4	1.1
CHSW1455	SW-1455	2/20/2026 12:23:53 PM	22.5	25.6	4.1	47.8			69.6	70.4	0.9
CHSW1455	SW-1455	2/20/2026 1:02:43 PM	25.2	24.4	3.8	46.6			68.3	68.6	1.0
CHSW1455	SW-1455	2/23/2026 9:57:35 AM	17.6	17.3	5.3	59.9			77.6	78.3	1.0
CHSW1455	SW-1455	2/24/2026 8:24:15 AM	23.9	26.6	4.2	45.3			72.0	72.0	0.9
CHSW1455	SW-1455	2/25/2026 10:00:04 AM	24.8	26.2	2.9	46.1			80.8	81.3	0.9
CHSW1455	SW-1455	2/26/2026 12:13:39 PM	28.1	22.8	2.6	46.5			86.2	86.3	1.2
CHSW1455	SW-1455	2/27/2026 9:57:33 AM	20.2	19.2	6.5	54.1			87.7	87.8	1.1
CHISW154	SW-154	2/25/2026 1:25:06 PM	0.2	1.6	21.1	77.1			92.4	92.8	0.1
CSW17135	SW-17-135	2/10/2026 9:59:55 AM	29.6	28.5	0.0	41.9			63.7	63.2	1.0
CSW17135	SW-17-135	2/12/2026 11:57:49 AM	34.3	30.6	0.0	35.1			78.1	78.8	1.1
CSW17135	SW-17-135	2/13/2026 12:47:59 PM	31.8	27.6	0.1	40.5			79.5	80.2	1.2
CSW17135	SW-17-135	2/20/2026 12:28:10 PM	35.0	30.6	0.0	34.4			68.2	69.5	1.1
CSW17135	SW-17-135	2/20/2026 12:28:51 PM	35.1	30.7	0.0	34.2			69.6	69.7	1.1
CSW17135	SW-17-135	2/20/2026 1:00:17 PM	35.6	29.5	0.1	34.8			68.7	69.0	1.2
CSW17135	SW-17-135	2/23/2026 10:01:17 AM	20.6	18.5	5.1	55.9			72.5	72.5	1.1
CSW17135	SW-17-135	2/24/2026 8:28:28 AM	35.8	31.5	0.0	32.7			69.7	69.8	1.1
CSW17135	SW-17-135	2/25/2026 10:02:21 AM	35.4	32.5	0.0	32.1			77.5	77.6	1.1
CSW17135	SW-17-135	2/26/2026 12:18:11 PM	35.9	27.7	0.0	36.4			85.7	85.2	1.3
CSW17135	SW-17-135	2/26/2026 12:19:24 PM	35.2	28.3	0.0	36.5			85.7	85.7	1.2
CSW17135	SW-17-135	2/27/2026 9:54:07 AM	31.8	26.7	0.6	40.9			84.3	84.3	1.2
CHISW187	SW-187	2/10/2026 2:26:29 PM	13.9	29.0	10.6	46.5			68.6	67.4	0.5
CHSW1930	SW-1930	2/10/2026 2:12:40 PM	26.4	39.8	4.6	29.2			79.4	81.2	0.7

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHISW020	SW-20	2/21/2026 11:05:59 AM	0.4	6.2	14.9	78.5			77.0	76.5	0.1
CHISW025	SW-25	2/10/2026 9:42:59 AM	17.4	29.0	1.9	51.7			62.0	61.5	0.6
CHISW025	SW-25	2/10/2026 9:44:47 AM	2.5	9.1	18.4	70.0			61.5	61.4	0.3
CHISW025	SW-25	2/10/2026 2:06:26 PM	6.5	11.2	14.0	68.3			67.7	66.0	0.6
CHISW025	SW-25	2/11/2026 9:48:52 AM	17.3	34.5	1.8	46.4			61.5	61.4	0.5
CHISW025	SW-25	2/11/2026 9:49:44 AM	16.8	34.3	1.7	47.2			61.3	61.3	0.5
CHISW025	SW-25	2/12/2026 9:55:39 AM	14.8	29.3	2.4	53.5			64.1	63.8	0.5
CHISW025	SW-25	2/12/2026 9:56:29 AM	14.8	30.9	2.4	51.9			63.6	63.3	0.5
CHISW025	SW-25	2/13/2026 8:42:00 AM	15.5	32.5	2.3	49.7			60.1	59.6	0.5
CHISW025	SW-25	2/13/2026 8:43:54 AM	14.9	32.5	2.4	50.2			59.9	60.2	0.5
CHISW025	SW-25	2/17/2026 9:11:35 AM	15.9	32.3	2.3	49.5			53.3	53.3	0.5
CHISW025	SW-25	2/17/2026 9:16:10 AM	14.6	33.1	3.0	49.2			53.1	53.2	0.4
CHISW025	SW-25	2/18/2026 8:58:28 AM	15.0	32.5	2.2	50.3			52.6	52.7	0.5
CHISW025	SW-25	2/18/2026 8:59:31 AM	14.7	33.4	2.1	49.9			52.9	52.9	0.4
CHISW025	SW-25	2/19/2026 7:49:56 AM	15.8	32.3	2.6	49.3			44.9	44.7	0.5
CHISW025	SW-25	2/19/2026 7:50:38 AM	15.3	31.3	2.5	50.9			44.5	44.4	0.5
CHISW025	SW-25	2/20/2026 9:09:44 AM	0.8	1.3	19.9	78.0			45.4	45.9	0.6
CHISW025	SW-25	2/23/2026 8:18:18 AM	0.0	0.1	21.1	78.8			59.6	59.7	0.0
CHISW025	SW-25	2/24/2026 12:25:37 PM	0.1	0.6	19.5	79.8			94.5	94.8	0.2
CHISW025	SW-25	2/25/2026 9:23:58 AM	0.0	0.9	19.6	79.5			75.7	75.6	0.0
CHISW025	SW-25	2/26/2026 10:34:40 AM	0.2	0.3	19.7	79.7			84.5	84.7	0.7
CHISW025	SW-25	2/27/2026 8:49:32 AM	0.1	1.0	19.8	79.1			80.8	80.8	0.1
SW2501D_	SW-2501D	2/10/2026 1:01:14 PM	17.5	82.5	0.0	0.0			70.8	73.6	0.2
SW2501D_	SW-2501D	2/10/2026 1:02:55 PM	17.4	82.6	0.0	0.0			73.7	74.0	0.2
SW2501D_	SW-2501D	2/11/2026 10:56:51 AM	20.6	72.1	0.0	7.4			72.4	73.3	0.3
SW2501D_	SW-2501D	2/11/2026 10:58:09 AM	20.3	72.7	0.0	7.0			73.6	73.5	0.3
SW2501D_	SW-2501D	2/11/2026 10:59:15 AM	20.1	72.4	0.0	7.5			73.7		0.3
SW2501D_	SW-2501D	2/11/2026 10:59:53 AM	20.3	72.4	0.0	7.3			73.8	73.8	0.3
SW2501D_	SW-2501D	2/11/2026 2:56:42 PM	20.6	70.8	0.0	8.7			72.9	73.0	0.3

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
SW2501D_	SW-2501D	2/12/2026 12:27:44 PM	19.4	80.6	0.0	0.0			75.9	76.1	0.2
SW2501D_	SW-2501D	2/12/2026 12:30:01 PM	19.2	80.8	0.0	0.0			76.2	76.3	0.2
SW2501D_	SW-2501D	2/13/2026 10:10:18 AM	18.8	81.2	0.0	0.0			71.9	72.7	0.2
SW2501D_	SW-2501D	2/13/2026 10:11:48 AM	18.6	81.4	0.0	0.0			72.7	72.8	0.2
SW2501D_	SW-2501D	2/17/2026 9:55:47 AM	21.3	69.9	0.0	8.8			69.6	69.6	0.3
SW2501D_	SW-2501D	2/18/2026 9:54:15 AM	22.0	70.0	0.0	8.1			70.8	70.8	0.3
SW2501D_	SW-2501D	2/18/2026 9:56:46 AM	21.0	70.6	0.0	8.4			69.1	69.3	0.3
SW2501D_	SW-2501D	2/19/2026 9:36:51 AM	22.1	68.6	0.0	9.3			69.1	69.1	0.3
SW2501D_	SW-2501D	2/20/2026 9:48:02 AM	21.2	78.5	0.0	0.3			69.4	69.4	0.3
SW2501D_	SW-2501D	2/23/2026 8:55:36 AM	22.1	70.1	0.0	7.8			70.7	70.7	0.3
SW2501D_	SW-2501D	2/24/2026 8:54:55 AM	21.7	70.8	0.0	7.4			71.1	71.2	0.3
SW2501D_	SW-2501D	2/25/2026 8:51:42 AM	21.6	71.4	0.0	7.0			71.3	71.3	0.3
SW2501D_	SW-2501D	2/26/2026 1:17:11 PM	21.1	74.6	0.0	4.3			76.9	76.8	0.3
SW2501D_	SW-2501D	2/27/2026 9:36:46 AM	22.1	77.9	0.0	0.0			77.6	77.6	0.3
SW2501M_	SW-2501M	2/10/2026 1:17:48 PM	32.8	67.2	0.0	0.0			68.0	68.5	0.5
SW2501M_	SW-2501M	2/10/2026 1:19:25 PM	31.8	68.2	0.0	0.0			68.1	68.0	0.5
SW2501M_	SW-2501M	2/11/2026 10:43:07 AM	2.1	1.1	20.4	76.4			68.4	68.8	2.0
SW2501M_	SW-2501M	2/11/2026 10:44:17 AM	1.3	0.7	20.7	77.3			69.1	69.1	1.9
SW2501M_	SW-2501M	2/11/2026 3:02:49 PM	0.3	0.3	21.6	77.9			67.8	67.9	0.8
SW2501M_	SW-2501M	2/12/2026 12:18:55 PM	0.2	0.7	21.0	78.1			72.6	68.9	0.3
SW2501M_	SW-2501M	2/12/2026 12:19:44 PM	0.2	0.8	20.9	78.1			68.4	68.2	0.3
SW2501M_	SW-2501M	2/13/2026 10:01:06 AM	0.1	1.2	21.4	77.3			66.8	65.6	0.1
SW2501M_	SW-2501M	2/13/2026 10:02:28 AM	0.1	1.1	21.4	77.4			64.2	63.0	0.1
SW2501M_	SW-2501M	2/17/2026 9:49:21 AM	28.3	48.3	3.9	19.5			54.7	55.1	0.6
SW2501M_	SW-2501M	2/18/2026 9:42:53 AM	31.0	52.2	2.6	14.2			64.0	63.7	0.6
SW2501M_	SW-2501M	2/19/2026 9:31:44 AM	29.1	57.9	1.7	11.4			53.4	53.4	0.5
SW2501M_	SW-2501M	2/20/2026 9:33:51 AM	28.2	65.6	1.0	5.2			50.4	50.8	0.4
SW2501M_	SW-2501M	2/23/2026 8:47:56 AM	24.6	46.1	5.9	23.5			59.3	59.2	0.5
SW2501M_	SW-2501M	2/24/2026 8:46:08 AM	19.8	38.7	9.0	32.4			60.8	60.7	0.5

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
SW2501M_	SW-2501M	2/25/2026 8:43:37 AM	11.0	23.3	14.2	51.5			62.7	62.6	0.5
SW2501M_	SW-2501M	2/26/2026 1:31:29 PM	15.3	29.9	11.4	43.4			89.7	89.9	0.5
SW2501M_	SW-2501M	2/27/2026 9:44:55 AM	5.2	10.1	16.2	68.5			79.1	79.1	0.5
SW2501MD	SW-2501MD	2/10/2026 1:11:52 PM	22.0	77.9	0.1	0.0			71.2	73.2	0.3
SW2501MD	SW-2501MD	2/10/2026 1:13:45 PM	22.0	78.0	0.0	0.0			74.5	74.6	0.3
SW2501MD	SW-2501MD	2/11/2026 10:49:50 AM	23.5	59.8	2.7	14.0			73.7	74.7	0.4
SW2501MD	SW-2501MD	2/11/2026 10:50:55 AM	23.4	61.6	2.1	12.9			74.9	74.9	0.4
SW2501MD	SW-2501MD	2/11/2026 2:47:02 PM	23.9	58.8	2.8	14.5			74.4	74.5	0.4
SW2501MD	SW-2501MD	2/12/2026 12:23:08 PM	23.3	65.0	2.9	8.8			76.1	76.4	0.4
SW2501MD	SW-2501MD	2/12/2026 12:24:40 PM	22.6	65.2	2.9	9.3			76.5	76.7	0.3
SW2501MD	SW-2501MD	2/13/2026 10:04:47 AM	22.2	61.8	3.5	12.5			73.8	74.1	0.4
SW2501MD	SW-2501MD	2/13/2026 10:05:58 AM	20.7	62.4	3.9	13.0			74.2	74.2	0.3
SW2501MD	SW-2501MD	2/17/2026 9:53:32 AM	20.3	46.7	6.8	26.2			73.5	73.5	0.4
SW2501MD	SW-2501MD	2/18/2026 9:48:00 AM	25.2	55.5	3.0	16.3			72.6	72.9	0.5
SW2501MD	SW-2501MD	2/18/2026 9:50:32 AM	24.5	55.5	3.9	16.1			66.8	69.2	0.4
SW2501MD	SW-2501MD	2/19/2026 9:33:43 AM	23.1	54.3	3.8	18.9			70.9	70.9	0.4
SW2501MD	SW-2501MD	2/20/2026 9:36:50 AM	20.0	59.6	4.9	15.5			71.3	71.6	0.3
SW2501MD	SW-2501MD	2/23/2026 8:51:51 AM	22.8	53.1	4.3	19.8			72.5	72.5	0.4
SW2501MD	SW-2501MD	2/24/2026 8:49:57 AM	24.8	55.2	3.4	16.7			72.9	72.9	0.4
SW2501MD	SW-2501MD	2/25/2026 8:47:34 AM	24.6	57.0	3.1	15.3			72.4	72.4	0.4
SW2501MD	SW-2501MD	2/26/2026 1:09:39 PM	24.6	57.7	2.9	14.8			80.2	78.8	0.4
SW2501MD	SW-2501MD	2/26/2026 1:11:21 PM	24.4	58.4	2.9	14.3			77.8	77.7	0.4
SW2501MD	SW-2501MD	2/27/2026 9:42:13 AM	24.5	57.4	3.4	14.7			78.7	78.7	0.4
SW2501S_	SW-2501S	2/10/2026 1:06:32 PM	30.1	65.5	0.5	3.9			68.9	68.6	0.5
SW2501S_	SW-2501S	2/10/2026 1:08:08 PM	4.1	16.8	18.0	61.1			68.8	68.9	0.2
SW2501S_	SW-2501S	2/11/2026 11:05:04 AM	0.0	1.4	21.1	77.5			64.4	64.0	0.0
SW2501S_	SW-2501S	2/11/2026 11:06:25 AM	0.0	0.4	21.3	78.3			63.6	63.6	0.1
SW2501S_	SW-2501S	2/11/2026 3:00:35 PM	0.0	0.7	21.4	77.9			62.3	62.2	0.0
SW2501S_	SW-2501S	2/12/2026 12:33:59 PM	0.3	4.5	20.6	74.6			63.2	63.1	0.1

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
SW2501S_	SW-2501S	2/12/2026 12:35:26 PM	0.3	2.0	21.0	76.7			63.1	63.1	0.2
SW2501S_	SW-2501S	2/13/2026 10:14:27 AM	0.2	2.0	21.3	76.5			59.8	59.7	0.1
SW2501S_	SW-2501S	2/13/2026 10:15:03 AM	0.2	1.9	21.0	76.9			59.6	59.5	0.1
SW2501S_	SW-2501S	2/17/2026 10:00:09 AM	0.1	3.2	20.9	75.9			56.3	56.3	0.0
SW2501S_	SW-2501S	2/17/2026 10:02:25 AM	0.1	3.0	20.9	76.0			56.3	56.2	0.0
SW2501S_	SW-2501S	2/18/2026 10:02:41 AM	0.0	1.9	20.3	77.8			53.0	53.8	0.0
SW2501S_	SW-2501S	2/18/2026 10:03:38 AM	0.1	1.3	20.3	78.4			54.1	54.0	0.0
SW2501S_	SW-2501S	2/19/2026 9:44:57 AM	0.1	5.0	20.9	74.0			52.9	52.8	0.0
SW2501S_	SW-2501S	2/19/2026 9:45:30 AM	0.1	4.6	20.9	74.4			52.7	52.8	0.0
SW2501S_	SW-2501S	2/20/2026 9:42:30 AM	0.1	3.7	21.0	75.2			51.2	51.2	0.0
SW2501S_	SW-2501S	2/20/2026 9:44:24 AM	0.1	2.7	21.3	75.9			51.2	51.2	0.0
SW2501S_	SW-2501S	2/23/2026 9:01:06 AM	0.0	0.5	20.5	79.0			55.3	55.4	0.0
SW2501S_	SW-2501S	2/23/2026 9:04:31 AM	0.0	0.2	20.6	79.2			55.4	55.5	0.0
SW2501S_	SW-2501S	2/23/2026 9:07:34 AM	0.0	0.3	20.5	79.1			55.2	55.3	0.1
SW2501S_	SW-2501S	2/24/2026 8:59:22 AM	0.0	1.9	20.9	77.2			56.4	56.4	0.0
SW2501S_	SW-2501S	2/25/2026 8:58:58 AM	0.0	0.5	20.2	79.3			58.8	58.8	0.0
SW2501S_	SW-2501S	2/26/2026 1:24:14 PM	0.1	0.3	20.3	79.3			67.4	67.7	0.3
SW2501S_	SW-2501S	2/26/2026 1:25:46 PM	0.2	0.2	20.3	79.3			67.8	67.9	1.0
SW2501S_	SW-2501S	2/27/2026 9:39:54 AM	0.2	4.0	18.4	77.4			84.3	84.6	0.1
SW2502D_	SW-2502D	2/10/2026 1:41:33 PM	11.5	82.6	0.8	5.1			68.5	71.3	0.1
SW2502D_	SW-2502D	2/10/2026 1:43:44 PM	12.2	87.4	0.0	0.4			72.6	72.8	0.1
SW2502D_	SW-2502D	2/11/2026 3:54:05 PM	14.9	76.3	0.0	8.9			62.1	63.3	0.2
SW2502D_	SW-2502D	2/11/2026 3:55:54 PM	14.8	76.2	0.0	9.0			64.9	65.0	0.2
SW2502D_	SW-2502D	2/12/2026 12:59:36 PM	13.8	86.2	0.0	0.0			72.8	73.1	0.2
SW2502D_	SW-2502D	2/12/2026 1:01:37 PM	13.2	86.8	0.0	0.0			73.0	73.1	0.2
SW2502D_	SW-2502D	2/13/2026 9:44:39 AM	13.0	87.0	0.0	0.0			71.1	71.5	0.1
SW2502D_	SW-2502D	2/13/2026 9:46:00 AM	12.6	87.4	0.0	0.0			71.5	71.6	0.1
SW2502D_	SW-2502D	2/17/2026 9:36:13 AM	13.8	74.7	0.0	11.5			67.5	68.0	0.2
SW2502D_	SW-2502D	2/18/2026 9:29:59 AM	13.5	76.7	0.0	9.9			63.5	63.5	0.2

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
SW2502D_	SW-2502D	2/19/2026 9:21:56 AM	13.3	75.6	0.0	11.1			65.9	65.9	0.2
SW2502D_	SW-2502D	2/20/2026 9:24:21 AM	12.0	87.7	0.0	0.3			65.1	65.2	0.1
SW2502D_	SW-2502D	2/23/2026 8:35:43 AM	13.1	76.8	0.0	10.0			67.4	67.4	0.2
SW2502D_	SW-2502D	2/24/2026 9:19:10 AM	12.7	77.6	0.0	9.7			69.8	69.8	0.2
SW2502D_	SW-2502D	2/25/2026 8:31:46 AM	12.7	78.8	0.0	8.5			69.2	69.2	0.2
SW2502D_	SW-2502D	2/26/2026 1:46:42 PM	13.1	82.2	0.0	4.7			76.3	76.3	0.2
SW2502D_	SW-2502D	2/26/2026 1:48:21 PM	12.1	83.1	0.0	4.8			76.6	76.6	0.1
SW2502D_	SW-2502D	2/26/2026 1:52:01 PM	12.8	81.0	0.1	6.1			76.7	76.7	0.2
SW2502D_	SW-2502D	2/27/2026 9:23:37 AM	13.7	85.2	0.0	1.1			71.5	71.6	0.2
SW2502M_	SW-2502M	2/10/2026 1:35:18 PM	11.3	69.5	4.7	14.5			70.1	73.4	0.2
SW2502M_	SW-2502M	2/10/2026 1:36:29 PM	14.6	85.0	0.0	0.4			72.5	72.4	0.2
SW2502M_	SW-2502M	2/11/2026 3:49:17 PM	0.9	4.9	20.4	73.9			63.6	62.0	0.2
SW2502M_	SW-2502M	2/11/2026 4:05:30 PM	0.5	5.2	20.9	73.4			57.3	57.3	0.1
SW2502M_	SW-2502M	2/12/2026 12:52:50 PM	1.5	6.0	19.7	72.8			61.3	63.2	0.3
SW2502M_	SW-2502M	2/12/2026 12:54:33 PM	1.6	6.8	19.7	71.9			65.4	65.7	0.2
SW2502M_	SW-2502M	2/13/2026 9:39:15 AM	4.2	18.6	16.5	60.7			57.8	57.8	0.2
SW2502M_	SW-2502M	2/13/2026 9:41:06 AM	4.5	23.5	15.9	56.1			58.6	59.9	0.2
SW2502M_	SW-2502M	2/17/2026 9:32:43 AM	8.1	41.5	11.6	38.8			52.9	52.9	0.2
SW2502M_	SW-2502M	2/18/2026 9:24:02 AM	7.1	36.0	11.8	45.2			51.4	51.4	0.2
SW2502M_	SW-2502M	2/19/2026 9:17:41 AM	9.7	46.4	9.3	34.6			50.2	50.0	0.2
SW2502M_	SW-2502M	2/20/2026 9:21:24 AM	8.2	47.6	10.0	34.2			49.2	49.3	0.2
SW2502M_	SW-2502M	2/23/2026 8:32:09 AM	11.2	49.6	7.4	31.7			51.7	51.8	0.2
SW2502M_	SW-2502M	2/24/2026 9:12:36 AM	12.2	55.5	6.9	25.4			58.1	58.2	0.2
SW2502M_	SW-2502M	2/25/2026 8:27:44 AM	9.5	47.6	9.0	33.9			61.4	61.4	0.2
SW2502M_	SW-2502M	2/26/2026 2:11:50 PM	16.5	77.2	0.0	6.3			84.6	84.9	0.2
SW2502M_	SW-2502M	2/26/2026 2:13:37 PM	16.1	77.7	0.0	6.2			85.9	86.6	0.2
SW2502M_	SW-2502M	2/27/2026 9:26:12 AM	17.2	82.8	0.0	0.0			78.5	78.5	0.2
SW2502MD	SW-2502MD	2/10/2026 1:47:31 PM	9.8	74.1	3.8	12.3			70.5	69.8	0.1
SW2502MD	SW-2502MD	2/10/2026 1:49:28 PM	12.0	84.9	0.0	3.1			69.4	69.3	0.1

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
SW2502MD	SW-2502MD	2/11/2026 4:01:21 PM	19.6	71.9	0.0	8.5			60.7	60.8	0.3
SW2502MD	SW-2502MD	2/11/2026 4:02:25 PM	19.6	72.9	0.0	7.5			61.4	61.5	0.3
SW2502MD	SW-2502MD	2/12/2026 1:05:36 PM	16.9	83.1	0.0	0.0			74.4	74.7	0.2
SW2502MD	SW-2502MD	2/12/2026 1:06:53 PM	16.8	83.2	0.0	0.0			74.8	74.8	0.2
SW2502MD	SW-2502MD	2/13/2026 9:48:20 AM	16.5	79.2	1.1	3.2			74.2	74.4	0.2
SW2502MD	SW-2502MD	2/13/2026 9:53:05 AM	16.2	78.5	1.1	4.2			74.4	74.5	0.2
SW2502MD	SW-2502MD	2/17/2026 9:41:02 AM	20.8	64.7	0.8	13.8			71.8	71.9	0.3
SW2502MD	SW-2502MD	2/18/2026 9:33:49 AM	20.3	70.6	0.0	9.1			67.9	67.5	0.3
SW2502MD	SW-2502MD	2/19/2026 9:24:25 AM	18.2	71.4	0.0	10.5			69.5	69.6	0.3
SW2502MD	SW-2502MD	2/20/2026 9:26:56 AM	16.7	83.3	0.0	0.0			69.0	69.2	0.2
SW2502MD	SW-2502MD	2/23/2026 8:39:44 AM	19.9	68.6	0.0	11.5			72.5	72.4	0.3
SW2502MD	SW-2502MD	2/24/2026 9:24:07 AM	19.0	69.3	0.0	11.7			72.1	72.0	0.3
SW2502MD	SW-2502MD	2/25/2026 8:36:05 AM	18.4	70.0	0.3	11.4			69.7	69.8	0.3
SW2502MD	SW-2502MD	2/26/2026 1:42:16 PM	19.4	73.9	0.0	6.7			77.5	77.5	0.3
SW2502MD	SW-2502MD	2/27/2026 9:20:53 AM	20.6	75.7	0.0	3.7			68.5	68.5	0.3
SW2502S_	SW-2502S	2/10/2026 1:28:48 PM	15.4	74.0	2.4	8.2			72.5		0.2
SW2502S_	SW-2502S	2/10/2026 1:30:20 PM	8.8	62.5	8.4	20.3			72.7	72.7	0.1
SW2502S_	SW-2502S	2/11/2026 3:42:05 PM	0.2	0.6	21.3	77.9			67.0	66.7	0.4
SW2502S_	SW-2502S	2/11/2026 3:45:09 PM	2.6	10.9	18.2	68.2			66.1	66.1	0.2
SW2502S_	SW-2502S	2/12/2026 12:46:40 PM	1.0	0.5	20.7	77.8			65.8	65.8	2.0
SW2502S_	SW-2502S	2/12/2026 12:48:02 PM	1.6	1.3	20.4	76.7			65.9	65.9	1.2
SW2502S_	SW-2502S	2/13/2026 9:35:05 AM	0.3	0.8	21.0	77.9			65.6	65.6	0.4
SW2502S_	SW-2502S	2/13/2026 9:37:13 AM	0.2	0.3	21.1	78.4			65.8	65.8	0.7
SW2502S_	SW-2502S	2/17/2026 9:28:16 AM	0.4	1.2	20.4	78.1			64.2	60.6	0.3
SW2502S_	SW-2502S	2/17/2026 9:29:27 AM	0.3	0.5	20.6	78.6			63.9	63.9	0.7
SW2502S_	SW-2502S	2/18/2026 9:19:37 AM	0.6	0.5	20.4	78.6			61.6	61.7	1.2
SW2502S_	SW-2502S	2/18/2026 9:20:53 AM	0.6	0.4	20.4	78.6			61.7	61.8	1.7
SW2502S_	SW-2502S	2/19/2026 9:14:04 AM	0.2	0.4	20.9	78.5			60.6	61.2	0.5
SW2502S_	SW-2502S	2/19/2026 9:40:46 AM	0.1	5.8	20.6	73.5			52.6	53.0	0.0

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
SW2502S_	SW-2502S	2/20/2026 9:18:11 AM	1.4	2.5	19.7	76.4			60.0	60.3	0.6
SW2502S_	SW-2502S	2/23/2026 8:28:33 AM	0.3	0.3	20.1	79.3			62.9	62.9	1.1
SW2502S_	SW-2502S	2/24/2026 9:07:11 AM	0.5	0.9	20.8	77.8			64.9	64.9	0.6
SW2502S_	SW-2502S	2/24/2026 9:09:02 AM	0.6	0.8	20.9	77.8			64.4	64.6	0.7
SW2502S_	SW-2502S	2/25/2026 8:25:11 AM	0.6	1.7	20.4	77.3			65.9	65.9	0.3
SW2502S_	SW-2502S	2/26/2026 2:18:24 PM	0.9	1.6	20.0	77.5			70.7	70.8	0.6
SW2502S_	SW-2502S	2/26/2026 2:19:25 PM	1.1	1.7	19.9	77.3			70.7	70.8	0.6
SW2502S_	SW-2502S	2/27/2026 9:29:54 AM	0.6	3.3	18.2	77.9			85.3	85.1	0.2
SW2503D_	SW-2503D	2/10/2026 9:05:34 AM	3.1	1.7	20.3	74.9			68.8	69.2	1.8
SW2503D_	SW-2503D	2/10/2026 9:07:15 AM	7.4	4.4	17.9	70.3			68.8	68.9	1.7
SW2503D_	SW-2503D	2/11/2026 9:11:14 AM	30.2	23.4	5.9	40.6			60.7	61.8	1.3
SW2503D_	SW-2503D	2/11/2026 9:12:37 AM	30.3	24.3	5.8	39.7			61.2	61.3	1.2
SW2503D_	SW-2503D	2/11/2026 1:34:50 PM	0.0	0.1	20.4	79.6			73.6	73.7	0.3
SW2503D_	SW-2503D	2/12/2026 9:27:38 AM	9.7	5.0	16.1	69.2			63.8	65.2	1.9
SW2503D_	SW-2503D	2/12/2026 9:33:43 AM	10.2	5.6	15.7	68.5			69.2	71.4	1.8
SW2503D_	SW-2503D	2/13/2026 8:12:15 AM	14.0	6.5	12.3	67.2			59.9	59.2	2.2
SW2503D_	SW-2503D	2/13/2026 8:13:48 AM	13.3	6.2	12.3	68.2			59.0	59.1	2.1
SW2503D_	SW-2503D	2/17/2026 8:29:50 AM	13.1	4.5	12.5	69.9			61.6	61.3	2.9
SW2503D_	SW-2503D	2/18/2026 8:30:45 AM	32.6	26.4	2.6	38.4			54.9	54.9	1.2
SW2503D_	SW-2503D	2/19/2026 7:24:48 AM	28.2	17.8	4.0	50.0			54.2	54.1	1.6
SW2503D_	SW-2503D	2/20/2026 8:23:39 AM	25.9	24.4	4.4	45.3			52.0	52.0	1.1
SW2503D_	SW-2503D	2/20/2026 8:25:34 AM	27.0	24.7	4.0	44.3			52.0	52.0	1.1
SW2503D_	SW-2503D	2/23/2026 7:57:02 AM	28.7	25.0	3.9	42.5			58.4	58.4	1.1
SW2503D_	SW-2503D	2/24/2026 10:21:13 AM	28.6	22.6	3.7	45.1			65.9	65.6	1.3
SW2503D_	SW-2503D	2/24/2026 12:17:56 PM	11.7	6.0	13.5	68.9			70.5	70.5	2.0
SW2503D_	SW-2503D	2/25/2026 8:01:47 AM	13.3	7.8	13.9	65.0			62.2	61.8	1.7
SW2503D_	SW-2503D	2/26/2026 9:50:34 AM	25.6	22.3	5.2	46.2			71.3	71.4	1.1
SW2503D_	SW-2503D	2/26/2026 9:53:34 AM	25.5	22.6	5.1	46.0			73.5	73.7	1.1
SW2503D_	SW-2503D	2/27/2026 8:37:59 AM	22.6	14.3	4.9	58.2			75.3	74.7	1.6

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
SW2503M_	SW-2503M	2/10/2026 9:21:32 AM	2.7	3.8	19.3	74.2			64.0	63.3	0.7
SW2503M_	SW-2503M	2/10/2026 9:23:04 AM	2.8	3.9	19.2	74.1			62.9	62.8	0.7
SW2503M_	SW-2503M	2/11/2026 9:27:31 AM	39.9	40.5	3.0	16.7			60.5	60.3	1.0
SW2503M_	SW-2503M	2/11/2026 9:29:14 AM	1.8	2.9	20.0	75.3			60.7	60.7	0.6
SW2503M_	SW-2503M	2/11/2026 1:42:06 PM	1.2	0.5	20.0	78.3			65.6	65.6	2.2
SW2503M_	SW-2503M	2/12/2026 9:43:10 AM	1.7	2.0	21.7	74.6			63.3	61.8	0.9
SW2503M_	SW-2503M	2/12/2026 9:46:47 AM	1.8	1.8	21.4	75.0			61.0	59.6	1.0
SW2503M_	SW-2503M	2/13/2026 8:21:46 AM	27.1	17.6	10.2	45.1			57.6	57.4	1.5
SW2503M_	SW-2503M	2/13/2026 8:24:39 AM	29.6	19.4	9.1	41.9			57.1	56.9	1.5
SW2503M_	SW-2503M	2/17/2026 8:37:04 AM	32.0	34.6	6.5	27.0			59.8	59.8	0.9
SW2503M_	SW-2503M	2/18/2026 8:40:16 AM	4.6	3.9	19.2	72.3			51.5	51.5	1.2
SW2503M_	SW-2503M	2/19/2026 7:32:08 AM	3.3	2.6	20.9	73.2			53.5	53.6	1.3
SW2503M_	SW-2503M	2/20/2026 8:35:26 AM	6.0	13.6	16.4	64.0			69.0	69.2	0.4
SW2503M_	SW-2503M	2/20/2026 8:54:05 AM	8.6	1.7	16.9	72.8			50.5	50.5	5.1
SW2503M_	SW-2503M	2/23/2026 8:06:39 AM	18.7	27.2	10.4	43.7			58.3	58.4	0.7
SW2503M_	SW-2503M	2/24/2026 10:34:14 AM	21.2	32.9	8.2	37.7			69.1	68.7	0.6
SW2503M_	SW-2503M	2/24/2026 12:10:38 PM	5.2	5.4	17.2	72.2			69.4	69.2	1.0
SW2503M_	SW-2503M	2/25/2026 8:10:43 AM	3.8	3.4	19.9	73.0			62.7	62.6	1.1
SW2503M_	SW-2503M	2/26/2026 10:20:42 AM	0.2	0.9	20.0	78.9			75.1	74.9	0.2
SW2503M_	SW-2503M	2/26/2026 10:23:24 AM	1.7	0.8	19.1	78.4			74.2	74.1	2.1
SW2503M_	SW-2503M	2/27/2026 8:45:19 AM	4.7	6.6	17.6	71.1			73.4	73.4	0.7
SW2503MD	SW-2503MD	2/10/2026 9:12:42 AM	0.0	0.2	21.8	78.0			64.2	63.8	0.0
SW2503MD	SW-2503MD	2/10/2026 9:14:40 AM	0.0	0.1	21.8	78.1			63.7	63.7	0.0
SW2503MD	SW-2503MD	2/11/2026 9:18:45 AM	3.4	2.8	19.8	74.1			63.1	63.5	1.2
SW2503MD	SW-2503MD	2/11/2026 9:20:16 AM	31.1	27.9	7.4	33.6			62.3	62.3	1.1
SW2503MD	SW-2503MD	2/11/2026 1:38:41 PM	15.4	9.4	14.2	61.0			72.1	72.2	1.6
SW2503MD	SW-2503MD	2/12/2026 9:37:04 AM	6.8	6.0	19.2	68.0			75.5	75.7	1.1
SW2503MD	SW-2503MD	2/12/2026 9:38:57 AM	6.8	6.0	19.1	68.1			75.8	75.8	1.1
SW2503MD	SW-2503MD	2/13/2026 8:16:05 AM	7.8	6.4	18.4	67.4			73.2	74.1	1.2

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
SW2503MD	SW-2503MD	2/13/2026 8:17:14 AM	7.9	6.5	18.4	67.2			74.3	74.3	1.2
SW2503MD	SW-2503MD	2/17/2026 8:32:55 AM	4.3	2.5	19.6	73.7			72.2	72.9	1.8
SW2503MD	SW-2503MD	2/18/2026 8:35:32 AM	34.3	36.9	4.9	23.9			57.6	57.7	0.9
SW2503MD	SW-2503MD	2/19/2026 7:27:14 AM	32.4	33.0	6.9	27.7			64.9	65.1	1.0
SW2503MD	SW-2503MD	2/20/2026 8:28:30 AM	28.7	33.4	6.5	31.4			60.0	61.2	0.9
SW2503MD	SW-2503MD	2/20/2026 8:29:56 AM	28.2	35.1	6.5	30.2			61.6	61.7	0.8
SW2503MD	SW-2503MD	2/20/2026 8:49:42 AM	2.8	12.6	13.1	71.5			55.6	55.6	0.2
SW2503MD	SW-2503MD	2/23/2026 8:01:09 AM	29.1	33.2	7.1	30.6			68.0	68.0	0.9
SW2503MD	SW-2503MD	2/24/2026 10:28:27 AM	31.4	33.5	6.2	28.9			77.0	77.2	0.9
SW2503MD	SW-2503MD	2/24/2026 12:14:34 PM	28.1	32.7	6.7	32.6			73.9	73.9	0.9
SW2503MD	SW-2503MD	2/25/2026 8:06:15 AM	18.0	27.2	10.4	44.4			64.0	64.0	0.7
SW2503MD	SW-2503MD	2/26/2026 10:00:12 AM	21.7	27.7	8.5	41.5			75.6	75.7	0.8
SW2503MD	SW-2503MD	2/26/2026 10:02:39 AM	22.1	27.2	8.4	41.6			76.4	76.3	0.8
SW2503MD	SW-2503MD	2/27/2026 8:40:39 AM	19.5	21.9	10.5	48.1			76.4	76.4	0.9
SW2503S_	SW-2503S	2/10/2026 9:29:19 AM	11.0	20.4	12.8	55.8			63.2	65.2	0.5
SW2503S_	SW-2503S	2/10/2026 9:31:11 AM	1.5	8.7	19.2	70.6			69.5	69.7	0.2
SW2503S_	SW-2503S	2/11/2026 9:33:30 AM	0.7	0.4	19.4	79.5			61.7	63.4	2.0
SW2503S_	SW-2503S	2/11/2026 9:34:40 AM	0.7	0.2	19.6	79.6			65.5	65.7	4.6
SW2503S_	SW-2503S	2/11/2026 1:46:13 PM	0.8	0.2	20.0	79.0			75.1	75.1	4.1
SW2503S_	SW-2503S	2/12/2026 9:49:21 AM	1.4	1.4	21.4	75.8			79.3	80.7	1.0
SW2503S_	SW-2503S	2/12/2026 9:50:34 AM	1.5	1.5	21.2	75.8			81.1	81.2	1.0
SW2503S_	SW-2503S	2/13/2026 8:27:37 AM	2.1	3.8	20.4	73.7			81.2	82.0	0.6
SW2503S_	SW-2503S	2/13/2026 8:29:18 AM	2.1	3.2	20.5	74.2			82.3	82.4	0.7
SW2503S_	SW-2503S	2/17/2026 8:43:23 AM	2.2	3.0	19.9	74.9			80.6	81.1	0.7
SW2503S_	SW-2503S	2/17/2026 8:47:03 AM	2.3	3.2	19.8	74.8			80.1	80.5	0.7
SW2503S_	SW-2503S	2/18/2026 8:44:08 AM	6.7	9.9	16.4	67.1			57.1	57.2	0.7
SW2503S_	SW-2503S	2/19/2026 7:36:08 AM	5.7	7.9	18.0	68.5			62.8	62.9	0.7
SW2503S_	SW-2503S	2/20/2026 8:38:16 AM	6.8	12.7	16.2	64.3			55.9	55.7	0.5
SW2503S_	SW-2503S	2/20/2026 8:56:26 AM	2.8	1.0	19.6	76.6			67.2	67.7	2.8

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
SW2503S_	SW-2503S	2/23/2026 8:10:10 AM	5.0	11.3	17.7	66.0			77.2	77.2	0.4
SW2503S_	SW-2503S	2/24/2026 12:08:04 PM	5.8	11.0	15.8	67.4			79.8	79.8	0.5
SW2503S_	SW-2503S	2/25/2026 8:15:00 AM	4.7	7.9	17.8	69.6			77.6	77.6	0.6
SW2503S_	SW-2503S	2/26/2026 10:10:28 AM	5.3	9.8	16.5	68.3			81.7	81.9	0.5
SW2503S_	SW-2503S	2/26/2026 10:12:35 AM	5.3	10.0	16.5	68.2			81.8	81.8	0.5
SW2503S_	SW-2503S	2/27/2026 8:42:55 AM	3.8	9.3	16.8	70.1			74.3	74.2	0.4
SW2504D_	SW-2504D	2/10/2026 8:24:30 AM	0.0	0.0	22.1	77.9			66.5	68.1	
SW2504D_	SW-2504D	2/10/2026 8:26:21 AM	0.0	0.0	22.0	78.0			71.0	70.7	
SW2504D_	SW-2504D	2/11/2026 8:31:40 AM	0.0	0.1	21.8	78.2			67.5	75.7	0.0
SW2504D_	SW-2504D	2/11/2026 8:33:09 AM	0.1	0.1	21.1	78.7			77.2	77.3	0.8
SW2504D_	SW-2504D	2/12/2026 8:59:01 AM	0.1	3.2	20.4	76.3			78.5	78.6	0.0
SW2504D_	SW-2504D	2/12/2026 9:00:48 AM	0.1	3.1	20.1	76.7			78.8	78.8	0.0
SW2504D_	SW-2504D	2/13/2026 7:39:28 AM	0.0	1.2	21.3	77.5			78.0	78.1	0.0
SW2504D_	SW-2504D	2/13/2026 7:40:46 AM	0.0	1.2	20.8	78.0			78.3	78.1	0.0
SW2504D_	SW-2504D	2/17/2026 8:05:34 AM	0.1	2.2	19.8	78.0			76.0	76.1	0.0
SW2504D_	SW-2504D	2/17/2026 8:06:51 AM	0.2	1.5	19.8	78.5			76.3	76.3	0.1
SW2504D_	SW-2504D	2/18/2026 7:43:14 AM	1.5	6.5	15.3	76.7					0.2
SW2504D_	SW-2504D	2/18/2026 8:15:28 AM	1.2	4.7	16.3	77.9			62.2	62.3	0.2
SW2504D_	SW-2504D	2/19/2026 7:04:06 AM	0.4	0.6	19.9	79.1			74.2	74.2	0.7
SW2504D_	SW-2504D	2/20/2026 8:46:30 AM	0.9	6.1	17.1	75.9			71.3	71.6	0.1
SW2504D_	SW-2504D	2/23/2026 7:24:32 AM	0.1	0.8	21.3	77.8			75.4	75.4	0.1
SW2504D_	SW-2504D	2/23/2026 7:26:42 AM	0.1	0.8	21.4	77.7			74.2	74.5	0.1
SW2504D_	SW-2504D	2/24/2026 10:00:03 AM	0.2	1.3	19.4	79.1			75.4	75.4	0.1
SW2504D_	SW-2504D	2/25/2026 7:42:07 AM	0.1	0.6	20.9	78.4			75.0	75.0	0.2
SW2504D_	SW-2504D	2/26/2026 8:58:41 AM	0.3	0.8	19.4	79.5			76.9	76.9	0.4
SW2504D_	SW-2504D	2/26/2026 9:03:25 AM	0.3	0.9	19.2	79.6			77.1	77.1	0.3
SW2504D_	SW-2504D	2/27/2026 8:23:24 AM	0.3	2.6	19.6	77.5			74.2	74.3	0.1
SW2504M_	SW-2504M	2/10/2026 8:40:05 AM	39.1	4.7	3.9	52.3			63.4	63.6	8.3
SW2504M_	SW-2504M	2/10/2026 8:42:13 AM	37.4	4.8	4.4	53.4			62.9	62.8	7.8

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
SW2504M_	SW-2504M	2/11/2026 8:46:22 AM	40.2	3.7	5.1	51.1			61.3	63.3	10.9
SW2504M_	SW-2504M	2/11/2026 8:47:59 AM	45.2	4.5	2.9	47.3			62.7	62.7	10.1
SW2504M_	SW-2504M	2/12/2026 9:06:10 AM	42.4	5.8	2.5	49.3			62.1	60.5	7.3
SW2504M_	SW-2504M	2/12/2026 9:07:46 AM	42.6	6.0	2.3	49.1			60.0	59.8	7.1
SW2504M_	SW-2504M	2/13/2026 7:45:15 AM	40.3	5.1	3.3	51.3			62.3	61.4	7.9
SW2504M_	SW-2504M	2/13/2026 7:47:29 AM	39.8	5.4	3.1	51.7			61.2	60.7	7.4
SW2504M_	SW-2504M	2/17/2026 8:15:53 AM	44.2	4.8	2.1	48.8			58.9	58.9	9.2
SW2504M_	SW-2504M	2/18/2026 8:08:42 AM	10.5	0.8	17.2	71.4			47.8	47.8	13.2
SW2504M_	SW-2504M	2/19/2026 7:11:37 AM	10.8	1.2	17.5	70.5			49.9	50.1	9.0
SW2504M_	SW-2504M	2/23/2026 7:36:04 AM	9.2	0.6	18.8	71.4			58.0	57.9	15.1
SW2504M_	SW-2504M	2/24/2026 10:08:30 AM	9.4	0.7	17.0	72.9			64.8	64.8	13.7
SW2504M_	SW-2504M	2/25/2026 7:50:15 AM	9.3	0.9	18.2	71.7			60.6	60.5	9.8
SW2504M_	SW-2504M	2/26/2026 9:16:34 AM	8.7	0.7	17.0	73.6			75.1	74.8	12.4
SW2504M_	SW-2504M	2/26/2026 9:19:30 AM	9.1	0.7	16.9	73.3			74.2	74.2	13.0
SW2504M_	SW-2504M	2/27/2026 8:29:16 AM	11.0	2.4	15.8	70.8			71.5	71.5	4.6
SW2504MD	SW-2504MD	2/10/2026 8:15:47 AM	0.0	0.1	22.4	77.5			65.3	66.9	0.0
SW2504MD	SW-2504MD	2/10/2026 8:17:19 AM	0.0	0.0	22.2	77.8			65.1	65.0	
SW2504MD	SW-2504MD	2/11/2026 8:39:07 AM	0.0	0.0	21.6	78.4			62.8	62.9	0.0
SW2504MD	SW-2504MD	2/11/2026 8:40:44 AM	0.0	0.0	21.6	78.4			63.0	63.0	0.0
SW2504MD	SW-2504MD	2/12/2026 9:16:25 AM	0.2	0.2	22.6	77.0			57.4	56.0	1.0
SW2504MD	SW-2504MD	2/12/2026 9:17:45 AM	0.2	0.2	22.4	77.2			55.3	54.9	1.0
SW2504MD	SW-2504MD	2/13/2026 7:59:28 AM	0.1	0.3	21.9	77.7			57.4	55.1	0.3
SW2504MD	SW-2504MD	2/13/2026 8:01:10 AM	0.1	0.2	21.5	78.2			54.4	54.3	0.5
SW2504MD	SW-2504MD	2/13/2026 8:02:42 AM	0.1	0.3	21.6	78.0			54.3	54.3	0.3
SW2504MD	SW-2504MD	2/17/2026 8:10:26 AM	2.9	9.4	14.2	73.5			61.8	61.9	0.3
SW2504MD	SW-2504MD	2/18/2026 7:48:20 AM	4.4	14.6	11.9	69.2					0.3
SW2504MD	SW-2504MD	2/18/2026 8:12:51 AM	4.5	14.4	11.5	69.7			49.9	50.0	0.3
SW2504MD	SW-2504MD	2/19/2026 7:07:38 AM	3.2	10.9	14.0	71.9			58.4	58.3	0.3
SW2504MD	SW-2504MD	2/23/2026 7:31:11 AM	2.2	9.0	15.3	73.4			59.8	59.9	0.2

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
SW2504MD	SW-2504MD	2/24/2026 10:04:36 AM	2.5	10.5	13.8	73.2			66.0	65.9	0.2
SW2504MD	SW-2504MD	2/25/2026 7:46:12 AM	2.7	11.0	14.8	71.5			63.9	63.9	0.2
SW2504MD	SW-2504MD	2/26/2026 9:08:45 AM	3.0	12.0	13.7	71.3			70.5	70.5	0.3
SW2504MD	SW-2504MD	2/26/2026 9:11:13 AM	3.1	12.8	13.4	70.6			71.1	71.1	0.2
SW2504MD	SW-2504MD	2/27/2026 8:26:16 AM	2.7	12.9	14.0	70.4			71.5	71.4	0.2
SW2504S_	SW-2504S	2/10/2026 8:32:20 AM	0.0	0.0	21.8	78.2			65.1	64.9	
SW2504S_	SW-2504S	2/10/2026 8:33:47 AM	0.0	0.0	21.7	78.3			64.7	64.6	
SW2504S_	SW-2504S	2/11/2026 8:53:14 AM	0.7	0.4	20.8	78.1			60.4	69.7	1.6
SW2504S_	SW-2504S	2/11/2026 8:54:35 AM	1.2	0.5	20.5	77.9			70.9	71.1	2.6
SW2504S_	SW-2504S	2/12/2026 9:11:36 AM	2.0	1.0	21.3	75.7			72.3	72.4	2.0
SW2504S_	SW-2504S	2/12/2026 9:13:17 AM	1.9	0.8	21.2	76.1			72.5	72.6	2.4
SW2504S_	SW-2504S	2/13/2026 7:52:32 AM	2.8	0.8	19.9	76.5			73.7	74.2	3.5
SW2504S_	SW-2504S	2/13/2026 7:53:40 AM	3.3	0.8	20.1	75.8			74.5	74.7	4.1
SW2504S_	SW-2504S	2/17/2026 8:19:49 AM	2.4	0.5	20.3	76.9			71.2	71.3	5.1
SW2504S_	SW-2504S	2/18/2026 8:04:20 AM	4.5	1.2	19.5	74.8			63.4	63.5	3.8
SW2504S_	SW-2504S	2/19/2026 7:15:35 AM	3.6	0.5	20.6	75.3			69.9	69.9	7.5
SW2504S_	SW-2504S	2/23/2026 7:42:03 AM	2.6	0.4	21.0	76.0			71.2	71.2	6.4
SW2504S_	SW-2504S	2/24/2026 10:12:38 AM	3.3	0.4	18.8	77.6			73.8	74.1	9.0
SW2504S_	SW-2504S	2/25/2026 7:52:45 AM	1.4	0.4	20.6	77.6			70.5	70.7	3.8
SW2504S_	SW-2504S	2/26/2026 9:25:43 AM	1.0	0.2	19.7	79.1			76.2	76.4	5.0
SW2504S_	SW-2504S	2/26/2026 9:36:14 AM	0.5	0.2	19.7	79.6			75.9	76.0	2.5
SW2504S_	SW-2504S	2/27/2026 8:33:36 AM	3.2	1.4	18.7	76.7			76.5	76.6	2.3
CHISW030	SW-30	2/10/2026 12:44:38 PM	17.5	73.1	0.0	9.4			69.4	69.6	0.2
CHISW030	SW-30	2/11/2026 4:17:04 PM	19.5	63.0	0.0	17.5			68.4	69.0	0.3
CHISW030	SW-30	2/11/2026 4:17:58 PM	19.2	63.7	0.0	17.1			69.4	69.5	0.3
CHISW030	SW-30	2/12/2026 1:15:13 PM	18.3	70.1	0.0	11.6			83.9	84.7	0.3
CHISW030	SW-30	2/12/2026 1:16:48 PM	18.2	70.4	0.0	11.4			84.9	85.0	0.3
CHISW030	SW-30	2/13/2026 1:14:51 PM	17.1	69.1	0.5	13.3			83.8	84.1	0.2
CHISW030	SW-30	2/13/2026 1:15:46 PM	17.2	67.4	1.3	14.1			85.0	85.4	0.3

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHISW030	SW-30	2/17/2026 1:11:08 PM	22.3	62.0	0.0	15.7			58.5	58.5	0.4
CHISW030	SW-30	2/17/2026 1:14:20 PM	2.9	12.2	18.3	66.7			58.4	58.4	0.2
CHISW030	SW-30	2/17/2026 1:14:44 PM	3.1	12.0	18.1	66.8			58.4	58.4	0.3
CHISW030	SW-30	2/18/2026 11:53:14 AM	5.9	20.0	15.5	58.6			67.3	67.8	0.3
CHISW030	SW-30	2/19/2026 9:55:14 AM	16.3	49.8	4.9	29.0			44.8	44.8	0.3
CHISW030	SW-30	2/20/2026 12:48:39 PM	3.8	14.6	16.3	65.3			68.9	70.1	0.3
CHISW030	SW-30	2/23/2026 9:23:49 AM	1.1	1.5	19.4	78.1			75.6	76.2	0.8
CHISW030	SW-30	2/24/2026 9:35:41 AM	6.0	13.7	15.9	64.4			80.2	80.4	0.4
CHISW030	SW-30	2/25/2026 9:11:58 AM	5.9	18.9	14.3	60.9			84.1	84.3	0.3
CHISW030	SW-30	2/26/2026 12:55:12 PM	8.0	17.8	13.9	60.3			90.9	91.0	0.4
CHISW030	SW-30	2/27/2026 9:14:29 AM	1.7	8.2	17.5	72.6			88.5	88.7	0.2
CHISW032	SW-32	2/10/2026 12:37:13 PM	33.7	57.9	0.6	7.8			68.3	62.9	0.6
CHISW032	SW-32	2/11/2026 4:29:41 PM	38.0	56.5	0.2	5.3			63.5	63.5	0.7
CHISW032	SW-32	2/11/2026 4:31:12 PM	36.9	57.3	0.0	5.7			63.5	63.5	0.6
CHISW032	SW-32	2/12/2026 1:21:32 PM	35.8	63.4	0.0	0.8			82.6	82.6	0.6
CHISW032	SW-32	2/12/2026 1:22:29 PM	34.8	65.2	0.0	0.0			82.5	82.6	0.5
CHISW032	SW-32	2/13/2026 1:08:00 PM	31.2	59.5	1.1	8.2			81.5	79.9	0.5
CHISW032	SW-32	2/13/2026 1:10:01 PM	31.7	56.8	0.8	10.7			79.7	77.3	0.6
CHISW032	SW-32	2/17/2026 12:53:44 PM	37.7	55.1	0.5	6.8			59.9	59.9	0.7
CHISW032	SW-32	2/17/2026 12:55:29 PM	36.8	55.9	0.3	6.9			59.9	59.9	0.7
CHISW032	SW-32	2/18/2026 12:00:36 PM	37.1	56.4	0.0	6.5			71.0	56.4	0.7
CHISW032	SW-32	2/18/2026 12:01:35 PM	36.4	57.3	0.0	6.3			71.0	71.0	0.6
CHISW032	SW-32	2/19/2026 10:01:54 AM	35.4	53.9	0.8	9.9			46.0	46.0	0.7
CHISW032	SW-32	2/19/2026 10:02:40 AM	34.6	54.2	1.3	9.9			46.0	45.9	0.6
CHISW032	SW-32	2/20/2026 12:42:32 PM	0.0	0.2	20.4	79.4			79.0	58.2	0.0
CHISW032	SW-32	2/23/2026 9:19:42 AM	24.1	41.4	6.7	27.8			82.0	82.8	0.6
CHISW032	SW-32	2/24/2026 9:39:42 AM	32.4	52.8	2.9	12.0			75.8	75.8	0.6
CHISW032	SW-32	2/25/2026 9:06:41 AM	34.3	54.2	1.6	9.9			75.3	75.3	0.6
CHISW032	SW-32	2/26/2026 1:02:43 PM	37.5	56.3	0.3	5.9			89.3	89.3	0.7

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHISW032	SW-32	2/27/2026 9:09:05 AM	38.9	58.0	0.3	2.8			84.9	84.5	0.7
CHISW064	SW-64	2/10/2026 12:42:08 PM	5.9	40.6	11.5	42.0			68.8	68.1	0.1
CHISW064	SW-64	2/11/2026 4:12:03 PM	8.8	53.4	8.4	29.4			64.2	63.4	0.2
CHISW064	SW-64	2/11/2026 4:13:20 PM	2.4	13.9	17.6	66.1			63.7	63.7	0.2
CHISW064	SW-64	2/12/2026 1:11:02 PM	8.8	60.4	6.2	24.6			82.2	83.4	0.1
CHISW064	SW-64	2/12/2026 1:11:37 PM	9.2	65.6	6.1	19.1			83.5	83.8	0.1
CHISW064	SW-64	2/13/2026 1:12:25 PM	12.8	85.2	0.3	1.7			84.8	85.3	0.2
CHISW064	SW-64	2/17/2026 1:02:02 PM	9.2	56.0	7.3	27.5			58.4	58.3	0.2
CHISW064	SW-64	2/17/2026 1:05:40 PM	6.8	47.1	10.1	36.0			58.3	58.3	0.1
CHISW064	SW-64	2/18/2026 11:49:44 AM	13.1	68.9	2.1	15.9			68.8	69.6	0.2
CHISW064	SW-64	2/19/2026 9:52:59 AM	14.4	76.5	0.0	9.1			44.8	44.8	0.2
CHISW064	SW-64	2/20/2026 12:45:51 PM	12.1	82.6	1.1	4.2			74.0	74.2	0.1
CHISW064	SW-64	2/23/2026 9:25:50 AM	14.2	77.5	0.0	8.3			80.4	81.0	0.2
CHISW064	SW-64	2/24/2026 9:32:57 AM	14.2	77.2	0.5	8.1			85.4	85.3	0.2
CHISW064	SW-64	2/25/2026 9:09:29 AM	13.6	78.7	0.0	7.7			86.8	86.9	0.2
CHISW064	SW-64	2/26/2026 12:51:21 PM	13.9	84.6	0.0	1.5			91.7	91.9	0.2
CHISW064	SW-64	2/27/2026 9:12:04 AM	15.3	84.7	0.0	0.0			85.8	86.0	0.2
CHISW065	SW-65	2/25/2026 10:08:50 AM	51.4	38.0	0.0	10.6			84.9	85.2	1.4
CHISW066	SW-66	2/25/2026 1:28:15 PM	11.5	12.7	10.2	65.6			86.1	86.1	0.9
CHISW068	SW-68	2/10/2026 12:34:23 PM	20.1	79.9	0.0	0.0			69.8	68.3	0.3
CHISW068	SW-68	2/11/2026 4:22:53 PM	22.7	70.2	0.1	7.0			64.3	64.1	0.3
CHISW068	SW-68	2/11/2026 4:24:45 PM	22.4	70.2	0.0	7.4			64.2	64.2	0.3
CHISW068	SW-68	2/12/2026 1:18:39 PM	21.4	77.8	0.0	0.8			77.7	77.7	0.3
CHISW068	SW-68	2/12/2026 1:19:21 PM	21.3	78.7	0.0	0.0			77.8	77.9	0.3
CHISW068	SW-68	2/13/2026 1:03:32 PM	19.4	69.2	3.0	8.4			80.4	81.5	0.3
CHISW068	SW-68	2/13/2026 1:04:10 PM	18.4	68.5	1.1	12.0			82.3	82.5	0.3
CHISW068	SW-68	2/17/2026 12:47:50 PM	24.6	66.1	0.3	9.0			60.0	59.0	0.4
CHISW068	SW-68	2/17/2026 12:49:00 PM	22.5	65.8	1.5	10.2			57.9	57.9	0.3
CHISW068	SW-68	2/18/2026 11:57:16 AM	0.5	1.5	20.7	77.4			72.7	72.8	0.3

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHISW068	SW-68	2/19/2026 9:57:46 AM	0.3	5.6	20.4	73.8			44.9	44.9	0.0
CHISW068	SW-68	2/20/2026 12:39:16 PM	0.2	1.3	20.1	78.4			68.8	69.3	0.2
CHISW068	SW-68	2/23/2026 9:15:10 AM	0.0	0.2	20.6	79.2			77.7	78.2	0.0
CHISW068	SW-68	2/23/2026 9:16:47 AM	0.0	0.0	20.2	79.8			81.5	81.6	
CHISW068	SW-68	2/24/2026 9:37:22 AM	0.0	1.5	20.9	77.5			81.3	81.8	0.0
CHISW068	SW-68	2/25/2026 9:04:09 AM	0.6	1.2	19.4	78.8			80.1	80.5	0.5
CHISW068	SW-68	2/26/2026 12:59:30 PM	25.8	67.8	0.0	6.4			94.5	94.5	0.4
CHISW068	SW-68	2/27/2026 9:07:34 AM	0.0	0.4	22.8	76.8			90.5	90.5	0.0
CHISW007	SW-7	2/10/2026 9:38:26 AM	0.0	4.4	15.7	79.9			64.4	62.7	0.0
CHISW007	SW-7	2/10/2026 9:39:20 AM	0.0	5.3	15.5	79.2			62.4	62.2	0.0
CHISW007	SW-7	2/10/2026 2:09:07 PM	0.0	2.6	21.3	76.1			65.7	66.3	0.0
CHISW007	SW-7	2/11/2026 9:42:15 AM	0.1	4.1	14.9	80.9			64.2	64.4	0.0
CHISW007	SW-7	2/11/2026 9:43:39 AM	0.0	5.4	14.8	79.8			64.5	64.5	0.0
CHISW007	SW-7	2/12/2026 9:59:12 AM	0.2	8.3	15.7	75.8			65.4	65.8	0.0
CHISW007	SW-7	2/12/2026 10:01:09 AM	0.1	7.6	15.5	76.8			65.6	65.4	0.0
CHISW007	SW-7	2/13/2026 8:37:48 AM	0.1	5.9	16.1	77.9			66.0	65.4	0.0
CHISW007	SW-7	2/13/2026 8:38:31 AM	0.1	6.0	16.0	77.9			65.1	65.1	0.0
CHISW007	SW-7	2/17/2026 9:05:45 AM	0.0	4.4	15.7	79.9			57.5	54.3	0.0
CHISW007	SW-7	2/17/2026 9:07:14 AM	0.0	4.3	15.7	80.0			54.5	54.5	0.0
CHISW007	SW-7	2/18/2026 8:52:40 AM	0.0	4.0	15.9	80.1			58.8	59.0	0.0
CHISW007	SW-7	2/18/2026 8:54:10 AM	0.0	4.4	15.8	79.9			59.1	59.2	0.0
CHISW007	SW-7	2/19/2026 7:45:24 AM	0.0	2.8	17.1	80.0			49.8	50.0	0.0
CHISW007	SW-7	2/19/2026 7:46:01 AM	0.0	3.0	17.7	79.2			49.8	49.8	0.0
CHISW007	SW-7	2/20/2026 9:04:09 AM	0.0	4.2	15.9	79.9			50.8	48.8	0.0
CHISW007	SW-7	2/20/2026 9:06:04 AM	0.0	0.8	20.6	78.6			48.6	48.5	0.0
CHISW007	SW-7	2/23/2026 8:20:35 AM	0.0	0.1	19.0	80.9			62.7	62.8	0.0
CHISW007	SW-7	2/24/2026 12:23:35 PM	0.1	1.0	17.2	81.8			89.7	89.7	0.1
CHISW007	SW-7	2/25/2026 9:26:02 AM	0.0	0.8	16.9	82.4			78.7	79.0	0.0
CHISW007	SW-7	2/26/2026 10:31:30 AM	0.1	1.0	16.6	82.2			86.2	86.5	0.1

Chiquita Canyon Landfill - Well Data - 02/01/2026 to 02/28/2026

Point ID	Point Name	Record Date	CH4 (% by vol)	CO2 (% by vol)	O2 (% by vol)	Bal Gas (% by vol)	CO (ppmv)	H2 (ppmv)	Init Temp (F)	Adj Temp (F)	CH4:CO2 Ratio
CHISW007	SW-7	2/27/2026 9:04:53 AM	0.0	1.8	16.8	81.4			82.1	82.1	0.0
CHISW070	SW-70	2/10/2026 2:28:09 PM	16.6	66.7	0.0	16.7			80.4	80.3	0.2
CHISW071	SW-71	2/5/2026 8:34:55 AM	15.8	22.5	2.7	59.0			56.4	56.3	0.7
CHISW071	SW-71	2/9/2026 7:41:56 AM	15.6	19.9	3.8	60.7			56.5	56.4	0.8
CHISW072	SW-72	2/5/2026 10:14:28 AM	16.2	24.4	3.2	56.2			71.1	71.5	0.7
CHISW080	SW-80	2/21/2026 9:57:52 AM	25.8	23.7	0.7	49.8			66.1	66.2	1.1
CHISW009	SW-9	2/10/2026 2:31:12 PM	1.5	32.3	6.9	59.3			68.6	68.8	0.0
CHH1961C	TC-1961C	2/2/2026 11:48:41 AM	47.1	43.8	0.0	9.1			107.8	107.8	1.1
CHH1961E	TC-1961E	2/5/2026 10:11:15 AM	51.2	46.4	0.0	2.4			109.4	109.7	1.1
CHTC2174	TC-2174	2/2/2026 8:45:00 AM					2030				
CHTC2174	TC-2174	2/2/2026 8:48:32 AM	10.8	71.9	2.1	15.2			174.4	174.6	0.2
CHTC2174	TC-2174	2/2/2026 8:49:32 AM	10.3	68.8	1.9	19.0			174.6	174.6	0.1
CHTC2174	TC-2174	2/9/2026 9:53:53 AM	2.2	86.9	0.0	10.9			181.2	181.3	0.0
CHTC2174	TC-2174	2/9/2026 10:00:00 AM						141900			
CHTC2174	TC-2174	2/9/2026 10:00:00 AM					2430				
CHTC2174	TC-2174	2/17/2026 7:54:48 AM	2.2	78.8	1.7	17.3			181.6	181.6	0.0
CHTC2174	TC-2174	2/17/2026 7:55:00 AM					3020				
CHTC2174	TC-2174	2/23/2026 8:46:26 AM	2.9	81.4	1.8	13.9			182.0	181.9	0.0
CHTC2174	TC-2174	2/23/2026 9:00:00 AM					2860				
CHIWTD01	WTD-01	2/27/2026 12:28:00 PM	22.4	66.6	0.6	10.4			158.7	158.0	0.3
CHIWTD02	WTD-02	2/27/2026 12:43:03 PM	6.2	39.5	9.6	44.7			161.0	161.0	0.2
CHIWTD03	WTD-03	2/27/2026 3:10:20 PM	0.0	1.7	20.5	77.8			0.0	0.0	0.0
CHIWTD04	WTD-04	2/27/2026 3:01:42 PM	1.7	11.6	16.8	69.9			0.0	0.0	0.1
CHIWTD05	WTD-05	2/27/2026 12:50:39 PM	3.7	10.7	17.6	68.0			102.8	102.0	0.3
CHIWTD06	WTD-06	2/27/2026 2:42:19 PM	3.2	12.7	14.9	69.2			0.0	0.0	0.3
CHIWTD07	WTD-07	2/27/2026 2:48:55 PM	4.1	15.9	14.4	65.6			0.0	0.0	0.3
CHIWTD10	WTD-10	2/27/2026 2:53:05 PM	12.0	23.7	10.5	53.8			0.0	0.0	0.5

Solid Waste Daily Borehole Temperature Averages

for February 1, 2026 to February 28, 2026

SCS ENGINEERS

07224053.00 | March 18, 2026

274 Granite Run Drive
Lancaster, PA 17601
717-550-6330

Note: Data represents the arithmatic mean of the available temperature readings for the specified date.

Solid Waste Daily Borehole Temperature Averages for Borehole 1

Chiquita LF

	Depth from Surface						
TP-01	**15 ft**	**30 ft**	**45 ft**	**60 ft**	**80 ft**	**100 ft**	**125 ft**
Feb 1	145.5	124.6	134.2	137.1	148.1	149.6	144.2
Feb 2	145.2	124.5	134.1	137.1	148.1	149.6	144.2
Feb 3	144.9	124.5	134.1	137.1	147.8	149.6	144.3
Feb 4	144.5	124.7	134.0	137.1	147.9	149.6	144.4
Feb 5	143.9	124.5	133.9	137.0	147.8	149.6	144.3
Feb 6	143.2	124.5	134.0	137.1	147.8	149.6	144.2
Feb 7	142.8	124.5	134.0	137.1	147.8	149.6	144.2
Feb 8	142.7	124.8	134.1	137.3	148.0	149.8	144.5
Feb 9	141.9	124.5	133.9	137.1	147.7	149.6	144.3
Feb 10	141.3	124.2	133.7	136.9	147.4	149.4	144.0
Feb 11	140.8	124.3	133.8	137.0	147.4	149.5	144.0
Feb 12	140.9	124.5	133.9	137.2	147.3	149.5	144.1
Feb 13	140.9	124.6	133.9	137.2	147.5	149.6	144.2
Feb 14	140.5	124.5	133.9	137.2	147.3	149.5	144.1
Feb 15	140.0	124.2	133.6	137.0	147.2	149.4	143.9
Feb 16	139.2	123.9	133.4	136.8	146.8	149.2	143.7
Feb 17	139.2	124.0	133.5	137.0	146.9	149.3	143.8
Feb 18	139.1	124.3	133.7	137.3	147.0	149.5	144.0
Feb 19	138.1	123.8	133.3	136.8	146.6	149.1	143.6
Feb 20	138.5	124.2	133.6	137.1	146.9	149.4	143.8
Feb 21	138.6	124.4	133.6	137.3	147.0	149.5	144.1
Feb 22	138.6	124.7	133.8	137.4	147.1	149.6	144.4
Feb 23	138.6	124.8	133.8	137.5	147.2	149.7	144.5
Feb 24	138.4	124.9	133.9	137.5	147.2	149.7	144.6
Feb 25	138.4	125.0	134.0	137.7	147.2	149.9	144.7
Feb 26	138.3	125.1	133.9	137.5	147.2	149.8	144.7
Feb 27	138.3	125.2	133.9	137.6	147.3	149.9	144.9
Feb 28	138.1	125.1	133.9	137.7	147.0	149.9	144.8
Average	**140.7**	**124.5**	**133.8**	**137.2**	**147.4**	**149.6**	**144.2**

Solid Waste Daily Borehole Temperature Averages for Borehole 2

Chiquita LF

	Depth from Surface			
TP-02	**15 ft**	**30 ft**	**45 ft**	**60 ft**
Feb 1	116.2	143.0	146.4	154.5
Feb 2	116.0	144.2	146.6	154.5
Feb 3	115.9	144.7	146.7	154.5
Feb 4	116.1	145.5	146.8	154.6
Feb 5	115.7	146.3	146.8	154.6
Feb 6	115.7	147.1	147.1	154.8
Feb 7	115.7	147.7	147.2	154.9
Feb 8	115.9	148.2	147.5	155.0
Feb 9	115.5	148.4	147.4	154.9
Feb 10	115.1	148.6	147.3	154.7
Feb 11	115.3	149.0	147.6	155.0
Feb 12	115.3	149.1	147.8	155.1
Feb 13	115.3	149.3	148.0	155.2
Feb 14	115.1	149.4	148.1	155.2
Feb 15	114.8	149.3	148.0	155.1
Feb 16	114.4	149.2	147.9	154.9
Feb 17	114.5	149.4	148.2	155.1
Feb 18	114.8	149.7	148.6	155.4
Feb 19	114.2	149.2	148.2	155.0
Feb 20	114.5	149.5	148.6	155.3
Feb 21	114.8	149.6	148.9	155.6
Feb 22	114.9	149.6	149.1	155.7
Feb 23	115.0	149.7	149.3	155.8
Feb 24	115.0	149.8	149.5	156.0
Feb 25	115.1	149.9	149.7	156.1
Feb 26	115.0	149.8	149.7	156.0
Feb 27	115.2	149.8	149.9	156.2
Feb 28	115.1	149.5	150.1	156.4
Average	**115.2**	**148.4**	**148.1**	**155.2**

Solid Waste Daily Borehole Temperature Averages for Borehole 3

Chiquita LF

	Depth from Surface		
TP-03	**15 ft**	**30 ft**	**45 ft**
Feb 1	204.5	210.7	232.0
Feb 2	203.1	211.3	232.1
Feb 3	202.7	211.7	232.2
Feb 4	202.2	211.9	232.5
Feb 5	202.1	211.5	232.4
Feb 6	202.0	211.5	232.4
Feb 7	201.9	211.7	232.5
Feb 8	202.1	211.9	232.6
Feb 9	202.1	211.4	232.4
Feb 10	202.3	210.9	231.9
Feb 11	201.8	211.3	232.2
Feb 12	201.5	211.5	232.3
Feb 13	202.0	211.5	232.4
Feb 14	202.0	211.5	232.4
Feb 15	202.0	211.1	232.2
Feb 16	203.2	210.1	231.5
Feb 17	202.9	210.2	231.6
Feb 18	202.9	210.7	231.9
Feb 19	203.3	209.9	231.5
Feb 20	202.5	210.5	231.7
Feb 21	201.0	211.4	232.2
Feb 22	201.4	211.7	232.3
Feb 23	201.8	211.8	232.5
Feb 24	202.0	211.6	232.5
Feb 25	202.2	211.6	232.6
Feb 26	202.6	211.6	232.4
Feb 27	203.8	211.5	232.4
Feb 28	203.8	211.4	232.2
Average	**202.4**	**211.3**	**232.2**

Solid Waste Daily Borehole Temperature Averages for Borehole 4

Chiquita LF

	Depth from Surface			
TP-04	**15 ft**	**30 ft**	**45 ft**	**60 ft**
Feb 1	150.8	157.7	154.3	152.7
Feb 2	150.8	157.7	154.2	152.7
Feb 3	150.7	157.8	154.1	152.9
Feb 4	150.9	157.9	154.1	153.0
Feb 5	150.7	157.7	153.9	152.9
Feb 6	150.8	157.8	154.0	153.0
Feb 7	150.8	157.8	154.0	152.9
Feb 8	151.0	158.0	154.1	153.1
Feb 9	150.8	157.8	154.0	153.0
Feb 10	150.5	157.6	153.8	152.8
Feb 11	150.5	157.7	153.9	152.9
Feb 12	150.3	157.8	154.1	153.1
Feb 13	149.8	157.8	154.2	153.1
Feb 14	149.5	157.8	154.2	153.1
Feb 15	149.6	157.7	154.2	153.0
Feb 16	149.4	157.4	154.0	152.7
Feb 17	149.2	157.5	154.2	152.8
Feb 18	149.1	157.7	154.4	153.1
Feb 19	148.8	157.4	154.2	152.7
Feb 20	149.1	157.5	154.2	152.9
Feb 21	149.4	157.7	154.4	152.9
Feb 22	150.0	157.8	154.5	153.0
Feb 23	150.4	158.0	154.7	153.2
Feb 24	150.7	158.1	154.8	153.3
Feb 25	150.8	158.1	154.9	153.3
Feb 26	150.8	158.1	155.0	153.3
Feb 27	150.8	158.2	155.1	153.3
Feb 28	150.7	158.3	155.2	153.3
Average	**150.2**	**157.8**	**154.3**	**153.0**

Solid Waste Daily Borehole Temperature Averages for Borehole 5

Chiquita LF

	Depth from Surface				
TP-05	**15 ft**	**30 ft**	**45 ft**	**60 ft**	**75 ft**
Feb 1	131.2	164.1	167.2	154.1	157.4
Feb 2	131.4	162.6	166.6	154.2	157.5
Feb 3	131.7	162.4	166.1	154.1	157.4
Feb 4	132.1	161.5	165.9	154.2	157.4
Feb 5	132.3	161.4	165.4	154.3	157.3
Feb 6	132.5	161.5	164.9	154.3	157.4
Feb 7	132.8	160.7	164.4	154.4	157.3
Feb 8	133.2	160.6	164.0	154.5	157.5
Feb 9	133.3	160.0	163.6	154.4	157.3
Feb 10	131.1	157.9	163.3	154.5	157.2
Feb 11	128.1	154.6	163.7	154.5	157.5
Feb 12	132.6	158.7	162.8	154.4	157.4
Feb 13	133.5	158.8	162.8	154.6	157.5
Feb 14	133.6	158.7	162.3	154.7	157.4
Feb 15	133.8	157.3	162.1	154.7	157.3
Feb 16	129.2	154.6	162.4	154.6	157.2
Feb 17	127.9	153.5	162.5	154.5	157.3
Feb 18	128.9	153.4	162.3	154.7	157.5
Feb 19	128.6	154.4	161.9	154.6	157.2
Feb 20	131.6	154.3	162.4	154.8	157.4
Feb 21	133.2	155.9	162.6	154.8	157.5
Feb 22	133.8	157.6	162.9	155.0	157.7
Feb 23	134.3	159.1	163.2	155.2	157.8
Feb 24	134.6	159.8	163.4	155.3	157.9
Feb 25	134.9	160.1	163.7	155.4	158.1
Feb 26	135.0	160.2	163.8	155.5	158.0
Feb 27	135.2	160.3	164.1	155.6	158.2
Feb 28	135.3	160.6	164.3	155.6	158.3
Average	**132.3**	**158.7**	**163.7**	**154.7**	**157.5**

Solid Waste Daily Borehole Temperature Averages for Borehole 6

Chiquita LF

	Depth from Surface							
TP-06	**15 ft**	**30 ft**	**45 ft**	**60 ft**	**80 ft**	**100 ft**	**120 ft**	**140 ft**
Feb 1	103.3	113.0	116.5	111.7	129.1	135.7	136.1	139.9
Feb 2	103.2	113.0	116.5	111.7	129.0	135.7	136.1	139.8
Feb 3	103.1	113.0	116.5	111.7	129.1	135.7	136.1	139.9
Feb 4	103.3	113.0	116.5	111.7	129.3	135.8	136.2	139.9
Feb 5	103.3	112.9	116.4	111.6	129.1	135.7	136.1	139.8
Feb 6	103.4	113.0	116.5	111.7	129.3	135.8	136.1	139.9
Feb 7	103.5	113.0	116.5	111.8	129.1	135.8	136.2	139.9
Feb 8	103.6	113.1	116.5	111.8	129.4	135.9	136.2	139.9
Feb 9	103.5	112.9	116.4	111.6	129.3	135.7	136.1	139.8
Feb 10	103.5	112.8	116.4	111.6	129.0	135.8	136.1	139.8
Feb 11	103.5	113.0	116.5	111.8	129.0	135.9	136.2	140.0
Feb 12	103.6	113.0	116.5	111.8	129.0	135.8	136.1	139.9
Feb 13	103.6	113.0	116.5	111.9	129.1	135.9	136.3	140.0
Feb 14	103.5	112.9	116.4	111.8	128.9	135.9	136.1	139.9
Feb 15	103.4	112.9	116.3	111.7	128.9	135.9	136.1	139.9
Feb 16	103.3	112.7	116.2	111.7	128.8	135.9	136.1	139.9
Feb 17	103.5	112.8	116.2	111.7	128.8	135.9	136.1	139.9
Feb 18	103.8	113.0	116.3	112.0	129.0	136.1	136.3	140.0
Feb 19	103.2	112.7	116.0	111.7	128.7	135.9	136.1	139.9
Feb 20	102.8	112.9	116.2	112.0	128.9	136.2	136.3	140.1
Feb 21	102.5	113.0	116.2	112.0	129.0	136.2	136.3	140.1
Feb 22	102.1	113.1	116.2	112.1	129.2	136.2	136.4	140.1
Feb 23	101.8	113.1	116.1	112.1	129.3	136.3	136.4	140.1
Feb 24	101.8	113.1	116.1	112.1	129.3	136.3	136.4	140.0
Feb 25	101.6	113.2	116.2	112.2	129.4	136.3	136.4	140.1
Feb 26	101.7	113.2	116.2	112.2	129.4	136.3	136.5	140.2
Feb 27	101.9	113.3	116.4	112.3	129.6	136.4	136.6	140.2
Feb 28	101.7	113.3	116.4	112.3	129.5	136.4	136.5	140.1
Average	**103.0**	**113.0**	**116.3**	**111.9**	**129.1**	**136.0**	**136.2**	**140**

Solid Waste Daily Borehole Temperature Averages for Borehole 7

Chiquita LF

	Depth from Surface					
TP-07	**15 ft**	**30 ft**	**45 ft**	**60 ft**	**75 ft**	**100 ft**
Feb 1	126.8	129.9	134.2	134.0	137.3	150.4
Feb 2	126.8	129.8	134.3	134.1	137.2	150.3
Feb 3	126.8	129.7	134.2	134.1	137.3	150.3
Feb 4	126.8	129.7	134.2	134.1	137.5	150.5
Feb 5	126.8	129.6	134.1	134.1	137.4	150.3
Feb 6	126.8	129.6	134.3	134.2	137.3	150.3
Feb 7	126.8	129.5	134.2	134.2	137.4	150.3
Feb 8	126.9	129.6	134.4	134.4	137.6	150.6
Feb 9	126.8	129.4	134.1	134.2	137.5	150.4
Feb 10	126.8	129.4	134.1	134.2	137.4	150.5
Feb 11	126.8	129.4	134.2	134.3	137.6	150.9
Feb 12	126.8	129.4	134.1	134.1	137.7	151.1
Feb 13	126.7	129.4	134.2	134.3	137.9	151.4
Feb 14	126.7	129.3	134.2	134.1	137.8	151.5
Feb 15	126.5	129.2	134.1	134.1	137.7	151.5
Feb 16	126.5	129.0	133.9	133.9	137.4	151.4
Feb 17	126.6	129.0	134.0	133.9	137.5	151.9
Feb 18	126.7	129.2	134.2	134.2	137.8	152.8
Feb 19	126.4	128.8	133.9	133.9	137.3	152.7
Feb 20	126.6	129.0	134.3	134.3	137.7	153.0
Feb 21	126.6	129.0	134.2	134.2	137.9	153.0
Feb 22	126.6	129.0	134.2	134.3	138.1	153.1
Feb 23	126.7	129.1	134.3	134.5	138.3	153.3
Feb 24	126.7	129.1	134.3	134.5	138.3	153.2
Feb 25	126.8	129.2	134.3	134.6	138.5	153.3
Feb 26	126.6	129.1	134.2	134.7	138.6	153.3
Feb 27	126.6	129.2	134.3	134.9	138.8	153.4
Feb 28	126.7	129.2	134.4	134.9	138.6	153.3
Average	**126.7**	**129.3**	**134.2**	**134.3**	**137.8**	**151.7**

Solid Waste Daily Borehole Temperature Averages for Borehole 8

Chiquita LF

	Depth from Surface					
TP-08	**15 ft**	**30 ft**	**45 ft**	**100 ft**	**125 ft**	**150 ft**
Feb 1	124.6	131.1	126.9	150.4	153.5	163.3
Feb 2	123.3	129.9	126.7	148.8	152.1	162.8
Feb 3	127.3	136.2	129.2	152.7	154.2	166.3
Feb 4	128.5	137.2	129.7	153.6	155.1	168.7
Feb 5	129.5	138.5	132.2	154.0	155.2	166.9
Feb 6	130.5	139.6	133.6	154.5	155.8	167.3
Feb 7	131.4	140.6	135.2	155.3	156.3	168.2
Feb 8	132.5	142.3	140.7	155.7	156.8	168.3
Feb 9	131.6	139.8	135.9	153.9	156.7	165.8
Feb 10	128.1	134.4	129.2	153.3	157.1	165.2
Feb 11	126.5	132.2	127.2	155.9	160.3	167.5
Feb 12	125.4	131.0	126.5	158.5	163.1	170.0
Feb 13	125.1	131.0	126.7	160.4	165.1	172.0
Feb 14	124.7	130.6	126.5	162.1	167.0	173.9
Feb 15	124.3	130.1	126.2	163.6	168.7	175.8
Feb 16	123.9	129.9	126.1	165.1	170.2	177.5
Feb 17	124.6	131.1	126.8	166.4	171.4	178.2
Feb 18	125.5	132.4	127.7	167.6	172.3	179.2
Feb 19	125.1	132.0	127.1	167.8	172.4	179.3
Feb 20	126.0	132.9	127.8	168.7	173.6	180.1
Feb 21	125.8	132.7	127.5	169.3	174.4	180.7
Feb 22	126.0	133.0	127.8	170.3	175.2	181.6
Feb 23	126.4	133.7	128.3	170.6	176.0	182.0
Feb 24	126.6	133.9	128.4	171.6	176.8	183.3
Feb 25	127.1	134.9	129.7	172.2	177.4	183.7
Feb 26	127.2	134.5	128.7	172.8	178.0	184.2
Feb 27	126.7	133.8	128.1	173.1	178.6	184.8
Feb 28	126.6	133.6	128.3	173.7	179.0	185.3
Average	**126.8**	**134.0**	**129.1**	**162.2**	**166.2**	**174.3**

Solid Waste Daily Borehole Temperature Averages for Borehole 9

Chiquita LF

	Depth from Surface						
TP-09	**15 ft**	**30 ft**	**45 ft**	**60 ft**	**80 ft**	**100 ft**	**125 ft**
Feb 1	111.7	118.7	126.8	133.6	137.8	158.3	207.6
Feb 2	111.7	118.7	126.8	133.6	137.8	158.4	207.5
Feb 3	111.6	118.7	126.8	133.6	137.8	158.4	207.8
Feb 4	111.6	118.7	126.8	133.6	138.0	158.5	207.9
Feb 5	111.6	118.7	126.8	133.6	137.9	158.5	207.6
Feb 6	111.6	118.4	126.5	133.4	137.5	158.4	207.2
Feb 7	111.7	118.6	126.7	133.5	137.7	158.6	207.3
Feb 8	111.8	118.7	126.8	133.6	137.8	158.7	207.4
Feb 9	111.9	118.8	126.9	133.8	138.0	158.8	207.5
Feb 10	112.0	118.9	127.0	133.9	138.1	159.0	207.6
Feb 11	112.1	119.0	127.1	134.0	138.3	159.1	207.6
Feb 12	112.2	119.1	127.2	134.1	138.4	159.2	207.7
Feb 13	112.3	119.2	127.3	134.3	138.6	159.4	207.8
Feb 14	112.3	119.3	127.4	134.4	138.7	159.5	207.9
Feb 15	112.4	119.4	127.5	134.5	138.8	159.6	208.0
Feb 16	112.5	119.5	127.6	134.6	139.0	159.8	208.1
Feb 17	112.6	119.6	127.7	134.8	139.1	159.9	208.2
Feb 18	112.7	119.7	127.8	134.9	139.3	160.0	208.3
Feb 19	112.8	119.8	127.9	135.0	139.4	160.2	208.4
Feb 20	112.9	119.9	128.0	135.1	139.6	160.3	208.5
Feb 21	113.0	120.0	128.1	135.2	139.7	160.4	208.6
Feb 22	113.1	120.1	128.2	135.4	139.8	160.6	208.7
Feb 23	112.6	119.7	127.9	134.8	139.3	160.3	208.3
Feb 24	111.6	119.1	127.4	134.2	138.2	159.8	207.4
Feb 25	111.7	119.2	127.5	134.2	138.3	159.9	207.5
Feb 26	111.6	119.2	127.4	134.2	138.4	160.0	207.7
Feb 27	111.6	119.3	127.5	134.3	138.6	160.1	207.7
Feb 28	111.6	119.3	127.5	134.3	138.5	160.1	207.5
Average	**112.1**	**119.2**	**127.3**	**134.2**	**138.5**	**159.4**	**207.8**

Solid Waste Daily Borehole Temperature Averages for Borehole 10

Chiquita LF

	Depth from Surface						
TP-10	**15 ft**	**30 ft**	**45 ft**	**60 ft**	**80 ft**	**100 ft**	**125 ft**
Feb 1	122.4	128.1	131.2	136.7	137.2	137.6	150.9
Feb 2	122.3	128.0	131.2	136.7	137.2	137.5	151.0
Feb 3	122.2	127.8	131.0	136.5	137.1	137.5	150.9
Feb 4	122.4	127.9	131.1	136.6	137.5	137.9	151.1
Feb 5	122.1	127.6	130.9	136.5	137.3	137.6	150.8
Feb 6	122.3	127.6	131.0	136.5	137.3	137.6	150.8
Feb 7	122.3	127.5	131.0	136.5	137.4	137.7	150.9
Feb 8	122.4	127.7	131.3	136.6	137.8	138.1	151.1
Feb 9	122.1	127.4	130.9	136.4	137.5	137.8	150.8
Feb 10	121.9	127.1	130.6	136.1	137.1	137.4	150.4
Feb 11	122.1	127.2	130.7	136.2	137.3	137.6	150.6
Feb 12	122.2	127.2	130.8	136.4	137.5	137.8	150.8
Feb 13	122.3	127.1	130.8	136.4	137.6	137.9	150.9
Feb 14	122.1	126.9	130.6	136.4	137.5	137.9	150.8
Feb 15	121.8	126.6	130.3	136.2	137.3	137.6	150.5
Feb 16	121.5	126.3	130.0	136.1	137.0	137.3	150.2
Feb 17	121.6	126.4	130.1	136.2	137.2	137.5	150.4
Feb 18	121.9	126.7	130.4	136.6	137.4	137.7	150.6
Feb 19	121.4	126.1	129.9	136.3	136.7	137.1	150.1
Feb 20	121.9	126.4	130.2	136.6	137.0	137.3	150.2
Feb 21	122.0	126.5	130.5	136.8	137.2	137.5	150.5
Feb 22	122.1	126.6	130.6	137.0	137.5	137.9	150.7
Feb 23	122.2	126.8	130.7	137.1	137.7	138.0	150.8
Feb 24	122.2	126.8	130.7	137.2	137.7	138.1	150.9
Feb 25	122.3	126.8	130.7	137.4	137.8	138.2	151.1
Feb 26	122.3	126.4	129.9	137.3	137.8	138.2	151.0
Feb 27	122.3	126.3	129.6	137.4	137.9	138.3	151.1
Feb 28	122.2	126.1	129.5	137.4	137.7	138.3	151.1
Average	**122.1**	**127.0**	**130.6**	**136.6**	**137.4**	**137.7**	**150.7**

Solid Waste Daily Borehole Temperature Averages for Borehole 11

Chiquita LF

	Depth from Surface					
TP-11	**15 ft**	**30 ft**	**45 ft**	**80 ft**	**100 ft**	**125 ft**
Feb 1	163.7	162.3	169.0	175.5	181.5	181.0
Feb 2	163.8	162.5	169.4	175.5	181.8	181.2
Feb 3	163.9	162.8	170.0	175.3	182.0	181.5
Feb 4	164.2	163.2	170.6	176.1	182.2	181.7
Feb 5	164.1	163.2	170.5	176.8	182.4	181.9
Feb 6	164.2	163.4	170.8	176.8	182.8	182.1
Feb 7	164.4	163.7	171.1	176.8	182.8	182.2
Feb 8	164.5	164.0	171.8	177.6	183.2	182.7
Feb 9	164.4	164.0	171.5	177.2	183.3	182.7
Feb 10	164.2	163.8	170.9	176.8	183.3	182.7
Feb 11	164.3	163.8	170.7	176.9	183.8	183.0
Feb 12	164.3	164.0	171.1	176.6	183.6	182.9
Feb 13	164.3	164.1	171.0	177.5	184.6	184.0
Feb 14	164.4	164.3	171.2	177.6	184.9	184.2
Feb 15	164.2	164.2	170.9	177.5	184.9	184.1
Feb 16	164.1	164.1	170.5	177.2	184.7	183.9
Feb 17	164.2	164.2	170.8	177.1	184.6	183.8
Feb 18	164.4	164.4	171.3	177.3	184.8	184.0
Feb 19	164.1	164.1	170.7	176.8	184.5	183.6
Feb 20	164.2	164.3	171.0	177.3	185.1	184.2
Feb 21	164.3	164.5	170.8	177.8	185.4	184.7
Feb 22	164.4	164.6	170.7	178.1	185.5	185.0
Feb 23	164.6	164.7	170.8	177.7	185.2	184.8
Feb 24	164.3	164.5	170.2	178.1	185.8	185.1
Feb 25	164.4	164.4	171.3	179.3	187.0	186.4
Feb 26	164.5	164.6	172.0	180.0	187.6	187.1
Feb 27	164.5	164.5	172.7	180.6	188.2	187.8
Feb 28	164.6	164.6	173.7	181.0	188.7	188.3
Average	**164.3**	**164.0**	**171.0**	**177.4**	**184.4**	**183.8**

Solid Waste Daily Borehole Temperature Averages for Borehole 12

Chiquita LF

	Depth from Surface					
TP-12	**15 ft**	**30 ft**	**45 ft**	**80 ft**	**100 ft**	**125 ft**
Feb 1	102.1	117.9	122.4	132.0	136.0	147.3
Feb 2	101.9	117.9	122.4	131.9	135.9	147.2
Feb 3	101.9	117.9	122.4	132.0	136.1	147.3
Feb 4	101.9	118.1	122.5	132.2	136.3	147.5
Feb 5	101.7	118.0	122.4	132.0	136.1	147.4
Feb 6	101.8	117.9	122.4	131.9	135.9	147.3
Feb 7	101.7	117.9	122.4	132.0	136.0	147.3
Feb 8	102.0	118.1	122.6	132.1	136.2	147.4
Feb 9	101.7	117.9	122.4	132.0	136.0	147.3
Feb 10	101.6	117.7	122.3	131.8	135.8	147.3
Feb 11	101.6	117.7	122.3	131.8	135.7	147.2
Feb 12	101.6	117.8	122.3	131.8	135.7	147.1
Feb 13	101.6	117.9	122.4	131.9	135.9	147.3
Feb 14	101.5	117.8	122.4	131.8	135.8	147.2
Feb 15	101.2	117.7	122.3	131.8	135.7	147.2
Feb 16	101.0	117.5	122.1	131.6	135.4	147.1
Feb 17	100.8	117.5	122.1	131.6	135.5	147.1
Feb 18	101.1	117.7	122.3	131.7	135.6	147.1
Feb 19	100.7	117.4	122.0	131.5	135.3	146.9
Feb 20	100.8	117.6	122.1	131.6	135.4	147.0
Feb 21	101.0	117.8	122.3	131.8	135.7	147.2
Feb 22	101.1	118.0	122.5	132.0	136.0	147.4
Feb 23	101.2	118.2	122.6	132.2	136.2	147.5
Feb 24	101.3	118.3	122.8	132.3	136.3	147.5
Feb 25	101.3	118.4	122.8	132.4	136.4	147.5
Feb 26	101.3	118.4	122.8	132.4	136.6	147.7
Feb 27	101.5	118.6	123.0	132.6	136.8	147.8
Feb 28	101.5	118.6	123.0	132.5	136.7	147.7
Average	**101.4**	**117.9**	**122.4**	**132.0**	**136.0**	**147.3**

Solid Waste Daily Borehole Temperature Averages for Borehole 13

Chiquita LF

	Depth from Surface					
TP-13	**15 ft**	**30 ft**	**45 ft**	**75 ft**	**100 ft**	**140 ft**
Feb 1	140.8	166.1	167.4	166.3	167.8	169.9
Feb 2	141.2	166.1	167.4	166.2	167.7	169.9
Feb 3	141.4	166.0	167.4	166.2	167.8	170.0
Feb 4	141.8	166.2	167.4	166.4	168.0	170.1
Feb 5	142.0	166.0	167.4	166.3	167.8	170.0
Feb 6	142.4	166.1	167.5	166.4	167.9	170.2
Feb 7	142.5	166.2	167.5	166.3	167.9	170.2
Feb 8	143.0	166.4	167.8	166.7	168.2	170.5
Feb 9	143.0	166.2	167.6	166.5	168.0	170.4
Feb 10	143.0	166.0	167.5	166.2	167.8	170.2
Feb 11	143.3	166.2	167.6	166.3	167.9	170.3
Feb 12	143.6	166.3	167.3	166.1	167.7	170.2
Feb 13	144.2	165.5	165.9	165.0	166.8	169.2
Feb 14	144.1	163.9	165.0	164.1	166.0	168.5
Feb 15	143.7	162.7	164.2	163.3	165.2	167.6
Feb 16	143.0	161.5	163.4	162.5	164.5	167.0
Feb 17	142.6	160.6	163.3	162.5	164.4	167.0
Feb 18	142.9	159.9	163.3	163.0	165.0	167.5
Feb 19	142.6	158.9	161.5	162.6	164.5	167.1
Feb 20	142.7	158.6	160.3	162.8	164.8	167.3
Feb 21	142.6	158.2	160.5	163.0	165.0	167.5
Feb 22	142.5	157.9	160.0	163.3	165.3	167.6
Feb 23	142.7	157.8	159.9	163.3	165.3	167.7
Feb 24	142.5	157.6	160.5	162.8	164.8	167.1
Feb 25	142.4	157.3	159.5	162.8	164.8	167.1
Feb 26	142.2	156.9	159.3	162.7	164.7	166.9
Feb 27	142.1	156.5	158.7	162.6	164.7	166.8
Feb 28	142.2	156.2	158.2	162.7	164.7	166.9
Average	**142.6**	**162.3**	**164.0**	**164.5**	**166.3**	**168.6**

Solid Waste Daily Borehole Temperature Averages for Borehole 14

Chiquita LF

	Depth from Surface						
TP-14	**15 ft**	**30 ft**	**45 ft**	**75 ft**	**100 ft**	**125 ft**	**150 ft**
Feb 1	96.0	114.1	125.9	148.0	158.8	167.4	170.3
Feb 2	95.7	114.0	125.9	147.8	158.8	167.3	170.3
Feb 3	95.7	113.9	125.9	147.9	158.8	167.4	170.3
Feb 4	95.7	113.9	125.9	148.0	158.9	167.5	170.4
Feb 5	95.4	113.9	125.9	147.9	158.8	167.5	170.4
Feb 6	95.3	114.0	125.9	147.8	158.9	167.3	170.4
Feb 7	95.2	114.0	125.9	147.7	158.8	167.4	170.4
Feb 8	95.3	114.2	125.9	147.8	158.9	167.5	170.5
Feb 9	94.9	114.2	125.8	147.5	158.8	167.3	170.5
Feb 10	94.5	114.1	125.7	147.2	158.7	167.2	170.4
Feb 11	94.1	114.2	125.8	147.3	158.7	167.1	170.4
Feb 12	94.3	114.3	125.8	147.3	158.7	167.1	170.3
Feb 13	94.3	114.2	125.8	147.3	158.7	167.2	170.4
Feb 14	93.9	114.1	125.7	147.2	158.6	167.0	170.3
Feb 15	93.6	113.9	125.7	147.0	158.5	166.9	170.4
Feb 16	93.2	113.7	125.5	146.7	158.4	166.7	170.2
Feb 17	93.1	113.7	125.6	146.6	158.3	166.7	170.2
Feb 18	93.5	113.9	125.8	146.9	158.5	166.7	170.3
Feb 19	92.8	113.5	125.5	146.4	158.2	166.4	170.2
Feb 20	92.9	113.8	125.7	146.7	158.4	166.6	170.3
Feb 21	92.9	113.8	125.7	146.8	158.4	166.7	170.2
Feb 22	93.2	114.0	125.8	147.0	158.4	166.8	170.4
Feb 23	93.3	114.1	126.0	147.2	158.6	167.0	170.5
Feb 24	93.2	114.1	126.0	147.1	158.5	167.0	170.5
Feb 25	93.3	114.3	126.1	147.3	158.6	167.0	170.5
Feb 26	93.1	114.3	126.0	147.2	158.6	167.0	170.5
Feb 27	93.3	114.4	126.1	147.4	158.6	167.2	170.5
Feb 28	93.1	114.4	126.1	147.2	158.6	167.0	170.5
Average	**94.1**	**114.0**	**125.8**	**147.3**	**158.6**	**167.1**	**170.4**

Solid Waste Daily Borehole Temperature Averages for Borehole 15

Chiquita LF

	Depth from Surface				
TP-15	**15 ft**	**30 ft**	**45 ft**	**75 ft**	**100 ft**
Feb 1	181.2	195.5	198.2	199.6	199.3
Feb 2	180.9	195.4	198.2	199.6	199.3
Feb 3	181.1	195.5	198.3	199.6	199.3
Feb 4	181.4	195.6	198.3	199.7	199.4
Feb 5	181.3	195.5	198.3	199.9	199.5
Feb 6	181.4	195.7	198.5	200.0	199.7
Feb 7	181.6	195.7	198.5	199.9	199.7
Feb 8	181.8	195.8	198.6	200.2	200.2
Feb 9	182.0	195.5	198.3	199.9	200.3
Feb 10	181.4	195.2	198.1	199.6	199.8
Feb 11	181.6	195.3	198.2	199.6	199.7
Feb 12	181.4	195.3	198.2	199.6	199.7
Feb 13	181.5	195.2	198.1	199.5	199.7
Feb 14	181.6	195.2	198.1	199.7	199.9
Feb 15	181.6	195.1	198.0	199.6	199.8
Feb 16	181.1	194.8	197.7	199.1	199.5
Feb 17	181.0	194.9	197.8	199.1	199.3
Feb 18	181.5	195.1	198.0	199.2	199.3
Feb 19	181.5	194.7	197.7	198.8	199.0
Feb 20	181.4	195.0	198.0	199.1	199.5
Feb 21	181.4	195.2	198.2	199.4	199.7
Feb 22	181.7	195.4	198.3	199.5	199.8
Feb 23	181.9	195.4	198.4	199.6	199.9
Feb 24	182.1	195.7	198.8	200.1	200.3
Feb 25	181.8	195.6	198.4	199.8	199.8
Feb 26	181.7	195.4	198.3	199.6	199.7
Feb 27	182.0	195.4	198.2	199.8	199.8
Feb 28	181.8	195.4	198.3	199.8	199.9
Average	**181.5**	**195.3**	**198.2**	**199.6**	**199.7**

Solid Waste Daily Borehole Temperature Averages for Borehole 16

Chiquita LF

	Depth from Surface					
TP-16	**15 ft**	**30 ft**	**45 ft**	**60 ft**	**80 ft**	**100 ft**
Feb 1	134.4	170.5	134.1	138.0	137.6	141.1
Feb 2	134.8	170.4	134.2	138.0	137.6	141.0
Feb 3	135.6	171.1	134.2	137.9	137.5	140.9
Feb 4	134.8	171.7	134.4	138.1	137.7	141.2
Feb 5	134.8	171.7	134.3	137.9	137.7	141.0
Feb 6	135.4	172.0	134.5	138.1	137.7	141.0
Feb 7	135.3	172.2	131.5	138.1	137.6	141.0
Feb 8	135.2	172.6	134.9	138.3	137.9	141.2
Feb 9	135.2	172.6	134.8	138.1	137.7	141.0
Feb 10	135.1	172.7	122.5	138.0	137.5	140.8
Feb 11	135.3	173.1	85.3	138.1	137.6	140.9
Feb 12	135.3	173.6	84.1	138.3	137.8	141.0
Feb 13	136.0	173.9	103.5	138.4	137.9	141.1
Feb 14	135.6	174.1	93.0	138.3	137.8	141.0
Feb 15	135.5	174.2	93.1	138.2	137.6	140.9
Feb 16	136.8	174.4	65.0	138.1	137.4	140.6
Feb 17	137.6	174.7	92.0	138.2	137.5	140.7
Feb 18	137.6	175.3	81.3	138.4	137.8	141.0
Feb 19	137.5	175.2	84.1	138.2	137.4	140.6
Feb 20	137.3	175.8	87.5	138.6	137.7	140.9
Feb 21	137.0	175.9	103.1	138.5	137.8	141.0
Feb 22	136.8	176.2	135.7	138.5	138.0	141.2
Feb 23	136.9	176.5	135.7	138.7	138.2	141.4
Feb 24	136.6	176.6	135.2	138.7	138.3	141.3
Feb 25	136.6	176.8	135.4	138.7	138.3	141.4
Feb 26	136.2	176.9	135.5	138.6	138.3	141.4
Feb 27	135.8	177.2	135.8	138.7	138.6	141.5
Feb 28	135.6	177.3	135.8	138.8	138.5	141.5
Average	**135.9**	**174.1**	**116.1**	**138.3**	**137.8**	**141.1**

Thermocouple at 45 ft malfunctioned on October 11th and was repaired on February 22.

Solid Waste Daily Borehole Temperature Averages for Borehole 17

Chiquita LF

	Depth from Surface						
TP-17	**15 ft**	**30 ft**	**45 ft**	**60 ft**	**80 ft**	**100 ft**	**125 ft**
Feb 1	132.1	135.5	141.4	141.8	143.3	144.4	157.1
Feb 2	131.5	135.4	141.4	141.9	143.2	144.2	156.3
Feb 3	132.7	135.3	141.4	141.9	143.3	144.4	156.2
Feb 4	135.4	135.5	141.5	142.0	143.5	144.5	156.4
Feb 5	135.0	135.4	141.5	142.0	143.3	144.4	156.3
Feb 6	136.0	135.7	141.5	142.1	143.4	144.4	156.2
Feb 7	136.8	135.9	141.4	142.0	143.3	144.4	156.3
Feb 8	137.5	136.4	141.6	142.1	143.4	144.5	156.5
Feb 9	136.2	137.0	141.5	142.0	143.2	144.4	156.5
Feb 10	134.9	137.0	141.4	141.9	143.1	144.1	156.5
Feb 11	136.0	137.1	141.5	142.0	143.3	144.3	156.8
Feb 12	136.7	136.8	141.5	142.1	143.4	144.4	156.8
Feb 13	137.2	136.8	141.5	142.1	143.4	144.4	156.8
Feb 14	137.7	136.9	141.5	142.1	143.4	144.3	156.7
Feb 15	138.1	136.8	141.5	142.0	143.2	144.1	156.7
Feb 16	138.2	136.8	141.4	141.8	143.0	143.9	156.6
Feb 17	138.9	136.8	141.5	142.0	143.2	144.0	156.5
Feb 18	139.8	137.0	141.6	142.1	143.6	144.3	157.0
Feb 19	139.8	136.8	141.2	141.8	143.2	143.9	156.7
Feb 20	140.3	137.0	141.4	142.0	143.6	144.3	157.1
Feb 21	140.8	137.1	141.5	142.0	143.7	144.5	157.2
Feb 22	141.4	137.3	141.6	142.1	143.7	144.7	157.5
Feb 23	141.6	137.6	141.6	142.2	143.8	144.9	157.7
Feb 24	141.6	138.2	141.6	142.2	143.8	144.9	157.7
Feb 25	141.6	139.3	141.7	142.3	143.9	145.0	157.7
Feb 26	141.9	139.9	141.6	142.2	143.8	144.9	157.9
Feb 27	142.2	139.3	141.6	142.2	143.9	145.1	158.0
Feb 28	142.1	139.1	141.7	142.2	143.9	145.1	158.0
Average	**138.0**	**137.0**	**141.5**	**142.0**	**143.5**	**144.5**	**156.9**

Solid Waste Daily Borehole Temperature Averages for Borehole 18

Chiquita LF

	Depth from Surface		
TP-18	**15 ft**	**30 ft**	**45 ft**
Feb 1	140.1	159.8	191.8
Feb 2	140.0	159.7	191.8
Feb 3	139.9	159.8	191.9
Feb 4	140.0	160.0	192.1
Feb 5	139.9	160.0	192.1
Feb 6	140.1	160.2	192.4
Feb 7	139.9	160.1	192.4
Feb 8	140.1	160.4	192.7
Feb 9	139.9	160.2	192.6
Feb 10	139.7	160.0	192.5
Feb 11	139.8	160.2	192.7
Feb 12	139.9	160.4	193.0
Feb 13	139.9	160.6	193.1
Feb 14	139.9	160.6	193.2
Feb 15	139.7	160.5	193.2
Feb 16	139.5	160.3	193.1
Feb 17	139.7	160.4	193.2
Feb 18	139.9	160.8	193.8
Feb 19	139.4	160.5	193.4
Feb 20	139.8	160.9	193.8
Feb 21	139.8	161.1	194.1
Feb 22	140.1	161.4	194.4
Feb 23	140.2	161.6	194.6
Feb 24	140.3	161.8	194.9
Feb 25	140.3	161.8	195.0
Feb 26	140.3	161.9	195.1
Feb 27	140.5	162.1	195.3
Feb 28	140.5	162.2	195.4
Average	**140.0**	**160.7**	**193.3**

Solid Waste Daily Borehole Temperature Averages for Borehole 19

Chiquita LF

	Depth from Surface						
TP-19	**15 ft**	**30 ft**	**45 ft**	**75 ft**	**100 ft**	**125 ft**	**150 ft**
Feb 1	135.4	143.4	147.3	146.2	147.6	146.9	160.2
Feb 2	135.9	143.5	147.2	146.1	147.5	146.7	160.3
Feb 3	136.0	142.9	147.1	145.9	147.3	146.7	160.3
Feb 4	136.1	142.4	147.1	146.1	147.4	146.8	160.4
Feb 5	136.3	142.1	147.0	145.8	147.2	146.6	160.3
Feb 6	136.5	142.0	147.1	145.7	147.2	146.5	160.4
Feb 7	136.4	141.7	147.0	145.7	147.2	146.5	160.4
Feb 8	136.5	141.7	147.0	145.9	147.3	146.6	160.6
Feb 9	136.4	141.5	146.8	145.5	147.0	146.3	160.4
Feb 10	136.6	141.3	146.7	145.2	146.8	146.0	160.4
Feb 11	137.4	141.2	146.6	145.2	146.8	146.0	160.5
Feb 12	138.0	141.1	146.5	145.2	146.7	145.9	160.5
Feb 13	138.3	141.0	146.4	145.1	146.6	145.9	160.6
Feb 14	138.9	141.0	146.4	144.9	146.5	145.7	160.5
Feb 15	139.1	140.9	146.3	144.7	146.4	145.5	160.5
Feb 16	139.3	140.9	146.1	144.4	146.2	145.2	160.4
Feb 17	140.1	140.8	146.0	144.4	146.1	145.1	160.4
Feb 18	140.3	141.1	146.2	144.7	146.4	145.4	160.7
Feb 19	139.8	140.9	146.0	144.3	146.1	145.0	160.4
Feb 20	139.7	141.1	146.2	144.6	146.3	145.3	160.8
Feb 21	139.4	140.9	146.1	144.7	146.3	145.5	160.7
Feb 22	139.3	140.9	146.2	145.0	146.5	145.7	160.9
Feb 23	139.1	140.9	146.2	145.2	146.6	145.9	161.0
Feb 24	138.9	140.8	146.2	145.1	146.5	145.8	161.0
Feb 25	138.7	140.8	146.2	145.2	146.5	145.9	161.0
Feb 26	138.5	140.7	146.1	145.2	146.5	145.9	161.0
Feb 27	138.4	140.7	146.2	145.4	146.6	146.2	161.2
Feb 28	138.4	140.8	146.3	145.3	146.6	146.0	161.1
Average	**138.0**	**141.4**	**146.5**	**145.2**	**146.7**	**146.0**	**160.6**

Solid Waste Daily Borehole Temperature Averages for Borehole 20

Chiquita LF

	Depth from Surface		
TP-20	**15 ft**	**30 ft**	**45 ft**
Feb 1	125.0	133.1	139.0
Feb 2	125.4	133.8	139.0
Feb 3	125.7	134.1	139.0
Feb 4	126.0	134.2	139.1
Feb 5	126.1	134.3	139.0
Feb 6	126.4	134.8	139.1
Feb 7	126.1	133.9	138.9
Feb 8	125.8	133.6	139.1
Feb 9	125.5	133.4	139.0
Feb 10	125.6	133.5	138.9
Feb 11	126.0	133.7	139.0
Feb 12	126.0	133.9	139.0
Feb 13	126.2	134.1	139.0
Feb 14	126.2	134.0	139.0
Feb 15	126.2	134.1	138.9
Feb 16	126.1	133.9	138.7
Feb 17	126.1	133.6	138.9
Feb 18	126.1	133.6	139.8
Feb 19	125.7	133.3	140.0
Feb 20	126.0	133.8	140.7
Feb 21	126.1	133.9	140.9
Feb 22	126.3	134.2	141.1
Feb 23	126.5	134.4	141.3
Feb 24	126.6	134.5	141.3
Feb 25	126.8	134.9	141.5
Feb 26	126.9	135.2	141.4
Feb 27	127.1	135.3	141.5
Feb 28	127.2	135.5	141.4
Average	**126.1**	**134.1**	**139.8**

Solid Waste Daily Borehole Temperature Averages for Borehole 21

Chiquita LF

	Depth from Surface							
TP-21	**15 ft**	**30 ft**	**45 ft**	**60 ft**	**70 ft**	**85 ft**	**95 ft**	**110 ft**
Feb 1	117.6	141.2	149.4	159.7	165.3	182.0	209.1	255.6
Feb 2	117.5	141.0	149.3	159.6	165.1	181.8	208.9	255.6
Feb 3	116.6	141.1	149.4	159.6	165.0	181.8	209.0	255.6
Feb 4	116.6	141.2	149.5	159.7	165.1	181.9	208.9	255.7
Feb 5	118.0	141.0	149.4	159.5	164.8	181.5	209.1	255.6
Feb 6	118.4	140.9	149.4	159.3	164.7	181.5	208.6	255.7
Feb 7	118.3	140.9	149.5	159.3	164.6	181.3	208.7	255.7
Feb 8	118.7	140.9	149.5	159.4	164.5	181.3	208.6	255.8
Feb 9	119.1	140.7	149.4	159.1	164.3	181.0	208.5	255.7
Feb 10	119.1	140.5	149.3	159.0	164.1	180.9	208.3	255.8
Feb 11	118.5	140.5	149.3	159.0	164.0	180.8	208.5	255.8
Feb 12	117.8	140.5	149.2	158.8	163.8	180.6	208.5	255.6
Feb 13	116.8	140.6	149.4	158.9	163.9	180.9	208.3	255.8
Feb 14	115.9	140.5	149.2	158.7	163.6	180.6	207.8	255.6
Feb 15	115.6	140.4	149.3	158.6	163.5	180.6	208.1	255.7
Feb 16	115.1	140.2	149.0	158.4	163.2	180.3	207.8	255.4
Feb 17	114.5	140.2	149.1	158.4	163.1	180.3	207.8	255.4
Feb 18	114.4	140.3	149.2	158.4	163.1	180.3	207.7	255.5
Feb 19	114.1	140.0	148.9	158.2	162.8	179.9	207.5	255.4
Feb 20	114.0	140.2	149.1	158.3	162.9	180.1	207.7	255.7
Feb 21	113.6	140.4	149.2	158.4	163.0	180.0	207.4	255.7
Feb 22	113.7	140.5	149.5	158.6	163.1	180.4	207.6	255.9
Feb 23	114.1	140.8	149.6	158.8	163.3	180.5	207.7	256.2
Feb 24	114.4	140.6	149.6	158.7	163.1	180.3	207.9	256.0
Feb 25	114.9	140.7	149.7	158.7	163.2	180.5	207.7	256.1
Feb 26	114.9	140.7	149.9	158.8	163.2	180.4	207.7	256.2
Feb 27	114.8	140.8	150.0	158.9	163.3	180.5	207.8	256.3
Feb 28	115.0	140.6	149.9	158.7	163.1	180.4	207.5	256.2
Average	**116.1**	**140.6**	**149.4**	**158.9**	**163.8**	**180.8**	**208.2**	**255.8**

Solid Waste Daily Borehole Temperature Averages for Borehole 22

Chiquita LF

	Depth from Surface
TP-22	**15 ft**
Feb 1	95.0
Feb 2	95.0
Feb 3	95.0
Feb 4	95.1
Feb 5	95.1
Feb 6	95.1
Feb 7	95.4
Feb 8	95.4
Feb 9	95.2
Feb 10	95.2
Feb 11	94.1
Feb 12	94.3
Feb 13	94.1
Feb 14	94.2
Feb 15	94.2
Feb 16	93.4
Feb 17	93.0
Feb 18	92.1
Feb 19	92.7
Feb 20	92.9
Feb 21	92.9
Feb 22	93.2
Feb 23	93.2
Feb 24	93.1
Feb 25	93.2
Feb 26	93.2
Feb 27	93.1
Feb 28	93.1
Average	**94.0**

Solid Waste Daily Borehole Temperature Averages for Borehole 23

Chiquita LF

	Depth from Surface			
TP-23	**15 ft**	**30 ft**	**45 ft**	**75 ft**
Feb 1	104.7	120.6	137.9	141.3
Feb 2	104.6	120.3	137.8	141.3
Feb 3	104.4	120.3	137.7	141.3
Feb 4	104.5	121.0	137.9	141.2
Feb 5	104.7	122.7	138.1	141.2
Feb 6	104.7	123.0	138.1	141.3
Feb 7	104.5	123.1	138.1	141.3
Feb 8	104.8	123.8	138.2	141.5
Feb 9	104.9	124.8	138.1	141.2
Feb 10	104.8	124.7	137.9	141.0
Feb 11	104.5	123.7	137.9	141.3
Feb 12	104.4	123.6	138.1	141.4
Feb 13	104.5	123.9	138.2	141.5
Feb 14	104.3	123.3	138.0	141.4
Feb 15	104.1	123.5	137.9	141.1
Feb 16	103.9	123.0	137.7	141.0
Feb 17	103.3	120.6	137.6	141.1
Feb 18	102.3	120.4	137.8	141.5
Feb 19	102.1	120.1	137.5	141.0
Feb 20	102.0	119.9	137.5	141.3
Feb 21	102.4	120.0	137.6	141.4
Feb 22	102.7	120.2	137.7	141.4
Feb 23	103.1	120.4	137.9	141.5
Feb 24	103.2	120.2	137.9	141.6
Feb 25	103.0	119.2	137.3	141.5
Feb 26	103.1	119.0	137.1	141.5
Feb 27	102.9	118.6	137.0	141.6
Feb 28	102.9	118.5	137.0	141.6
Average	**103.8**	**121.5**	**137.8**	**141.3**

Solid Waste Daily Borehole Temperature Averages for Borehole 24

Chiquita LF

	Depth from Surface							
TP-24	**15 ft**	**30 ft**	**45 ft**	**100 ft**	**155 ft**	**210 ft**	**265 ft**	**320 ft**
Feb 1	90.9	114.1	123.2	132.6	161.9	182.0	199.3	151.5
Feb 2	90.7	114.0	123.2	132.6	161.8	182.1	199.3	151.4
Feb 3	90.6	114.1	123.2	132.7	161.9	182.2	199.4	151.4
Feb 4	90.7	114.3	123.3	132.9	161.9	182.3	199.5	151.6
Feb 5	90.5	114.4	123.3	132.7	161.9	182.3	199.6	151.5
Feb 6	90.5	114.2	123.2	132.6	161.8	182.1	199.5	151.4
Feb 7	90.4	114.1	123.2	132.7	161.8	182.2	199.5	151.4
Feb 8	90.5	114.4	123.4	132.9	161.9	182.3	199.7	151.5
Feb 9	90.2	114.8	123.3	132.8	161.9	182.3	199.8	151.5
Feb 10	90.1	114.6	123.2	132.6	161.8	182.2	199.8	151.4
Feb 11	90.0	114.2	123.2	132.6	161.8	182.0	199.7	151.3
Feb 12	89.9	114.0	123.2	132.7	161.7	182.0	199.6	151.1
Feb 13	90.0	114.0	123.3	132.8	161.8	182.2	199.9	151.3
Feb 14	89.8	113.8	123.2	132.8	161.8	182.1	199.8	151.2
Feb 15	89.7	113.8	123.1	132.8	161.9	182.2	200.0	151.3
Feb 16	89.3	113.6	123.0	132.7	161.7	182.0	199.8	151.1
Feb 17	89.1	113.5	123.1	132.6	161.8	182.1	199.9	151.1
Feb 18	85.1	113.7	123.2	132.9	161.8	182.1	199.9	151.1
Feb 19	84.8	113.4	123.0	133.1	161.6	181.9	199.8	150.9
Feb 20	85.2	113.5	123.2	132.7	161.7	182.3	200.0	151.1
Feb 21	85.7	113.4	123.3	132.8	161.9	182.4	200.1	151.1
Feb 22	86.3	113.3	123.6	132.9	162.1	182.5	200.4	151.3
Feb 23	86.7	113.4	123.7	132.8	162.2	182.8	200.6	151.5
Feb 24	86.9	113.3	123.7	132.6	162.2	182.7	200.6	151.4
Feb 25	87.1	113.5	123.8	132.9	162.3	182.9	200.8	151.5
Feb 26	87.1	113.5	123.8	133.0	162.3	182.9	200.9	151.6
Feb 27	87.3	113.5	124.0	132.8	162.3	183.1	201.1	151.7
Feb 28	87.3	113.4	123.9	132.4	162.3	183.0	201.0	151.6
Average	**88.7**	**113.9**	**123.4**	**132.8**	**161.9**	**182.3**	**200.0**	**151.3**

Solid Waste Daily Borehole Temperature Averages for Borehole 25

Chiquita LF

	Depth from Surface							
TP-25	**15 ft**	**30 ft**	**45 ft**	**60 ft**	**75 ft**	**90 ft**	**110 ft**	**130 ft**
Feb 1	110.7	123.1	125.0	125.4	130.0	141.9	189.0	197.6
Feb 2	110.7	123.0	125.0	125.4	130.0	141.8	188.6	197.2
Feb 3	110.6	123.0	125.0	125.4	129.9	141.6	188.4	197.0
Feb 4	110.6	123.1	125.0	125.4	130.0	141.7	188.2	196.9
Feb 5	110.6	123.1	125.0	125.4	129.9	141.9	187.7	196.5
Feb 6	110.7	123.1	125.1	125.5	130.1	142.4	187.6	196.5
Feb 7	110.7	123.0	125.1	125.5	130.0	142.4	187.6	196.3
Feb 8	110.8	123.1	125.2	125.6	130.2	142.7	187.6	196.6
Feb 9	110.7	123.1	125.1	125.5	130.0	142.5	187.2	196.2
Feb 10	110.5	123.0	124.9	125.3	129.9	142.2	186.8	195.9
Feb 11	110.5	123.2	125.1	125.5	130.0	142.0	187.1	196.2
Feb 12	110.5	123.3	125.1	125.6	130.1	141.7	187.4	196.5
Feb 13	110.5	123.3	125.1	125.6	130.1	142.0	187.5	196.4
Feb 14	110.4	123.4	125.1	125.6	130.1	142.1	187.5	196.2
Feb 15	110.3	123.2	125.0	125.5	129.9	142.2	187.0	195.6
Feb 16	110.2	123.2	124.9	125.4	129.8	142.3	186.5	195.1
Feb 17	110.2	123.3	124.9	125.5	129.8	142.6	186.5	195.2
Feb 18	110.4	123.5	125.2	125.7	130.2	142.8	187.2	196.1
Feb 19	110.1	123.1	124.8	125.4	129.7	142.1	187.5	196.1
Feb 20	110.3	123.4	125.1	125.6	130.0	142.3	188.3	196.9
Feb 21	110.2	123.5	125.1	125.7	130.1	142.1	188.6	197.3
Feb 22	110.3	123.6	125.2	125.8	130.1	142.3	189.0	197.5
Feb 23	110.3	123.7	125.2	125.8	130.2	143.0	189.0	197.4
Feb 24	110.3	123.6	125.3	125.9	130.3	142.8	189.0	197.4
Feb 25	110.3	123.7	125.3	126.0	130.4	142.7	189.1	197.5
Feb 26	110.2	123.8	125.3	125.9	130.3	142.6	189.2	197.6
Feb 27	110.2	124.0	125.3	125.9	130.3	142.7	189.3	197.7
Feb 28	110.3	124.2	125.3	126.0	130.3	143.0	188.9	197.3
Average	**110.4**	**123.3**	**125.1**	**125.6**	**130.1**	**142.3**	**188.0**	**196.7**

Solid Waste Daily Borehole Temperature Averages for Borehole 26

Chiquita LF

	Depth from Surface							
TP-26	**15 ft**	**30 ft**	**45 ft**	**60 ft**	**80 ft**	**100 ft**	**125 ft**	**150 ft**
Feb 1	121.6	137.8	141.6	149.5	146.8	167.5	170.5	175.1
Feb 2	121.7	137.8	141.6	149.5	146.8	167.5	170.6	175.1
Feb 3	121.7	137.7	141.5	149.4	146.7	167.4	170.4	175.0
Feb 4	121.8	137.7	141.6	149.4	146.8	167.4	170.5	175.0
Feb 5	121.6	137.7	141.5	149.3	146.7	167.4	170.4	175.0
Feb 6	121.4	137.8	141.6	149.4	146.9	167.6	170.6	175.3
Feb 7	121.3	137.7	141.6	149.3	146.8	167.5	170.5	175.1
Feb 8	121.6	137.9	141.7	149.4	147.0	167.6	170.7	175.4
Feb 9	121.5	137.7	141.4	149.1	146.8	167.4	170.4	175.1
Feb 10	121.2	137.5	141.3	149.0	146.7	167.2	170.1	174.7
Feb 11	121.1	137.7	141.4	149.0	146.8	167.3	170.3	175.0
Feb 12	121.1	137.7	141.6	149.2	147.1	167.6	170.6	175.3
Feb 13	121.1	137.7	141.6	149.2	147.1	167.5	170.5	175.3
Feb 14	121.0	137.7	141.6	149.1	147.1	167.5	170.5	175.3
Feb 15	121.0	137.5	141.4	148.9	146.9	167.3	170.2	174.9
Feb 16	120.9	137.4	141.3	148.8	146.8	167.2	170.1	174.7
Feb 17	120.9	137.5	141.3	148.8	146.8	167.3	170.1	174.8
Feb 18	121.3	137.7	141.6	149.1	147.2	167.8	170.5	175.3
Feb 19	121.2	137.4	141.3	148.7	146.8	167.3	170.1	174.8
Feb 20	121.4	137.6	141.5	148.9	147.1	167.5	170.3	175.1
Feb 21	121.1	137.7	141.5	149.0	147.2	167.6	170.4	175.3
Feb 22	121.1	137.7	141.6	149.0	147.2	167.6	170.4	175.3
Feb 23	121.2	137.7	141.6	149.0	147.2	167.6	170.5	175.4
Feb 24	121.1	137.7	141.6	149.0	147.3	167.8	170.6	175.5
Feb 25	121.1	137.7	141.7	149.1	147.3	167.8	170.7	175.6
Feb 26	120.8	137.6	141.5	149.0	147.2	167.6	170.4	175.4
Feb 27	119.6	137.7	141.6	149.0	147.3	167.7	170.5	175.5
Feb 28	119.3	137.8	141.7	149.0	147.4	167.8	170.6	175.6
Average	**121.1**	**137.7**	**141.5**	**149.1**	**147.0**	**167.5**	**170.4**	**175.2**

Solid Waste Daily Borehole Temperature Averages for Borehole 27

Chiquita LF

	Depth from Surface							
TP-27	**15 ft**	**30 ft**	**45 ft**	**60 ft**	**80 ft**	**100 ft**	**125 ft**	**150 ft**
Feb 1	129.2	136.8	140.1	148.2	153.7	155.3	151.1	127.6
Feb 2	129.1	136.7	140.1	148.2	153.7	155.3	151.1	127.6
Feb 3	129.0	136.7	140.1	148.2	153.7	155.3	151.1	127.5
Feb 4	129.2	136.8	140.1	148.2	153.7	155.3	151.1	127.6
Feb 5	129.2	136.7	140.1	148.2	153.7	155.3	151.2	127.7
Feb 6	129.1	136.7	140.1	148.2	153.8	155.3	151.1	127.6
Feb 7	128.7	136.5	140.1	148.2	153.7	155.3	151.1	127.6
Feb 8	128.8	136.7	140.2	148.3	153.8	155.4	151.2	127.7
Feb 9	128.8	136.6	140.1	148.2	153.7	155.3	151.2	127.7
Feb 10	128.3	136.4	140.0	148.2	153.7	155.4	151.2	127.8
Feb 11	115.9	134.6	138.3	148.3	153.7	155.4	151.2	127.7
Feb 12	124.1	135.9	139.3	148.6	153.7	155.3	151.1	127.6
Feb 13	125.9	136.0	139.5	148.7	153.7	155.3	151.1	127.7
Feb 14	126.6	136.1	139.7	148.6	153.8	155.4	151.2	127.7
Feb 15	126.9	136.0	139.6	148.5	153.7	155.4	151.3	127.7
Feb 16	108.3	129.9	136.2	148.1	153.6	155.2	151.1	127.7
Feb 17	95.9	125.4	133.2	147.4	153.7	155.4	151.2	127.8
Feb 18	93.5	123.0	130.6	145.8	153.8	155.4	151.2	127.8
Feb 19	97.9	126.6	133.5	146.3	153.6	155.2	151.0	127.6
Feb 20	102.1	130.3	134.8	146.6	153.6	155.3	151.1	127.6
Feb 21	112.4	134.0	136.9	147.1	153.7	155.4	151.1	127.6
Feb 22	116.8	134.7	137.8	147.4	153.8	155.4	151.2	127.7
Feb 23	119.5	135.1	138.2	147.6	153.9	155.5	151.2	127.8
Feb 24	121.6	135.4	138.6	147.8	153.9	155.5	151.3	127.8
Feb 25	122.8	135.5	138.8	147.9	153.9	155.5	151.3	127.8
Feb 26	123.5	135.5	138.9	147.9	153.9	155.5	151.3	127.8
Feb 27	124.4	135.6	139.1	148.0	153.9	155.5	151.3	127.8
Feb 28	125.0	135.7	139.1	148.1	153.8	155.5	151.3	127.8
Average	**120.4**	**134.4**	**138.3**	**147.9**	**153.7**	**155.4**	**151.2**	**127.7**

Solid Waste Daily Borehole Temperature Averages for Borehole 28

Chiquita LF

	Depth from Surface							
TP-28	**15 ft**	**30 ft**	**45 ft**	**70 ft**	**95 ft**	**120 ft**	**145 ft**	**170 ft**
Feb 1	76.7	96.0	113.0	122.6	129.0	128.8	138.1	142.0
Feb 2	76.6	95.9	113.0	122.5	129.0	128.8	138.1	142.0
Feb 3	76.6	95.9	113.0	122.5	128.9	128.8	138.0	141.9
Feb 4	76.6	96.0	113.1	122.6	129.0	128.9	138.1	142.0
Feb 5	76.6	95.9	113.0	122.5	128.9	128.7	137.9	141.8
Feb 6	76.5	95.8	113.1	122.5	129.0	128.8	138.0	142.0
Feb 7	76.4	95.8	113.0	122.5	129.0	128.8	138.1	141.9
Feb 8	76.5	95.8	113.1	122.7	129.1	128.9	138.3	142.1
Feb 9	76.4	95.8	113.0	122.5	128.9	128.8	138.1	141.9
Feb 10	76.3	95.7	112.9	122.4	128.9	128.6	137.8	141.7
Feb 11	76.2	95.5	112.9	122.4	129.1	128.7	137.9	141.7
Feb 12	76.2	95.4	112.8	122.4	128.9	128.6	137.9	141.7
Feb 13	76.3	95.5	113.0	122.6	129.1	128.9	138.1	142.0
Feb 14	76.2	95.4	112.9	122.5	129.0	128.8	138.0	141.9
Feb 15	76.0	95.3	112.9	122.5	129.0	128.8	137.8	141.8
Feb 16	75.8	95.1	112.7	122.3	128.8	128.6	137.6	141.6
Feb 17	75.8	95.0	112.7	122.3	128.8	128.6	137.4	141.6
Feb 18	75.9	95.1	112.9	122.5	129.0	128.8	137.4	141.9
Feb 19	75.6	94.8	112.6	122.2	128.8	128.5	137.4	141.5
Feb 20	75.8	94.9	112.9	122.5	129.1	128.9	137.9	141.9
Feb 21	75.7	94.9	112.9	122.6	129.1	129.0	138.1	142.0
Feb 22	75.8	95.1	113.0	122.7	129.2	129.0	138.2	142.1
Feb 23	75.8	95.2	113.2	122.9	129.5	129.2	138.4	142.3
Feb 24	75.7	95.1	113.1	122.8	129.4	129.1	138.3	142.2
Feb 25	75.7	95.2	113.1	122.9	129.5	129.2	138.4	142.3
Feb 26	75.7	95.2	113.2	123.0	129.4	129.3	138.5	142.4
Feb 27	75.7	95.2	113.2	123.0	129.4	129.3	138.5	142.4
Feb 28	75.6	95.1	113.2	123.0	129.3	129.2	138.5	142.3
Average	**76.1**	**95.4**	**113.0**	**122.6**	**129.1**	**128.9**	**138.0**	**142.0**

Solid Waste Daily Borehole Temperature Averages for Borehole 29

Chiquita LF

	Depth from Surface							
TP-29	**15 ft**	**30 ft**	**45 ft**	**80 ft**	**120 ft**	**160 ft**	**200 ft**	**240 ft**
Feb 1	98.9	124.5	125.8	131.4	147.1	153.6	162.8	183.7
Feb 2	99.0	124.5	125.8	131.4	147.1	153.6	162.8	183.8
Feb 3	98.9	124.5	125.8	131.4	147.1	153.5	162.7	183.8
Feb 4	98.6	124.6	125.8	131.4	147.1	153.6	162.8	183.8
Feb 5	97.3	124.6	125.8	131.4	147.2	153.8	162.9	184.0
Feb 6	96.9	124.6	125.9	131.7	147.2	153.7	162.9	184.3
Feb 7	96.2	124.7	125.9	131.8	147.2	153.6	162.9	184.2
Feb 8	95.9	124.7	125.9	131.8	147.1	153.6	162.8	183.9
Feb 9	96.0	124.7	125.9	131.9	147.2	153.7	162.9	184.0
Feb 10	95.5	124.6	125.8	131.8	147.1	153.6	162.9	184.6
Feb 11	95.7	124.6	125.9	131.8	147.1	153.5	162.9	185.5
Feb 12	96.8	124.7	126.0	131.8	147.1	153.6	162.8	185.1
Feb 13	96.3	124.8	126.0	131.7	147.1	153.6	162.8	183.9
Feb 14	97.7	124.8	126.0	131.6	147.1	153.6	162.9	184.4
Feb 15	96.2	124.7	125.9	131.5	147.1	153.6	163.0	184.6
Feb 16	94.3	124.5	125.8	131.2	146.9	153.2	162.8	184.8
Feb 17	98.6	124.7	125.9	131.4	147.1	153.3	163.0	184.6
Feb 18	99.5	124.9	126.0	131.5	147.1	153.6	164.0	183.9
Feb 19	101.5	124.7	125.9	131.3	147.0	153.4	163.9	184.0
Feb 20	103.0	124.9	126.0	131.5	147.1	153.6	163.8	183.8
Feb 21	104.0	124.9	126.0	131.6	147.1	153.5	163.8	183.8
Feb 22	105.8	125.0	126.1	131.7	147.2	153.6	163.9	183.9
Feb 23	107.8	125.1	126.2	131.8	147.2	153.6	163.9	184.1
Feb 24	108.7	125.1	126.2	131.9	147.2	153.7	164.0	184.1
Feb 25	108.4	125.2	126.3	131.9	147.2	153.7	164.0	184.1
Feb 26	105.3	125.1	126.2	131.9	147.2	153.7	164.0	184.1
Feb 27	107.5	125.1	126.3	132.0	147.1	153.7	163.9	184.1
Feb 28	105.8	125.2	126.3	132.0	147.2	153.8	164.0	184.2
Average	**100.2**	**124.8**	**126.0**	**131.6**	**147.1**	**153.6**	**163.3**	**184.2**

Solid Waste Daily Borehole Temperature Averages for Borehole 30

Chiquita LF

	Depth from Surface							
TP-30	**15 ft**	**30 ft**	**45 ft**	**70 ft**	**100 ft**	**130 ft**	**160 ft**	**190 ft**
Feb 1	98.9	108.1	112.1	143.7	166.1	164.5	166.2	171.8
Feb 2	98.9	108.3	112.5	143.6	166.1	164.6	166.1	171.8
Feb 3	98.9	108.4	112.7	143.6	166.1	164.5	166.1	171.8
Feb 4	99.1	108.6	112.9	143.8	166.2	164.7	166.2	171.9
Feb 5	99.1	108.6	112.9	143.7	166.2	164.6	166.2	171.9
Feb 6	99.2	108.7	113.0	143.7	166.2	164.7	166.3	171.9
Feb 7	99.3	108.8	113.0	143.7	166.2	164.6	166.2	171.9
Feb 8	99.4	108.9	113.1	143.8	166.2	164.7	166.2	171.9
Feb 9	99.3	108.7	113.0	143.7	166.3	164.7	166.2	171.9
Feb 10	99.2	108.8	113.0	143.6	166.2	164.5	166.2	171.9
Feb 11	99.3	108.9	113.2	143.7	166.2	164.6	166.2	171.8
Feb 12	99.4	108.9	113.2	143.6	166.1	164.5	166.0	171.6
Feb 13	99.5	108.9	113.2	143.7	166.3	164.6	166.1	171.7
Feb 14	99.5	108.9	113.3	143.7	166.2	164.5	166.1	171.7
Feb 15	99.5	108.9	113.2	143.7	166.3	164.5	166.2	171.9
Feb 16	99.2	108.7	112.8	143.5	166.2	164.3	166.1	171.7
Feb 17	99.0	108.7	112.5	143.6	166.2	164.4	166.2	171.7
Feb 18	98.9	108.7	112.6	143.6	166.3	164.4	166.2	171.7
Feb 19	98.6	108.4	112.2	143.5	166.1	164.3	166.1	171.7
Feb 20	98.9	108.6	112.5	143.7	166.3	164.5	166.2	171.8
Feb 21	99.0	108.8	112.7	143.6	166.3	164.6	166.1	171.7
Feb 22	99.2	109.1	113.0	143.8	166.4	164.7	166.2	171.8
Feb 23	99.3	109.2	112.9	143.9	166.5	164.9	166.3	172.0
Feb 24	99.4	109.2	112.9	143.9	166.4	164.8	166.3	171.9
Feb 25	99.5	109.2	112.9	143.9	166.1	164.8	166.3	171.9
Feb 26	99.5	109.0	112.6	144.0	166.0	164.9	166.3	171.9
Feb 27	99.9	109.3	113.1	144.1	166.1	165.0	166.4	172.0
Feb 28	100.1	109.4	113.2	144.1	166.1	165.0	166.4	172.0
Average	**99.2**	**108.8**	**112.9**	**143.7**	**166.2**	**164.6**	**166.2**	**171.8**

Solid Waste Daily Borehole Temperature Averages for Borehole 31

Chiquita LF

	Depth from Surface							
TP-31	**15 ft**	**30 ft**	**45 ft**	**80 ft**	**130 ft**	**180 ft**	**230 ft**	**280 ft**
Feb 1	112.6	124.6	129.7	138.1	161.5	190.8	185.5	140.6
Feb 2	112.6	124.6	129.7	138.1	161.6	190.8	185.5	140.6
Feb 3	112.6	124.5	129.6	138.0	161.4	190.7	185.4	140.5
Feb 4	112.7	124.5	129.7	138.0	161.4	190.7	185.4	140.5
Feb 5	112.7	124.5	129.7	137.9	161.5	190.6	185.3	140.3
Feb 6	112.8	124.6	129.8	138.0	161.6	190.9	185.4	140.6
Feb 7	112.8	124.5	129.8	138.0	161.6	190.8	185.4	140.5
Feb 8	112.9	124.6	129.9	138.1	161.8	191.0	185.6	140.7
Feb 9	112.8	124.5	129.7	137.9	161.7	190.8	185.3	140.4
Feb 10	112.3	124.6	129.4	137.8	161.6	190.8	185.2	140.1
Feb 11	112.0	124.8	129.4	137.9	161.9	191.0	185.4	140.4
Feb 12	111.8	125.0	129.3	138.0	161.9	191.1	185.5	140.5
Feb 13	111.7	125.0	129.3	138.0	162.0	191.1	185.5	140.6
Feb 14	111.6	125.1	129.2	138.0	161.8	191.1	185.4	140.5
Feb 15	111.4	125.1	129.1	137.8	161.5	190.9	185.2	140.2
Feb 16	111.3	125.0	128.9	137.7	161.6	190.8	185.1	140.0
Feb 17	111.2	125.1	129.0	137.8	161.5	190.9	185.2	140.1
Feb 18	111.5	125.4	129.3	138.1	161.8	191.3	185.4	140.5
Feb 19	111.2	125.1	129.0	137.7	161.7	190.9	185.1	140.0
Feb 20	111.4	125.4	129.2	138.0	162.0	191.2	185.4	140.5
Feb 21	111.4	125.4	129.3	138.0	162.0	191.2	185.5	140.5
Feb 22	111.4	125.5	129.3	138.0	161.9	191.2	185.5	140.5
Feb 23	111.5	125.6	129.4	138.1	161.9	191.3	185.5	140.6
Feb 24	111.5	125.6	129.4	138.1	161.9	191.4	185.6	140.6
Feb 25	111.5	125.6	129.5	138.1	161.9	191.4	185.6	140.6
Feb 26	111.5	125.5	129.4	138.0	161.9	191.4	185.5	140.5
Feb 27	111.5	125.6	129.4	138.1	162.0	191.4	185.6	140.6
Feb 28	111.5	125.7	129.5	138.1	162.0	191.5	185.7	140.6
Average	**111.9**	**125.0**	**129.4**	**138.0**	**161.7**	**191.0**	**185.4**	**140.4**

Solid Waste Daily Borehole Temperature Averages for Borehole 32

Chiquita LF

	Depth from Surface							
TP-32	**15 ft**	**30 ft**	**45 ft**	**70 ft**	**100 ft**	**130 ft**	**160 ft**	**190 ft**
Feb 1	126.6	138.6	142.4	149.6	159.1	167.0	164.4	147.5
Feb 2	126.5	138.6	142.5	149.8	159.0	167.0	164.4	147.5
Feb 3	126.5	138.6	142.5	150.1	159.1	167.0	164.4	147.5
Feb 4	126.5	138.7	142.5	150.1	159.2	167.0	164.5	147.5
Feb 5	126.5	138.6	142.4	149.9	159.2	167.1	164.5	147.6
Feb 6	126.6	138.6	142.5	150.0	159.2	167.1	164.5	147.6
Feb 7	126.5	138.7	142.5	150.1	159.2	167.1	164.5	147.6
Feb 8	126.7	138.7	142.5	150.2	159.2	167.1	164.4	147.5
Feb 9	126.6	138.6	142.5	149.8	159.2	167.1	164.5	147.6
Feb 10	126.4	138.5	142.5	149.6	159.1	167.1	164.5	147.6
Feb 11	126.5	138.6	142.5	150.0	159.2	167.1	164.5	147.6
Feb 12	126.6	138.7	142.5	150.2	159.2	167.1	164.5	147.6
Feb 13	126.6	138.6	142.6	150.0	159.2	167.1	164.5	147.5
Feb 14	126.5	138.6	142.5	150.0	159.2	167.1	164.5	147.6
Feb 15	126.4	138.5	142.4	149.7	159.1	167.1	164.5	147.6
Feb 16	126.2	138.3	142.3	149.3	159.0	167.0	164.4	147.5
Feb 17	126.3	138.6	142.3	149.8	159.0	167.1	164.5	147.6
Feb 18	126.5	138.6	142.3	149.7	159.1	167.1	164.5	147.6
Feb 19	126.2	138.4	142.1	149.4	158.9	166.9	164.3	147.4
Feb 20	126.4	138.6	142.3	149.7	159.0	167.0	164.4	147.4
Feb 21	126.4	138.7	142.4	150.1	159.1	167.0	164.4	147.4
Feb 22	126.4	138.7	142.4	150.2	159.2	167.1	164.5	147.5
Feb 23	126.6	138.7	142.5	150.1	159.2	167.2	164.5	147.6
Feb 24	126.6	138.8	142.6	149.9	159.2	167.2	164.6	147.7
Feb 25	126.7	138.8	142.6	149.9	159.3	167.2	164.7	147.7
Feb 26	126.6	138.7	142.6	149.9	159.2	167.2	164.6	147.6
Feb 27	126.6	138.7	142.6	149.9	159.2	167.2	164.6	147.7
Feb 28	126.5	138.7	142.6	149.8	159.2	167.2	164.6	147.7
Average	**126.5**	**138.6**	**142.5**	**149.9**	**159.1**	**167.1**	**164.5**	**147.6**

Solid Waste Daily Borehole Temperature Averages for Borehole 33

Chiquita LF

	Depth from Surface		
TP-33	**15 ft**	**30 ft**	**45 ft**
Feb 1	0.0	0.0	0.0
Feb 2	0.0	0.0	0.0
Feb 3	0.0	0.0	0.0
Feb 4	0.0	0.0	0.0
Feb 5	0.0	0.0	0.0
Feb 6	0.0	0.0	0.0
Feb 7	0.0	0.0	0.0
Feb 8	0.0	0.0	0.0
Feb 9	0.0	0.0	0.0
Feb 10	166.4	186.6	199.4
Feb 11	119.5	170.5	199.3
Feb 12	130.5	175.3	199.3
Feb 13	153.7	182.9	199.2
Feb 14	161.0	184.7	199.0
Feb 15	162.9	185.0	198.7
Feb 16	124.0	152.2	198.6
Feb 17	81.4	89.7	198.7
Feb 18	77.2	80.6	198.5
Feb 19	76.8	82.1	197.5
Feb 20	77.8	81.5	197.2
Feb 21	82.9	88.1	197.3
Feb 22	91.3	99.8	198.2
Feb 23	102.5	142.5	198.9
Feb 24	108.7	164.0	199.3
Feb 25	116.7	169.6	199.5
Feb 26	125.5	172.9	199.5
Feb 27	133.9	174.8	199.6
Feb 28	140.0	177.5	199.7
Average	**79.7**	**98.6**	**134.9**

TP-33 started on February 10

Solid Waste Daily Borehole Temperature Averages for Borehole 34

Chiquita LF

	Depth from Surface							
TP-34	**15 ft**	**30 ft**	**45 ft**	**60 ft**	**75 ft**	**90 ft**	**110 ft**	**120 ft**
Feb 1	121.2	122.9	132.9	131.1	132.8	133.8	142.6	149.2
Feb 2	121.2	123.0	132.9	131.2	132.8	133.8	142.7	149.2
Feb 3	121.1	123.0	132.9	131.1	132.7	133.7	142.6	149.1
Feb 4	121.3	123.1	133.0	131.1	132.8	133.8	142.6	149.1
Feb 5	121.2	123.0	132.9	131.1	132.8	133.7	142.6	149.0
Feb 6	121.3	123.2	133.0	131.2	132.9	133.8	142.7	149.2
Feb 7	121.3	123.2	133.1	131.3	132.9	133.8	142.8	149.2
Feb 8	121.5	123.4	133.2	131.4	133.0	133.9	142.9	149.3
Feb 9	121.2	123.2	133.0	131.2	132.8	133.8	142.7	149.0
Feb 10	121.1	123.1	133.0	131.1	132.7	133.5	142.5	148.7
Feb 11	121.2	123.2	133.1	131.2	132.9	133.7	142.7	149.0
Feb 12	121.2	123.3	133.2	131.3	133.0	133.8	142.8	149.1
Feb 13	121.2	123.3	133.3	131.3	132.9	133.9	142.8	149.1
Feb 14	121.0	123.3	133.3	131.4	133.0	133.9	142.9	149.1
Feb 15	120.8	123.2	133.1	131.2	132.8	133.6	142.6	148.8
Feb 16	120.6	123.1	133.0	131.1	132.7	133.5	142.5	148.5
Feb 17	120.6	123.2	133.1	131.2	132.8	133.6	142.7	148.8
Feb 18	121.0	123.5	133.4	131.4	133.0	133.9	143.0	149.1
Feb 19	120.6	123.2	133.0	131.0	132.6	133.5	142.5	148.5
Feb 20	121.0	123.5	133.2	131.2	132.8	133.6	142.7	148.7
Feb 21	121.0	123.6	133.4	131.3	132.8	133.8	142.9	148.8
Feb 22	121.0	123.8	133.5	131.4	133.0	133.9	143.0	149.0
Feb 23	121.2	123.9	133.6	131.4	133.0	133.9	143.0	149.0
Feb 24	121.0	123.9	133.7	131.6	133.2	134.0	143.2	149.2
Feb 25	121.2	123.9	133.7	131.5	133.2	134.1	143.3	149.2
Feb 26	121.2	123.9	133.8	131.5	133.2	134.0	143.2	149.1
Feb 27	121.2	124.1	133.9	131.5	133.1	134.0	143.2	149.1
Feb 28	121.4	124.1	133.9	131.6	133.3	134.1	143.4	149.2
Average	**121.1**	**123.4**	**133.3**	**131.3**	**132.9**	**133.8**	**142.8**	**149.0**

Solid Waste Daily Borehole Temperature Averages for Borehole 35

Chiquita LF

	Depth from Surface							
TP-35	**15 ft**	**30 ft**	**45 ft**	**65 ft**	**85 ft**	**105 ft**	**125 ft**	**140 ft**
Feb 1	105.7	122.5	130.7	130.8	145.7	161.0	168.7	170.7
Feb 2	105.6	122.5	130.7	130.8	145.6	160.9	168.8	170.8
Feb 3	105.2	122.4	130.7	130.9	145.7	161.0	168.8	170.8
Feb 4	105.1	122.6	130.8	131.2	145.7	161.0	168.8	170.8
Feb 5	105.0	122.5	130.7	131.3	145.7	161.1	168.8	170.9
Feb 6	105.1	122.5	130.8	131.1	145.7	161.0	168.8	170.9
Feb 7	105.0	122.5	130.8	131.0	145.7	160.7	168.8	170.8
Feb 8	105.0	122.7	131.0	131.2	145.8	160.8	168.9	170.9
Feb 9	104.7	122.5	130.9	131.3	145.7	160.8	168.9	170.9
Feb 10	104.3	122.3	130.7	131.1	145.6	160.6	168.8	170.9
Feb 11	104.2	122.3	130.9	131.0	145.7	160.7	168.8	170.9
Feb 12	104.2	122.5	130.9	131.0	145.7	160.6	168.8	170.9
Feb 13	104.2	122.6	131.0	131.0	145.8	160.5	168.8	170.8
Feb 14	104.2	122.5	131.0	131.0	145.8	160.6	168.9	170.9
Feb 15	104.0	122.4	130.8	130.9	145.7	160.5	168.8	170.8
Feb 16	103.8	122.2	130.7	130.9	145.6	160.4	168.8	170.7
Feb 17	103.7	122.4	130.8	131.2	145.5	160.5	168.9	170.8
Feb 18	103.6	122.6	131.1	131.4	145.5	160.5	168.9	170.9
Feb 19	103.0	122.2	130.8	131.3	145.3	160.3	168.7	170.6
Feb 20	103.1	122.4	130.9	131.5	145.4	160.3	168.7	170.6
Feb 21	102.7	122.5	131.1	131.8	145.5	160.5	168.8	170.9
Feb 22	102.4	122.6	131.2	132.0	145.6	160.5	168.9	170.9
Feb 23	101.6	122.6	131.3	132.1	145.6	160.5	168.8	170.9
Feb 24	101.1	122.7	131.4	132.2	145.7	160.6	168.9	171.0
Feb 25	101.9	122.7	131.5	132.2	145.8	160.7	169.0	171.1
Feb 26	102.2	122.7	131.4	132.1	145.8	160.7	168.9	171.1
Feb 27	102.2	122.8	131.5	132.1	145.8	160.7	168.9	171.1
Feb 28	101.8	122.8	131.6	132.2	145.9	160.8	169.0	171.1
Average	**103.7**	**122.5**	**131.0**	**131.4**	**145.7**	**160.7**	**168.8**	**170.9**

Solid Waste Daily Borehole Temperature Averages for Borehole 36

Chiquita LF

	Depth from Surface							
TP-36	**15 ft**	**30 ft**	**45 ft**	**75 ft**	**120 ft**	**165 ft**	**210 ft**	**250 ft**
Feb 1	102.9	119.8	126.8	131.6	153.2	169.9	159.5	134.3
Feb 2	103.1	119.9	126.9	131.7	153.2	169.9	159.5	134.3
Feb 3	103.2	120.0	127.1	131.8	153.3	169.9	159.4	134.3
Feb 4	103.4	120.3	127.3	131.9	153.3	169.9	159.5	134.3
Feb 5	103.4	120.5	127.3	132.0	153.3	169.9	159.5	134.2
Feb 6	103.6	120.6	127.5	132.1	153.3	169.9	159.4	134.2
Feb 7	103.7	120.7	127.7	132.2	153.4	170.0	159.6	134.4
Feb 8	103.9	120.9	127.8	132.3	153.4	170.0	159.6	134.4
Feb 9	103.8	121.2	127.8	132.3	153.4	169.9	159.4	134.2
Feb 10	103.7	121.0	127.8	132.3	153.2	169.8	159.3	124.4
Feb 11	80.8	104.4	120.1	132.4	153.4	169.8	159.4	106.9
Feb 12	80.5	107.1	121.7	132.4	153.5	170.0	159.6	134.4
Feb 13	85.4	112.6	125.2	132.6	153.5	170.0	159.6	134.3
Feb 14	90.1	115.7	127.1	132.7	153.6	170.0	159.5	134.3
Feb 15	93.6	117.3	128.1	132.6	153.5	169.8	159.4	134.0
Feb 16	80.1	97.4	108.4	132.1	153.3	169.7	159.3	133.9
Feb 17	59.8	69.0	79.6	128.2	153.5	169.8	159.4	134.0
Feb 18	58.7	67.2	76.5	119.5	153.8	170.0	159.6	134.3
Feb 19	60.1	72.4	83.7	121.5	153.4	169.6	159.2	133.8
Feb 20	61.2	76.6	88.8	121.5	153.6	169.8	159.4	134.0
Feb 21	68.3	90.3	103.3	124.4	153.7	170.0	159.6	134.3
Feb 22	73.9	98.6	110.8	126.7	153.7	170.1	159.7	134.4
Feb 23	79.0	104.2	115.4	128.3	153.7	170.0	159.6	134.3
Feb 24	82.6	107.6	118.4	129.6	153.8	170.2	159.8	134.5
Feb 25	85.7	110.0	120.5	130.5	153.7	170.1	159.7	134.4
Feb 26	88.2	111.7	122.1	131.0	153.8	170.1	159.6	134.3
Feb 27	90.4	113.0	123.3	131.5	153.8	170.1	159.7	134.4
Feb 28	92.3	114.0	124.3	131.9	154.0	170.2	159.7	134.5
Average	**87.3**	**106.9**	**116.8**	**130.0**	**153.5**	**169.9**	**159.5**	**132.9**

Solid Waste Daily Borehole Temperature Averages for Borehole 37

Chiquita LF

	Depth from Surface							
TP-37	**15 ft**	**30 ft**	**45 ft**	**75 ft**	**100 ft**	**130 ft**	**155 ft**	**180 ft**
Feb 1	104.4	113.0	133.7	135.2	139.4	161.2	175.1	181.2
Feb 2	104.3	113.0	133.8	135.2	139.3	161.1	175.0	181.2
Feb 3	104.3	113.0	133.9	135.2	139.3	161.2	175.1	181.2
Feb 4	104.4	113.2	134.0	135.3	139.5	161.3	175.2	181.3
Feb 5	104.3	113.0	133.9	135.1	139.2	161.1	174.9	181.0
Feb 6	104.3	113.1	134.0	135.1	139.3	161.1	174.9	181.1
Feb 7	104.3	113.1	134.1	135.1	139.3	161.2	175.1	181.3
Feb 8	104.4	113.2	134.2	135.2	139.3	161.2	175.1	181.3
Feb 9	104.2	113.1	133.8	135.0	139.1	161.0	174.8	180.9
Feb 10	104.0	112.8	133.4	134.7	138.7	160.7	174.6	180.7
Feb 11	104.0	112.7	134.3	134.8	138.8	160.9	174.7	180.9
Feb 12	104.3	112.9	135.8	135.0	139.0	161.0	175.0	181.2
Feb 13	104.4	113.0	134.6	135.0	139.1	161.1	175.1	181.3
Feb 14	104.2	112.9	134.3	134.9	139.0	161.0	174.9	181.1
Feb 15	104.0	112.7	134.0	134.7	138.8	160.7	174.7	180.8
Feb 16	103.7	112.5	133.9	134.4	138.6	160.5	174.4	180.5
Feb 17	103.7	112.4	134.1	134.5	138.7	160.7	174.7	180.7
Feb 18	104.1	112.7	134.3	134.8	138.9	161.0	175.0	181.2
Feb 19	103.7	112.3	134.0	134.3	138.4	160.5	174.4	180.4
Feb 20	104.1	112.7	134.4	134.6	138.7	160.7	174.7	180.8
Feb 21	104.1	112.8	134.6	134.8	138.9	161.0	175.0	181.1
Feb 22	104.2	113.0	134.7	135.0	139.0	161.2	175.2	181.3
Feb 23	104.5	113.1	134.8	135.1	139.1	161.3	175.2	181.4
Feb 24	104.4	113.2	134.8	135.1	139.2	161.4	175.3	181.5
Feb 25	104.5	113.2	135.0	135.1	139.2	161.4	175.4	181.5
Feb 26	104.4	113.2	135.1	135.0	139.1	161.3	175.3	181.4
Feb 27	104.6	113.4	135.3	135.2	139.2	161.5	175.4	181.6
Feb 28	104.5	113.3	135.4	135.1	139.2	161.5	175.4	181.5
Average	**104.2**	**112.9**	**134.4**	**134.9**	**139.1**	**161.1**	**175.0**	**181.1**

Solid Waste Daily Borehole Temperature Averages for Borehole 38

Chiquita LF

	Depth from Surface							
TP-38	**15 ft**	**30 ft**	**45 ft**	**75 ft**	**120 ft**	**165 ft**	**210 ft**	**250 ft**
Feb 1	117.5	135.7	142.7	148.0	160.1	168.3	164.2	134.2
Feb 2	117.4	135.4	142.6	148.0	160.0	168.3	164.0	134.2
Feb 3	117.2	135.0	142.6	148.0	160.1	168.3	164.0	134.2
Feb 4	117.1	135.1	142.6	148.0	160.2	168.4	164.1	134.3
Feb 5	117.1	135.4	142.6	147.9	160.1	168.3	163.9	134.1
Feb 6	117.2	134.9	142.5	148.0	160.1	168.4	163.9	134.1
Feb 7	116.4	132.9	142.3	148.0	160.1	168.4	163.9	134.2
Feb 8	116.1	132.5	142.5	148.0	160.2	168.5	164.0	134.3
Feb 9	116.2	132.9	142.4	147.9	160.0	168.4	163.8	134.1
Feb 10	116.1	132.6	142.1	147.7	160.0	168.3	163.7	133.9
Feb 11	115.9	131.7	141.9	147.9	160.0	168.4	163.0	134.2
Feb 12	115.7	131.0	141.9	147.9	160.0	168.4	162.4	134.2
Feb 13	115.7	131.0	142.0	148.0	160.1	168.5	162.9	134.3
Feb 14	115.5	130.6	141.8	147.9	160.0	168.4	163.0	134.1
Feb 15	115.2	130.3	141.7	147.7	159.9	168.4	162.8	134.0
Feb 16	114.8	130.0	141.5	147.5	159.8	168.2	162.3	133.9
Feb 17	114.7	129.8	141.3	147.6	159.8	168.3	162.8	133.9
Feb 18	114.7	130.0	141.6	147.9	160.0	168.5	163.2	134.2
Feb 19	114.1	129.6	141.4	147.5	159.7	168.3	163.0	133.8
Feb 20	114.6	129.7	141.3	147.8	160.0	168.5	163.3	134.1
Feb 21	114.6	129.6	141.4	147.9	160.0	168.6	163.4	134.1
Feb 22	114.6	129.6	141.5	147.9	160.2	168.7	163.5	134.2
Feb 23	114.7	129.8	141.7	148.1	160.3	168.8	163.7	134.4
Feb 24	114.6	129.7	141.6	148.0	160.3	168.8	163.6	134.3
Feb 25	114.7	129.7	141.6	148.0	160.4	168.9	163.6	134.4
Feb 26	114.6	129.7	141.6	147.9	160.4	169.0	163.6	134.4
Feb 27	114.4	129.6	141.6	148.1	160.5	169.0	163.8	134.6
Feb 28	114.5	129.6	141.6	148.0	160.4	169.0	163.7	134.4
Average	**115.6**	**131.5**	**141.9**	**147.9**	**160.1**	**168.5**	**163.5**	**134.2**

Solid Waste Daily Borehole Temperature Averages for Borehole 39

Chiquita LF

	Depth from Surface						
TP-39	**15 ft**	**30 ft**	**45 ft**	**75 ft**	**105 ft**	**135 ft**	**160 ft**
Feb 1	104.7	120.6	137.9	141.3	147.2	154.7	157.5
Feb 2	104.6	120.3	137.8	141.3	147.2	154.6	157.6
Feb 3	104.4	120.3	137.7	141.3	147.2	154.6	157.6
Feb 4	104.5	121.0	137.9	141.2	147.2	154.7	157.6
Feb 5	104.7	122.7	138.1	141.2	147.1	154.5	157.4
Feb 6	104.7	123.0	138.1	141.3	147.1	154.6	157.5
Feb 7	104.5	123.1	138.1	141.3	147.2	154.6	157.6
Feb 8	104.8	123.8	138.2	141.5	147.3	154.8	157.7
Feb 9	104.9	124.8	138.1	141.2	147.1	154.6	157.4
Feb 10	104.8	124.7	137.9	141.0	147.0	154.4	157.3
Feb 11	104.5	123.7	137.9	141.3	147.1	154.5	157.4
Feb 12	104.4	123.6	138.1	141.4	147.1	154.6	157.5
Feb 13	104.5	123.9	138.2	141.5	147.3	154.7	157.6
Feb 14	104.3	123.3	138.0	141.4	147.2	154.6	157.5
Feb 15	104.1	123.5	137.9	141.1	147.0	154.5	157.4
Feb 16	103.9	123.0	137.7	141.0	146.9	154.3	157.2
Feb 17	103.3	120.6	137.6	141.1	147.0	154.4	157.3
Feb 18	102.3	120.4	137.8	141.5	147.3	154.7	157.6
Feb 19	102.1	120.1	137.5	141.0	147.0	154.3	157.2
Feb 20	102.0	119.9	137.5	141.3	147.4	154.6	157.6
Feb 21	102.4	120.0	137.6	141.4	147.5	154.7	157.7
Feb 22	102.7	120.2	137.7	141.4	147.6	154.7	157.7
Feb 23	103.1	120.4	137.9	141.5	147.7	154.8	157.8
Feb 24	103.2	120.2	137.9	141.6	147.6	154.7	157.7
Feb 25	103.0	119.2	137.3	141.5	147.7	154.8	157.8
Feb 26	103.1	119.0	137.1	141.5	147.7	154.8	157.8
Feb 27	102.9	118.6	137.0	141.6	147.9	154.8	157.9
Feb 28	102.9	118.5	137.0	141.6	147.9	154.8	157.9
Average	**103.8**	**121.5**	**137.8**	**141.3**	**147.3**	**154.6**	**157.6**

Solid Waste Daily Borehole Temperature Averages for Borehole 40

Chiquita LF

	Depth from Surface							
TP-40	**15 ft**	**30 ft**	**45 ft**	**75 ft**	**110 ft**	**155 ft**	**185 ft**	**220 ft**
Feb 1	95.0	120.6	126.0	124.7	120.6	141.0	145.8	132.4
Feb 2	95.0	120.7	126.0	124.8	120.6	141.0	145.7	132.4
Feb 3	95.0	120.7	126.0	124.9	120.6	141.1	145.8	132.4
Feb 4	95.1	120.6	126.1	124.9	120.7	141.1	145.9	132.5
Feb 5	95.1	120.5	126.0	124.9	120.7	141.1	145.8	132.3
Feb 6	95.1	120.4	126.0	124.9	120.7	141.1	145.8	132.4
Feb 7	95.4	120.5	126.0	125.0	120.8	141.1	145.9	132.4
Feb 8	95.4	120.5	126.0	125.0	120.8	141.2	145.9	132.4
Feb 9	95.2	120.5	126.0	124.9	120.8	141.1	145.8	132.3
Feb 10	95.2	120.4	125.9	124.9	120.9	141.0	145.8	132.3
Feb 11	94.1	120.2	125.9	124.9	120.8	141.0	145.8	132.3
Feb 12	94.3	120.2	125.9	124.9	120.6	141.0	145.7	132.2
Feb 13	94.1	120.2	126.0	125.0	120.9	141.1	145.9	132.4
Feb 14	94.2	120.2	125.9	125.0	120.8	141.0	145.8	132.3
Feb 15	94.2	120.2	125.9	125.0	120.9	141.0	145.8	132.3
Feb 16	93.4	119.9	125.8	124.8	120.8	140.9	145.7	132.1
Feb 17	93.0	119.8	125.8	124.8	120.8	140.9	145.7	132.1
Feb 18	92.1	119.7	125.9	124.8	120.8	141.0	145.8	132.3
Feb 19	92.7	119.8	125.8	124.6	120.7	140.8	145.6	132.1
Feb 20	92.9	119.9	125.9	124.9	121.0	141.0	145.9	132.4
Feb 21	92.9	120.0	126.0	124.9	120.9	141.0	145.9	132.4
Feb 22	93.2	120.1	126.1	125.0	121.1	141.2	146.1	132.5
Feb 23	93.2	120.2	126.2	125.1	121.2	141.3	146.2	132.6
Feb 24	93.1	120.3	126.2	125.1	121.3	141.3	146.2	132.5
Feb 25	93.2	120.2	126.2	125.2	121.3	141.3	146.1	132.5
Feb 26	93.2	120.2	126.3	125.3	121.4	141.4	146.2	132.6
Feb 27	93.1	120.3	126.4	125.4	121.5	141.5	146.3	132.7
Feb 28	93.1	120.1	126.3	125.4	121.5	141.4	146.3	132.6
Average	**94.0**	**120.2**	**126.0**	**125.0**	**120.9**	**141.1**	**145.9**	**132.4**

Attachment F

Draeger Tube Readings

Attachment F - Lab Analysis and Draeger Tube Data
February 2026

Date Sampled	Flare	Permanent Flare Station				Zeeco TOx (Reaction Area)				Parnel TOx (Reaction Area)				Hero TOx (Reaction Area)			
		Draeger Tube (ppmv)	Lab Analysis (ppmv)			Draeger Tube (ppmv)	Lab Analysis (ppmv)			Draeger Tube (ppmv)	Lab Analysis (ppmv)			Draeger Tube (ppmv)	Lab Analysis (ppmv)		
		H2S	H2S	DMS	TRS	H2S	H2S	DMS	TRS	H2S	H2S	DMS	TRS	H2S	H2S	DMS	TRS
02/01/26	FL-2009	100	151.0	281	531.7	170	256.0	280	644.4	140	173.0	681	1130.9	120	160.0	689	1132.4
02/02/26	FL-1995	100	120.0	269	472	150	228.0	282	611.4	160	157.0	620	1030.8	130	168.0	697	1153.8
02/03/26	FL-2009	120	161.0	267	522	210	227.0	257	568.7	150	163.0	653	1081.7	110	168.0	729	1215.9
02/04/26	FL-2009	80	145.0	247	479.1	175	225.0	245	549.4	125	155.0	584	979.5	120	178.0	757	1267.1
02/05/26	FL-1995	80	143.0	220	444.6	180	245.0	276	607.6	120	173.0	656	1102.2	120	174.0	732	1231.1
02/06/26	FL-2009	90	152.0	238	476.5	150	235.0	269	591.1	100	157.0	578	977.6	150	166.0	679	1144.5
02/07/26	FL-1995	100	120.0	291	511.1	250	266.0	284	645.1	170	188.0	779	1296.1	140	141.0	505	860.1
02/08/26	FL-1995	65	108.0	284	491.3	100	260.0	290	645.6	110	189.0	836	1392.8	100	162.0	630	1063
02/09/26	FL-1995	80	141.0	273	510.9	200	271.0	296	662.2	120	186	768	1277.8	100	173	600	1031.7
02/10/26	FL-1995	100	176.0	325	630.3	200	215.0	304	616.2	190	192	821	1383.7	100	137	385	633.4
02/11/26	FL-1995	160	167.0	261	532.8	180	190.0	301	585.4	210	211	698	1208.3	180	152	589	988.3
02/12/26	FL-2009	180	176.0	202	457	100	94.3	324	524.4	230	203	813	1368.9	180	152	711	1166.8
02/13/26	FL-2009	140	182.0	204	463.5	100	89.4	278	450.5	210	213	889	1484	200	163	731	1200.4
02/14/26	FL-2009	110	164.0	196	431.4	80	86.7	347	545.9	200	212	895	1489.6	200	156	706	1166.7
02/15/26	FL-2009	120	176.0	193	443.3	85	111.0	431	703.1	200	211	875	1458.9	160	177	792	1311.2
02/16/26	FL-2009	140	163.0	166	392.2	100	103.0	337	563.3	200	230.0	841	1434.5	200	181.0	773	1289
02/17/26	FL-2009	160	165.0	179	414.4	100	88.0	324	525.9	210	194.0	798	1332.2	200	170.0	793	1302
02/18/26	FL-2009	160	158.0	223	471.7	80	90.1	316	516.6	160	182.0	765	1259.7	200	172.0	747	1250.8
02/19/26	FL-2009	120	169.0	185	423.2	80	91.5	283	473.1	210	187.0	778	1289.5	200	162.0	729	1202.4
02/20/26	FL-2009	150	146.0	157	363.7	90	79.9	288	468.1	220	177.0	718	1199.5	200	153.0	744	1213.3
02/21/26	FL-2009	140	164.0	179	411.4	80	86.6	283	467.8	180	217.0	890	1488.6	160	162.0	764	1252.2
02/22/26	FL-2009	120	166.0	186	424.6	75	92.6	308	515.7	160	183.0	826	1354.9	160	160.0	806	1304.2
02/23/26	FL-2009	140	151.0	159	370	80	80.0	249	418.3	170	165.0	739	1206.7	140	140.0	684	1109.7
02/24/26	FL-2009	150	156.0	168	389.7	80	88.4	309	507.7	200	183.0	758	1254.1	200	164.0	768	1252.5
02/25/26	FL-2009	130	141.0	154	352.6	80	82.4	256	431.5	190	174.0	763	1251.5	150	144.0	707	1145
02/26/26	FL-2009	140	146.0	168	373.3	75	94.1	341	564.9	210	195.0	891	1460.5	200	164.0	835	1352.2
02/27/26	FL-2009	135	140.0	132	323	90	89.3	310	517.4	150	146.0	672	1075.8	150	126.0	599	977.7
02/28/26	FL-2009	130	133.0	123	301.8	110	93.5	327	543.1	140	167.0	852	1346.4	140	134.0	727	1162.3

Chiquita Canyon Landfill Flare Station H_2S Draeger Tube Readings
February 2026

			Tube Used					
Sample Date	Time	H_2S (PPM)	2 to 20 ppm 20 to 200 ppm (6728821)	2 to 60 ppm (8101961)	5 to 60 ppm (29801)	100 to 2000 ppm (CH29101)	Technician	Flare
2/1/26	13:10	100	x				Donald Senegal	FL-2009
2/2/26	7:57	100	x				Eric Arias	FL-1995
2/3/26	7:35	120	x				Victor Amaya	FL-2009
2/4/26	7:40	80	x				Victor Amaya	FL-2009
2/5/26	7:45	80	x				Victor Amaya	FL-1995
2/6/26	5:50	90	x				Victor Amaya	FL-2009
2/7/26	8:51	100	x				Eric Arias	FL-1995
2/8/26	12:19	65	x				Angel Javalera	FL-1995
2/9/26	7:05	80	x				Victor Amaya	FL-1995
2/10/26	6:55	100	x				Victor Amaya	FL-1995
2/11/26	6:55	160	x				Victor Amaya	FL-1995
2/12/26	7:15	180	x				Victor Amaya	FL-2009
2/13/26	6:50	140	x				Victor Amaya	FL-2009
2/14/26	7:50	110	x				Angel Javalera	FL-2009
2/15/26	13:35	120	x				Donald Senegal	FL-2009
2/16/26	6:40	140	x				Angel Javalera	FL-2009
2/17/26	7:20	160	x				Victor Amaya	FL-2009
2/18/26	6:50	160	x				Victor Amaya	FL-2009
2/19/26	7:05	120	x				Victor Amaya	FL-2009
2/20/26	7:00	150	x				Victor Amaya	FL-2009
2/21/26	8:34	140	x				Eric Arias	FL-2009
2/22/26	13:55	120	x				Donald Senegal	FL-2009
2/23/26	7:57	140	x				Eric Arias	FL-2009
2/24/26	7:07	150	x				Cage Johnson	FL-2009
2/25/26	5:30	130	x				Victor Amaya	FL-2009
2/26/26	7:45	140	x				Alex Higuera	FL-2009
2/27/26	7:35	135	x				Alex Higuera	FL-2009
2/28/26	0:00	130	x				Alex Higuera	FL-2009

Attachment F - Lab Analysis and Draeger Tube Data

Chiquita Canyon Landfill Zeeco TOx H_2S Draeger Tube Readings
February 2026

			Tube Used				
Sample Date	Time	H_2S (PPM)	2 to 20 ppm 20 to 200 ppm (6728821)	2 to 60 ppm (8101961)	5 to 60 ppm (29801)	100 to 2000 ppm (CH29101)	Technician
2/1/26	13:45	170				x	Donald Senegal
2/2/26	7:49	150	x				Eric Arias
2/3/26	7:25	210				x	Victor Amaya
2/4/26	7:30	175				x	Victor Amaya
2/5/26	7:20	180				x	Victor Amaya
2/6/26	5:25	150				x	Victor Amaya
2/7/26	8:48	250				x	Eric Arias
2/8/26	12:45	100				x	Angel Javalera
2/9/26	7:30	200				x	Victor Amaya
2/10/26	7:30	200				x	Victor Amaya
2/11/26	7:40	180	x				Victor Amaya
2/12/26	7:35	100	x				Victor Amaya
2/13/26	7:25	100	x				Victor Amaya
2/14/26	8:15	80	x				Angel Javalera
2/15/26	13:25	85	x				Donald Senegal
2/16/26	6:55	100	x				Angel Javalera
2/17/26	6:50	100	x				Victor Amaya
2/18/26	7:30	80	x				Victor Amaya
2/19/26	7:45	80	x				Victor Amaya
2/20/26	7:25	90	x				Victor Amaya
2/21/26	8:33	80	x				Eric Arias
2/22/26	14:20	75	x				Donald Senegal
2/23/26	8:02	80	x				Eric Arias
2/24/26	7:10	80	x				Cage Johnson
2/25/26	5:55	80	x				Victor Amaya
2/26/26	14:30	75	x				Alex Higuera
2/27/26	7:20	90	x				Alex Higuera
2/28/26	7:20	110	x				Alex Higuera

Chiquita Canyon Landfill Parnel TOx H_2S Draeger Tube Readings
February 2026

			Tube Used				
Sample Date	Time	H_2S (PPM)	2 to 20 ppm 20 to 200 ppm (6728821)	2 to 60 ppm (8101961)	5 to 60 ppm (29801)	100 to 2000 ppm (CH29101)	Technician
2/1/26	13:50	140	x				Donald Senegal
2/2/26	7:55	160	x				Eric Arias
2/3/26	7:15	150				x	Victor Amaya
2/4/26	7:25	125				x	Victor Amaya
2/5/26	7:25	120				x	Victor Amaya
2/6/26	5:15	100				x	Victor Amaya
2/7/26	8:49	170	x				Eric Arias
2/8/26	12:40	110				x	Angel Javalera
2/9/26	7:35	120	x				Victor Amaya
2/10/26	7:15	190				x	Victor Amaya
2/11/26	7:35	210				x	Victor Amaya
2/12/26	7:30	230				x	Victor Amaya
2/13/26	7:20	210				x	Victor Amaya
2/14/26	8:10	200				x	Angel Javalera
2/15/26	13:20	200				x	Donald Senegal
2/16/26	6:50	200				x	Angel Javalera
2/17/26	6:55	210				x	Victor Amaya
2/18/26	16:34	160	x				Cage Johnson
2/19/26	7:35	210				x	Victor Amaya
2/20/26	7:20	220				x	Victor Amaya
2/21/26	8:27	180	x				Eric Arias
2/22/26	14:15	160	x				Donald Senegal
2/23/26	7:59	170	x				Eric Arias
2/24/26	7:04	200				x	Cage Johnson
2/25/26	5:50	190				x	Victor Amaya
2/26/26	7:36	210				x	Alex Higuera
2/27/26	7:25	150				x	Alex Higuera
2/28/26	7:23	140	x				Alex Higuera

Attachment F - Lab Analysis and Draeger Tube Data

Chiquita Canyon Landfill Hero TOx H_2S Draeger Tube Readings
February 2026

			Tube Used				
Sample Date	Time	H_2S (PPM)	2 to 20 ppm 20 to 200 ppm (6728821)	2 to 60 ppm (8101961)	5 to 60 ppm (29801)	100 to 2000 ppm (CH29101)	Technician
2/1/26	13:40	120	x				Donald Senegal
2/2/26	7:52	130	x				Eric Arias
2/3/26	7:15	110				x	Victor Amaya
2/4/26	7:35	120				x	Victor Amaya
2/5/26	7:35	120				x	Victor Amaya
2/6/26	5:30	150				x	Victor Amaya
2/7/26	8:50	140	x				Eric Arias
2/8/26	12:35	100				x	Angel Javalera
2/9/26	7:20	100	x				Victor Amaya
2/10/26	7:10	100				x	Victor Amaya
2/11/26	7:30	180				x	Victor Amaya
2/12/26	7:25	180				x	Victor Amaya
2/13/26	7:10	200				x	Victor Amaya
2/14/26	8:00	200				x	Angel Javalera
2/15/26	13:15	160	x				Donald Senegal
2/16/26	6:45	200				x	Angel Javalera
2/17/26	7:10	200				x	Victor Amaya
2/18/26	7:10	200				x	Victor Amaya
2/19/26	7:30	200				x	Victor Amaya
2/20/26	7:10	200				x	Victor Amaya
2/21/26	8:35	160	x				Eric Arias
2/22/26	14:05	160	x				Donald Senegal
2/23/26	8:05	140	x				Eric Arias
2/24/26	7:02	200				x	Cage Johnson
2/25/26	5:40	150				x	Victor Amaya
2/26/26	7:29	200				x	Victor Amaya
2/27/26	7:15	150				x	Alex Higuera
2/28/26	7:15	140	x				Alex Higuera

Attachment G

Graphic Maps

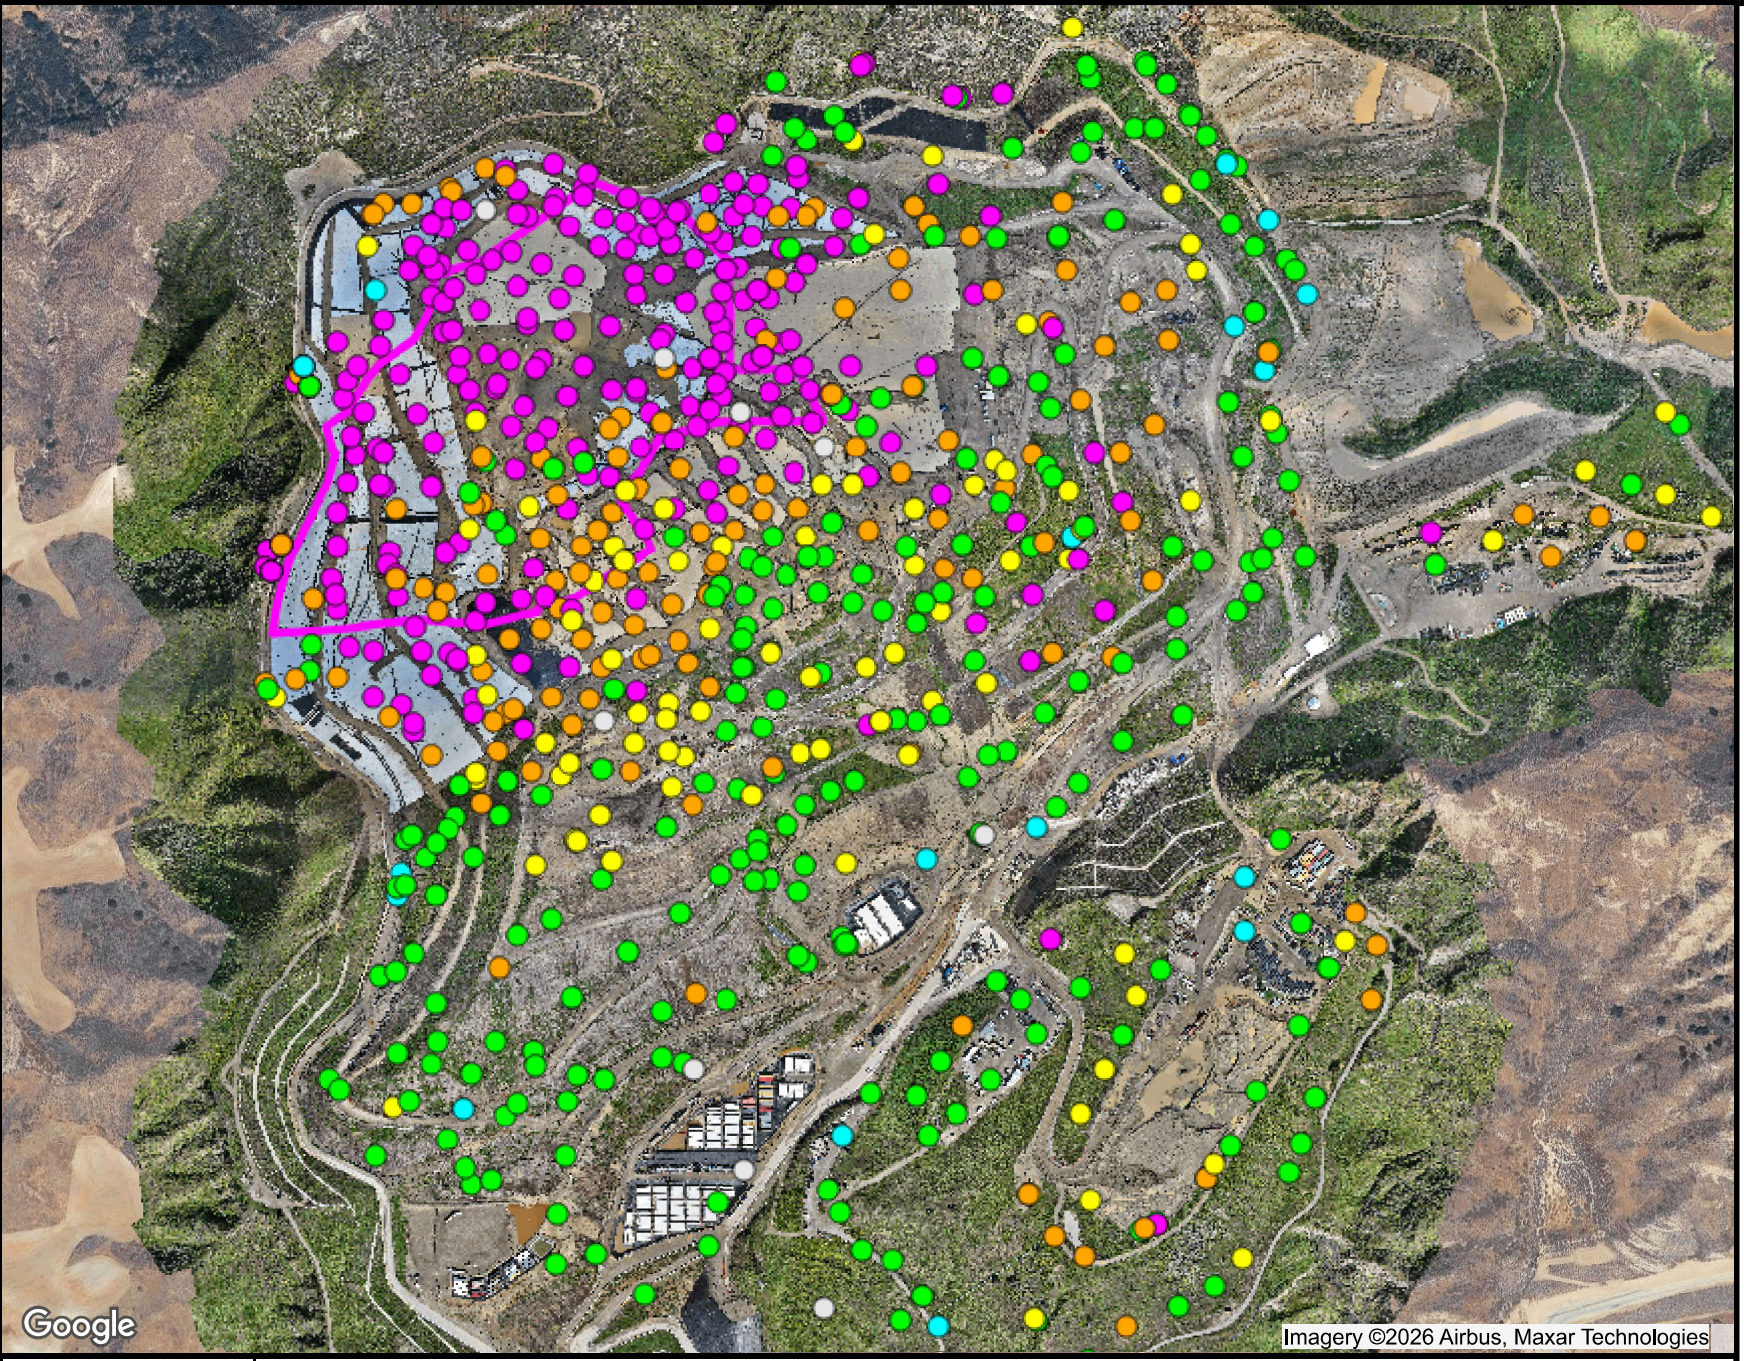

Ranges Mapped

						# Points
	>=	0	and	<	0.5	250
	>=	0.5	and	<	0.9	141
	>=	0.9	and	<	1.1	91
	>=	1.1	and	<	1.5	251
	>=	1.5	and	<	101	19
		N/A			N/A	10

Point Type Legend

well

N

SCSeTools

Chiquita Canyon Landfill

Range Map

Parameter: CH4/CO2 Ratio (high range)

Analysis Method: Average

Date Range: 02/01/2026 - 02/28/2026

Map generation date : 03/19/2026

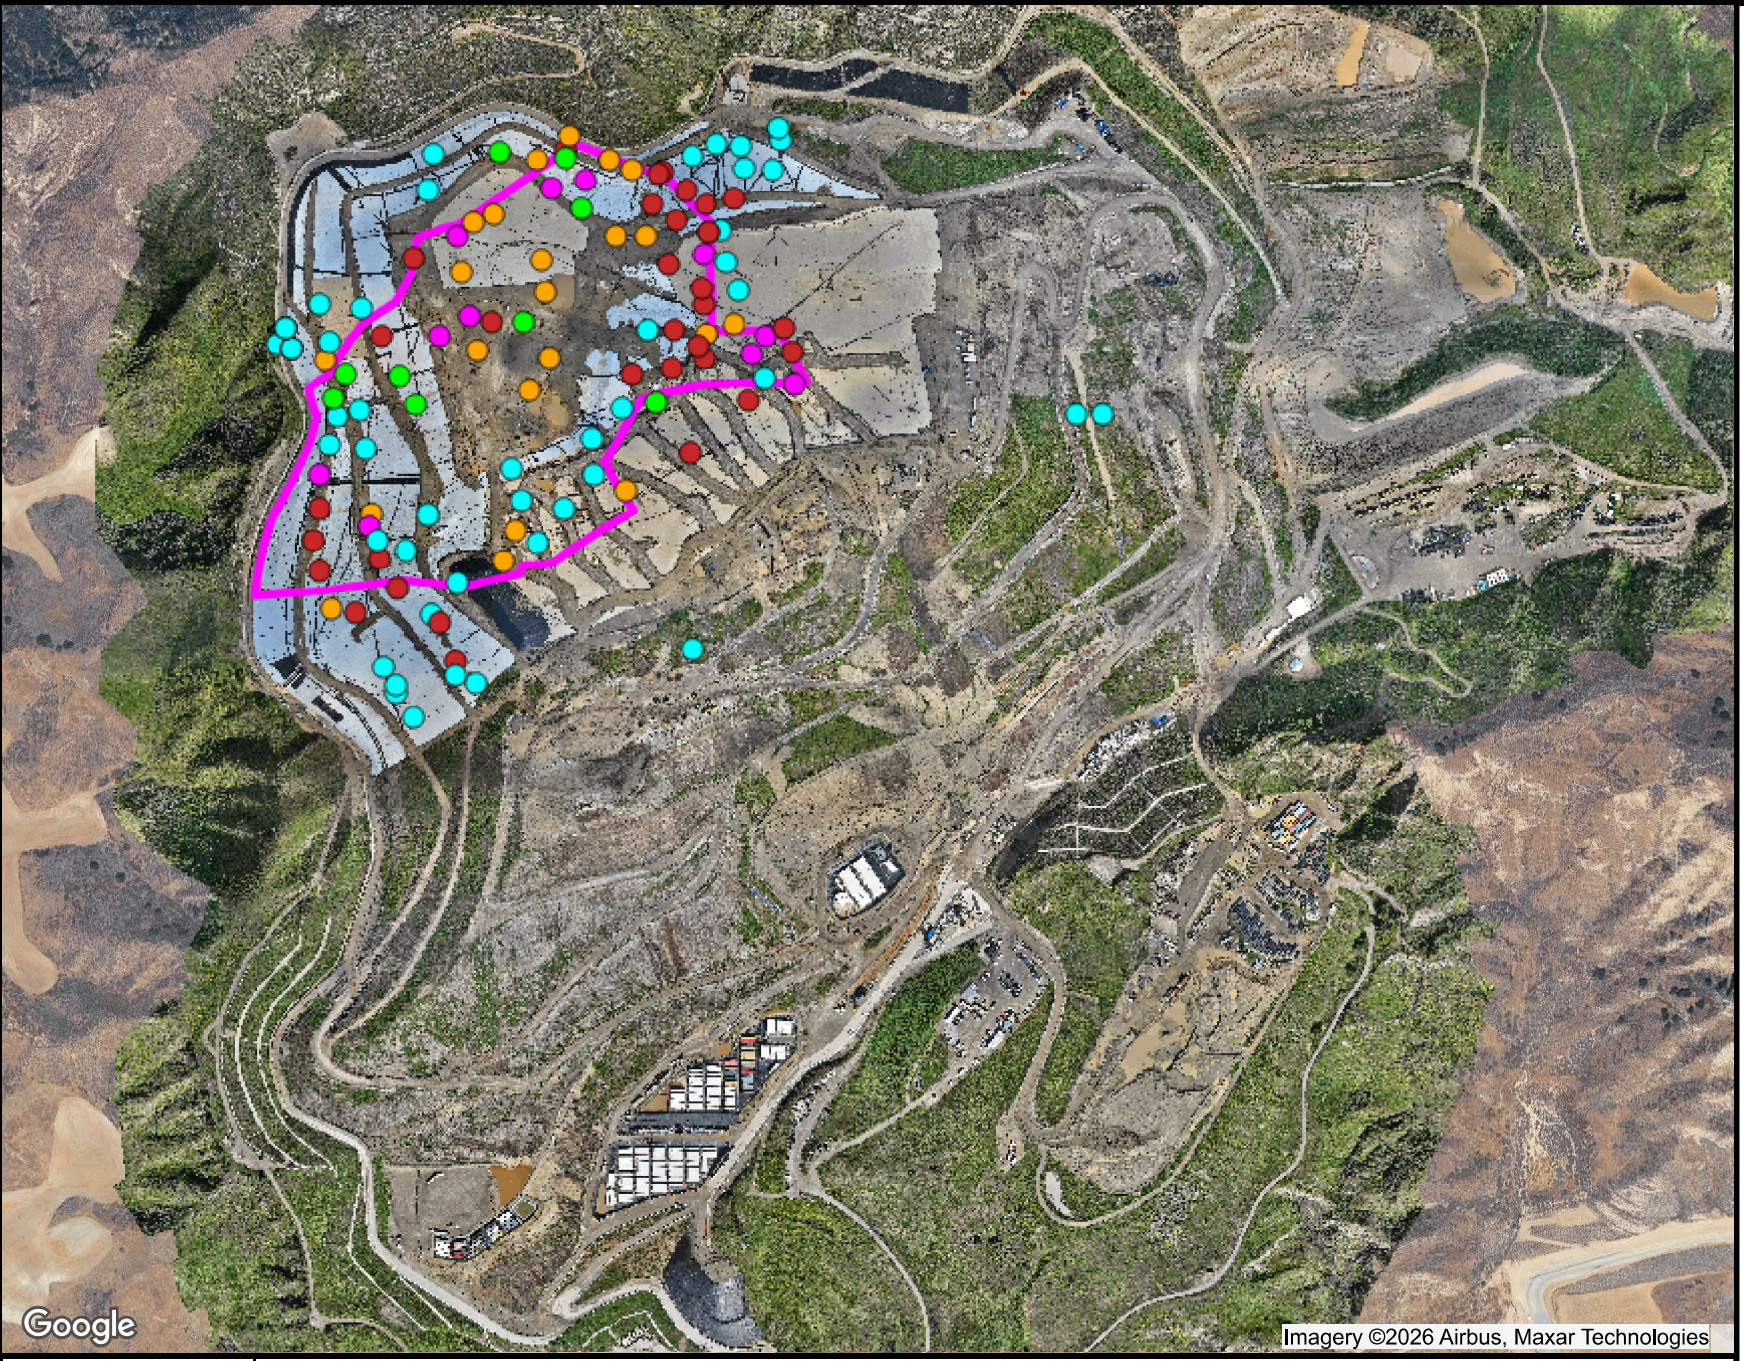

Ranges Mapped

						# Points
	>=	0	and	<	1000	52
	>=	1000	and	<	1500	9
	>=	1500	and	<	2000	22
	>=	2000	and	<	2500	11
	>=	2500	and	<	1000000	33

Point Type Legend

well

N

SCSeTools

Chiquita Canyon Landfill

Range Map

Parameter: CO (mid range)

Analysis Method: Average

Date Range: 02/01/2026 - 02/28/2026

Map generation date : 03/19/2026

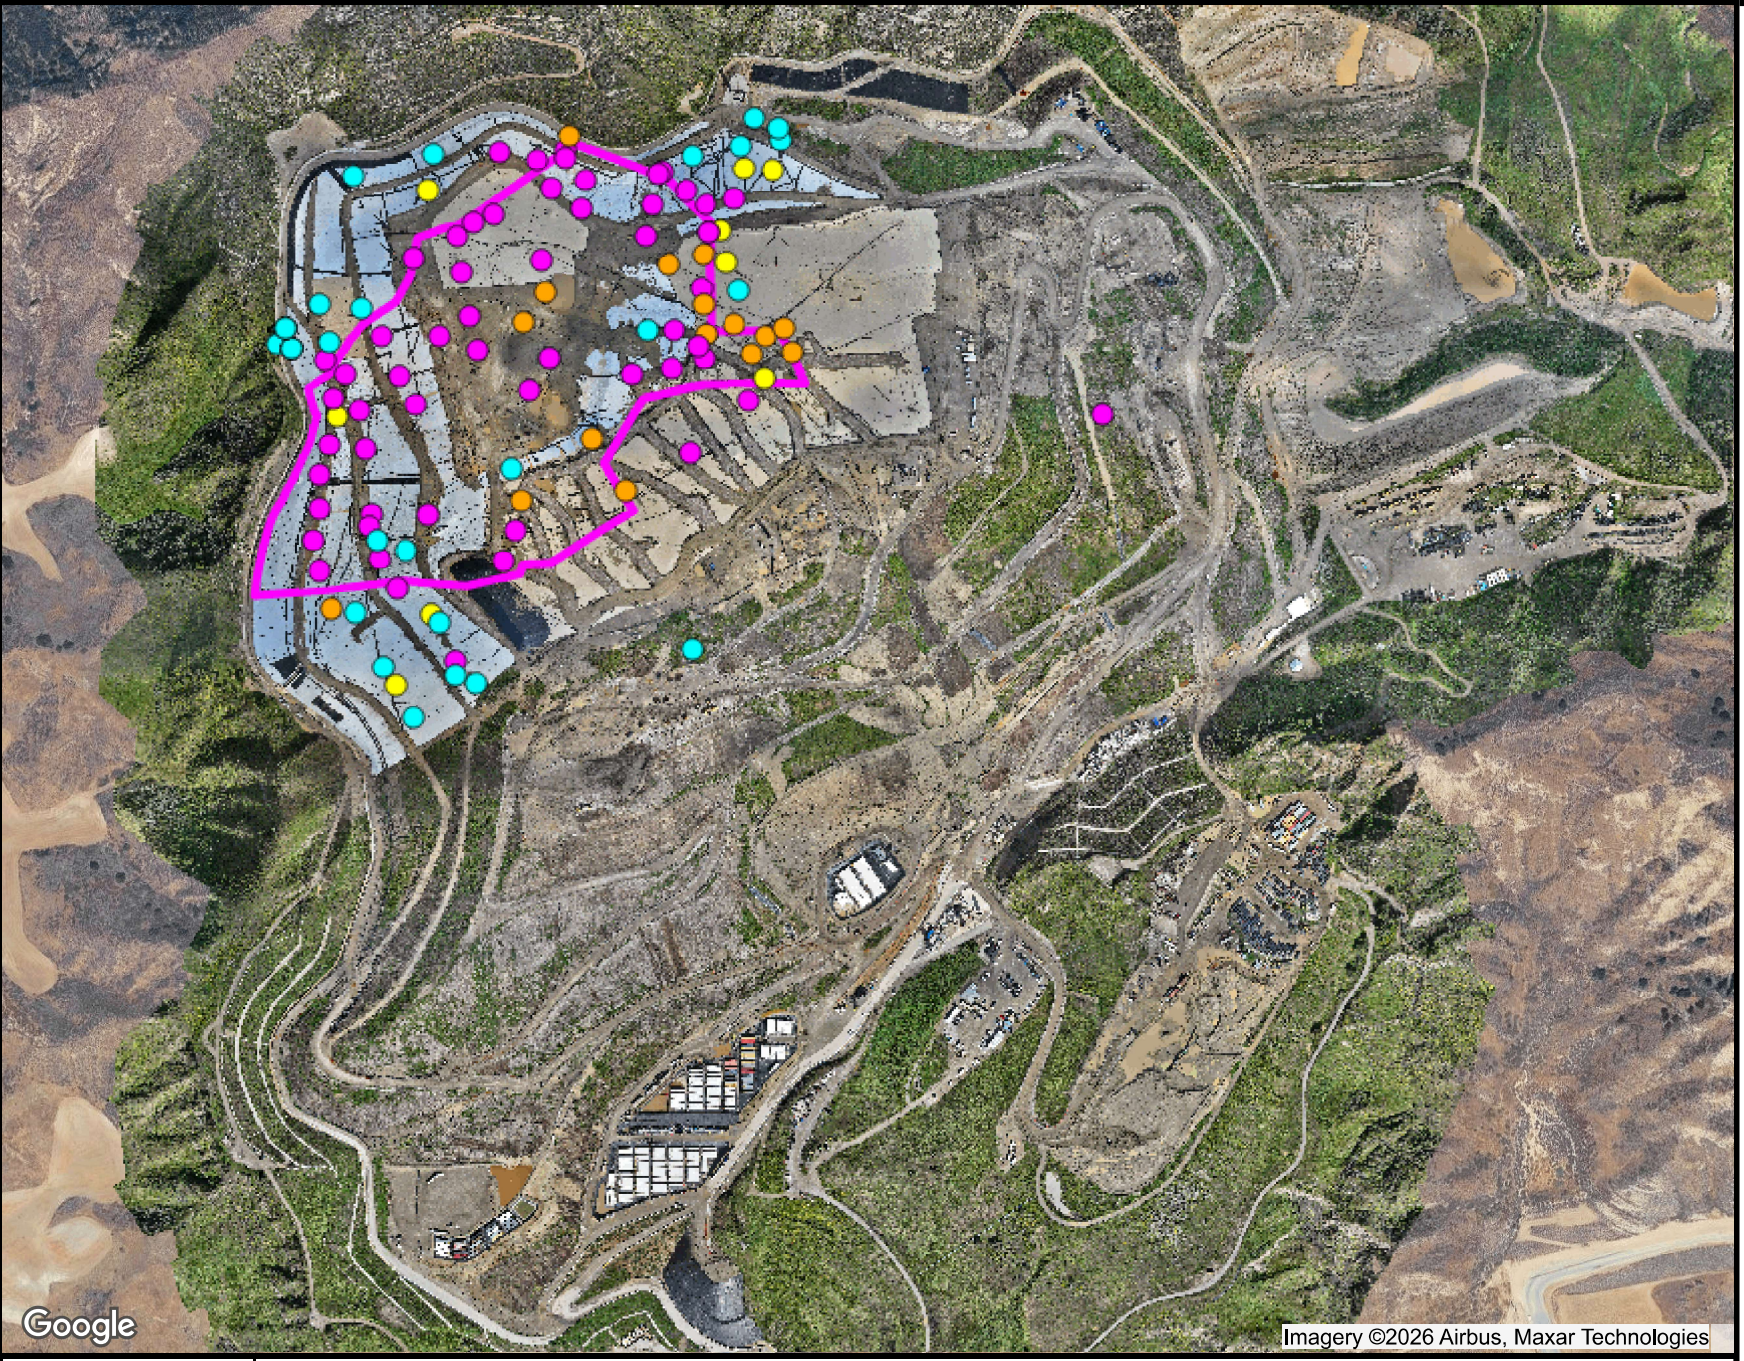

Ranges Mapped

						# Points
	>=	0	and	<	20000	32
	>=	20000	and	<	50000	9
	>=	50000	and	<	100000	16
	>=	100000	and	<	10000000	57

Point Type Legend

well

N

SCSeTools

Chiquita Canyon Landfill

Range Map

Parameter: H2 (mid range)

Analysis Method: Average

Date Range: 02/01/2026 - 02/28/2026

Map generation date : 03/19/2026

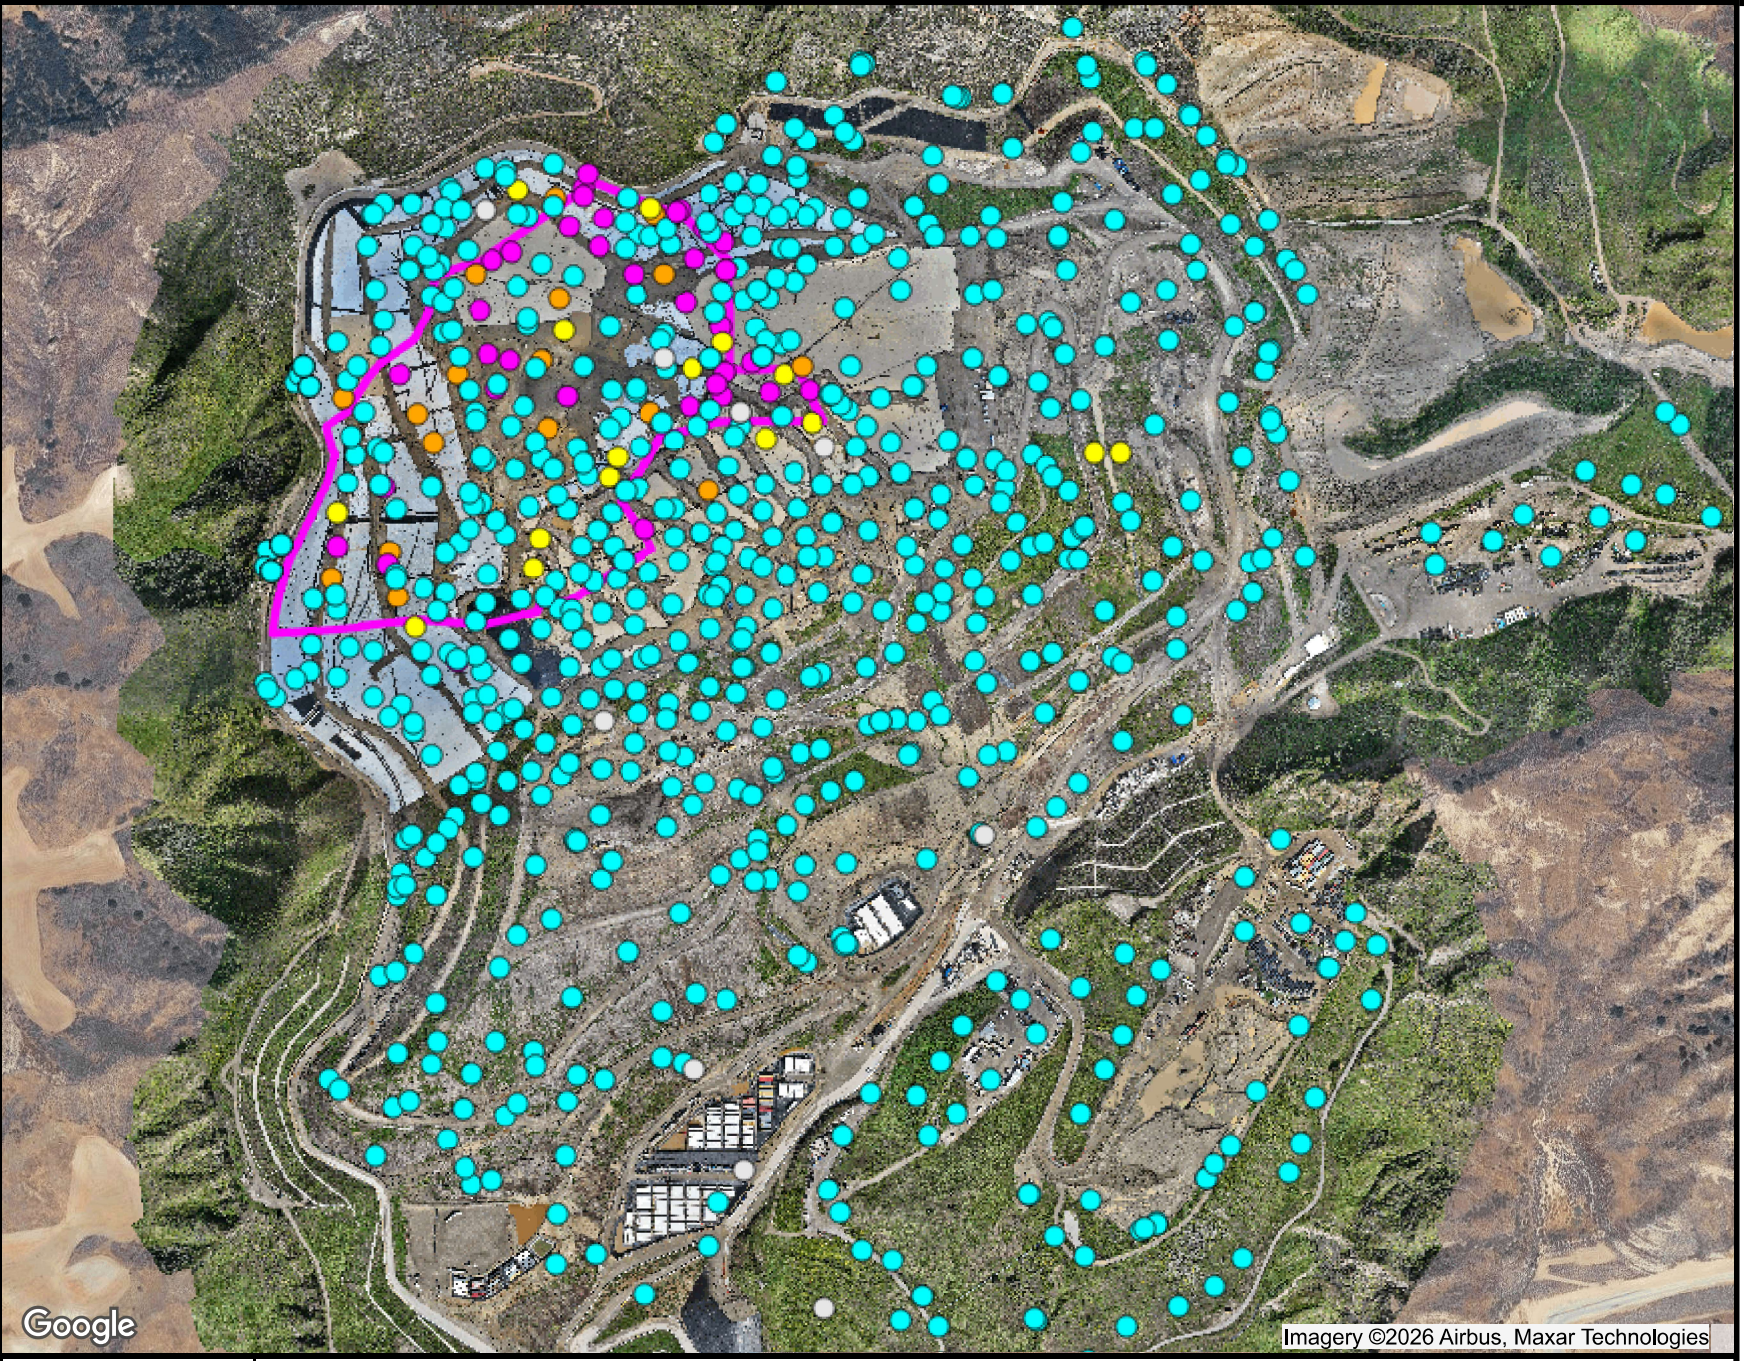

Ranges Mapped

						# Points
	>	-50	and	<=	145	680
	>	145	and	<=	160	18
	>	160	and	<=	169.99	18
	>	169.99	and	<=	999	36
		N/A			N/A	10

Point Type Legend

well

N

SCSeTools

Chiquita Canyon Landfill

Range Map

Parameter: Adj Temp (mid range)

Analysis Method: Average

Date Range: 02/01/2026 - 02/28/2026

Map generation date : 03/19/2026

Attachment H

Inspection Logs

CHIQUITA CANYON
A Waste Connections Company

February 10, 2026

Via E-Mail
Karen Gork
Chief Environmental Health Specialist
Los Angeles County Department of Public Health
Local Enforcement Agency
Environmental Programs Division
5050 Commerce Drive,
Baldwin Park, California 91706
KGork@ph.lacounty.gov

Re: Chiquita Canyon, LLC's Weekly Report on the Documentation and Tracking of Cover Issues, Monthly Summary and Monthly Isopach Map

Dear Ms. Gork:

In accordance with the Local Enforcement Agency's ("LEA") May 2, 2024 letter approving Chiquita's April 16, 2024 Second Revised Written Plan for Documenting and Tracking Cover Issues ("Second Revised Written Plan"), the LEA's May 29, 2024 letter, and the LEA's June 6, 2024 Compliance Order, Chiquita presents the enclosed report for documenting and tracking cover issues for the week of February 2, 2026 to February 7, 2026.

Also included in this report are the monthly isopach map and the monthly summary of fissures and tension cracks prepared for January 2026, pursuant to the Second Revised Written Plan.

Please contact me if you have any questions regarding this matter.

Regards,

Sarah Phillips
Corporate Compliance Manager
Waste Connections

Attachment: February 10, 2026 Weekly Cover Issues Report
cc: Mark Como, Department of Public Health
Eric Morofuji, Department of Public Health

Fissures and Tension Cracks

4050 - Chiquita Reaction Area Tracking of Fissures and Tension Cracks

2 Feb 2026 / Tom Roe

Complete

Conducted on	2 Feb 2026 10:16 AM PST
Prepared by	Tom Roe

Chiquita Reaction Area Tracking of Fissures and Tension Cracks

Chiquita Reaction Area Tracking of Fissures and Tension Cracks

Chiquita Reaction Area Tracking of Fissures and Tension Cracks 1

Fissure or Tension Crack Found?	No

Grid 164

Photo 1

Instability

Are there any indications of slope stability concerns?	No

4050 - Chiquita Reaction Area Tracking of Fissures and Tension Cracks

3 Feb 2026 / Tom Roe

Complete

Conducted on	3 Feb 2026 10:48 AM PST
Prepared by	Tom Roe

Chiquita Reaction Area Tracking of Fissures and Tension Cracks

Chiquita Reaction Area Tracking of Fissures and Tension Cracks

Chiquita Reaction Area Tracking of Fissures and Tension Cracks 1

Fissure or Tension Crack Found?	No

Grid 160

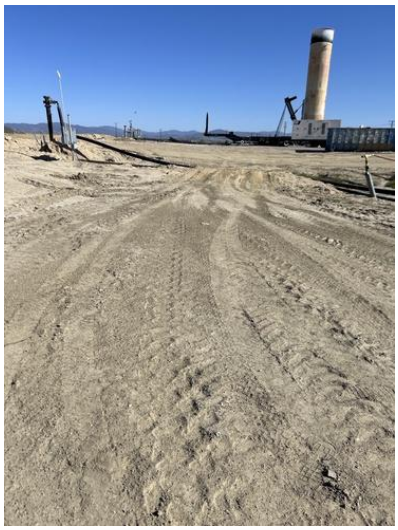

Photo 1

Instability

Are there any indications of slope stability concerns?	No

4050 - Chiquita Reaction Area Tracking of Fissures and Tension Cracks

4 Feb 2026 / Tom Roe

Complete

Conducted on	4 Feb 2026 10:29 AM PST
Prepared by	Tom Roe

Chiquita Reaction Area Tracking of Fissures and Tension Cracks

Chiquita Reaction Area Tracking of Fissures and Tension Cracks

Chiquita Reaction Area Tracking of Fissures and Tension Cracks 1

Fissure or Tension Crack Found?	No

Grid 83

Photo 1

Instability

Are there any indications of slope stability concerns?	No

4050 - Chiquita Reaction Area Tracking of Fissures and Tension Cracks

5 Feb 2026 / John Boucher

Complete

Conducted on	5 Feb 2026 6:57 AM PST
Prepared by	John Boucher

Chiquita Reaction Area Tracking of Fissures and Tension Cracks

Chiquita Reaction Area Tracking of Fissures and Tension Cracks

Chiquita Reaction Area Tracking of Fissures and Tension Cracks 1

Fissure or Tension Crack Found?	Yes

Using the attached image, annotate all areas where inspectors identified a fissure or tension crack.

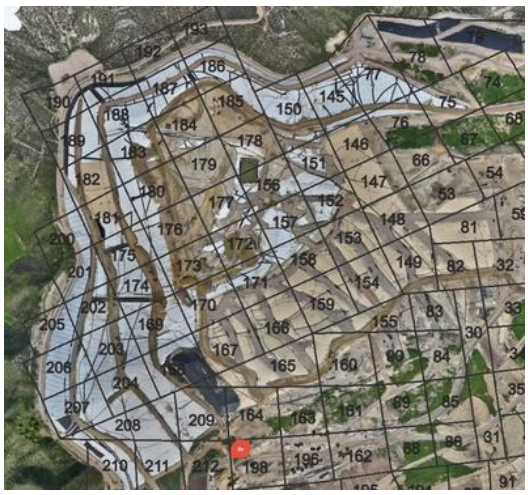

Grid Location	198
Date and Time Found	5 Feb 2026 10:20 AM PST

Image of Fissure/Tension Crack

Photo 1

Photo 2

Photo 3

Length of crack (ft) or area containing multiple cracks (ft x ft)	4ft
Horizontal Offset (width)	Extra Small <0.5 in width
Vertical Offset (height)	Extra small <0.5" in height
Orientation (direction)	E to W
Location	Castaic CA 91384 United States (34.43230245344594, -118.6486940635171)
Was Fissure or Crack fixed? If yes, add photo and description of repairs performed	Yes

Photo 4

Photo 5

Date and time of repairs	5 Feb 2026 11:34 AM PST
Description of repairs	Cracks were track walked.

Pipes moved and dirt added

Chiquita Reaction Area Tracking of Fissures and Tension Cracks
2

Fissure or Tension Crack Found?	Yes

Using the attached image, annotate all areas where inspectors identified a fissure or tension crack.

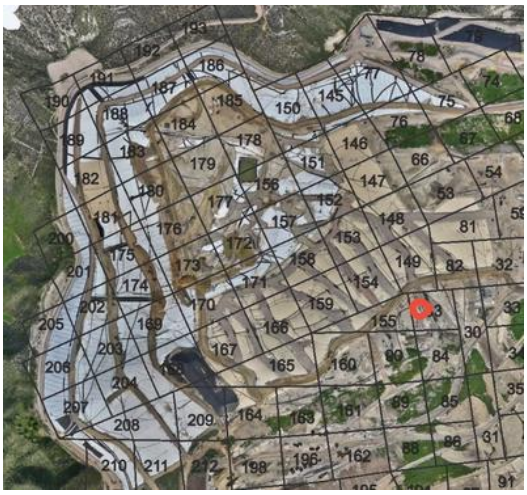

Grid Location	83
Date and Time Found	5 Feb 2026 11:38 AM PST

Image of Fissure/Tension Crack

Photo 6

Photo 7

Length of crack (ft) or area containing multiple cracks (ft x ft)	11ft
Horizontal Offset (width)	Extra Small <0.5 in width

Vertical Offset (height)	Extra small <0.5" in height
Orientation (direction)	E to W
Location	Castaic CA 91384 United States (34.43501850652935, -118.64491234811581)
Was Fissure or Crack fixed? If yes, add photo and description of repairs performed	Yes

Photo 8

Photo 9

Date and time of repairs	5 Feb 2026 1:56 PM PST
Description of repairs	Cracks were track walked.

Cracks were track walked and compacted with excavator

Instability

Are there any indications of slope stability concerns?	No

4050 - Chiquita Reaction Area Tracking of Fissures and Tension Cracks

6 Feb 2026 / John Boucher

Complete

Conducted on	6 Feb 2026 7:08 AM PST
Prepared by	John Boucher

Chiquita Reaction Area Tracking of Fissures and Tension Cracks

Chiquita Reaction Area Tracking of Fissures and Tension Cracks

Chiquita Reaction Area Tracking of Fissures and Tension Cracks 1

Fissure or Tension Crack Found?	Yes

Using the attached image, annotate all areas where inspectors identified a fissure or tension crack.

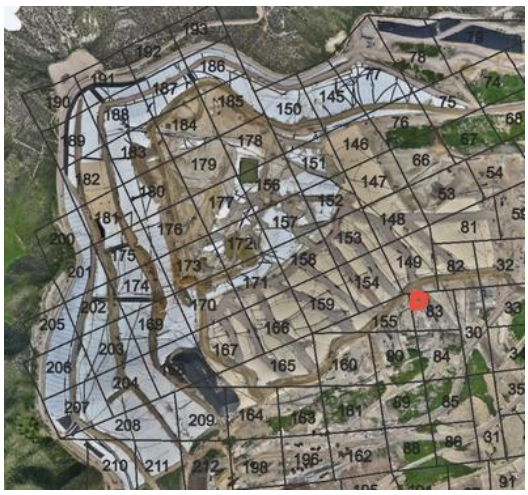

Grid Location	83
Date and Time Found	6 Feb 2026 10:27 AM PST

Image of Fissure/Tension Crack

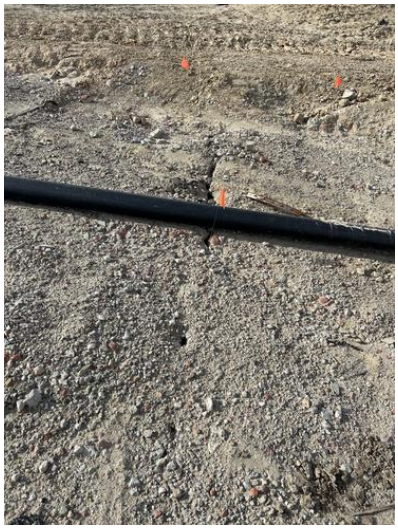

Photo 1

Photo 2

Photo 3

Photo 4

Length of crack (ft) or area containing multiple cracks (ft x ft)	Multiple cracks in a 11ft x 16ft area
Horizontal Offset (width)	Small 0.5-2" in width
Vertical Offset (height)	Extra small <0.5" in height
Orientation (direction)	E to W
Location	Castaic CA 91384 United States (34.434193771180176, -118.64603794500265)
Was Fissure or Crack fixed? If yes, add photo and description of repairs performed	Yes

Photo 5

Date and time of repairs	6 Feb 2026 11:45 AM PST
Description of repairs	Cracks were track walked.

Instability	
Are there any indications of slope stability concerns?	No

4050 - Chiquita Reaction Area Tracking of Fissures and Tension Cracks

7 Feb 2026 / John Boucher

Complete

Conducted on	7 Feb 2026 7:32 AM PST
Prepared by	John Boucher

Chiquita Reaction Area Tracking of Fissures and Tension Cracks

Chiquita Reaction Area Tracking of Fissures and Tension Cracks

Chiquita Reaction Area Tracking of Fissures and Tension Cracks 1

Fissure or Tension Crack Found?	No

Grid 198

Photo 1

Instability

Are there any indications of slope stability concerns?	No

Settlement

The bi-weekly drone flyover was not conducted this week. The drone data from the next flyover event will be included in the next weekly report.

Geosynthetic Cover

4050 - Geosynthetic Cover Inspection

2 Feb 2026 / Tom Roe

Complete

Flagged items	0
Conducted on	2 Feb 2026 7:14 AM PST
Prepared by	Tom Roe

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	Yes
Date and Time Issue Found	2 Feb 2026 9:47 AM PST

Grid Location

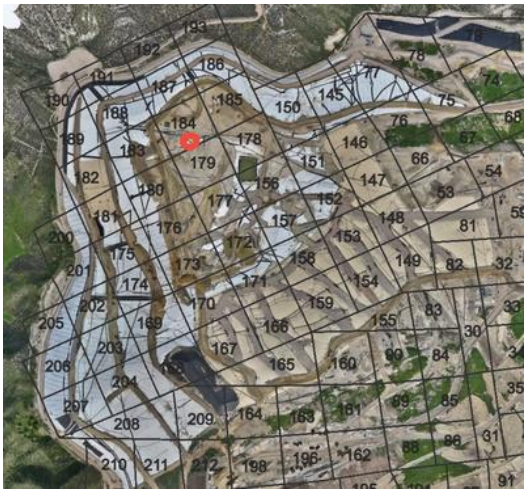

Grid Number	184

Take photo of identified issues

Photo 1

Notate what the issue is and what needs to be repaired	Hole where a pole was removed needs to be patched and extrusion welded.

Take photo of repair

Photo 2

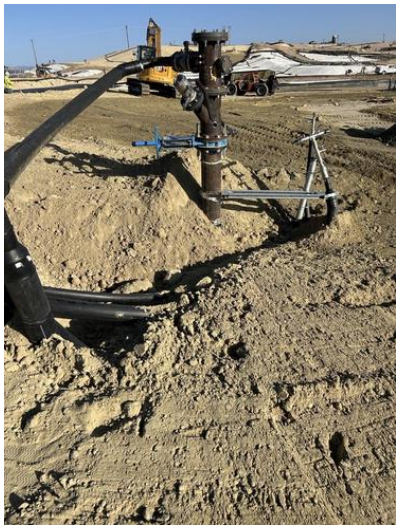

Photo 3

Description of repair work	Hole was taped and sandbagged upon discovery. As part of ongoing construction the area was covered with dirt and will eventually be lined with EVOH.
Date and time of repair (within 2 hours)	2 Feb 2026 9:52 AM PST
Are further permanent repairs required?	No
Date and Time of final repair (if necessary)	

Identified Issue 2

Are there any issues with the geosynthetic cover?	Yes
Date and Time Issue Found	2 Feb 2026 10:02 AM PST

Grid Location

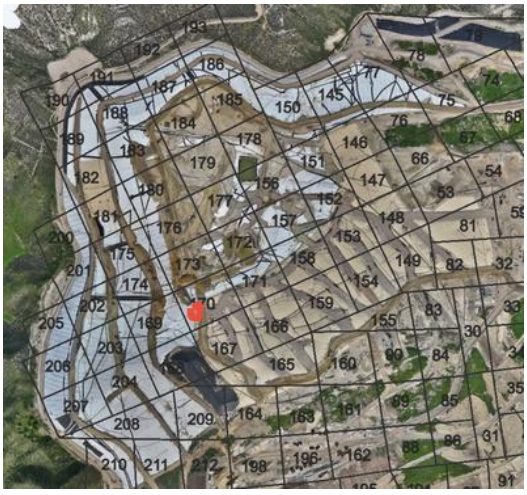

Grid Number	170

Take photo of identified issues

Photo 4

Notate what the issue is and what needs to be repaired	Hole in liner needs to be patched/extrusion welded.

Take photo of repair

Photo 5

Photo 6

Description of repair work	Hole taped and sandbagged upon discovery and later patched and extrusion welded.
Date and time of repair (within 2 hours)	2 Feb 2026 12:40 PM PST
Are further permanent repairs required?	No
Date and Time of final repair (if necessary)	2 Feb 2026 1:06 PM PST
Identified Issue 3	
Are there any issues with the geosynthetic cover?	Yes

Date and Time Issue Found 2 Feb 2026 12:58 PM PST

Grid Location

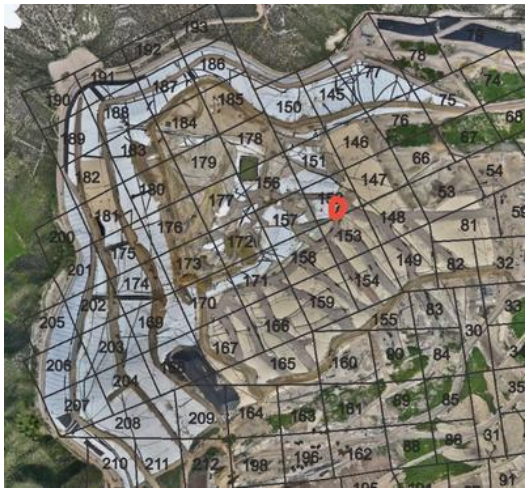

Grid Number 152

Take photo of identified issues

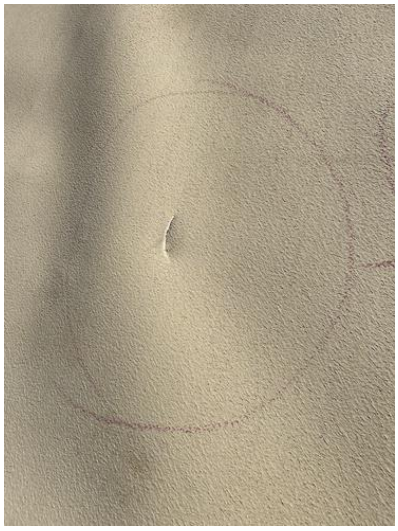

Photo 7

Notate what the issue is and what needs to be repaired Tear in liner needs to be patched/extrusion welded.

Take photo of repair

Photo 8

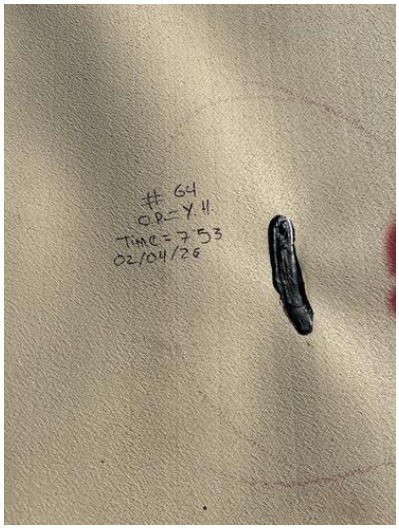

Photo 9

Description of repair work	Tear was taped and sandbagged upon discovery and later extrusion welded.
Date and time of repair (within 2 hours)	2 Feb 2026 1:00 PM PST
Are further permanent repairs required?	No
Date and Time of final repair (if necessary)	4 Feb 2026 7:53 AM PST

Identified Issue 4

Are there any issues with the geosynthetic cover?	Yes
Date and Time Issue Found	2 Feb 2026 1:11 PM PST

Grid Location

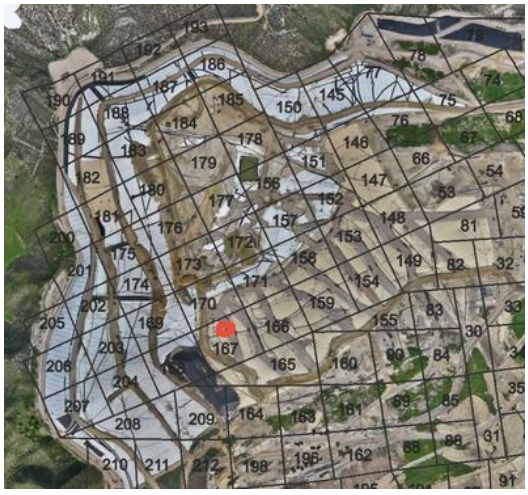

Grid Number	167

Take photo of identified issues

Photo 10

Notate what the issue is and what needs to be repaired	Hole in liner needs to be patched and extrusion welded.

Take photo of repair

Photo 11

Photo 12

Description of repair work	Tear taped and sandbagged upon discovery and later extrusion welded.
Date and time of repair (within 2 hours)	2 Feb 2026 1:13 PM PST
Are further permanent repairs required?	No
Date and Time of final repair (if necessary)	4 Feb 2026 12:47 PM PST
Identified Issue 5	
Are there any issues with the geosynthetic cover?	Yes
Date and Time Issue Found	2 Feb 2026 1:16 PM PST

Grid Location

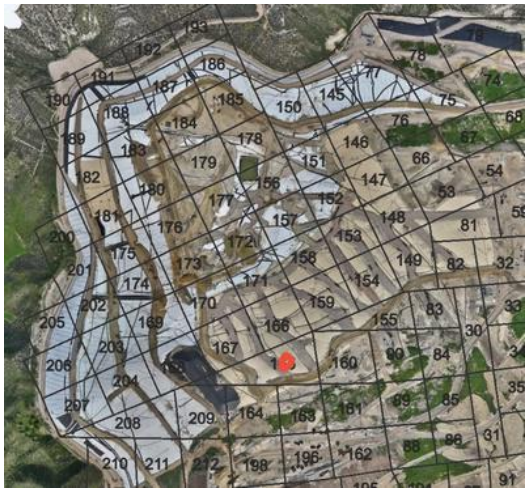

Grid Number 165

Take photo of identified issues

Photo 13

Notate what the issue is and what needs to be repaired Hole in liner needs to be patched/extrusion welded.

Take photo of repair

Photo 14

Photo 15

Description of repair work	Hole taped and sandbagged upon discovery and later extrusion welded.
Date and time of repair (within 2 hours)	2 Feb 2026 1:18 PM PST
Are further permanent repairs required?	No
Date and Time of final repair (if necessary)	4 Feb 2026 12:04 PM PST

Identified Issue 6

Are there any issues with the geosynthetic cover?	Yes
Date and Time Issue Found	2 Feb 2026 1:47 PM PST

Grid Location

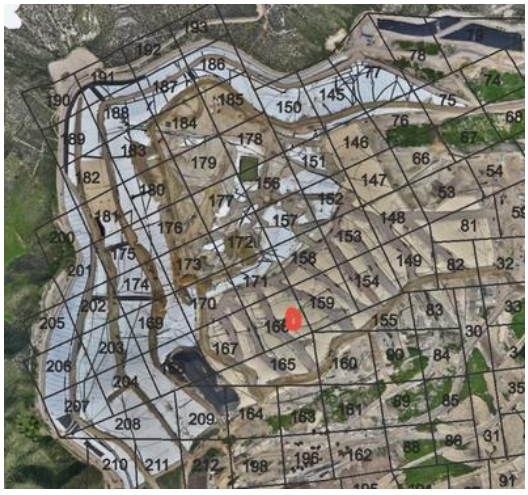

Grid Number	166

Take photo of identified issues

Photo 16

Photo 17

Notate what the issue is and what needs to be repaired

Two small tears in liner near each other need to be extrusion welded.

Take photo of repair

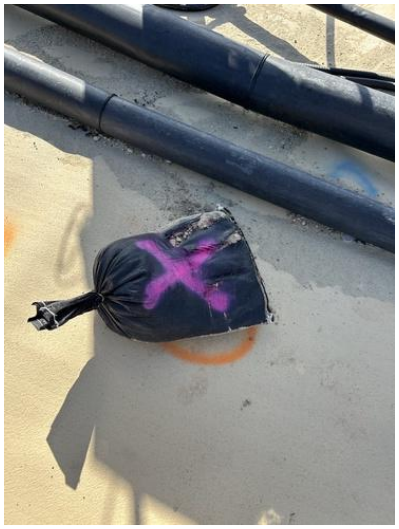

Photo 18

Photo 19

Photo 20

Photo 21

Description of repair work	Tears taped and sandbagged upon discovery and later extrusion welded.
Date and time of repair (within 2 hours)	2 Feb 2026 1:51 PM PST
Are further permanent repairs required?	No
Date and Time of final repair (if necessary)	4 Feb 2026 11:19 AM PST
Instability under the cover	
Are there any anomalous (unusual or unexpected) areas of cover damage or deformation that may indicate underlying instability?	No
Are there any signs of a downslope tension crack at the top of the slope or bulging at or near the toe of the slope?	No
Is there any movement of the equipment that vertically penetrates the cover (e.g., tilting)?	No

4050 - Geosynthetic Cover Inspection

3 Feb 2026 / Tom Roe

Complete

Flagged items	0
Conducted on	3 Feb 2026 6:28 AM PST
Prepared by	Tom Roe

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	Yes
Date and Time Issue Found	3 Feb 2026 2:16 PM PST

Grid Location

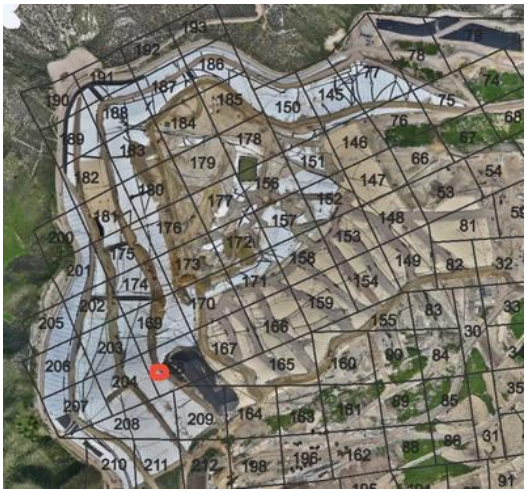

Grid Number	168

Take photo of identified issues

Photo 1

Notate what the issue is and what needs to be repaired	Hole in liner needs to be patched/extrusion welded.

Take photo of repair

Patch photo states repair was on 2/3 but was actually conducted on 2/4

Photo 2

Photo 3

Description of repair work	Hole taped and sandbagged upon discovery and later patched and extrusion welded.
Date and time of repair (within 2 hours)	3 Feb 2026 2:20 PM PST
Are further permanent repairs required?	No
Date and Time of final repair (if necessary)	4 Feb 2026 12:17 PM PST
Instability under the cover	
Are there any anomalous (unusual or unexpected) areas of cover damage or deformation that may indicate underlying instability?	No
Are there any signs of a downslope tension crack at the top of the slope or bulging at or near the toe of the slope?	No
Is there any movement of the equipment that vertically penetrates the cover (e.g., tilting)?	No

4050 - Geosynthetic Cover Inspection

4 Feb 2026 / Tom Roe

Complete

Flagged items	0
Conducted on	4 Feb 2026 1:47 PM PST
Prepared by	Tom Roe

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	No

Photo 1

Photo 2

Photo 3

Photo 4

Instability under the cover	
Are there any anomalous (unusual or unexpected) areas of cover damage or deformation that may indicate underlying instability?	No
Are there any signs of a downslope tension crack at the top of the slope or bulging at or near the toe of the slope?	No
Is there any movement of the equipment that vertically penetrates the cover (e.g., tilting)?	No

4050 - Geosynthetic Cover Inspection

5 Feb 2026 / John Boucher

Complete

Flagged items	0
Conducted on	5 Feb 2026 6:57 AM PST
Prepared by	John Boucher

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	No

Photo 1

Photo 2

Photo 3

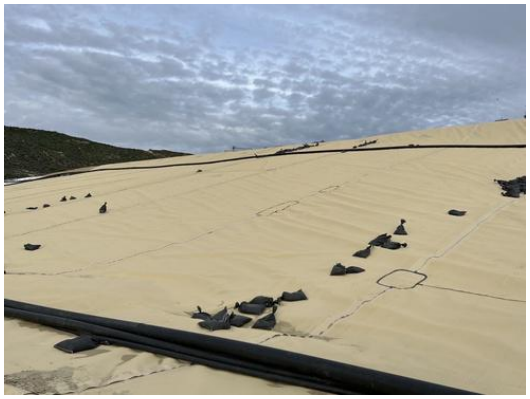

Photo 4

Instability under the cover	
Are there any anomalous (unusual or unexpected) areas of cover damage or deformation that may indicate underlying instability?	No
Are there any signs of a downslope tension crack at the top of the slope or bulging at or near the toe of the slope?	No
Is there any movement of the equipment that vertically penetrates the cover (e.g., tilting)?	No

4050 - Geosynthetic Cover Inspection

6 Feb 2026 / John Boucher

Complete

Flagged items	0
Conducted on	6 Feb 2026 7:08 AM PST
Prepared by	John Boucher

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	No

Photo 1

Photo 2

Photo 3

Photo 4

Instability under the cover	
Are there any anomalous (unusual or unexpected) areas of cover damage or deformation that may indicate underlying instability?	No
Are there any signs of a downslope tension crack at the top of the slope or bulging at or near the toe of the slope?	No
Is there any movement of the equipment that vertically penetrates the cover (e.g., tilting)?	No

4050 - Geosynthetic Cover Inspection

7 Feb 2026 / John Boucher

Complete

Flagged items	0
Conducted on	7 Feb 2026 7:32 AM PST
Prepared by	John Boucher

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	No

Photo 1

Photo 2

Photo 3

Photo 4

Instability under the cover	
Are there any anomalous (unusual or unexpected) areas of cover damage or deformation that may indicate underlying instability?	No
Are there any signs of a downslope tension crack at the top of the slope or bulging at or near the toe of the slope?	No
Is there any movement of the equipment that vertically penetrates the cover (e.g., tilting)?	No

Geo-Logic ASSOCIATES

February 9, 2026

Mr. Kevin Green
Chiquita Canyon Landfill
29201 Henry Mayo Drive
Castaic, California 91384

JANUARY 2026 FISSURE AND TENSION CRACK MONITORING SUMMARY
CHIQUITA CANYON LANDFILL
CASTAIC, CALIFORNIA

Dear Mr. Green:

This monthly summary report was prepared by Geo-Logic Associates, Inc. (GLA) to summarize the monitoring and tracking of fissures and tension cracks that was performed at the Chiquita Canyon Landfill (Landfill) between January 1 and January 31, 2026, in accordance with Milestone 2B of the Local Enforcement Agency's (LEA) June 6, 2024 Compliance Order, formerly referred to as Mitigation Measure #2B. This summary was prepared in accordance with Chiquita Canyon, LLC's (Chiquita) April 16, 2024 Second Revised Written Plan (Second Revised Written Plan) to document and track cover issues and is associated with Milestone 2B.

JANUARY OBSERVATIONS

Chiquita conducts daily monitoring of the soil cover for fissures and tension cracks and of the geomembrane-covered area for damage or evidence of possible instability. The cracks and fissures that were observed in January 2026 are summarized in Table 1. Table 2 summarizes the daily observations performed in geomembrane-covered areas in January 2026. Chiquita repaired all the cracks identified in Table 1 and all the small geomembrane tears identified in Table 2.

As indicated in these tables, no evidence of instability was reported in the soil-covered areas or the geomembrane-covered areas. The cracks and fissures summarized in Table 1 were reviewed with respect to the criteria for "significant" as that term is defined in Chiquita's Second Revised Written Plan.[1] As shown in this table, three cracks or fissures that potentially met these criteria were observed in January:

[1] Pursuant to the Second Revised Written Plan, a "significant" fissure or tension crack is one that (1) is 100 feet or longer in length; (2) has a horizontal offset of 0.5 inches or more when the fissure/crack is at least 50 feet in length; or (3) has a vertical offset of 0.5 inches or more when the fissure/crack is at least 50 feet in length or there are multiple fissures/cracks oriented in the same direction. The classification of

- An approximately 130 ft by 8 ft area with "small" horizontal offset and "extra small" vertical offset cracks was observed on January 13, 2026 in Grid 148 in the portion of the grid not yet covered by EVOH geomembrane. No crack was greater than 50 feet. As shown in Figure 1, Grid 148 had been covered by geomembrane by the end of January.
- An approximately 60 ft by 45 ft area with "small" horizontal offset and "extra small" vertical offset cracks was observed on January 20, 2026 in Grid 148 in the portion of the grid not yet covered by EVOH geomembrane. No crack was greater than 50 feet. As shown in Figure 1, Grid 148 had been covered by geomembrane by the end of January.
- An approximately 70 ft by 35 ft area with "small" horizontal offset and "extra small" vertical offset cracks was observed on January 28, 2026 in Grid 155 adjacent to the EVOH geomembrane cover. No crack was greater than 50 feet. The log notes that no individual crack was over 50 feet long.

All the cracks identified in Table 1 and summarized above were repaired. Cross sections that compare December 30, 2025 and January 28, 2026 topography are shown in Figures 2A through 2E. The locations of these cross sections are shown in Figure 1. The sections show no significant differences in slope or evidence of instability between the December 2025 and January 2026 profiles, which is consistent with the observational records summarized in Tables 1 and 2.

GRID TRENDS

Monitoring in May, June, and December 2024 and in June, July, August, September, and October 2025 documented cracks potentially meeting the definition of "significant", as that term is defined in Chiquita's Second Revised Written Plan, in the following grids:

- **Grid 183.** On May 23, 2024, a 65-ft tension crack with 0.5–2 in. horizontal offset ("small") was observed. It was repaired by track-walking, and no further cracking was reported in subsequent May and June 2024 inspections. The grid has since been geomembrane-covered, with no evidence of instability observed from July 2024 through January 2026.
- **Grid 151.** Cracking was noted on May 20 and 28, 2024. A June 19, 2024 inspection confirmed multiple cracks within a 15 ft x 35 ft area, including one with >4 in. horizontal offset ("large") and 0.5–2 in. vertical offset ("small"). On July 2, 2024,

a crack or fissure as "significant" for purposes of this summary does not mean that there is a concern for slope instability or that the Landfill's containment system is compromised. The criteria were established for comparison purposes only.

an additional non-significant crack with similar offsets was observed and repaired. This grid has since been geomembrane-covered and there has been no evidence of instability from August 2024 through January 2026.

- **Grid 180.** On June 3, 2024, a 60-ft crack with "small" horizontal offset was observed. The feature was not present in subsequent June 2024 monitoring. The grid has been geomembrane-covered, with no evidence of instability observed through January 2026.
- **Grid 152.** On June 24, 2024, a 55-ft crack with "small" horizontal offset was observed. No cracking was reported in this grid in subsequent inspections until more than a year later. On July 30, 2025, a 10 ft x 5 ft area of cracks with "medium" horizontal and "extra small" vertical offsets was documented, classified as nonsignificant, and repaired. This grid is geomembrane-covered, and there has been no evidence of instability through January 2026.
- **Grid 146.** A 55-ft crack with "medium" horizontal and "extra-small" vertical offsets was documented and repaired on December 4, 2024. Additional minor cracks with "medium" to "large" horizontal offsets were identified and repaired in May and June 2025. On July 8, 2025, a 75-ft-long crack with "small" horizontal and "extra-small" vertical offsets was observed across the Grid 146/147 boundary and repaired. Two minor cracks were noted later in July, one in August, and five in September 2025; all were repaired. In October 2025, one potentially "significant" and two minor cracks were documented and subsequently repaired by soil placement and track-walking. One non-significant crack with "large" displacement was identified in November 2025 and was repaired. This grid was partially covered at the beginning of January 2026 and was completely covered by geomembrane by the end of January. No cracking was observed in the exposed portions of the grid in December 2025 or January 2026.
- **Grid 147.** A 100-ft crack with "large" horizontal and "medium" vertical offsets was documented and repaired on June 23, 2025. On July 8, 2025, a 75-ft crack spanning Grids 146 and 147 with "small" horizontal and "extra-small" vertical offsets was observed and repaired. Later July inspections identified three minor cracks with "medium" to "large" offsets; all were repaired. In August 2025, one 65-ft crack and several localized cracks or small settlement-related "collapse" features were documented and repaired. Five additional minor cracks were observed and repaired in September. In October 2025, two potentially "significant" cracks within Grid 147 and one spanning Grids 147–148 were documented, along with three minor cracks. All October features were repaired by soil placement and track-walking. One non-significant crack with "large"

displacement was identified in November 2025 and was repaired. One non-significant crack with "small" horizontal offset and "extra small" vertical offset was identified in the exposed portion of the grid in December 2025 and was repaired. This grid was partially covered at the beginning of January 2026 and was completely covered by geomembrane by the end of January. Non-significant cracking was observed in the exposed portion of the grid on January 19, 2026.

- **Grid 164**. On September 12, 2025, potentially "significant" cracking was observed in Grid 164 based on the presence of an approximately 40-ft x 50-ft area containing multiple intersecting cracks, the longest of which was about 50 ft. The horizontal offset (width) of the crack(s) was identified as "large," the vertical offset (height) of the crack(s) was identified as "extra small", and the orientation of the crack(s) was identified as northeast-to-southwest. No slope-stability concerns were noted in this grid at the time of observation, and the cracks were repaired. Approximately 50 percent of this grid is now covered by the geomembrane. No cracking was documented in exposed portions of Grid 164 in the October 2025 through December 2026 field records. Non-significant cracking was documented in the grid on January 20, 2026.

CONCLUSIONS

As summarized in Table 1, three areas with maximum crack lengths of no more than 50 feet were identified in January 2026 at the approximate location shown in Figure 1. Although much of the top deck of the landfill in the affected area is now geomembrane-covered, monitoring to date indicates the documented cracking is attributable to settlement and does not constitute evidence of slope instability.

Please let me know if you have any questions regarding the information in this report.

Very truly yours,
Geo-**L**ogic **A**ssociates, Inc.

Richard A. Mitchell, PG, CEG
Principal Engineering Geologist

Table 1
SUMMARY OF JANUARY 2026 FISSURE AND TENSION CRACK OBSERVATIONS
Chiquita Canyon Landfill

DATE	INSPECTOR	GRID	LOCATION	TYPE	LENGTH (ft)	AREA (ft x ft)	HORIZONTAL OFFSET	VERTICAL OFFSET	ORIENTATION	LATITUDE	LONGITUDE	REPAIRED	INDICATIONS OF SLOPE STABILITY CONCERNS
1/2/2026	John Boucher		No Cracks Found	N/A									No
1/3/2026	John Boucher		No Cracks Found	N/A									No
1/5/2026	Tom Roe		No Cracks Found	N/A									No
1/6/2026	Tom Roe		No Cracks Found	N/A									No
1/7/2026	Tom Roe		No Cracks Found	N/A									No
1/8/2026	John Boucher		No Cracks Found	N/A									No
1/9/2026	John Boucher		No Cracks Found	N/A									No
1/10/2026	John Boucher		No Cracks Found	N/A									No
1/12/2026	Tom Roe		No Cracks Found	N/A									No
1/13/2026	Tom Roe	148	Top Deck	Area		130x8	Small	Extra Small	NW	34.435554	-118.646344	Yes	No
1/14/2026	John Boucher		No Cracks Found	N/A									No
1/15/2026	John Boucher		No Cracks Found	N/A									No
1/16/2026	John Boucher		No Cracks Found	N/A									No
1/17/2026	John Boucher		No Cracks Found	N/A									No
1/19/2026	Tom Roe	147	Top Deck	Area		20x35	Small	Extra Small	NW	34.435674	-118.646393	Yes	No
1/20/2026	Tom Roe	148	Top Deck	Area		60x45	Small	Extra Small	NW	34.435364	-118.645982	Yes	No
1/20/2026	Tom Roe	164	Top Deck South	Area		40x6	Extra Small	Extra Small	EW	34.432527	-118.648376	Yes	No
1/21/2026	Tom Roe	82	Top Deck South	Area		15x3	Extra Small	Extra Small	NE	34.434375	-118.645724	Yes	No
1/22/2026	John Boucher		No Cracks Found	N/A									No
1/23/2026	John Boucher		No Cracks Found	N/A									No
1/24/2026	John Boucher		No Cracks Found	N/A									No
1/26/2026	Tom Roe		No Cracks Found	N/A									No
1/27/2026	Tom Roe	160	Top Deck South	Area		30x35	Extra Small	Extra Small	NE	34.432932	-118.647636	Yes	No
1/28/2026	Tom Roe	155	Top Deck South	Area		70x35	Small	Extra Small	NE	34.434001	-118.646200	Yes	No
1/29/2026	John Boucher		No Cracks Found	N/A									No
1/30/2026	John Boucher		No Cracks Found	N/A									No
1/31/2026	John Boucher		No Cracks Found	N/A									No

HORIZONTAL CRACK DEFINITIONS
Extra Small <0.5-in Width
Small 0.5-in to 2-in Width
Medium 2-in to 4-in Width
Large >4-in Width

VERTICAL CRACK DEFINITIONS
Extra Small <0.5-in Height
Small 0.5-in to 2-in Height
Medium 2-in to 4-in Height
Large >4-in Height

Pursuant to the Second Revised Written Plan, a "significant" fissure or tension crack is one that (1) is 100 feet or longer in length; (2) has a horizontal offset of 0.5 inches or more when the fissure/crack is at least 50 feet in length; or (3) has a vertical offset of 0.5 inches or more when the fissure/crack is at least 50 feet in length or there are multiple fissures/cracks oriented in the same direction. The classification of a crack or fissure as "significant" for purposes of this summary does not mean that there is a concern for slope instability or that the Landfill's containment system is compromised. The criteria were established for comparison purposes only.

Table 2
SUMMARY OF JANUARY 2026 GEOMEMBRANE COVER OBSERVATIONS
Chiquita Canyon Landfill

DATE	ISSUES OR CONCERNS			
	Issue Identified	Evidence of Underlying Deformation	Tension Cracks at Top of Slope or Bulging at Toe of Slope	Vetical Deformation of Infrastructure Such as Wells or Probes
1/2/2026	No	No	No	No
1/3/2026	No	No	No	No
1/5/2026	No	No	No	No
1/6/2026	No	No	No	No
1/7/2026	Yes[1]	No	No	No
1/8/2026	No	No	No	No
1/9/2026	Yes[2]	No	No	No
1/10/2026	No	No	No	No
1/12/2026	No	No	No	No
1/13/2026	No	No	No	No
1/14/2026	No	No	No	No
1/15/2026	No	No	No	No
1/16/2026	No	No	No	No
1/17/2026	No	No	No	No
1/19/2026	Yes[3]	No	No	No
1/20/2026	Yes[4,5]	No	No	No
1/21/2026	Yes[6,7,8,9]	No	No	No
1/22/2026	Yes[10]	No	No	No
1/23/2026	Yes[11,12]	No	No	No
1/24/2026	No	No	No	No
1/26/2026	Yes[13]	No	No	No
1/27/2026	Yes[14,15]	No	No	No
1/28/2026	Yes[16,17]	No	No	No
1/29/2026	Yes[18,19]	No	No	No
1/30/2026	No	No	No	No
1/31/2026	No	No	No	No

JANUARY 2026 NOTES:

1. Liner tear in Grid 183. Tear taped and sandbagged on discovery. Final repair completed on 1/8/2026.
2. Liner tear in Grid 191. Flex tap placed on discovery. Final repair scheduled for 1/13/2026.
3. Small hole in cover in Grid 185. Hole was patched and extrusion welded on 1/19/2026.
4. Old repair needs to be patched and extrusion welded. Work was performed on 1/20/2026.
5. Small hole in weld. Hole was taped on discovery.
6. Tear in liner in Grid 148. Tear was taped and sandbagged on discovery. Final repair scheduled for 1/26/2026.
7. Two small tears in liner in Grid 159. Tears were taped and sandbagged on discovery. Final repair performed on 1/26/2026.
8. Tear in liner in Grid 170. Tear was taped and sandbagged on discovery. Final repair performed on 1/23/2026.
9. Four small tears in liner in Grid 173. Tears were taped on discovery and later extrusion welded. Final repairs completed on 1/23/2026.
10. Small hole in liner in Grid 210. Hole was sealed with flex tape on discovery. Hole was later patched and extrusion welded. Final Repairs completed on 1/27/2026.
11. Liner torn in Grid 182. Tears were temporarily sealed using flex tape and a piece of liner. Final repairs scheduled for 1/28/2026.
12. Liner torn in Grid 205. Liner was patched and extrusion welded.
13. Pipe boot needs to be lowered; tears in liner in Grid 81. Tears were taped on discovery and were later extrusion welded. Final repairs completed on 1/27/2026.
14. Liner torn in Grid 200. Tear was taped and sandbagged on discovery and was later patched and extrusion welded. Final repairs were completed on 1/27/2026.
15. Liner torn in Grid 201. Tear was taped and sandbagged on discovery. Final repairs scheduled for 2/4/2026.
16. Two small tears in Grid 175. Tears were taped and sandbagged on discovery and later patched and extrusion welded. Final repairs were completed on 1/29/2026.
17. Tears in liner in Grid 181. Tears were in an area that could not be accessed safely. A repair plan was under development.
18. Pinhole in liner in Grid 155. Flex tape placed to seal hole. Hole was later patched and extrusion welded. Final Repairs completed 2/2/2026.
19. Liner torm in Grid 188. Liner sealed with flex tape. Tear was later patched and extrusion welded. Final repairs completed on 2/2/2026.

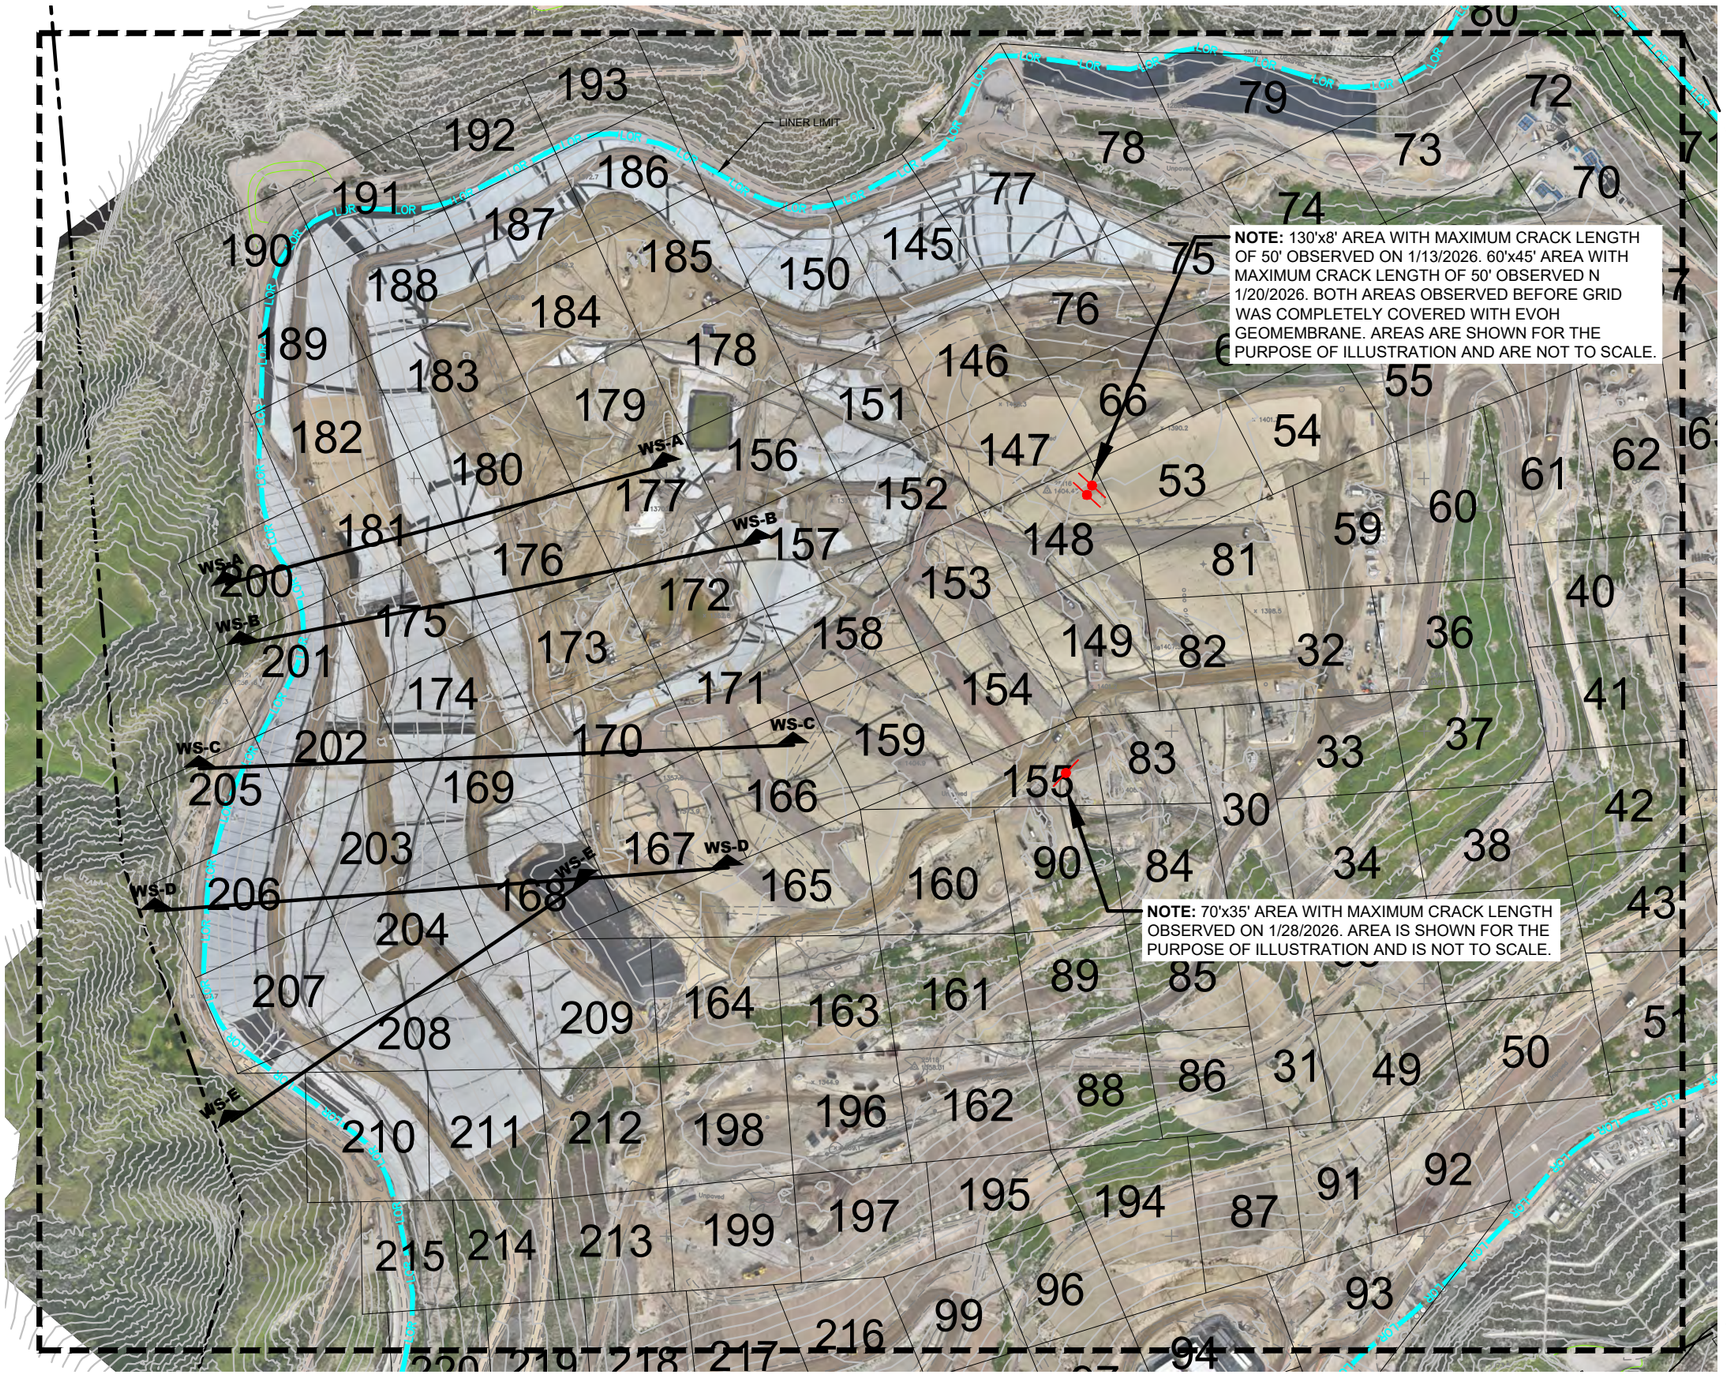

LEGEND:

PROPERTY LINE

LOR LOR LINER LIMIT

WS-A WS-A CROSS SECTION
WS= WESTERN SLOPE EVALUATION
CROSS SECTION LOCATION
NS= NORTHERN SLOPE EVALUATION
CROSS SECTION LOCATION

NOTE:
CRACKS ARE SHOWN FOR THE PURPOSE OF ILLUSTRATION AND ARE NOT TO SCALE. SEE TABLE 1 FOR ACTUAL LOCATION WITHIN THE MONITORING GRIDS.

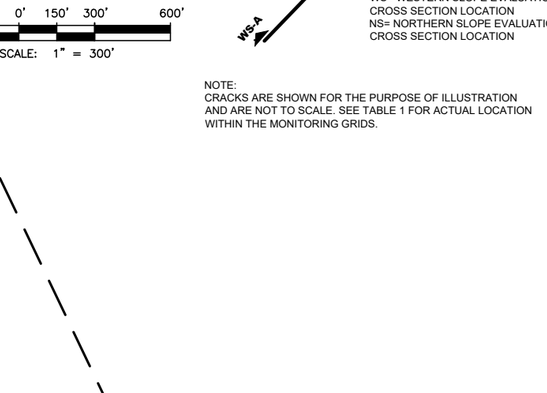

SITE MAP

This drawing has not been published but rather has been prepared by Geo-Logic Associates, Inc. for use by the client named in the title block, solely in respect of the construction operation, and maintenance of the facility named in the title block. Geo-Logic Associates, Inc. shall not be liable for the use of this drawing on any other facility or for any other purpose.

ISSUED FOR REVIEW

REFERENCE AERIAL TOPO BASED ON JANUARY 28, 2026 AERIAL SURVEY PROVIDED BY PROPELLER

REV. NO.	DATE	DESCRIPTION	APPROVED BY

DATE OF ISSUE: FEBRUARY 2026
DESIGNED BY: R MITCHELL
CAD DESIGN BY: L PADILLA
CHECKED BY: R MITCHELL
APPROVED BY: R MITCHELL

DIGALERT 811

Geo-Logic ASSOCIATES
2777 EAST GUASTI ROAD
SUITE 1
ONTARIO, CA 91761
(909) 626-2282
www.geo-logic.com

CHIQUITA CANYON
A Waste Connections Company
29201 HENRY MAYO DRIVE
CASTAIC, CA 91384

JANUARY 2026 MONITORING SUMMARY CHIQUITA CANYON LANDFILL COUNTY OF LOS ANGELES, CA

MONITORING GRID

FIG NO. 01

PROJECT NO. RM22.1077

P:\SITES\CHIQUITA CYN LF\MONITORING SUMMARY\FIGURES\RM22.1077-CQL-MS-FIG 1-(2026-02-09).DWG February 9, 2026 - 10:35 AM BY: GLA-USER

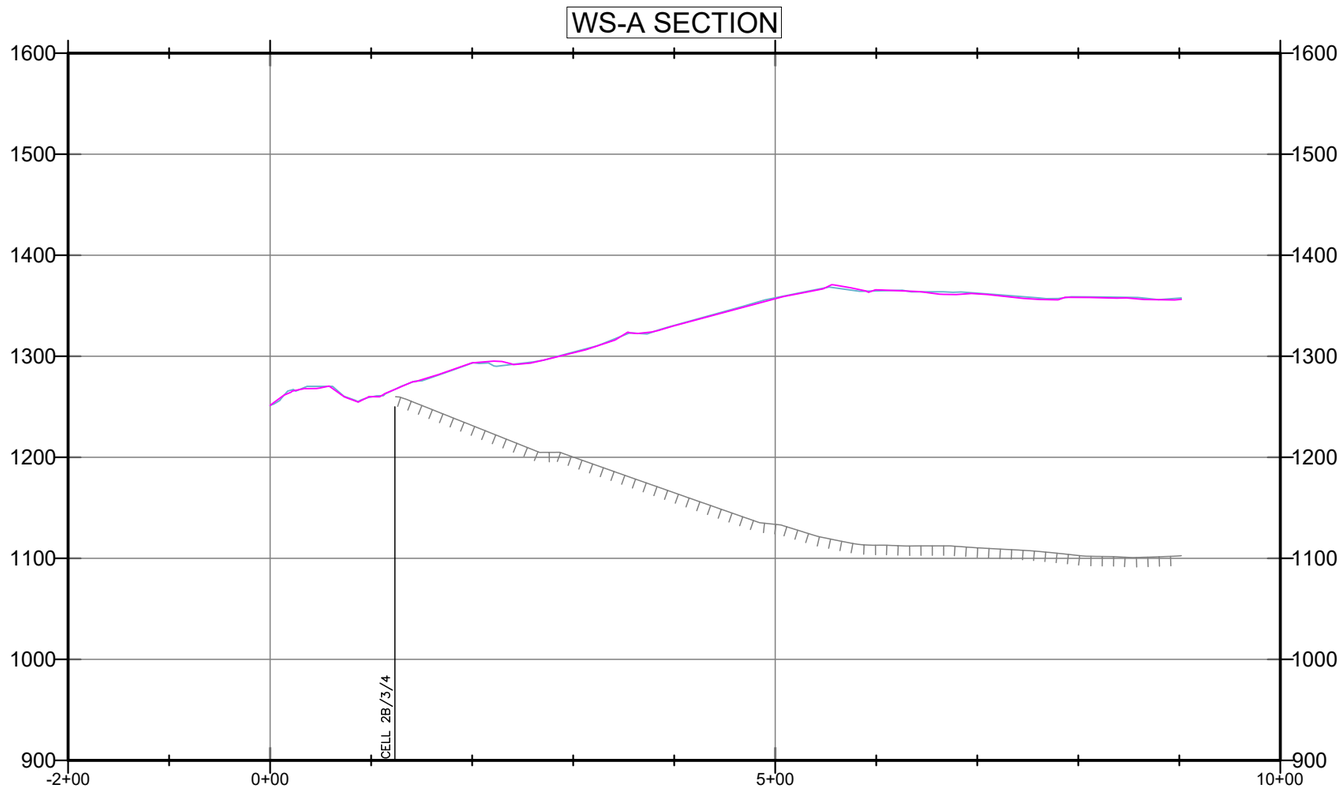

LEGEND:

- SUBGRADE
- TOPO 2025-12-30
- TOPO 2026-01-28

150’ 0’ 75’ 150’

SCALE: 1” = 150’

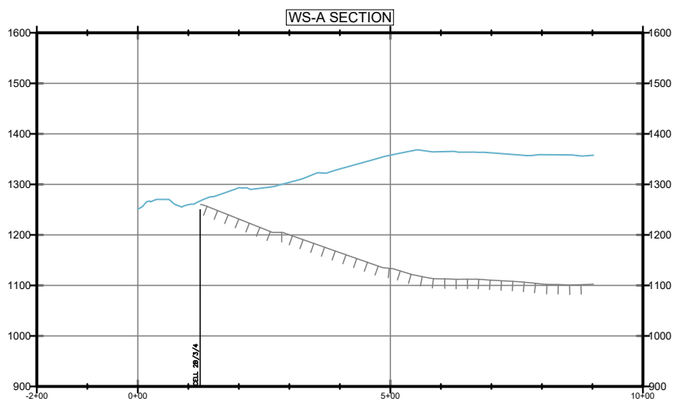

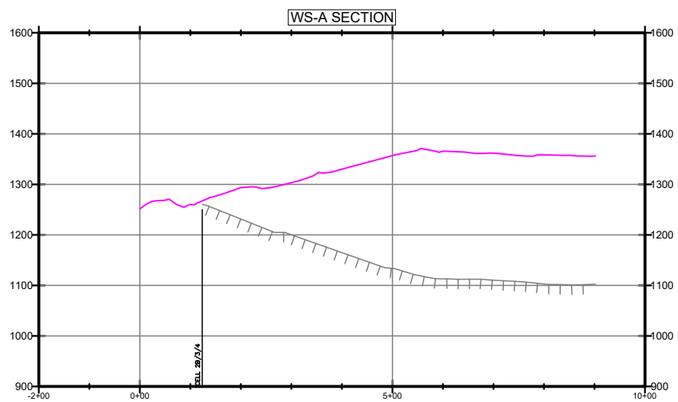

300’ 0’ 150’ 300’

SCALE: 1” = 300’

FIGURE 2A

WESTERN SLOPE CROSS SECTION A

JANUARY 2026 MONITORING SUMMARY
CHIQUITA CANYON LANDFILL
COUNTY OF LOS ANGELES, CA

Geo-Logic ASSOCIATES

DRAWN BY: LP/RM | DATE: FEBRUARY 2026 | JOB NO.: RM22.1077

P:\SITES\CHIQUITA CYN LF\MONITORING SUMMARY\FIGURES\RM22.1077-CCL-MS-FIG 2A-2E-(2026-02-09).DWG February 9, 2026 - 11:09 AM BY: GLA-USER

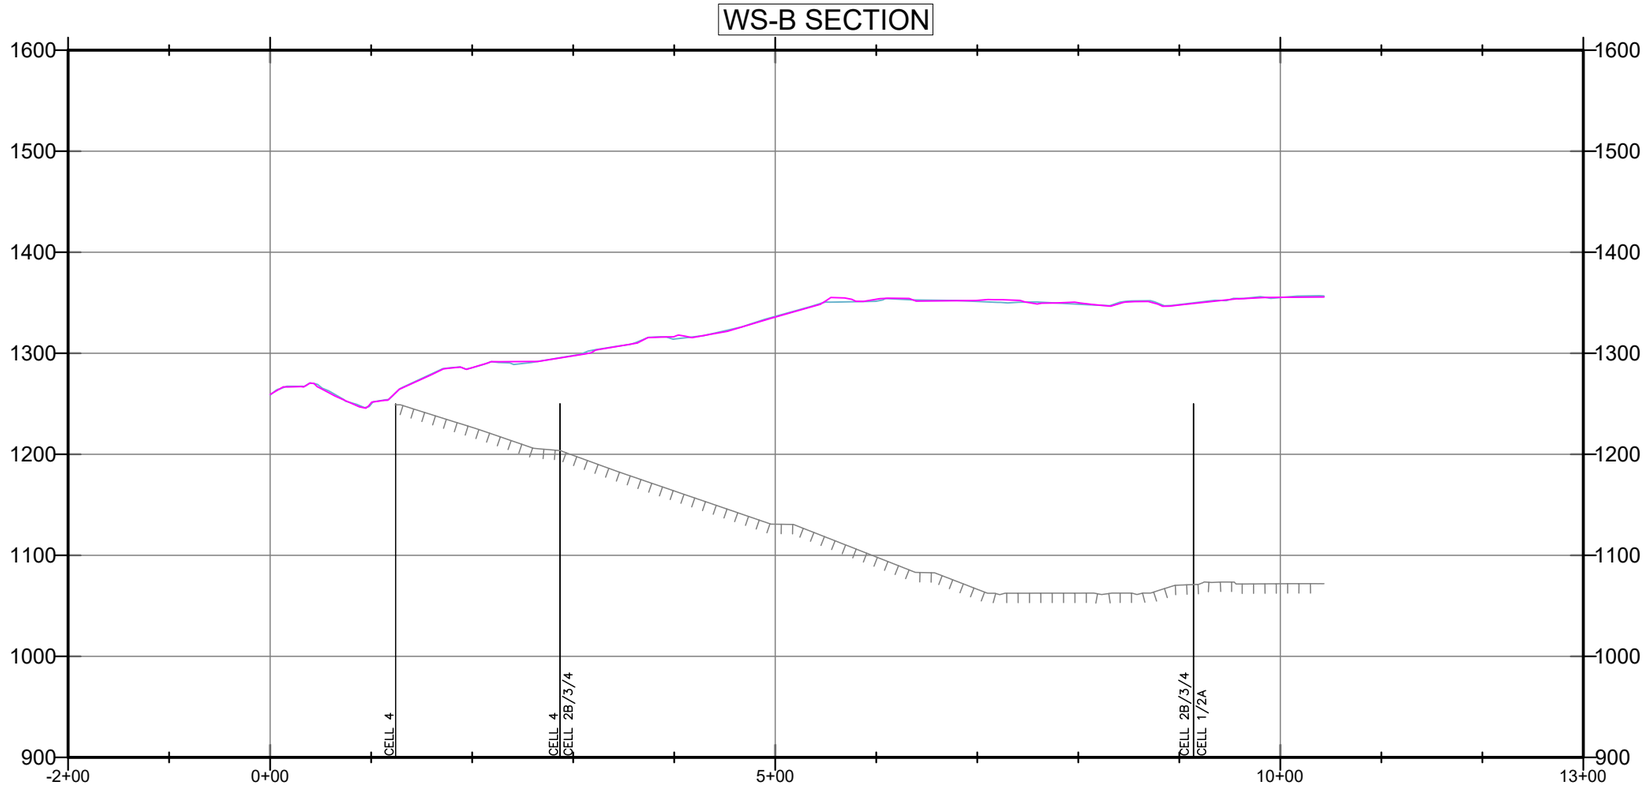

LEGEND:

- SUBGRADE
- TOPO 2025-12-30
- TOPO 2026-01-28

150’ 0’ 75’ 150’

SCALE: 1” = 150’

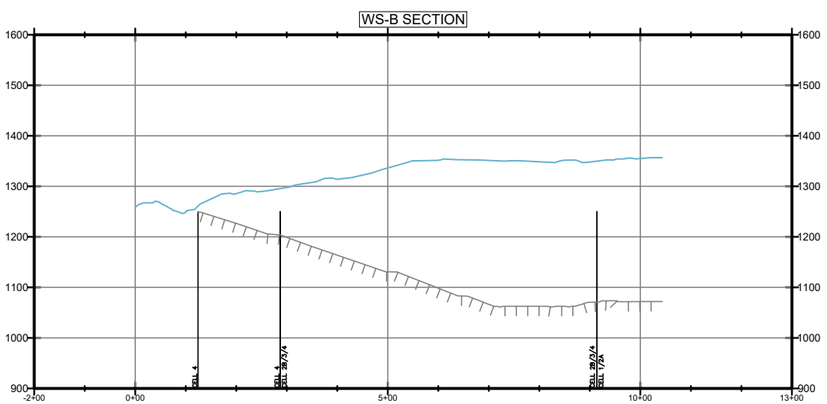

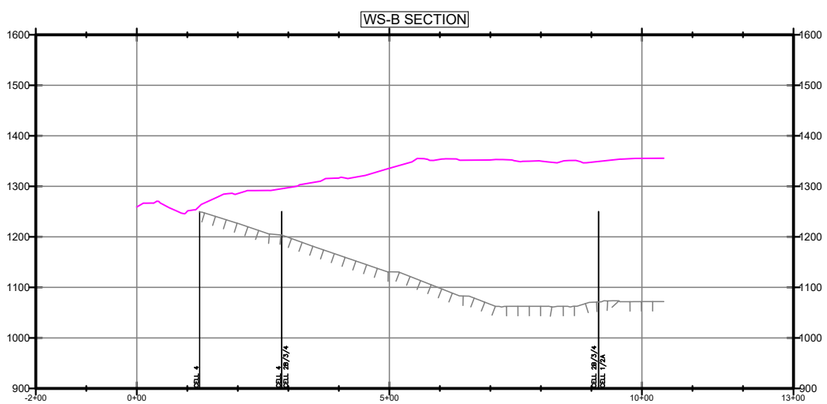

300’ 0’ 150’ 300’

SCALE: 1” = 300’

FIGURE 2B

WESTERN SLOPE CROSS SECTION B

JANUARY 2026 MONITORING SUMMARY
CHIQUITA CANYON LANDFILL
COUNTY OF LOS ANGELES, CA

Geo-Logic ASSOCIATES

DRAWN BY: LP/RM | DATE: FEBRUARY 2026 | JOB NO.: RM22.1077

P:\SITES\CHIQUITA CYN LF\MONITORING SUMMARY\FIGURES\RM22.1077-CCL-MS-FIG 2A-2E-(2026-02-09).DWG February 9, 2026 - 11:09 AM BY: GLA-USER

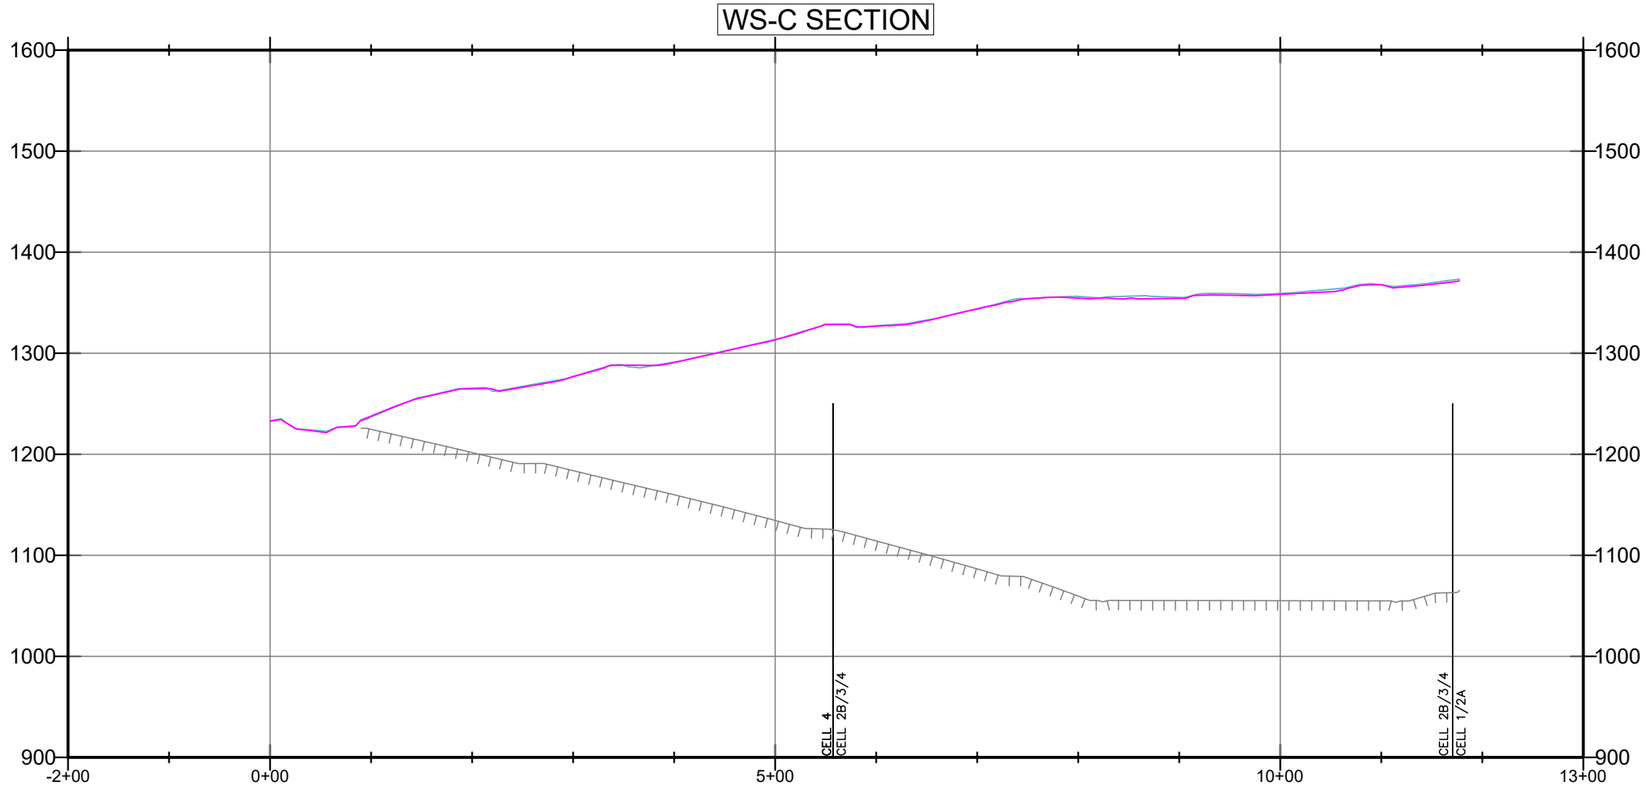

LEGEND:

- SUBGRADE
- TOPO 2025-12-30
- TOPO 2026-01-28

150’ 0’ 75’ 150’

SCALE: 1” = 150’

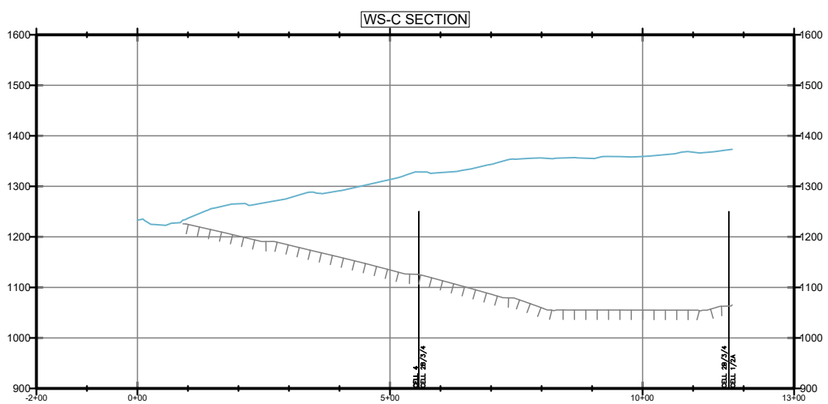

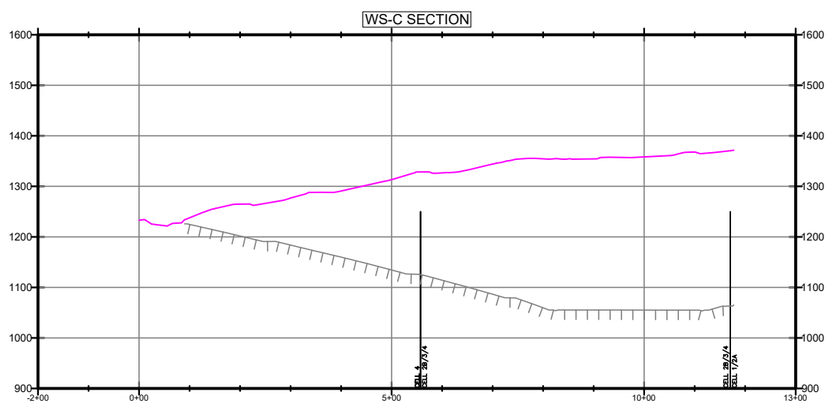

300’ 0’ 150’ 300’

SCALE: 1” = 300’

FIGURE 2C

WESTERN SLOPE CROSS SECTION C

JANUARY 2026 MONITORING SUMMARY
CHIQUITA CANYON LANDFILL
COUNTY OF LOS ANGELES, CA

Geo-Logic ASSOCIATES

DRAWN BY: LP/RM	DATE: FEBRUARY 2026	JOB NO.: RM22.1077

P:\SITES\CHIQUITA CYN LF\MONITORING SUMMARY\FIGURES\RM22.1077-CCL-MS-FIG 2A-2E-(2026-02-09).DWG February 9, 2026 - 11:08 AM BY: GLA-USER

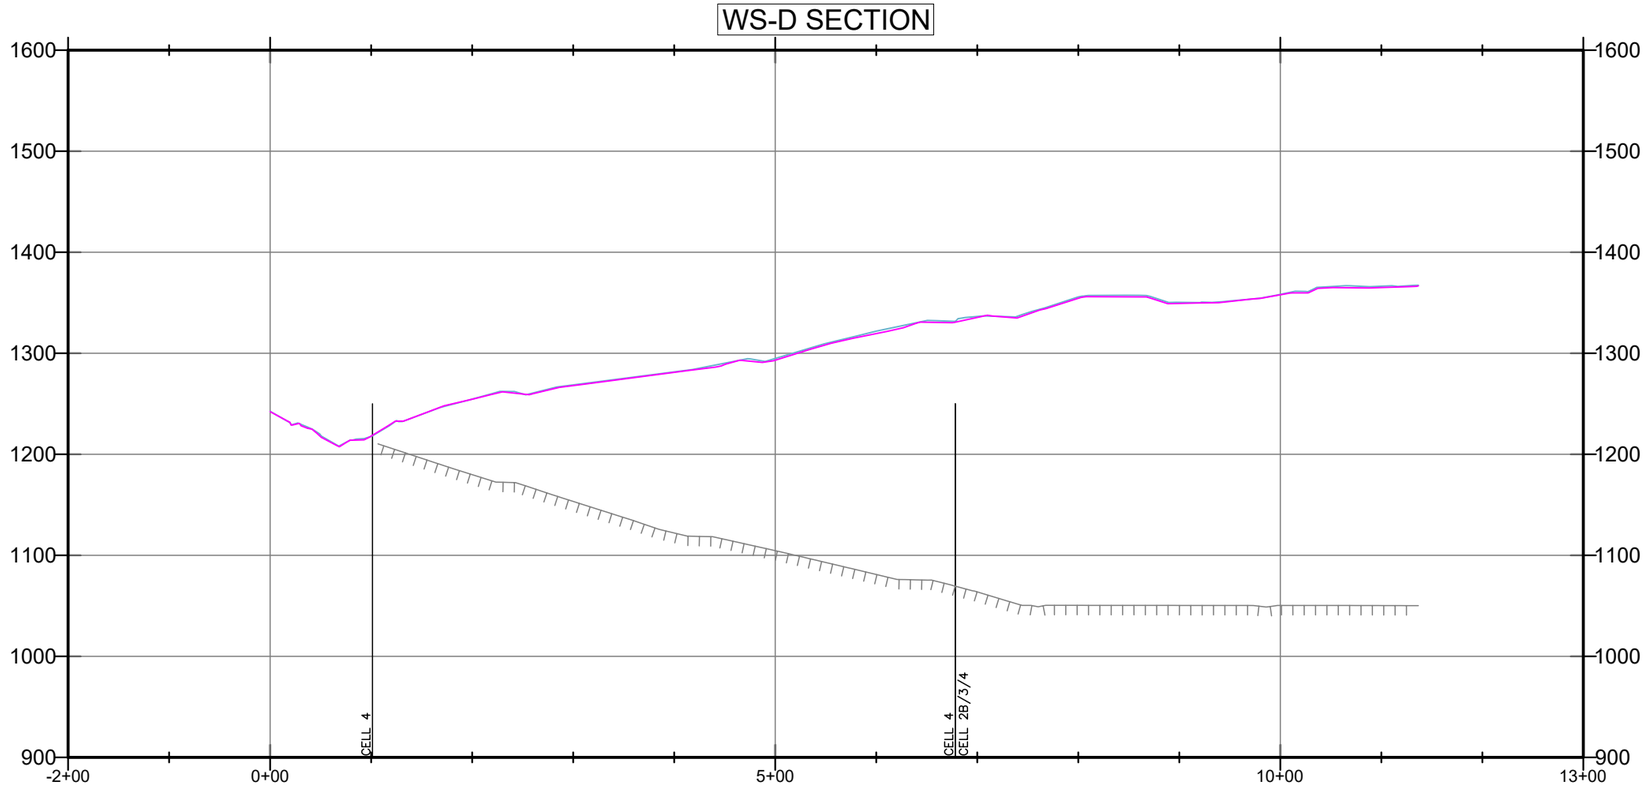

LEGEND:

- SUBGRADE
- TOPO 2025-12-30
- TOPO 2026-01-28

150’ 0’ 75’ 150’

SCALE: 1” = 150’

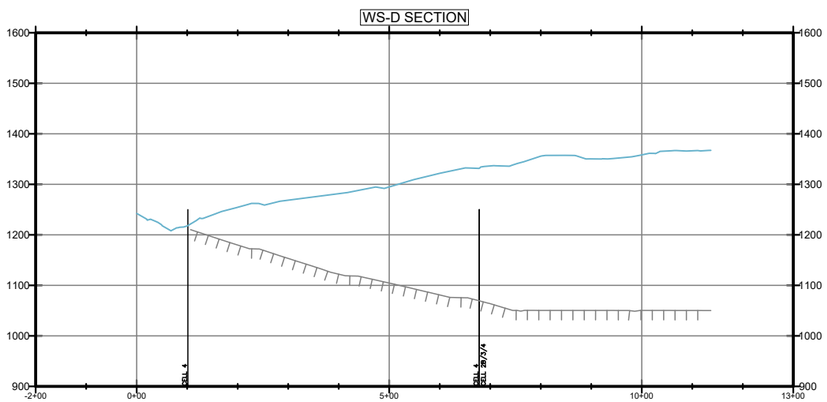

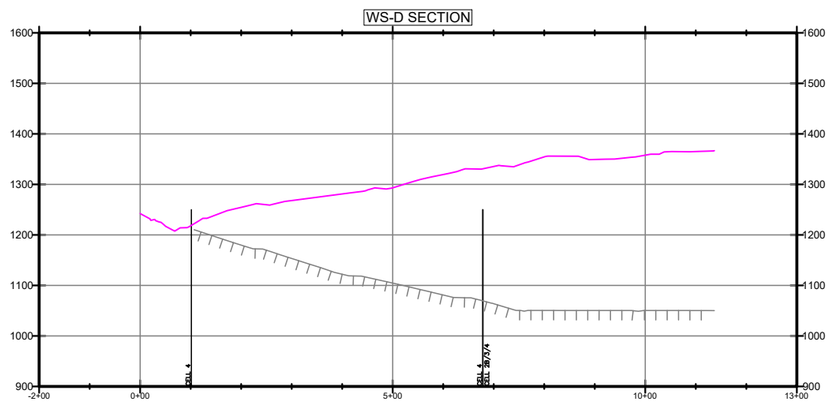

300’ 0’ 150’ 300’

SCALE: 1” = 300’

FIGURE 2D

WESTERN SLOPE CROSS SECTION D

JANUARY 2026 MONITORING SUMMARY
CHIQUITA CANYON LANDFILL
COUNTY OF LOS ANGELES, CA

Geo-Logic ASSOCIATES

DRAWN BY: LP/RM | DATE: FEBRUARY 2026 | JOB NO.: RM22.1077

P:\SITES\CHIQUITA CYN LF\MONITORING SUMMARY\FIGURES\RM22.1077-CCL-MS-FIG 2A-2E-(2026-02-09).DWG February 9, 2026 - 11:08 AM BY: GLA-USER

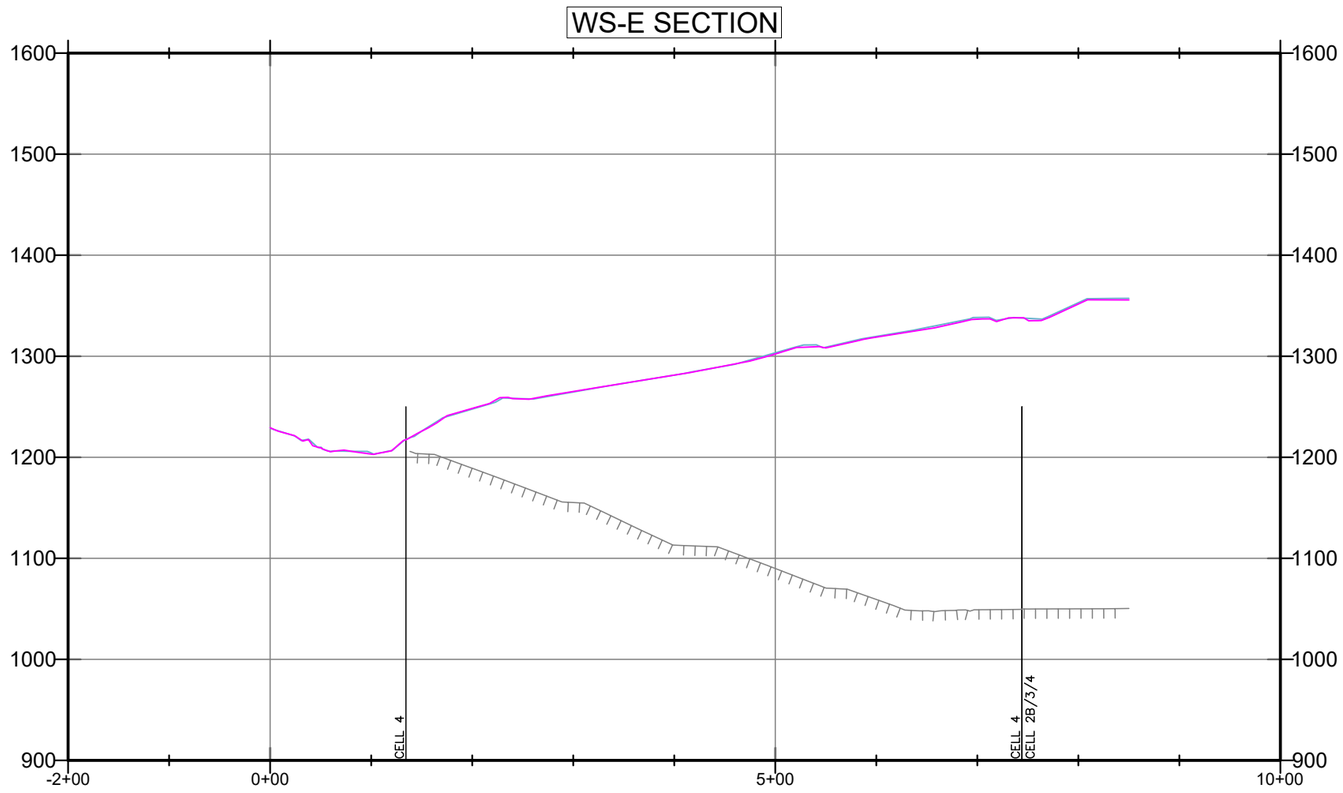

LEGEND:

- SUBGRADE
- TOPO 2025-12-30
- TOPO 2026-01-28

150’ 0’ 75’ 150’

SCALE: 1” = 150’

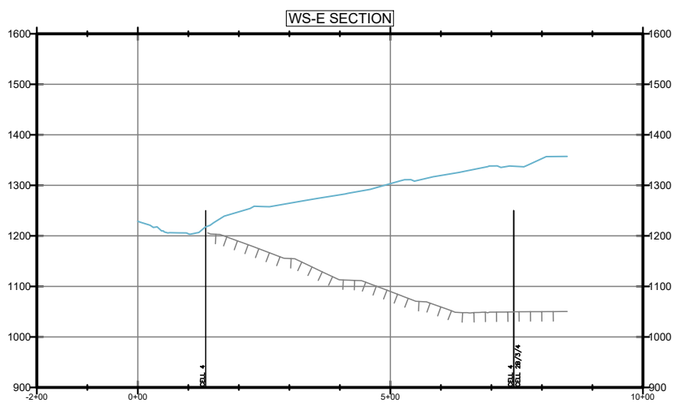

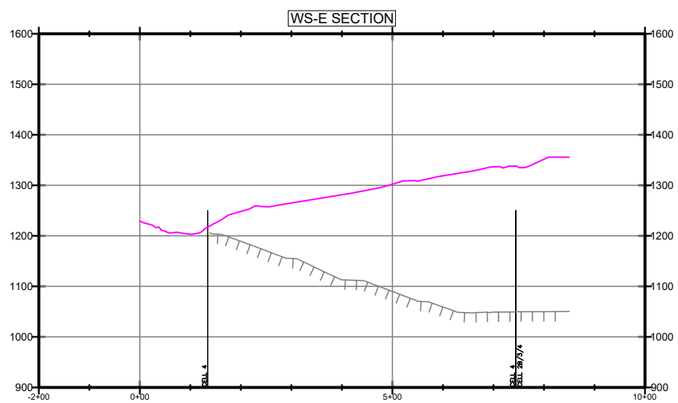

300’ 0’ 150’ 300’

SCALE: 1” = 300’

FIGURE 2E

WESTERN SLOPE CROSS SECTION E

JANUARY 2026 MONITORING SUMMARY
CHIQUITA CANYON LANDFILL
COUNTY OF LOS ANGELES, CA

Geo-Logic ASSOCIATES

DRAWN BY: LP/RM | DATE: FEBRUARY 2026 | JOB NO.: RM22.1077

P:\SITES\CHIQUITA CYN LF\MONITORING SUMMARY\FIGURES\RM22.1077-CCL-MS-FIG 2A-2E-(2026-02-09).DWG February 9, 2026 - 11:08 AM BY: GLA-USER

Chiquita Canyon Landfill - Isopach

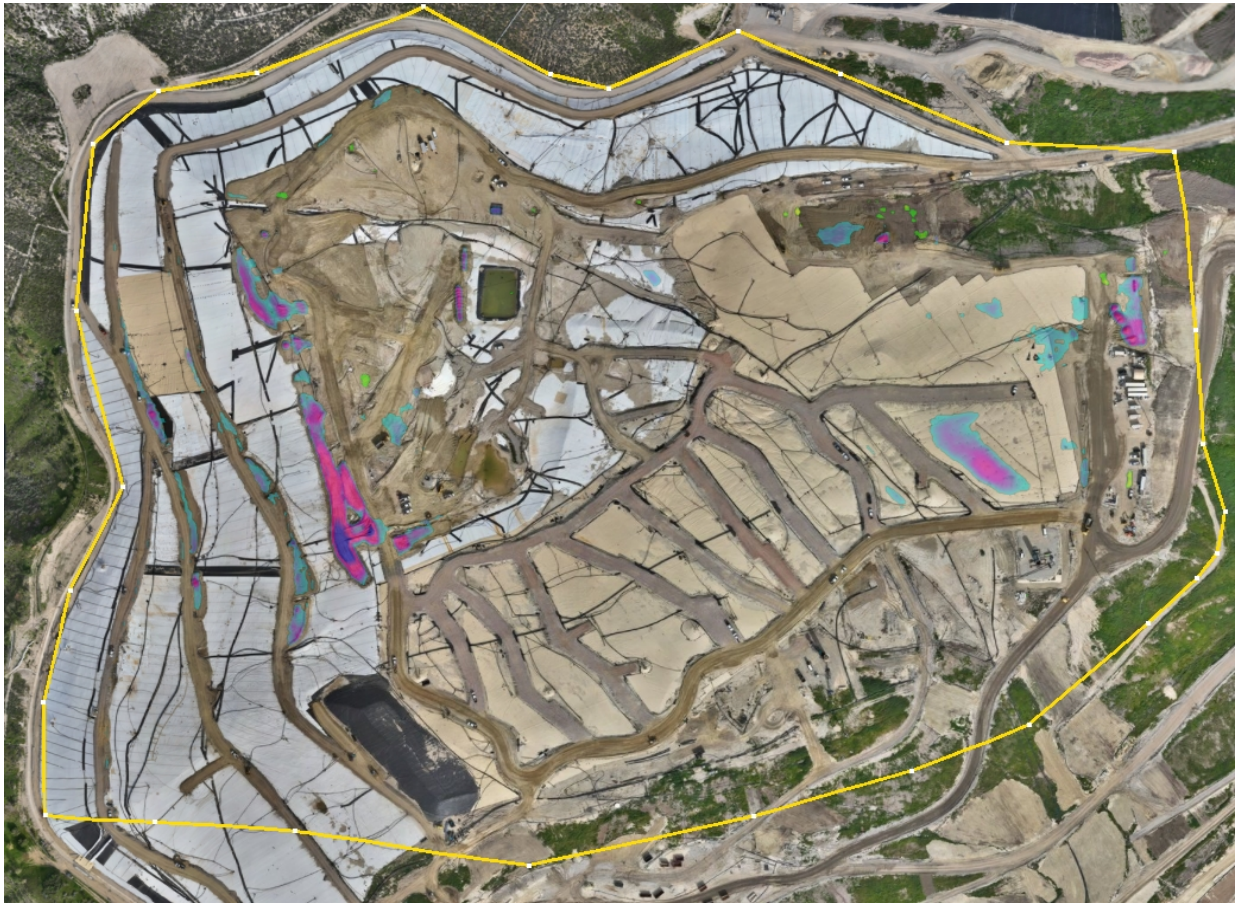

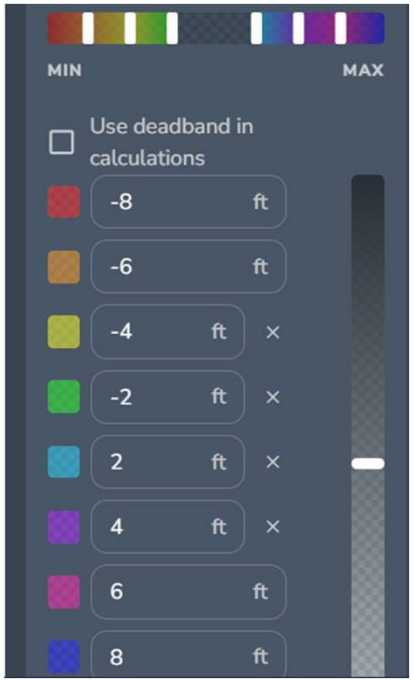

January 28, 2026 Survey Image. January 7, 2026 vs. January 28, 2026

CHIQUITA CANYON
A Waste Connections Company

February 17, 2026

Via E-Mail
Karen Gork
Chief Environmental Health Specialist
Los Angeles County Department of Public Health
Local Enforcement Agency
Environmental Programs Division
5050 Commerce Drive,
Baldwin Park, California 91706
KGork@ph.lacounty.gov

Re: Chiquita Canyon, LLC's Weekly Report on the Documentation and Tracking of Cover Issues

Dear Ms. Gork:

In accordance with the Local Enforcement Agency's ("LEA") May 2, 2024 letter approving Chiquita's April 16, 2024 Second Revised Written Plan for Documenting and Tracking Cover Issues ("Second Revised Written Plan"), the LEA's May 29, 2024 letter, and the LEA's June 6, 2024 Compliance Order, Chiquita presents the enclosed report for documenting and tracking cover issues for the week of February 9, 2026 to February 14, 2026.

Please contact me if you have any questions regarding this matter.

Regards,

Sarah Phillips

Sarah Phillips
Corporate Compliance Manager
Waste Connections

Attachment: February 17, 2026 Weekly Cover Issues Report
cc: Mark Como, Department of Public Health
Eric Morofuji, Department of Public Health

Fissures and Tension Cracks

4050 - Chiquita Reaction Area Tracking of Fissures and Tension Cracks

9 Feb 2026 / Tom Roe

Complete

Conducted on	9 Feb 2026 9:49 AM PST
Prepared by	Tom Roe

Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks 1	
Fissure or Tension Crack Found?	No

Grid 160

Photo 1

Instability	
Are there any indications of slope stability concerns?	No

4050 - Chiquita Reaction Area Tracking of Fissures and Tension Cracks

10 Feb 2026 / Tom Roe

Complete

Conducted on	10 Feb 2026 10:21 AM PST
Prepared by	Tom Roe

Chiquita Reaction Area Tracking of Fissures and Tension Cracks

Chiquita Reaction Area Tracking of Fissures and Tension Cracks

Chiquita Reaction Area Tracking of Fissures and Tension Cracks 1

Fissure or Tension Crack Found?	No

Grid 164

Photo 1

Instability

Are there any indications of slope stability concerns?	No

4050 - Chiquita Reaction Area Tracking of Fissures and Tension Cracks

11 Feb 2026 / John Boucher

Complete

Conducted on	11 Feb 2026 7:19 AM PST
Prepared by	John Boucher

Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks 1	
Fissure or Tension Crack Found?	No

Grid 160

Photo 1

Instability	
Are there any indications of slope stability concerns?	No

4050 - Chiquita Reaction Area Tracking of Fissures and Tension Cracks

12 Feb 2026 / Nancy Bahena Hernandez

Complete

Conducted on	12 Feb 2026 9:20 AM PST
Prepared by	Nancy Bahena Hernandez

Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks 1	
Fissure or Tension Crack Found?	No

Grid 198

Photo 1

Instability	
Are there any indications of slope stability concerns?	No

4050 - Chiquita Reaction Area Tracking of Fissures and Tension Cracks

13 Feb 2026 / John Boucher

Complete

Conducted on	13 Feb 2026 7:01 AM PST
Prepared by	John Boucher

Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks 1	
Fissure or Tension Crack Found?	No

Grid 164

Photo 1

Instability	
Are there any indications of slope stability concerns?	No

4050 - Chiquita Reaction Area Tracking of Fissures and Tension Cracks

14 Feb 2026 / John Boucher

Complete

Conducted on	14 Feb 2026 7:19 AM PST
Prepared by	John Boucher

Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks 1	
Fissure or Tension Crack Found?	No

Photo 1

Instability	
Are there any indications of slope stability concerns?	No

Settlement

Settlement Data Notes

- The charts on the following page show the settlement in cubic yards measured at a fixed location.
    - Chiquita restaked the survey benchmarks between July 31, 2025 and August 13, 2025 to maintain accuracy. After performing additional surveys, Chiquita has confirmed that the restaking caused the data to show an inflated amount of settlement, which does not accurately convey the true rate of settlement.
- The map shows the area between 2/6/2025 and 2/10/2026 where the grades have changed more than 10 feet. A typical MSW strain rate is 3% per year - for a landfill with a 300-foot waste column, this would be 9 feet per year.
    - On January 16, 2026, all three flares went offline as a result of high temperatures at Flares 1 and 3, and a blower failure at Flare 2. Due to the decrease in landfill gas collection, landfill gas temporarily accumulated under the geomembrane cover creating a "ballooning" effect. This ballooning effect disrupted the drone's ability to accurately capture the amount of settlement – making it appear as though more settlement had occurred. Flares 1, 2, and 3 were initially brought back online by January 23, 2026. There have been subsequent downtimes associated with Flares 2 and 3 as described in the downtime alerts posted to Chiquita's public website. Chiquita anticipates that the imaging, and settlement results, will return to normal by the time of the next flyover event.
    - Recently, Castaic, California has experienced atypical amounts of rainfall resulting in standing stormwater across the landfill. As the water evaporates and the levels of standing water decrease, the evaporation manifests as increased settlement in the drone flyovers, although no such settlement has occurred. Chiquita anticipates that the imaging, and settlement results, will return to normal once the stormwater has fully evaporated.
    - As previously noted, on November 19, 2025, landfill gas piping was temporarily offline in certain areas to perform tie in work as part of the EVOH/HDPE geomembrane cover deployment work. Taking the piping offline caused a small amount of landfill gas to temporarily accumulate under the geomembrane cover. As a result, the image gives the impression of more settlement than what actually occurred. The piping has since been reinstalled and is back online, and the landfill gas bubbles are no longer present.
- During normal site operations before site closure, large stockpiles of rock materials were maintained, and sometimes moved as other operations necessitated. The areas used for these material stockpiles were south and east of the lined area. There is not a way to differentiate between settlement and stockpile movements.
- On a monthly basis, SCS leads the collection and review of data to determine whether the boundaries of the Reaction Area, as defined in the Stipulated Order for Abatement with the South Coast Air Quality Management District (SCAQMD), have changed. The Reaction Committee of experts formed under the Stipulated Order then further reviews and submits these monthly determinations to SCAQMD. These determinations are also posted on Chiquita's website. As part of this monthly review, SCS considers the below factors in determining the estimated boundary of the reaction area, in accordance with the Stipulated Order.
    - Landfill gas (LFG) wellhead temperatures in excess of approximately 160 degrees Fahrenheit.

- Poor gas quality (defined as methane levels of less than 30 percent) in conjunction with methane-to-carbon dioxide (CH_4:CO2) ratios less than 1.0.
- The concentration of hydrogen (H_2) in the LFG measured greater than 2 percent by volume.
- The concentration of carbon monoxide (CO) in the LFG measured greater than 2,000 ppm.
- Accelerated settlement of the landfill surface, defined as approximately 18 inches or greater within a 60-day period, and cracks in the landfill cover.
- First-hand observations of the Chiquita Canyon Landfill (Landfill) and/or SCS engineering, construction, and operations and maintenance field personnel who are on-site related to: 1) atypical excess leachate quantities (presence and quantity of liquids); 2) instances of pressurized liquids emitting from the Landfill surface, from boreholes during drilling, and from LFG wells; and, 3) the characteristics of the odors originating from the select areas of the waste footprint (often described as “chemical-like” and distinctly different from typical LFG or landfill working face odors).
- Observations of subsurface waste conditions and characteristics as noted on borehole drilling logs for recently installed new wells and/or TMPs.
- Subsurface temperatures recorded at the in-situ waste TMPs during the month being assessed.
- Temperature of gas or liquids measured at depth within the LFG well riser pipe (using an automated transmitter or manual field instrumentation).

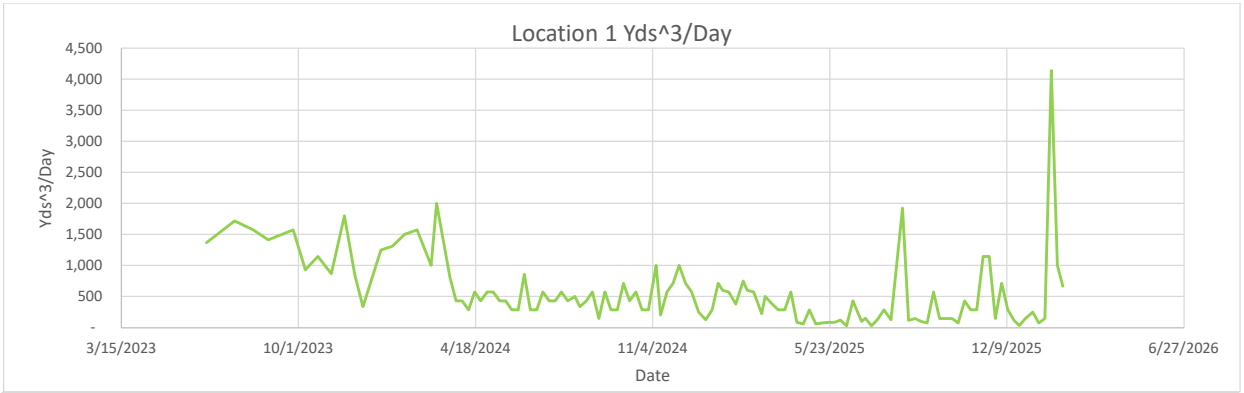
Location 1 Yds^3/Day
Yds^3/Day
4,500
4,000
3,500
3,000
2,500
2,000
1,500
1,000
500
-
3/15/2023
10/1/2023
4/18/2024
11/4/2024
5/23/2025
12/9/2025
6/27/2026
Date

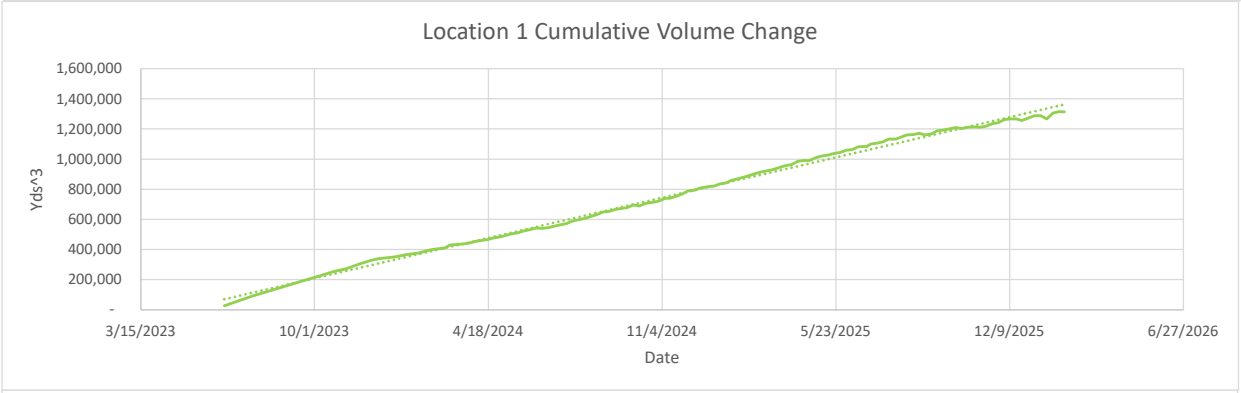
Location 1 Cumulative Volume Change
Yds^3
1,600,000
1,400,000
1,200,000
1,000,000
800,000
600,000
400,000
200,000
-
3/15/2023
10/1/2023
4/18/2024
11/4/2024
5/23/2025
12/9/2025
6/27/2026
Date

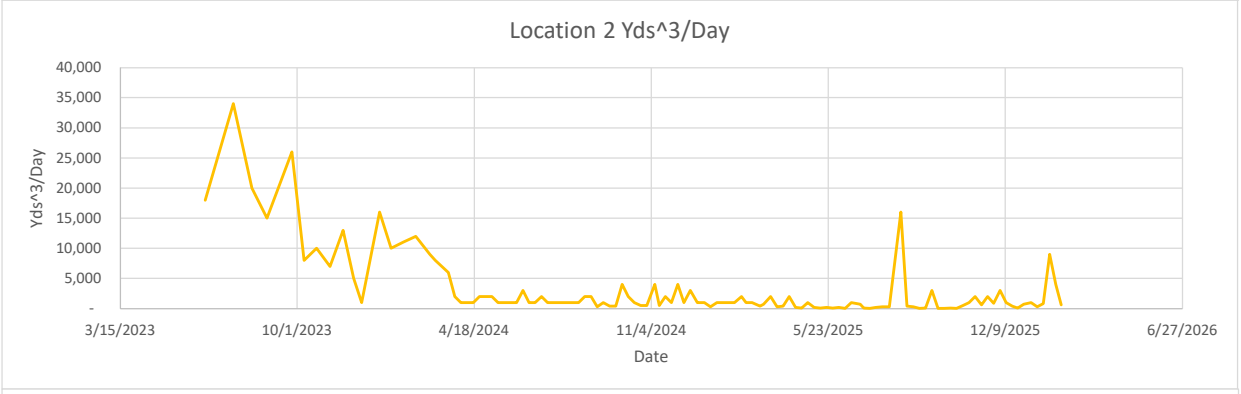
Location 2 Yds^3/Day
Yds^3/Day
40,000
35,000
30,000
25,000
20,000
15,000
10,000
5,000
-
3/15/2023
10/1/2023
4/18/2024
11/4/2024
5/23/2025
12/9/2025
6/27/2026
Date

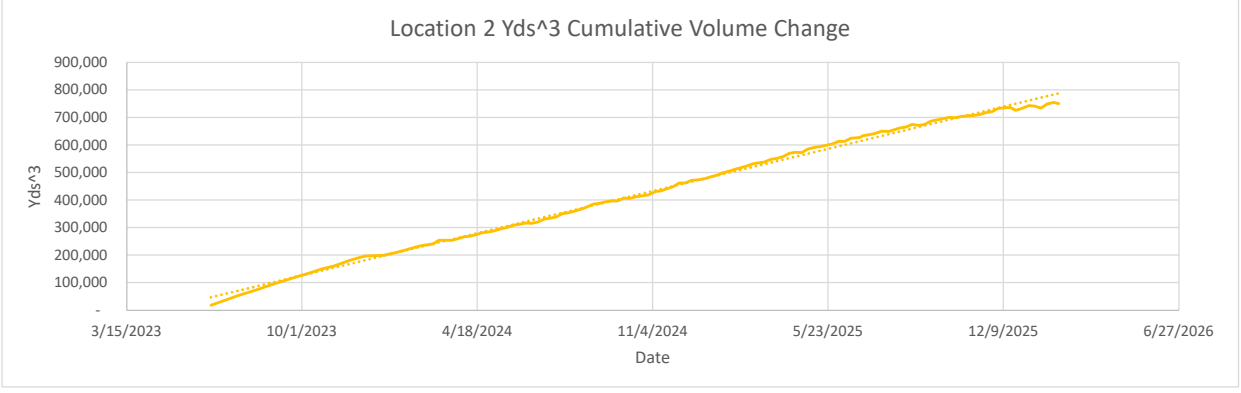
Location 2 Yds^3 Cumulative Volume Change
Yds^3
900,000
800,000
700,000
600,000
500,000
400,000
300,000
200,000
100,000
-
3/15/2023
10/1/2023
4/18/2024
11/4/2024
5/23/2025
12/9/2025
6/27/2026
Date

Location 1

Flyover Date	Days Between Flights	Volume Change	Cumulative Volume Change	Volume Change Per Day	
5/31/2023	0	-	-	-	
6/19/2023	19	26,000	26,000	1,368	
7/21/2023	32	55,000	90,000	1,719	
8/11/2023	21	33,000	126,000	1,571	
8/28/2023	17	24,000	156,000	1,412	
9/25/2023	28	44,000	205,000	1,571	
10/9/2023	14	13,000	229,000	929	
10/23/2023	14	16,000	254,000	1,143	
11/7/2023	15	13,000	272,000	867	
11/22/2023	15	27,000	304,000	1,800	
12/4/2023	12	10,000	325,000	833	
12/13/2023	9	3,000	338,000	333	
1/2/2024	20	25,000	352,000	1,250	*Waste fill near reaction area
1/15/2024	13	17,000	367,000	1,308	
1/29/2024	14	21,000	377,000	1,500	*Waste fill near reaction area
2/12/2024	14	22,000	398,000	1,571	
2/28/2024	16	16,000	411,000	1,000	
3/5/2024	6	12,000	430,000	2,000	
3/20/2024	15	12,000	436,000	800	
3/27/2024	7	3,000	442,362	429	
4/3/2024	7	3,000	454,000	429	
4/10/2024	7	2,000	459,000	286	
4/17/2024	7	4,000	467,000	571	
4/24/2024	7	3,000	476,000	429	
5/1/2024	7	4,000	484,000	571	
5/8/2024	7	4,000	494,000	571	
5/15/2024	7	3,000	505,000	429	
5/22/2024	7	3,000	511,000	429	
5/29/2024	7	2,000	524,000	286	
6/5/2024	7	2,000	532,000	286	
6/12/2024	7	6,000	542,853	857	
6/19/2024	7	2,000	540,000	286	
6/26/2024	7	2,000	545,000	286	
7/3/2024	7	4,000	555,000	571	
7/10/2024	7	3,000	563,000	429	
7/17/2024	7	3,000	573,000	429	
7/24/2024	7	4,000	590,000	571	
7/31/2024	7	3,000	597,000	429	
8/8/2024	8	4,000	609,000	500	
8/14/2024	6	2,000	619,000	333	
8/21/2024	7	3,000	631,000	429	
8/28/2024	7	4,000	649,000	571	
9/4/2024	7	1,000	654,000	143	
9/11/2024	7	4,000	665,000	571	
9/18/2024	7	2,000	673,000	286	
9/25/2024	7	2,000	679,000	286	
10/2/2024	7	5,000	696,000	714	
10/9/2024	7	3,000	689,000	429	
10/16/2024	7	4,000	706,000	571	
10/23/2024	7	2,000	712,000	286	
10/30/2024	7	2,000	719,000	286	
11/8/2024	9	9,000	739,000	1,000	
11/13/2024	5	1,000	739,000	200	
11/20/2024	7	4,000	753,000	571	
11/27/2024	7	5,000	768,000	714	
12/4/2024	7	7,000	788,000	1,000	
12/11/2024	7	5,000	794,000	714	
12/18/2024	7	4,000	807,000	571	
12/26/2024	8	2,000	816,000	250	
1/3/2025	8	1,000	821,000	125	
1/10/2025	7	2,000	835,000	286	
1/17/2025	7	5,000	843,000	714	
1/22/2025	5	3,000	856,000	600	
1/29/2025	7	4,000	868,000	571	
2/6/2025	8	3,000	880,000	375	
2/14/2025	8	6,000	894,000	750	
2/19/2025	5	3,000	903,000	600	
2/26/2025	7	4,000	915,000	571	
3/7/2025	9	2,000	925,000	222	
3/11/2025	4	2,000	930,000	500	
3/19/2025	8	3,000	945,000	375	
3/26/2025	7	2,000	956,000	286	
4/2/2025	7	2,000	964,000	286	
4/9/2025	7	4,000	985,000	571	
4/16/2025	7	600	990,000	86	
4/23/2025	7	400	991,000	57	
4/30/2025	7	2,000	1,009,000	286	

5/7/2025	7	400	1,020,000	57
5/14/2025	7	500	1,027,000	71
5/21/2025	7	600	1,038,000	86
5/28/2025	7	600	1,044,000	86
6/4/2025	7	822	1,058,000	117
6/11/2025	7	200	1,062,000	29
6/18/2025	7	3,000	1,081,000	429
6/28/2025	10	1,000	1,084,000	100
7/2/2025	4	600	1,099,000	150
7/9/2025	7	200	1,106,000	29
7/16/2025	7	900	1,114,000	129
7/23/2025	7	2,000	1,132,000	286
7/31/2025	8	1,000	1,132,000	125
8/13/2025	13	25,000	1,160,000	1,923
8/20/2025	7	800	1,163,000	114
8/27/2025	7	1,000	1,172,000	143
9/3/2025	7	700	1,160,000	100
9/10/2025	7	500	1,167,000	71
9/17/2025	7	4,000	1,189,000	571
9/24/2025	7	1,000	1,193,000	143
10/1/2025	7	1,000	1,202,000	143
10/8/2025	7	1,000	1,209,000	143
10/15/2025	7	500	1,203,000	71
10/22/2025	7	3,000	1,211,000	429
10/29/2025	7	2,000	1,214,000	286
11/5/2025	7	2,000	1,212,000	286
11/12/2025	7	8,000	1,218,000	1,143
11/19/2025	7	8,000	1,236,000	1,143
11/26/2025	7	1,000	1,242,000	143
12/3/2025	7	5,000	1,263,000	714
12/10/2025	7	2,000	1,266,000	286
12/17/2025	7	800	1,267,000	114
12/23/2025	6	200	1,256,000	33
12/30/2025	7	1,000	1,271,000	143
1/7/2026	8	2,000	1,288,000	250
1/14/2026	7	500	1,288,000	71
1/21/2026	7	1,000	1,267,000	143
1/28/2026	7	29,000	1,305,000	4,143
2/4/2026	7	7,000	1,317,000	1,000
2/10/2026	6	4,000	1,314,000	667

Location 2

Flyover Date	Days Between Flights	Volume Change	Cumulative Volume Change	Volume Change Per Day
5/31/2023	0	-	-	-
6/19/2023	19	18,000	18,000	947
7/21/2023	32	34,000	54,000	1,063
8/11/2023	21	20,000	75,000	952
8/28/2023	17	15,000	93,000	882
9/25/2023	28	26,000	121,000	929
10/9/2023	14	8,000	134,000	571
10/23/2023	14	10,000	149,000	714
11/7/2023	15	7,000	161,000	467
11/22/2023	15	13,000	178,000	867
12/4/2023	12	5,000	190,000	417
12/13/2023	9	1,000	197,000	111
1/2/2024	20	16,000	199,000	800
1/15/2024	13	10,000	208,000	769
1/29/2024	14	11,000	220,000	786
2/12/2024	14	12,000	233,000	857
2/28/2024	16	9,000	241,000	563
3/5/2024	6	8,000	254,000	1,333
3/20/2024	15	6,000	254,000	400
3/27/2024	7	2,000	260,000	286
4/3/2024	7	1,000	267,000	143
4/10/2024	7	1,000	269,000	143
4/17/2024	7	1,000	274,000	143
4/24/2024	7	2,000	281,000	286
5/1/2024	7	2,000	284,000	286
5/8/2024	7	2,000	289,000	286
5/15/2024	7	1,000	296,000	143
5/22/2024	7	1,000	300,000	143
5/29/2024	7	1,000	308,000	143
6/5/2024	7	1,000	312,000	143
6/12/2024	7	3,000	316,000	429
6/19/2024	7	1,000	315,000	143
6/26/2024	7	1,000	320,000	143
7/3/2024	7	2,000	330,000	286
7/10/2024	7	1,000	334,000	143

*Waste fill near reaction area

*Waste fill near reaction area

7/17/2024	7	1,000	339,000	143
7/24/2024	7	1,000	350,000	143
7/31/2024	7	1,000	354,000	143
8/8/2024	8	1,000	361,000	125
8/14/2024	6	1,000	366,000	167
8/21/2024	7	2,000	375,000	286
8/28/2024	7	2,000	385,000	286
9/4/2024	7	300	387,000	43
9/11/2024	7	1,000	393,000	143
9/18/2024	7	400	396,000	57
9/25/2024	7	400	397,000	57
10/2/2024	7	4,000	407,000	571
10/9/2024	7	2,000	406,000	286
10/16/2024	7	1,000	412,000	143
10/23/2024	7	500	415,000	71
10/30/2024	7	500	419,000	71
11/8/2024	9	4,000	431,000	444
11/13/2024	5	500	432,000	100
11/20/2024	7	2,000	441,000	286
11/27/2024	7	1,000	448,000	143
12/4/2024	7	4,000	461,000	571
12/11/2024	7	1,000	461,000	143
12/18/2024	7	3,000	471,000	429
12/26/2024	8	1,000	473,000	125
1/3/2025	8	1,000	478,000	125
1/10/2025	7	300	485,000	43
1/17/2025	7	1,000	490,000	143
1/22/2025	5	1,000	498,000	200
1/29/2025	7	1,000	503,000	143
2/6/2025	8	1,000	511,000	125
2/14/2025	8	2,000	518,000	250
2/19/2025	5	1,000	523,000	200
2/26/2025	7	1,000	531,000	143
3/7/2025	9	400	536,000	44
3/11/2025	4	700	537,000	175
3/19/2025	8	2,000	547,000	250
3/26/2025	7	300	551,000	43
4/2/2025	7	400	558,000	57
4/9/2025	7	2,000	569,000	286
4/16/2025	7	200	573,000	29
4/23/2025	7	60	572,000	9
4/30/2025	7	1,000	585,000	143
5/7/2025	7	200	591,000	29
5/14/2025	7	80	594,000	11
5/21/2025	7	200	599,000	29
5/28/2025	7	60	603,000	9
6/4/2025	7	200	612,000	29
6/11/2025	7	40	613,000	6
6/18/2025	7	1,000	624,000	143
6/28/2025	10	700	626,000	70
7/2/2025	4	100	633,000	25
7/9/2025	7	30	637,000	4
7/16/2025	7	200	641,000	29
7/23/2025	7	300	650,000	43
7/31/2025	8	300	648,000	38
8/13/2025	13	16,000	661,000	1,231
8/20/2025	7	400	665,000	57
8/27/2025	7	300	674,000	43
9/3/2025	7	50	670,000	7
9/10/2025	7	90	674,000	13
9/17/2025	7	3,000	686,000	429
9/24/2025	7	40	690,000	6
10/1/2025	7	50	695,000	7
10/8/2025	7	100	700,000	14
10/15/2025	7	30	699,000	4
10/22/2025	7	500	703,000	71
10/29/2025	7	1,000	705,000	143
11/5/2025	7	2,000	707,000	286
11/12/2025	7	600	710,000	86
11/19/2025	7	2,000	717,000	286
11/26/2025	7	900	721,000	129
12/3/2025	7	3,000	732,000	429
12/10/2025	7	1,000	734,000	143
12/17/2025	7	400	736,000	57
12/23/2025	6	70	725,000	12
12/30/2025	7	700	732,000	100
1/7/2026	8	1,000	743,000	125
1/14/2026	7	300	740,000	43
1/21/2026	7	800	733,000	114

1/28/2026	7	9,000	748,000	1,286
2/4/2026	7	4,000	754,000	571
2/10/2026	6	600	750,000	100

-10 ft
-10 ft

Settlement area between 1/29/2025 to 1/28/2026, submitted on 2/3/2026, and provided here again for comparison.
-10 ft
-10 ft

Geosynthetic Cover

4050 - Geosynthetic Cover Inspection

9 Feb 2026 / Tom Roe

Complete

Flagged items	0
Conducted on	9 Feb 2026 10:09 AM PST
Prepared by	Tom Roe

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	Yes
Date and Time Issue Found	9 Feb 2026 12:29 PM PST

Grid Location

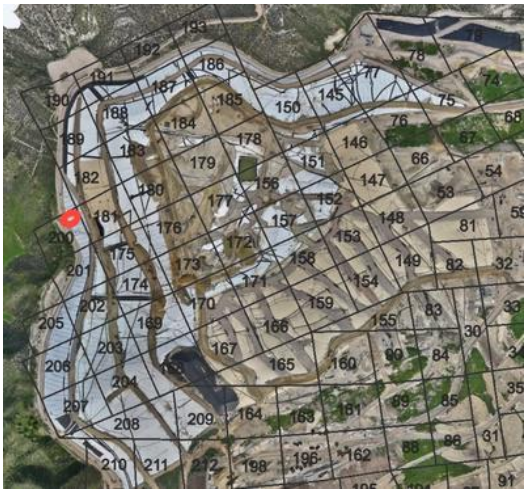

Grid Number	200

Take photo of identified issues

Photo 1

Notate what the issue is and what needs to be repaired	Tear in liner needs to be patched and extrusion welded.

Take photo of repair

Photo 2

Description of repair work	Tear was patched and extrusion welded.
Date and time of repair (within 2 hours)	10 Feb 2026 1:09 PM PST
Are further permanent repairs required?	No
Date and Time of final repair (if necessary)	

Instability under the cover

Are there any anomalous (unusual or unexpected) areas of cover damage or deformation that may indicate underlying instability?	No
Are there any signs of a downslope tension crack at the top of the slope or bulging at or near the toe of the slope?	No
Is there any movement of the equipment that vertically penetrates the cover (e.g., tilting)?	No

4050 - Geosynthetic Cover Inspection

10 Feb 2026 / Tom Roe

Complete

Flagged items	0
Conducted on	10 Feb 2026 10:06 AM PST
Prepared by	Tom Roe

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	No

Photo 1

Photo 2

Photo 3

Photo 4

Instability under the cover	
Are there any anomalous (unusual or unexpected) areas of cover damage or deformation that may indicate underlying instability?	No
Are there any signs of a downslope tension crack at the top of the slope or bulging at or near the toe of the slope?	No
Is there any movement of the equipment that vertically penetrates the cover (e.g., tilting)?	No

4050 - Geosynthetic Cover Inspection

11 Feb 2026 / John Boucher

Complete

Flagged items	0
Conducted on	11 Feb 2026 7:19 AM PST
Prepared by	John Boucher

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	Yes
Date and Time Issue Found	11 Feb 2026 11:50 AM PST

Grid Location

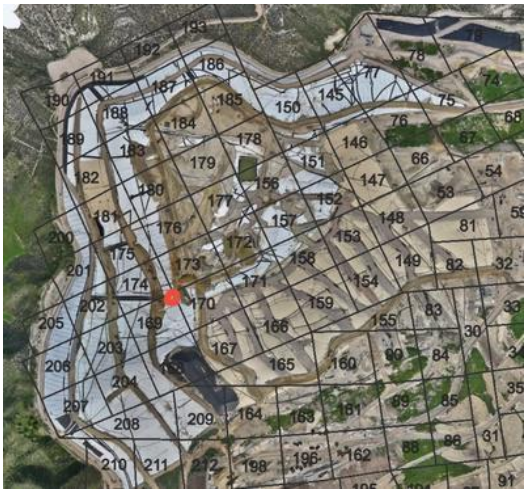

Grid Number	169

Take photo of identified issues

Photo 1

Notate what the issue is and what needs to be repaired	Small tear in liner. Needs to be patched and extrusion welded

Take photo of repair

Photo 2

Photo 3

Photo 4

Description of repair work	Taped and sandbagged upon discovery. Permanent repairs were conducted and tear was patched and extrusion welded
Date and time of repair (within 2 hours)	11 Feb 2026 11:52 AM PST
Are further permanent repairs required?	No
Date and Time of final repair (if necessary)	12 Feb 2026 9:10 AM PST
Instability under the cover	
Are there any anomalous (unusual or unexpected) areas of cover damage or deformation that may indicate underlying instability?	No
Are there any signs of a downslope tension crack at the top of the slope or bulging at or near the toe of the slope?	No

Is there any movement of the equipment that vertically penetrates the cover (e.g., tilting)?	No

4050 - Geosynthetic Cover Inspection

12 Feb 2026 / Nancy Bahena Hernandez

Complete

Flagged items	0
Conducted on	12 Feb 2026 8:31 AM PST
Prepared by	Nancy Bahena Hernandez

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	No

Photo 1

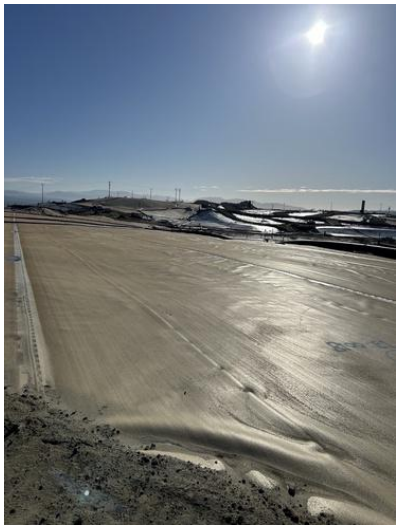

Photo 2

Photo 3

Photo 4

Instability under the cover	
Are there any anomalous (unusual or unexpected) areas of cover damage or deformation that may indicate underlying instability?	No
Are there any signs of a downslope tension crack at the top of the slope or bulging at or near the toe of the slope?	No
Is there any movement of the equipment that vertically penetrates the cover (e.g., tilting)?	No

4050 - Geosynthetic Cover Inspection

13 Feb 2026 / John Boucher

Complete

Flagged items	0
Conducted on	13 Feb 2026 7:01 AM PST
Prepared by	John Boucher

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	No

Photo 1

Photo 2

Photo 3

Photo 4

Instability under the cover	
Are there any anomalous (unusual or unexpected) areas of cover damage or deformation that may indicate underlying instability?	No
Are there any signs of a downslope tension crack at the top of the slope or bulging at or near the toe of the slope?	No
Is there any movement of the equipment that vertically penetrates the cover (e.g., tilting)?	No

4050 - Geosynthetic Cover Inspection

14 Feb 2026 / John Boucher

Complete

Flagged items	0
Conducted on	14 Feb 2026 7:19 AM PST
Prepared by	John Boucher

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	No

Photo 1

Photo 2

Photo 3

Photo 4

Instability under the cover	
Are there any anomalous (unusual or unexpected) areas of cover damage or deformation that may indicate underlying instability?	No
Are there any signs of a downslope tension crack at the top of the slope or bulging at or near the toe of the slope?	No
Is there any movement of the equipment that vertically penetrates the cover (e.g., tilting)?	No

CHIQUITA CANYON
A Waste Connections Company

February 24, 2026

Via E-Mail
Karen Gork
Chief Environmental Health Specialist
Los Angeles County Department of Public Health
Local Enforcement Agency
Environmental Programs Division
5050 Commerce Drive,
Baldwin Park, California 91706
KGork@ph.lacounty.gov

Re: Chiquita Canyon, LLC's Weekly Report on the Documentation and Tracking of Cover Issues

Dear Ms. Gork:

In accordance with the Local Enforcement Agency's ("LEA") May 2, 2024 letter approving Chiquita's April 16, 2024 Second Revised Written Plan for Documenting and Tracking Cover Issues ("Second Revised Written Plan"), the LEA's May 29, 2024 letter, and the LEA's June 6, 2024 Compliance Order, Chiquita presents the enclosed report for documenting and tracking cover issues for the week of February 16, 2026 to February 21, 2026.

Please contact me if you have any questions regarding this matter.

Regards,

Matt Breuer
Environmental Manager
Waste Connections

Attachment: February 24, 2026 Weekly Cover Issues Report
cc: Mark Como, Department of Public Health
Eric Morofuji, Department of Public Health

Fissures and Tension Cracks

4050 - Chiquita Reaction Area Tracking of Fissures and Tension Cracks

16 Feb 2026 / Tom Roe

Complete

Conducted on	16 Feb 2026 9:14 AM PST
Prepared by	Tom Roe

Chiquita Reaction Area Tracking of Fissures and Tension Cracks

Chiquita Reaction Area Tracking of Fissures and Tension Cracks

Chiquita Reaction Area Tracking of Fissures and Tension Cracks 1

Fissure or Tension Crack Found?	No

Grid 160

Photo 1

Instability

Are there any indications of slope stability concerns?	No

4050 - Chiquita Reaction Area Tracking of Fissures and Tension Cracks

17 Feb 2026 / Tom Roe

Complete

Conducted on	17 Feb 2026 9:48 AM PST
Prepared by	Tom Roe

Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks 1	
Fissure or Tension Crack Found?	No

Grid 163

Photo 1

Instability	
Are there any indications of slope stability concerns?	No

4050 - Chiquita Reaction Area Tracking of Fissures and Tension Cracks

18 Feb 2026 / Tom Roe

Complete

Conducted on	18 Feb 2026 9:33 AM PST
Prepared by	Tom Roe

Chiquita Reaction Area Tracking of Fissures and Tension Cracks

Chiquita Reaction Area Tracking of Fissures and Tension Cracks

Chiquita Reaction Area Tracking of Fissures and Tension Cracks 1

Fissure or Tension Crack Found?	No

Grid 90

Photo 1

Instability

Are there any indications of slope stability concerns?	No

4050 - Chiquita Reaction Area Tracking of Fissures and Tension Cracks

19 Feb 2026 / John Boucher

Complete

Conducted on	19 Feb 2026 7:04 AM PST
Prepared by	John Boucher

Chiquita Reaction Area Tracking of Fissures and Tension Cracks

Chiquita Reaction Area Tracking of Fissures and Tension Cracks

Chiquita Reaction Area Tracking of Fissures and Tension Cracks 1

Fissure or Tension Crack Found?	No

Grid 198

Photo 1

Instability

Are there any indications of slope stability concerns?	No

4050 - Chiquita Reaction Area Tracking of Fissures and Tension Cracks

20 Feb 2026 / John Boucher

Complete

Conducted on	20 Feb 2026 7:05 AM PST
Prepared by	John Boucher

Chiquita Reaction Area Tracking of Fissures and Tension Cracks

Chiquita Reaction Area Tracking of Fissures and Tension Cracks

Chiquita Reaction Area Tracking of Fissures and Tension Cracks 1

Fissure or Tension Crack Found?	No

Grid 160

Photo 1

Instability

Are there any indications of slope stability concerns?	No

4050 - Chiquita Reaction Area Tracking of Fissures and Tension Cracks

21 Feb 2026 / John Boucher

Complete

Conducted on	21 Feb 2026 7:57 AM PST
Prepared by	John Boucher

Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks 1	
Fissure or Tension Crack Found?	No

Grid 196

Photo 1

Instability	
Are there any indications of slope stability concerns?	No

Settlement

The bi-weekly drone flyover was not conducted this week. The drone data from the next flyover event will be included in the next weekly report.

Geosynthetic Cover

4050 - Geosynthetic Cover Inspection

16 Feb 2026 / Tom Roe

Complete

Flagged items	0
Conducted on	16 Feb 2026 9:24 AM PST
Prepared by	Tom Roe

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	No

Photo 1

Photo 2

Photo 3

Photo 4

Instability under the cover	
Are there any anomalous (unusual or unexpected) areas of cover damage or deformation that may indicate underlying instability?	No
Are there any signs of a downslope tension crack at the top of the slope or bulging at or near the toe of the slope?	No
Is there any movement of the equipment that vertically penetrates the cover (e.g., tilting)?	No

4050 - Geosynthetic Cover Inspection

17 Feb 2026 / Tom Roe

Complete

Flagged items	0
Conducted on	17 Feb 2026 9:52 AM PST
Prepared by	Tom Roe

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	No

Photo 1

Photo 2

Photo 3

Photo 4

Instability under the cover	
Are there any anomalous (unusual or unexpected) areas of cover damage or deformation that may indicate underlying instability?	No
Are there any signs of a downslope tension crack at the top of the slope or bulging at or near the toe of the slope?	No
Is there any movement of the equipment that vertically penetrates the cover (e.g., tilting)?	No

4050 - Geosynthetic Cover Inspection

18 Feb 2026 / Tom Roe

Complete

Flagged items	0
Conducted on	18 Feb 2026 9:41 AM PST
Prepared by	Tom Roe

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	No

Photo 1

Photo 2

Photo 3

Photo 4

Instability under the cover	
Are there any anomalous (unusual or unexpected) areas of cover damage or deformation that may indicate underlying instability?	No
Are there any signs of a downslope tension crack at the top of the slope or bulging at or near the toe of the slope?	No
Is there any movement of the equipment that vertically penetrates the cover (e.g., tilting)?	No

4050 - Geosynthetic Cover Inspection

19 Feb 2026 / John Boucher

Complete

Flagged items	0
Conducted on	19 Feb 2026 7:04 AM PST
Prepared by	John Boucher

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	No

Photo 1

Photo 2

Photo 3

Photo 4

Instability under the cover	
Are there any anomalous (unusual or unexpected) areas of cover damage or deformation that may indicate underlying instability?	No
Are there any signs of a downslope tension crack at the top of the slope or bulging at or near the toe of the slope?	No
Is there any movement of the equipment that vertically penetrates the cover (e.g., tilting)?	No

4050 - Geosynthetic Cover Inspection

20 Feb 2026 / John Boucher

Complete

Flagged items	0
Conducted on	20 Feb 2026 7:05 AM PST
Prepared by	John Boucher

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	No

Photo 1

Photo 2

Photo 3

Photo 4

Instability under the cover	
Are there any anomalous (unusual or unexpected) areas of cover damage or deformation that may indicate underlying instability?	No
Are there any signs of a downslope tension crack at the top of the slope or bulging at or near the toe of the slope?	No
Is there any movement of the equipment that vertically penetrates the cover (e.g., tilting)?	No

4050 - Geosynthetic Cover Inspection

21 Feb 2026 / John Boucher

Complete

Flagged items	0
Conducted on	21 Feb 2026 7:57 AM PST
Prepared by	John Boucher

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	No

Photo 1

Photo 2

Photo 3

Photo 4

Instability under the cover	
Are there any anomalous (unusual or unexpected) areas of cover damage or deformation that may indicate underlying instability?	No
Are there any signs of a downslope tension crack at the top of the slope or bulging at or near the toe of the slope?	No
Is there any movement of the equipment that vertically penetrates the cover (e.g., tilting)?	No

CHIQUITA CANYON
A Waste Connections Company

March 3, 2026

Via E-Mail
Karen Gork
Chief Environmental Health Specialist
Los Angeles County Department of Public Health
Local Enforcement Agency
Environmental Programs Division
5050 Commerce Drive,
Baldwin Park, California 91706
KGork@ph.lacounty.gov

Re: Chiquita Canyon, LLC's Weekly Report on the Documentation and Tracking of Cover Issues

Dear Ms. Gork:

In accordance with the Local Enforcement Agency's ("LEA") May 2, 2024 letter approving Chiquita's April 16, 2024 Second Revised Written Plan for Documenting and Tracking Cover Issues ("Second Revised Written Plan"), the LEA's May 29, 2024 letter, and the LEA's June 6, 2024 Compliance Order, Chiquita presents the enclosed report for documenting and tracking cover issues for the week of February 23, 2026 to February 28, 2026.

Please contact me if you have any questions regarding this matter.

Regards,

Sarah Phillips

Sarah Phillips
Corporate Compliance Manager
Chiquita Canyon

Attachment: March 3, 2026 Weekly Cover Issues Report
cc: Mark Como, Department of Public Health
Eric Morofuji, Department of Public Health

Fissures and Tension Cracks

4050 - Chiquita Reaction Area Tracking of Fissures and Tension Cracks

23 Feb 2026 / Tom Roe

Complete

Conducted on	23 Feb 2026 11:14 AM PST
Prepared by	Tom Roe

Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks 1	
Fissure or Tension Crack Found?	No

Grid 160

Photo 1

Instability	
Are there any indications of slope stability concerns?	No

4050 - Chiquita Reaction Area Tracking of Fissures and Tension Cracks

24 Feb 2026 / Tom Roe

Complete

Conducted on	24 Feb 2026 10:40 AM PST
Prepared by	Tom Roe

Chiquita Reaction Area Tracking of Fissures and Tension Cracks

Chiquita Reaction Area Tracking of Fissures and Tension Cracks

Chiquita Reaction Area Tracking of Fissures and Tension Cracks 1

Fissure or Tension Crack Found?	Yes

Using the attached image, annotate all areas where inspectors identified a fissure or tension crack.

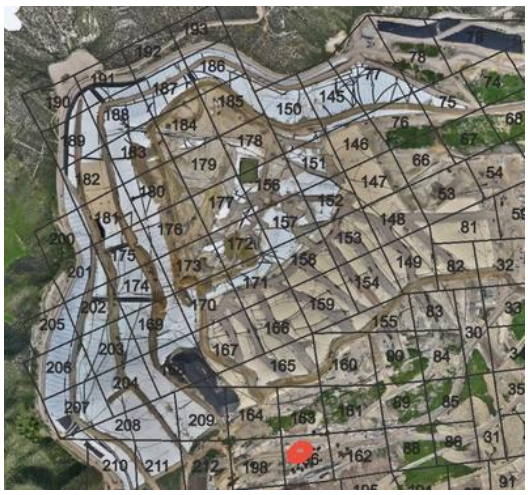

Grid Location	196
Date and Time Found	24 Feb 2026 11:08 AM PST

Image of Fissure/Tension Crack

Photo 1

Photo 2

Length of crack (ft) or area containing multiple cracks (ft x ft)	approximately 3ft x 3ft rainfall-related depression with an

	approximately 1ft crack at the bottom of the depression
Horizontal Offset (width)	Large >4" in width

While the rainfall-related depression was greater than 4" in width, the width of the crack at the bottom of the depression was less than 1"

Vertical Offset (height)	Extra small <0.5" in height
Orientation (direction)	NE to SW
Location	Castaic CA 91384 United States (34.4320926802783, -118.64784376107973)
Was Fissure or Crack fixed? If yes, add photo and description of repairs performed	Yes

Photo 3

Date and time of repairs	24 Feb 2026 11:44 AM PST
Description of repairs	Other (please describe)

Depression filled with dirt and compacted.

Instability

Are there any indications of slope stability concerns?	No

4050 - Chiquita Reaction Area Tracking of Fissures and Tension Cracks

25 Feb 2026 / Tom Roe

Complete

Conducted on	25 Feb 2026 10:51 AM PST
Prepared by	Tom Roe

Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks 1	
Fissure or Tension Crack Found?	No

Grid 164

Photo 1

Instability	
Are there any indications of slope stability concerns?	No

4050 - Chiquita Reaction Area Tracking of Fissures and Tension Cracks

26 Feb 2026 / John Boucher

Complete

Conducted on	26 Feb 2026 7:30 AM PST
Prepared by	John Boucher

Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks 1	
Fissure or Tension Crack Found?	No

Grid 196

Photo 1

Instability	
Are there any indications of slope stability concerns?	No

4050 - Chiquita Reaction Area Tracking of Fissures and Tension Cracks

27 Feb 2026 / John Boucher

Complete

Conducted on	27 Feb 2026 7:08 AM PST
Prepared by	John Boucher

Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks 1	
Fissure or Tension Crack Found?	No

Grid 161

Photo 1

Instability	
Are there any indications of slope stability concerns?	No

4050 - Chiquita Reaction Area Tracking of Fissures and Tension Cracks

28 Feb 2026 / John Boucher

Complete

Conducted on	28 Feb 2026 7:55 AM PST
Prepared by	John Boucher

Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks	
Chiquita Reaction Area Tracking of Fissures and Tension Cracks 1	
Fissure or Tension Crack Found?	No

Grid 164

Photo 1

Instability	
Are there any indications of slope stability concerns?	No

Settlement

Settlement Data Notes

- The charts on the following page show the settlement in cubic yards measured at a fixed location.
    - Chiquita restaked the survey benchmarks between July 31, 2025 and August 13, 2025 to maintain accuracy. After performing additional surveys, Chiquita has confirmed that the restaking caused the data to show an inflated amount of settlement, which does not accurately convey the true rate of settlement.
- The map shows the area between 2/26/2025 and 2/25/2026 where the grades have changed more than 10 feet. A typical MSW strain rate is 3% per year - for a landfill with a 300-foot waste column, this would be 9 feet per year.
- During normal site operations before site closure, large stockpiles of rock materials were maintained, and sometimes moved as other operations necessitated. The areas used for these material stockpiles were south and east of the lined area. There is not a way to differentiate between settlement and stockpile movements.
- On a monthly basis, SCS leads the collection and review of data to determine whether the boundaries of the Reaction Area, as defined in the Stipulated Order for Abatement with the South Coast Air Quality Management District (SCAQMD), have changed. The Reaction Committee of experts formed under the Stipulated Order then further reviews and submits these monthly determinations to SCAQMD. These determinations are also posted on Chiquita's website. As part of this monthly review, SCS considers the below factors in determining the estimated boundary of the reaction area, in accordance with the Stipulated Order.
    - Landfill gas (LFG) wellhead temperatures in excess of approximately 160 degrees Fahrenheit.
    - Poor gas quality (defined as methane levels of less than 30 percent) in conjunction with methane-to-carbon dioxide (CH_4:CO2) ratios less than 1.0.
    - The concentration of hydrogen (H_2) in the LFG measured greater than 2 percent by volume.
    - The concentration of carbon monoxide (CO) in the LFG measured greater than 2,000 ppm.
    - Accelerated settlement of the landfill surface, defined as approximately 18 inches or greater within a 60-day period, and cracks in the landfill cover.
    - First-hand observations of the Chiquita Canyon Landfill (Landfill) and/or SCS engineering, construction, and operations and maintenance field personnel who are on-site related to: 1) atypical excess leachate quantities (presence and quantity of liquids); 2) instances of pressurized liquids emitting from the Landfill surface, from boreholes during drilling, and from LFG wells; and, 3) the characteristics of the odors originating from the select areas of the waste footprint (often described as "chemical-like" and distinctly different from typical LFG or landfill working face odors).
    - Observations of subsurface waste conditions and characteristics as noted on borehole drilling logs for recently installed new wells and/or TMPs.
    - Subsurface temperatures recorded at the in-situ waste TMPs during the month being assessed.
    - Temperature of gas or liquids measured at depth within the LFG well riser pipe (using an automated transmitter or manual field instrumentation).

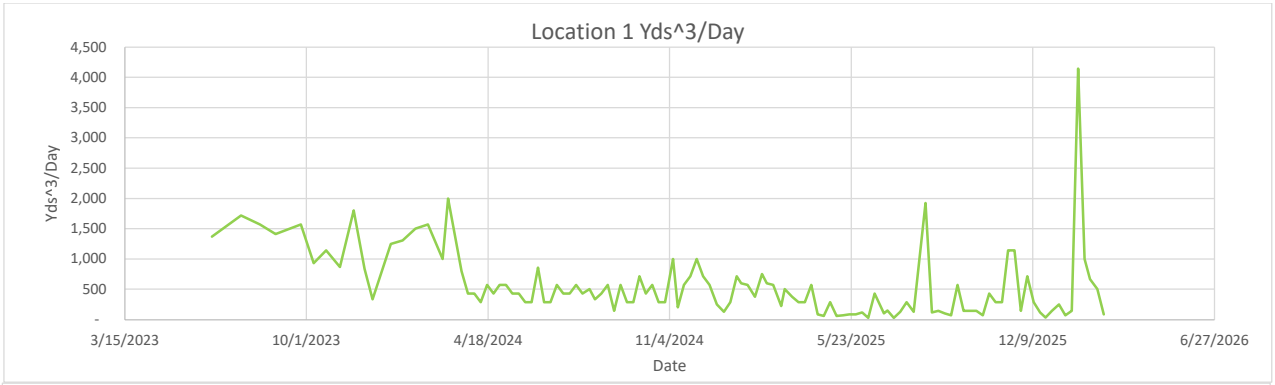
Location 1 Yds^3/Day
Yds^3/Day
4,500
4,000
3,500
3,000
2,500
2,000
1,500
1,000
500
-
3/15/2023
10/1/2023
4/18/2024
11/4/2024
5/23/2025
12/9/2025
6/27/2026
Date

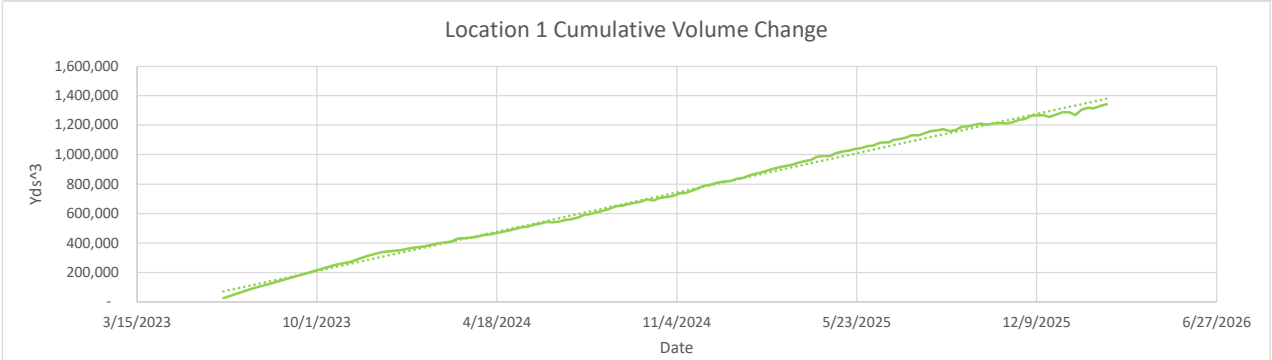
Location 1 Cumulative Volume Change
Yds^3
1,600,000
1,400,000
1,200,000
1,000,000
800,000
600,000
400,000
200,000
-
3/15/2023
10/1/2023
4/18/2024
11/4/2024
5/23/2025
12/9/2025
6/27/2026
Date

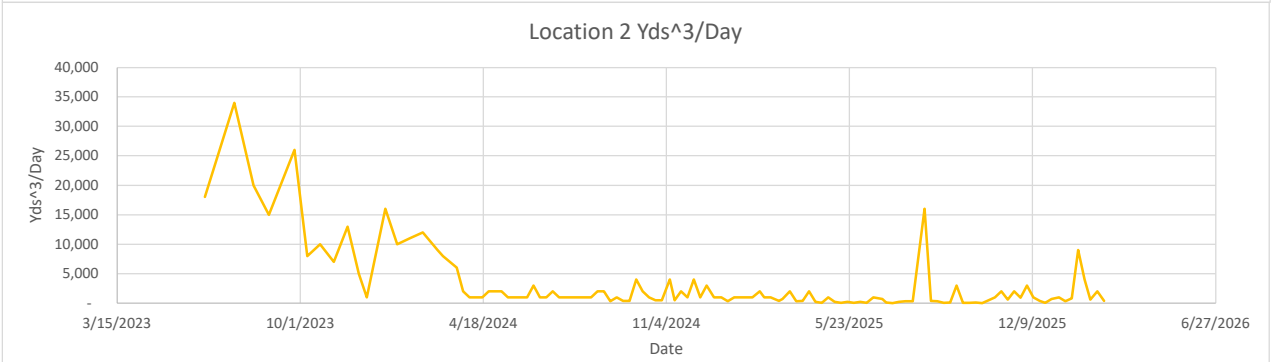
Location 2 Yds^3/Day
Yds^3/Day
40,000
35,000
30,000
25,000
20,000
15,000
10,000
5,000
-
3/15/2023
10/1/2023
4/18/2024
11/4/2024
5/23/2025
12/9/2025
6/27/2026
Date

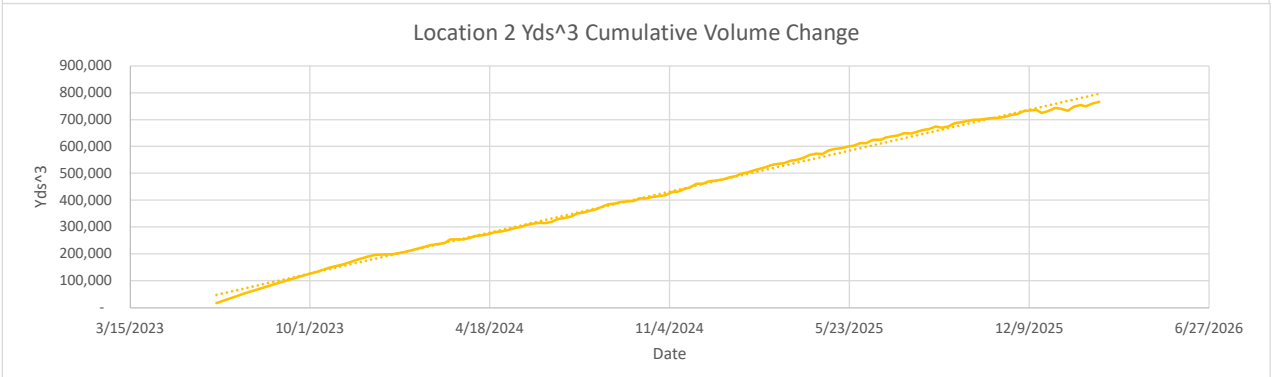
Location 2 Yds^3 Cumulative Volume Change
Yds^3
900,000
800,000
700,000
600,000
500,000
400,000
300,000
200,000
100,000
-
3/15/2023
10/1/2023
4/18/2024
11/4/2024
5/23/2025
12/9/2025
6/27/2026
Date

Location 1

Flyover Date	Days Between Flights	Volume Change	Cumulative Volume Change	Volume Change Per Day	
5/31/2023	0	-	-	-	
6/19/2023	19	26,000	26,000	1,368	
7/21/2023	32	55,000	90,000	1,719	
8/11/2023	21	33,000	126,000	1,571	
8/28/2023	17	24,000	156,000	1,412	
9/25/2023	28	44,000	205,000	1,571	
10/9/2023	14	13,000	229,000	929	
10/23/2023	14	16,000	254,000	1,143	
11/7/2023	15	13,000	272,000	867	
11/22/2023	15	27,000	304,000	1,800	
12/4/2023	12	10,000	325,000	833	
12/13/2023	9	3,000	338,000	333	
1/2/2024	20	25,000	352,000	1,250	*Waste fill near reaction area
1/15/2024	13	17,000	367,000	1,308	
1/29/2024	14	21,000	377,000	1,500	*Waste fill near reaction area
2/12/2024	14	22,000	398,000	1,571	
2/28/2024	16	16,000	411,000	1,000	
3/5/2024	6	12,000	430,000	2,000	
3/20/2024	15	12,000	436,000	800	
3/27/2024	7	3,000	442,362	429	
4/3/2024	7	3,000	454,000	429	
4/10/2024	7	2,000	459,000	286	
4/17/2024	7	4,000	467,000	571	
4/24/2024	7	3,000	476,000	429	
5/1/2024	7	4,000	484,000	571	
5/8/2024	7	4,000	494,000	571	
5/15/2024	7	3,000	505,000	429	
5/22/2024	7	3,000	511,000	429	
5/29/2024	7	2,000	524,000	286	
6/5/2024	7	2,000	532,000	286	
6/12/2024	7	6,000	542,853	857	
6/19/2024	7	2,000	540,000	286	
6/26/2024	7	2,000	545,000	286	
7/3/2024	7	4,000	555,000	571	
7/10/2024	7	3,000	563,000	429	
7/17/2024	7	3,000	573,000	429	
7/24/2024	7	4,000	590,000	571	
7/31/2024	7	3,000	597,000	429	
8/8/2024	8	4,000	609,000	500	
8/14/2024	6	2,000	619,000	333	
8/21/2024	7	3,000	631,000	429	
8/28/2024	7	4,000	649,000	571	
9/4/2024	7	1,000	654,000	143	
9/11/2024	7	4,000	665,000	571	
9/18/2024	7	2,000	673,000	286	
9/25/2024	7	2,000	679,000	286	
10/2/2024	7	5,000	696,000	714	
10/9/2024	7	3,000	689,000	429	
10/16/2024	7	4,000	706,000	571	
10/23/2024	7	2,000	712,000	286	
10/30/2024	7	2,000	719,000	286	
11/8/2024	9	9,000	739,000	1,000	
11/13/2024	5	1,000	739,000	200	
11/20/2024	7	4,000	753,000	571	
11/27/2024	7	5,000	768,000	714	
12/4/2024	7	7,000	788,000	1,000	
12/11/2024	7	5,000	794,000	714	
12/18/2024	7	4,000	807,000	571	
12/26/2024	8	2,000	816,000	250	
1/3/2025	8	1,000	821,000	125	
1/10/2025	7	2,000	835,000	286	
1/17/2025	7	5,000	843,000	714	
1/22/2025	5	3,000	856,000	600	
1/29/2025	7	4,000	868,000	571	
2/6/2025	8	3,000	880,000	375	
2/14/2025	8	6,000	894,000	750	
2/19/2025	5	3,000	903,000	600	
2/26/2025	7	4,000	915,000	571	
3/7/2025	9	2,000	925,000	222	
3/11/2025	4	2,000	930,000	500	
3/19/2025	8	3,000	945,000	375	
3/26/2025	7	2,000	956,000	286	
4/2/2025	7	2,000	964,000	286	
4/9/2025	7	4,000	985,000	571	
4/16/2025	7	600	990,000	86	
4/23/2025	7	400	991,000	57	
4/30/2025	7	2,000	1,009,000	286	
5/7/2025	7	400	1,020,000	57	
5/14/2025	7	500	1,027,000	71	

5/21/2025	7	600	1,038,000	86
5/28/2025	7	600	1,044,000	86
6/4/2025	7	822	1,058,000	117
6/11/2025	7	200	1,062,000	29
6/18/2025	7	3,000	1,081,000	429
6/28/2025	10	1,000	1,084,000	100
7/2/2025	4	600	1,099,000	150
7/9/2025	7	200	1,106,000	29
7/16/2025	7	900	1,114,000	129
7/23/2025	7	2,000	1,132,000	286
7/31/2025	8	1,000	1,132,000	125
8/13/2025	13	25,000	1,160,000	1,923
8/20/2025	7	800	1,163,000	114
8/27/2025	7	1,000	1,172,000	143
9/3/2025	7	700	1,160,000	100
9/10/2025	7	500	1,167,000	71
9/17/2025	7	4,000	1,189,000	571
9/24/2025	7	1,000	1,193,000	143
10/1/2025	7	1,000	1,202,000	143
10/8/2025	7	1,000	1,209,000	143
10/15/2025	7	500	1,203,000	71
10/22/2025	7	3,000	1,211,000	429
10/29/2025	7	2,000	1,214,000	286
11/5/2025	7	2,000	1,212,000	286
11/12/2025	7	8,000	1,218,000	1,143
11/19/2025	7	8,000	1,236,000	1,143
11/26/2025	7	1,000	1,242,000	143
12/3/2025	7	5,000	1,263,000	714
12/10/2025	7	2,000	1,266,000	286
12/17/2025	7	800	1,267,000	114
12/23/2025	6	200	1,256,000	33
12/30/2025	7	1,000	1,271,000	143
1/7/2026	8	2,000	1,288,000	250
1/14/2026	7	500	1,288,000	71
1/21/2026	7	1,000	1,267,000	143
1/28/2026	7	29,000	1,305,000	4,143
2/4/2026	7	7,000	1,317,000	1,000
2/10/2026	6	4,000	1,314,000	667
2/18/2026	8	4,000	1,330,000	500
2/25/2026	7	600	1,342,000	86

Location 2

Flyover Date	Days Between Flights	Volume Change	Cumulative Volume Change	Volume Change Per Day
5/31/2023	0	-	-	-
6/19/2023	19	18,000	18,000	947
7/21/2023	32	34,000	54,000	1,063
8/11/2023	21	20,000	75,000	952
8/28/2023	17	15,000	93,000	882
9/25/2023	28	26,000	121,000	929
10/9/2023	14	8,000	134,000	571
10/23/2023	14	10,000	149,000	714
11/7/2023	15	7,000	161,000	467
11/22/2023	15	13,000	178,000	867
12/4/2023	12	5,000	190,000	417
12/13/2023	9	1,000	197,000	111
1/2/2024	20	16,000	199,000	800
1/15/2024	13	10,000	208,000	769
1/29/2024	14	11,000	220,000	786
2/12/2024	14	12,000	233,000	857
2/28/2024	16	9,000	241,000	563
3/5/2024	6	8,000	254,000	1,333
3/20/2024	15	6,000	254,000	400
3/27/2024	7	2,000	260,000	286
4/3/2024	7	1,000	267,000	143
4/10/2024	7	1,000	269,000	143
4/17/2024	7	1,000	274,000	143
4/24/2024	7	2,000	281,000	286
5/1/2024	7	2,000	284,000	286
5/8/2024	7	2,000	289,000	286
5/15/2024	7	1,000	296,000	143
5/22/2024	7	1,000	300,000	143
5/29/2024	7	1,000	308,000	143
6/5/2024	7	1,000	312,000	143
6/12/2024	7	3,000	316,000	429
6/19/2024	7	1,000	315,000	143
6/26/2024	7	1,000	320,000	143
7/3/2024	7	2,000	330,000	286
7/10/2024	7	1,000	334,000	143
7/17/2024	7	1,000	339,000	143
7/24/2024	7	1,000	350,000	143

*Waste fill near reaction area

*Waste fill near reaction area

7/31/2024	7	1,000	354,000	143
8/8/2024	8	1,000	361,000	125
8/14/2024	6	1,000	366,000	167
8/21/2024	7	2,000	375,000	286
8/28/2024	7	2,000	385,000	286
9/4/2024	7	300	387,000	43
9/11/2024	7	1,000	393,000	143
9/18/2024	7	400	396,000	57
9/25/2024	7	400	397,000	57
10/2/2024	7	4,000	407,000	571
10/9/2024	7	2,000	406,000	286
10/16/2024	7	1,000	412,000	143
10/23/2024	7	500	415,000	71
10/30/2024	7	500	419,000	71
11/8/2024	9	4,000	431,000	444
11/13/2024	5	500	432,000	100
11/20/2024	7	2,000	441,000	286
11/27/2024	7	1,000	448,000	143
12/4/2024	7	4,000	461,000	571
12/11/2024	7	1,000	461,000	143
12/18/2024	7	3,000	471,000	429
12/26/2024	8	1,000	473,000	125
1/3/2025	8	1,000	478,000	125
1/10/2025	7	300	485,000	43
1/17/2025	7	1,000	490,000	143
1/22/2025	5	1,000	498,000	200
1/29/2025	7	1,000	503,000	143
2/6/2025	8	1,000	511,000	125
2/14/2025	8	2,000	518,000	250
2/19/2025	5	1,000	523,000	200
2/26/2025	7	1,000	531,000	143
3/7/2025	9	400	536,000	44
3/11/2025	4	700	537,000	175
3/19/2025	8	2,000	547,000	250
3/26/2025	7	300	551,000	43
4/2/2025	7	400	558,000	57
4/9/2025	7	2,000	569,000	286
4/16/2025	7	200	573,000	29
4/23/2025	7	60	572,000	9
4/30/2025	7	1,000	585,000	143
5/7/2025	7	200	591,000	29
5/14/2025	7	80	594,000	11
5/21/2025	7	200	599,000	29
5/28/2025	7	60	603,000	9
6/4/2025	7	200	612,000	29
6/11/2025	7	40	613,000	6
6/18/2025	7	1,000	624,000	143
6/28/2025	10	700	626,000	70
7/2/2025	4	100	633,000	25
7/9/2025	7	30	637,000	4
7/16/2025	7	200	641,000	29
7/23/2025	7	300	650,000	43
7/31/2025	8	300	648,000	38
8/13/2025	13	16,000	661,000	1,231
8/20/2025	7	400	665,000	57
8/27/2025	7	300	674,000	43
9/3/2025	7	50	670,000	7
9/10/2025	7	90	674,000	13
9/17/2025	7	3,000	686,000	429
9/24/2025	7	40	690,000	6
10/1/2025	7	50	695,000	7
10/8/2025	7	100	700,000	14
10/15/2025	7	30	699,000	4
10/22/2025	7	500	703,000	71
10/29/2025	7	1,000	705,000	143
11/5/2025	7	2,000	707,000	286
11/12/2025	7	600	710,000	86
11/19/2025	7	2,000	717,000	286
11/26/2025	7	900	721,000	129
12/3/2025	7	3,000	732,000	429
12/10/2025	7	1,000	734,000	143
12/17/2025	7	400	736,000	57
12/23/2025	6	70	725,000	12
12/30/2025	7	700	732,000	100
1/7/2026	8	1,000	743,000	125
1/14/2026	7	300	740,000	43
1/21/2026	7	800	733,000	114
1/28/2026	7	9,000	748,000	1,286
2/4/2026	7	4,000	754,000	571
2/10/2026	6	600	750,000	100
2/18/2026	8	2,000	760,000	250

2/25/2026	7	400	766,000	57

-10 ft
-10 ft

Settlement area between 2/6/2025 and 2/10/2026, submitted on 2/17/2026. and produced here again for comparison.
-10 ft
-10 ft

Geosynthetic Cover

4050 - Geosynthetic Cover Inspection

23 Feb 2026 / Tom Roe

Complete

Flagged items	0
Conducted on	23 Feb 2026 10:58 AM PST
Prepared by	Tom Roe

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	Yes
Date and Time Issue Found	23 Feb 2026 1:55 PM PST

Grid Location

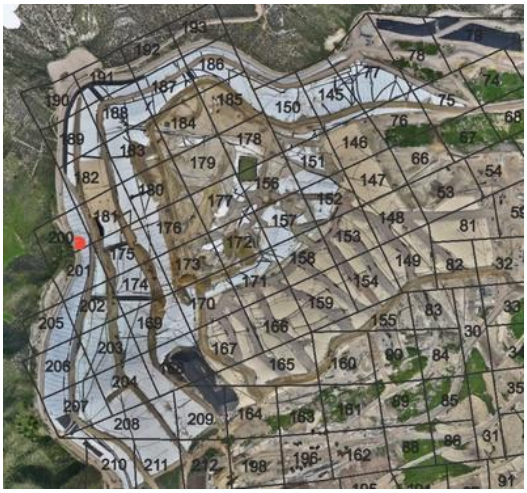

Grid Number	200

Take photo of identified issues

Photo 1

Notate what the issue is and what needs to be repaired	Tear in liner needs to be patched and extrusion welded.

Take photo of repair

Photo 2

Description of repair work	Tear taped upon discovery.
Date and time of repair (within 2 hours)	23 Feb 2026 1:58 PM PST
Are further permanent repairs required?	Yes

Permanent repair scheduled for 3/2/26

Date and Time of final repair (if necessary)

Identified Issue 2

Are there any issues with the geosynthetic cover?	Yes
Date and Time Issue Found	23 Feb 2026 10:58 AM PST

Grid Location

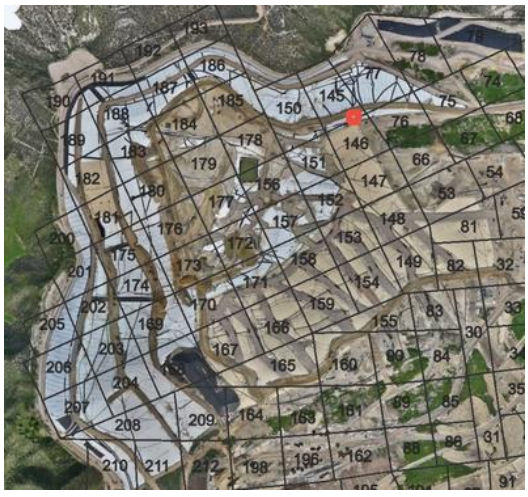

Grid Number	145

Take photo of identified issues

Photo 3

Notate what the issue is and what needs to be repaired	Tear at seam in liner, needs to be patched and extrusion welded.

Take photo of repair

Photo 4

Description of repair work	Tears taped and sandbagged upon discovery.
Date and time of repair (within 2 hours)	23 Feb 2026 11:06 AM PST
Are further permanent repairs required?	Yes

Permanent repairs scheduled for 3/2/26

Date and Time of final repair (if necessary)	

Instability under the cover

Are there any anomalous (unusual or unexpected) areas of cover damage or deformation that may indicate underlying	No

instability?	
Are there any signs of a downslope tension crack at the top of the slope or bulging at or near the toe of the slope?	No
Is there any movement of the equipment that vertically penetrates the cover (e.g., tilting)?	No

4050 - Geosynthetic Cover Inspection

24 Feb 2026 / Tom Roe

Complete

Flagged items	0
Conducted on	24 Feb 2026 10:51 AM PST
Prepared by	Tom Roe

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	Yes
Date and Time Issue Found	24 Feb 2026 12:33 PM PST

Grid Location

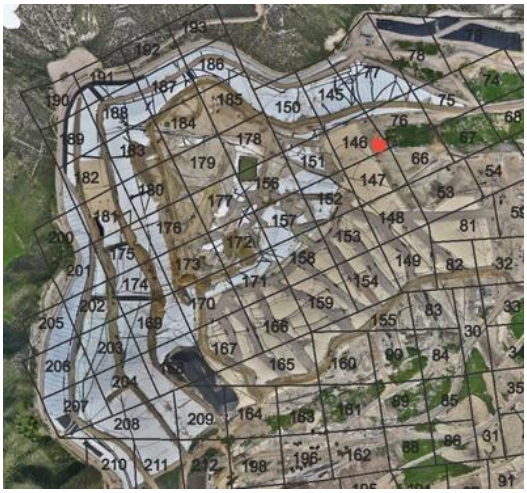

Grid Number	146

Take photo of identified issues

Photo 1

Notate what the issue is and what needs to be repaired	Tear in liner needs to be patched and extrusion welded.

Take photo of repair

Photo 2

Description of repair work	Tear taped and sandbagged upon discovery.
Date and time of repair (within 2 hours)	24 Feb 2026 12:36 PM PST
Are further permanent repairs required?	Yes

Permanent repairs scheduled for 3/2/26

Date and Time of final repair (if necessary)	

Identified Issue 2

Are there any issues with the geosynthetic cover?	Yes
Date and Time Issue Found	24 Feb 2026 12:36 PM PST

Grid Location

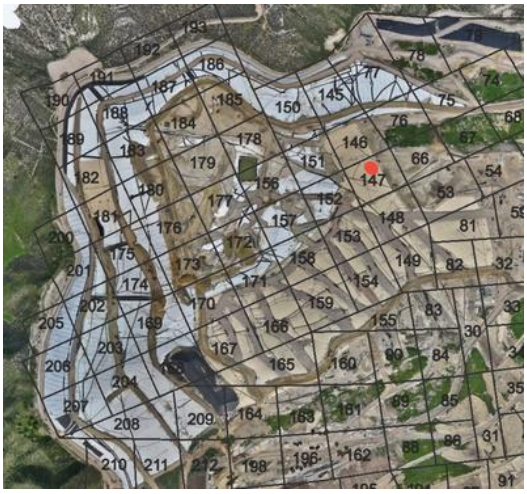

Grid Number	147

Take photo of identified issues

Photo 3

Photo 4

Notate what the issue is and what needs to be repaired	Two tears in liner in close proximity need to be extrusion welded.

Take photo of repair

Photo 5

Photo 6

Description of repair work	Tears taped and sandbagged upon discovery.
Date and time of repair (within 2 hours)	24 Feb 2026 12:39 PM PST
Are further permanent repairs required?	Yes

Permanent repairs scheduled for 3/2/26

Date and Time of final repair (if necessary)

Instability under the cover

Are there any anomalous (unusual or unexpected) areas of cover damage or deformation that may indicate underlying instability?	No
Are there any signs of a downslope tension crack at the top of the slope or bulging at or near the toe of the slope?	No
Is there any movement of the equipment that vertically penetrates the cover (e.g., tilting)?	No

4050 - Geosynthetic Cover Inspection

25 Feb 2026 / Tom Roe

Complete

Flagged items	0
Conducted on	25 Feb 2026 2:41 PM PST
Prepared by	Tom Roe

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	No

Photo 1

Photo 2

Photo 3

Photo 4

Instability under the cover	
Are there any anomalous (unusual or unexpected) areas of cover damage or deformation that may indicate underlying instability?	No
Are there any signs of a downslope tension crack at the top of the slope or bulging at or near the toe of the slope?	No
Is there any movement of the equipment that vertically penetrates the cover (e.g., tilting)?	No

4050 - Geosynthetic Cover Inspection

26 Feb 2026 / John Boucher

Complete

Flagged items	0
Conducted on	26 Feb 2026 7:30 AM PST
Prepared by	John Boucher

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	No

Photo 1

Photo 2

Photo 3

Photo 4

Photo 5

Instability under the cover	
Are there any anomalous (unusual or unexpected) areas of cover damage or deformation that may indicate underlying instability?	No

Are there any signs of a downslope tension crack at the top of the slope or bulging at or near the toe of the slope?	No
Is there any movement of the equipment that vertically penetrates the cover (e.g., tilting)?	No

4050 - Geosynthetic Cover Inspection

27 Feb 2026 / John Boucher

Complete

Flagged items	0
Conducted on	27 Feb 2026 7:08 AM PST
Prepared by	John Boucher

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	No

Photo 1

Photo 2

Photo 3

Photo 4

Instability under the cover	
Are there any anomalous (unusual or unexpected) areas of cover damage or deformation that may indicate underlying instability?	No
Are there any signs of a downslope tension crack at the top of the slope or bulging at or near the toe of the slope?	No
Is there any movement of the equipment that vertically penetrates the cover (e.g., tilting)?	No

4050 - Geosynthetic Cover Inspection

28 Feb 2026 / John Boucher

Complete

Flagged items	0
Conducted on	28 Feb 2026 7:55 AM PST
Prepared by	John Boucher

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	No

Photo 1

Photo 2

Photo 3

Photo 4

Photo 5

Instability under the cover	
Are there any anomalous (unusual or unexpected) areas of cover damage or deformation that may indicate underlying instability?	No

Are there any signs of a downslope tension crack at the top of the slope or bulging at or near the toe of the slope?	No
Is there any movement of the equipment that vertically penetrates the cover (e.g., tilting)?	No

Attachment I

Drilling and Waste Characterization Map, Surface Emissions Monitoring Grid Map, and GCCS As-Built Map

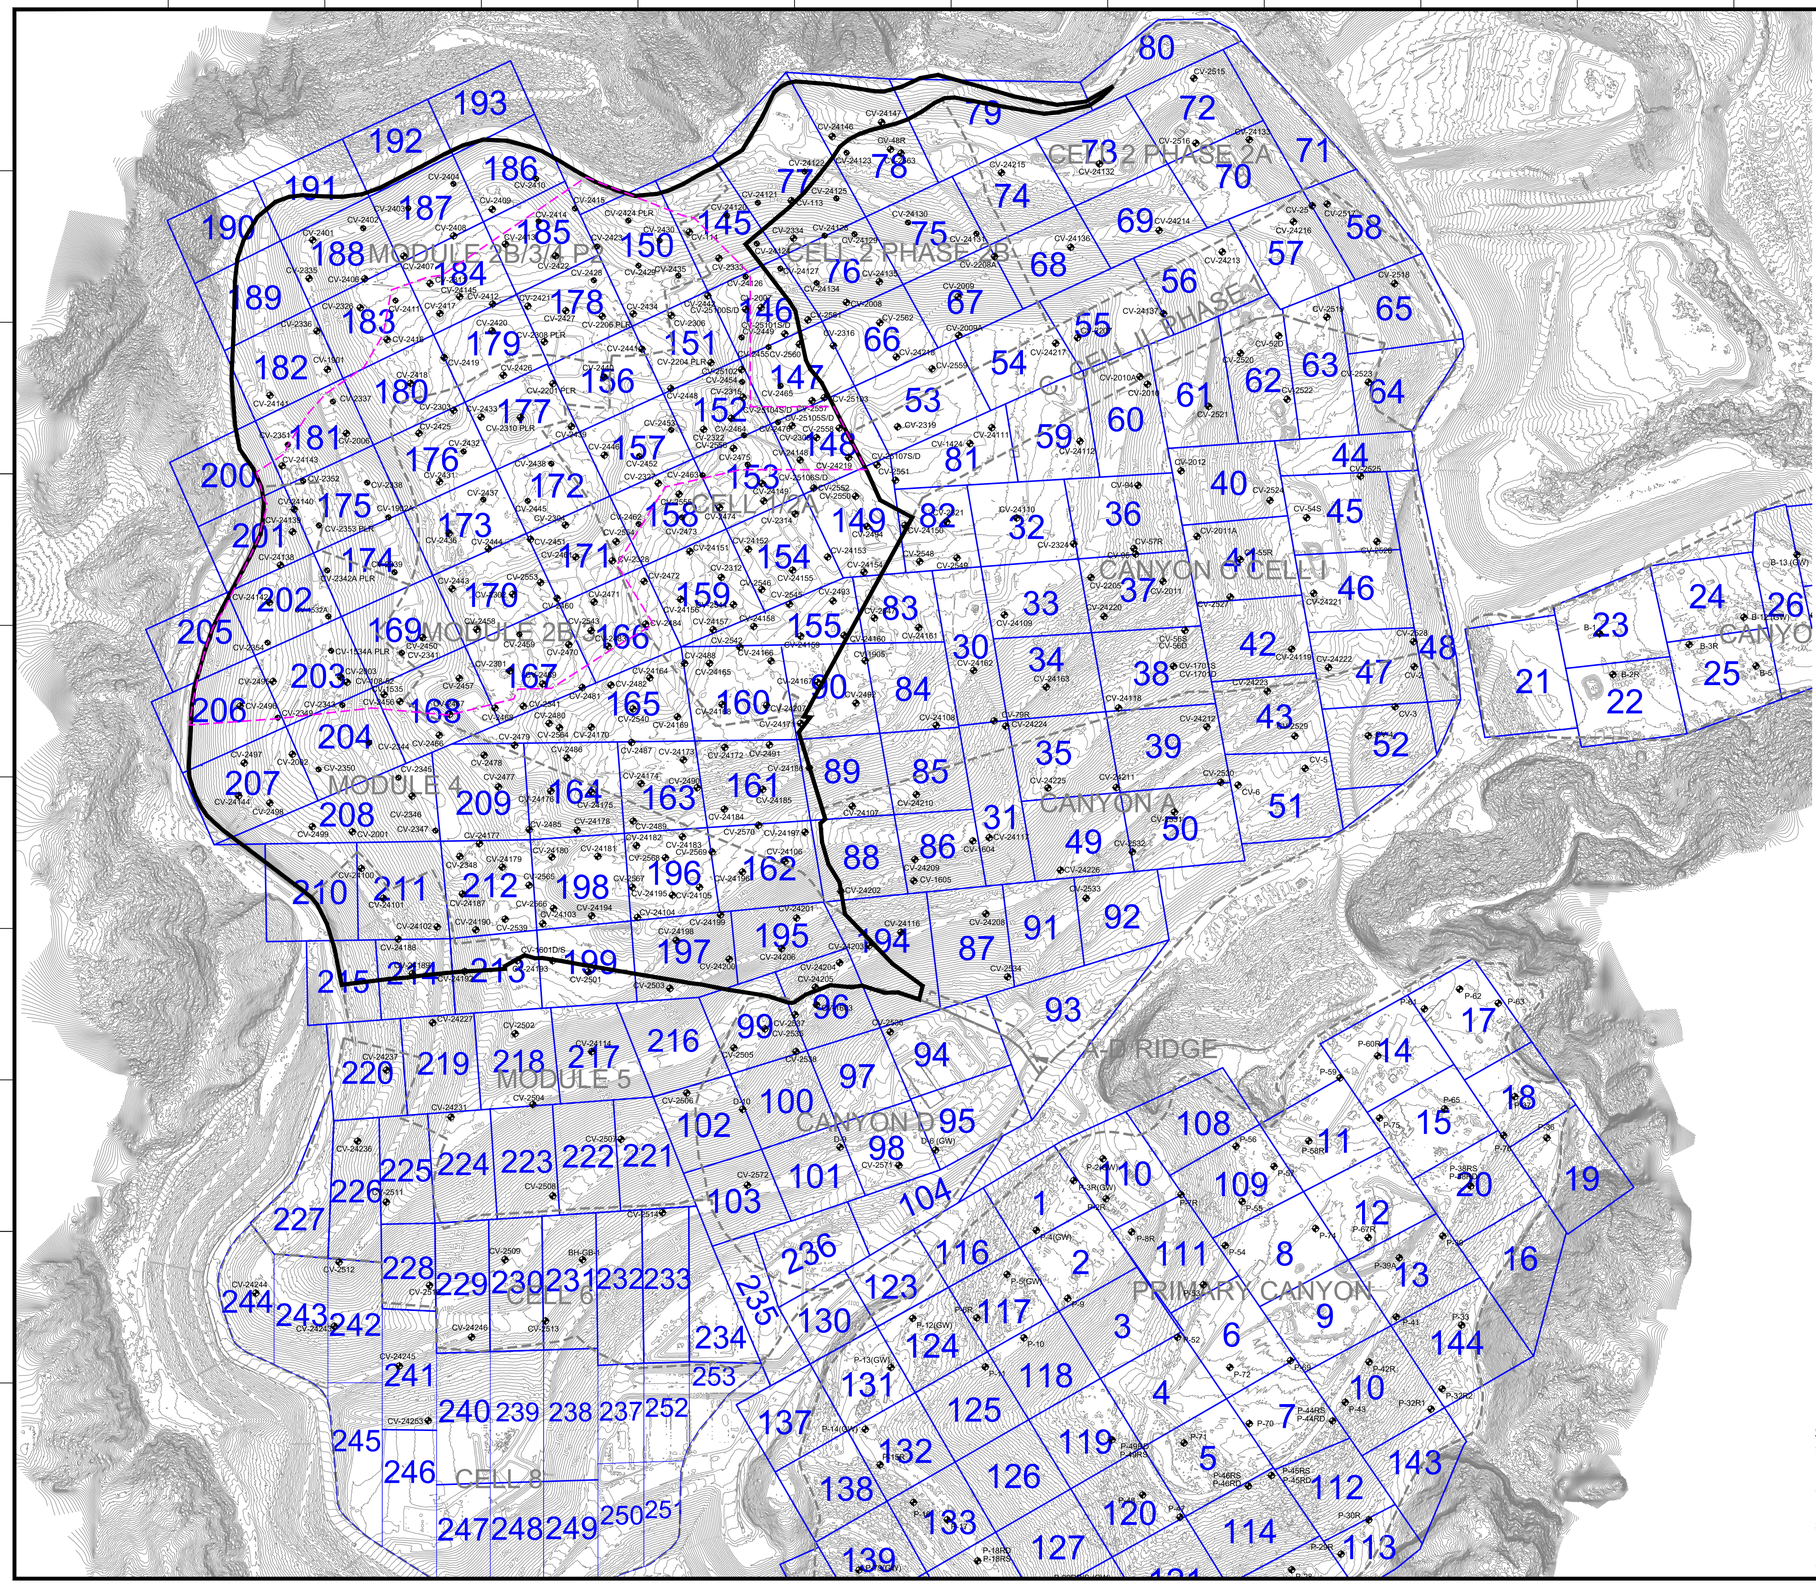

N

GRAPHIC SCALE

200 100 0 200 400 600

SCALE: 1"=200'

LEGEND

- 1150 — TOPOGRAPHIC CONTOUR
- EXISTING CELL LIMITS (APPROXIMATE)
- CV-XX — EXISTING VERTICAL LFG EXTRACTION WELL
- CV-XX PLR — EXISTING LFG VERTICAL EXTRACTION WELL - PRESSURIZED LEACHATE RELEASE
- REACTION AREA BOUNDARY (APPROXIMATE) - BASED ON DATA REVIEW
- REACTION AREA BOUNDARY - CONDITION 9A
- 23 — SURFACE EMISSION MONITORING GRID

GENERAL DRAWING NOTES:

1. EXISTING TOPOGRAPHIC SURVEY INFORMATION SHOWN WAS PROVIDED BY PROPELLOR. AERIAL PHOTOGRAPHY DATED FEBRUARY 25, 2026.
2. NORTH ARROW SHOWN HERE IS REFERENCE TO THE CALIFORNIA STATE PLANE ZONE V COORDINATE SYSTEM, NAD 83.
3. THE LOCATION OF ANY EXISTING GCCS COMPONENTS AND OTHER FEATURES ARE APPROXIMATE AND SHOULD BE USED FOR INFORMATION PURPOSES ONLY.
4. EXISTING GCCS AS-BUILT DATED FEBRUARY 28, 2026.

NO.	REVISION	DATE

SHEET TITLE: SURFACE EMISSION MONITORING GRIDS AND VERTICAL LFG EXTRACTION WELLS

PROJECT TITLE: CHIQUITA CANYON LANDFILL CASTAIC, CALIFORNIA

CLIENT: CHIQUITA CANYON LANDFILL CASTAIC, CALIFORNIA

SCS ENGINEERS
ENVIRONMENTAL CONSULTANTS
3800 KILROY AIRPORT WAY, SUITE 300
LONG BEACH, CA 90806
PH: (562) 426-9544

PROJ. NO. 01204122.41 | DWN. BY: AEK | CHK. BY: WCH | APP. BY: WCH | ACAD FILE: FIELD SERVICES

DSN. BY: -

DATE: 03/03/2026

SCALE: AS SHOWN

SHEET: 1

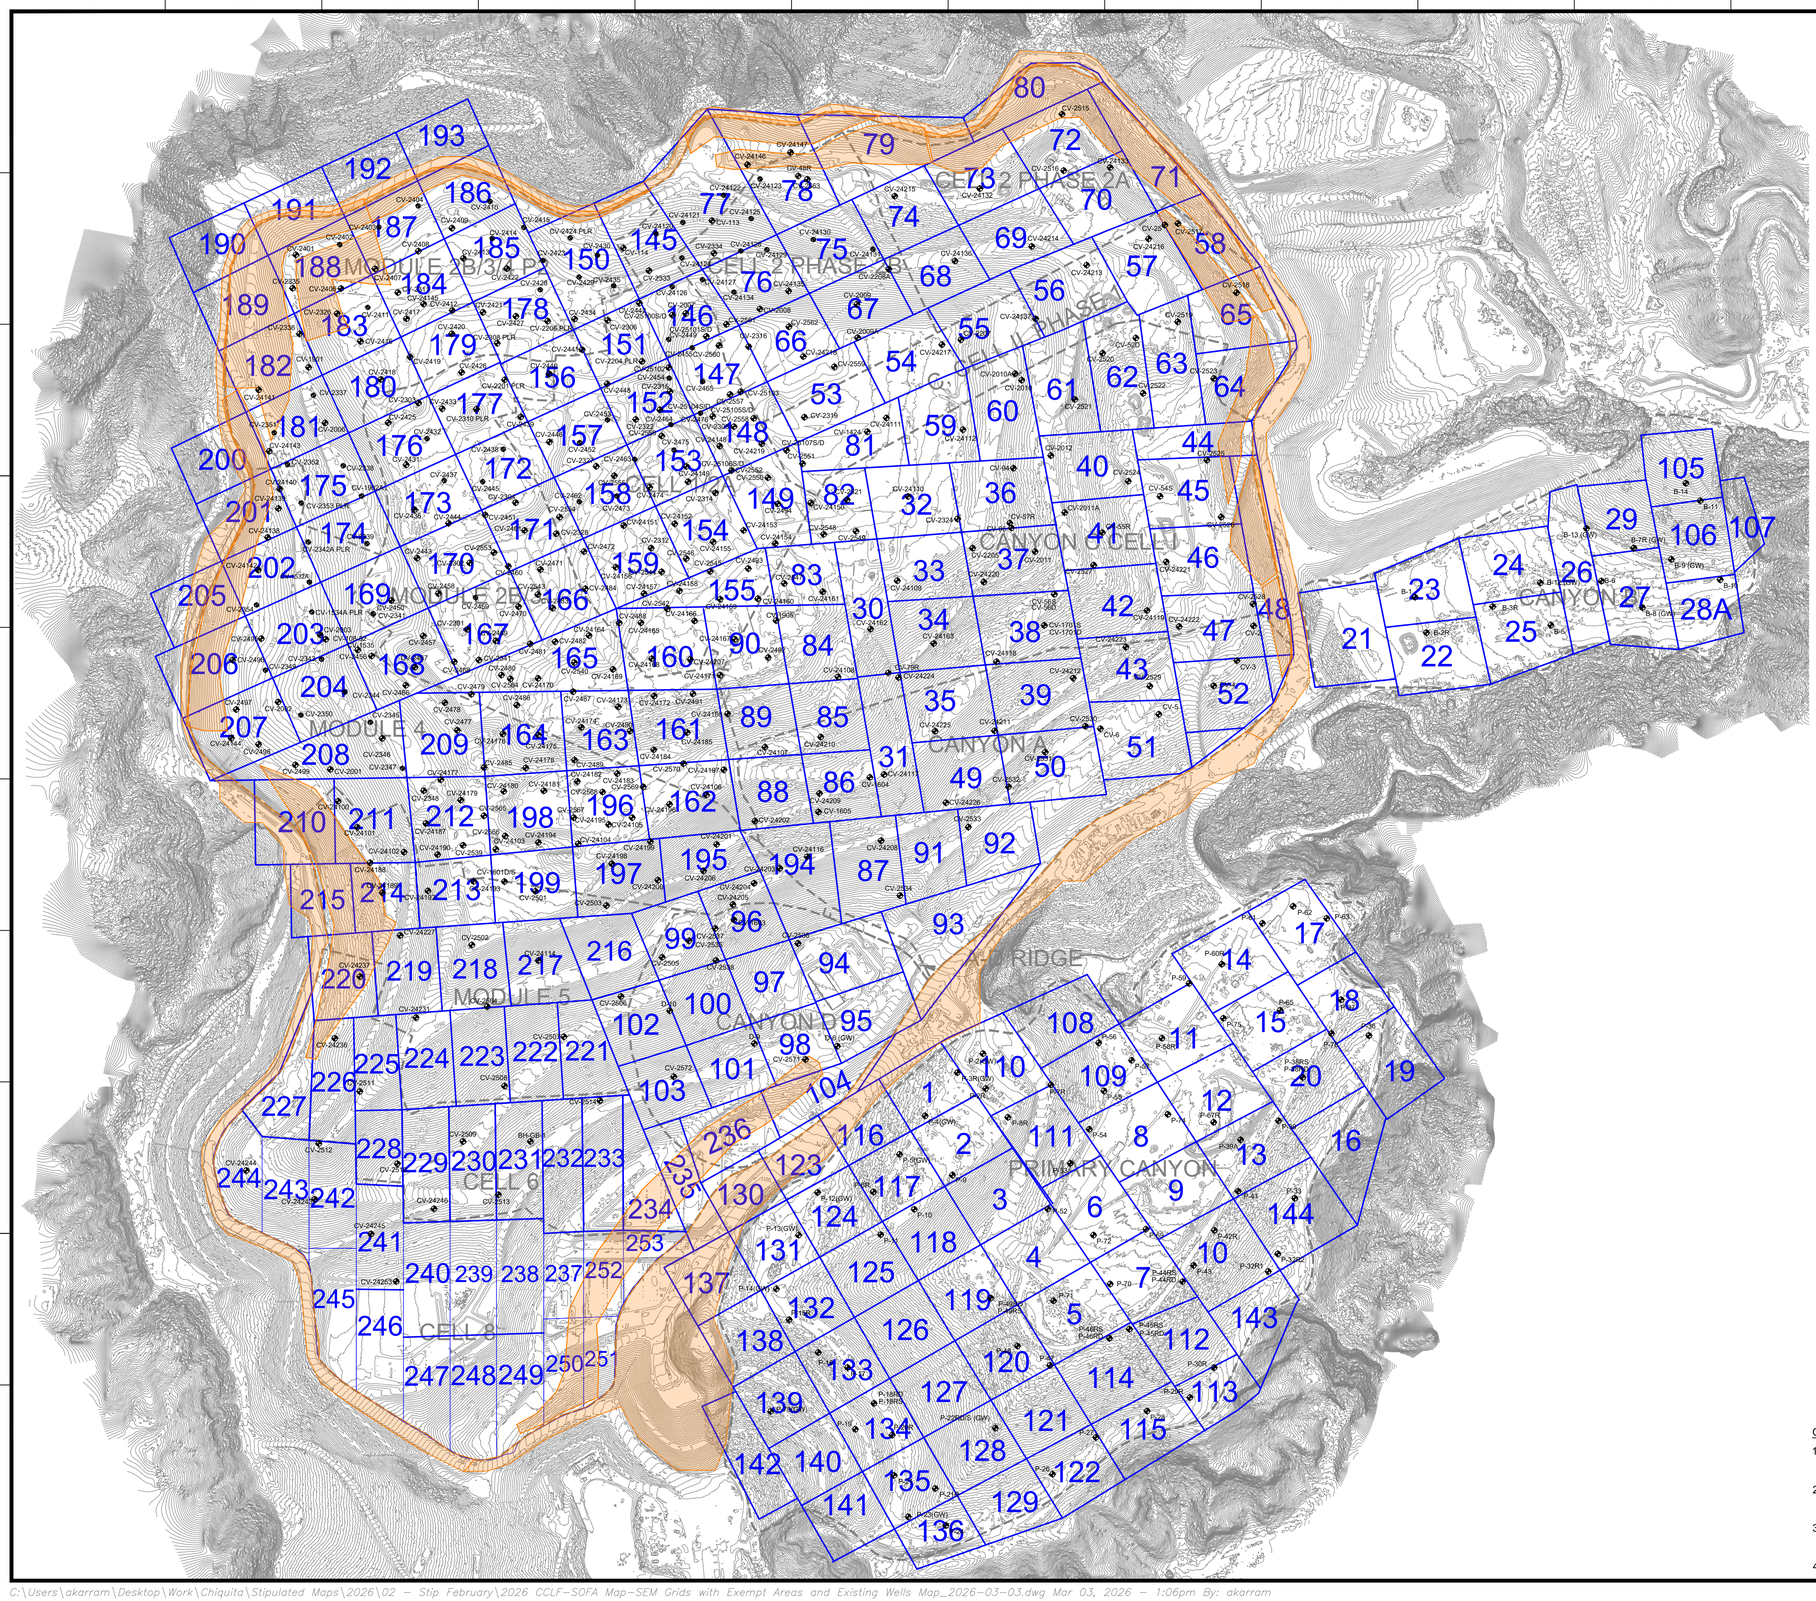

GENERAL DRAWING NOTES:

1. EXISTING TOPOGRAPHIC SURVEY INFORMATION SHOWN WAS PROVIDED BY PROPELLOR. AERIAL PHOTOGRAPHY DATED FEBRUARY 25, 2026.
2. NORTH ARROW SHOWN HERE IS REFERENCE TO THE CALIFORNIA STATE PLANE ZONE V COORDINATE SYSTEM, NAD 83.
3. THE LOCATION OF ANY EXISTING GCCS COMPONENTS AND OTHER FEATURES ARE APPROXIMATE AND SHOULD BE USED FOR INFORMATION PURPOSES ONLY.
4. EXISTING GCCS AS-BUILT DATED FEBRUARY 28, 2026.

NO.	REVISION	DATE

SHEET TITLE: SURFACE EMISSION MONITORING GRIDS AND VERTICAL LFG EXTRACTION WELLS

PROJECT TITLE: CHIQUITA CANYON LANDFILL CASTAIC, CALIFORNIA

CLIENT: CHIQUITA CANYON LANDFILL CASTAIC, CALIFORNIA

SCS ENGINEERS
ENVIRONMENTAL CONSULTANTS
3900 KILROY AIRPORT WAY, SUITE 300
LONG BEACH, CA 90806
PH: (562) 426-9544

PROJ. NO. 01204123.41 | DWN. BY: AEK | CHK. BY: WCH | ACAD FILE/FIELD SERVICES | APP. BY: WCH | DSN. BY: -

DATE: 03/03/2026

SCALE: AS SHOWN

SHEET: 1

C:\Users\akarram\Desktop\Work\Chiquita\Stipulated Maps\2026\02 - Stip February\2026 CCLF-SOFA Map-SEM Grids with Exempt Areas and Existing Wells Map_2026-03-03.dwg Mar 03, 2026 - 1:06pm By: akarram

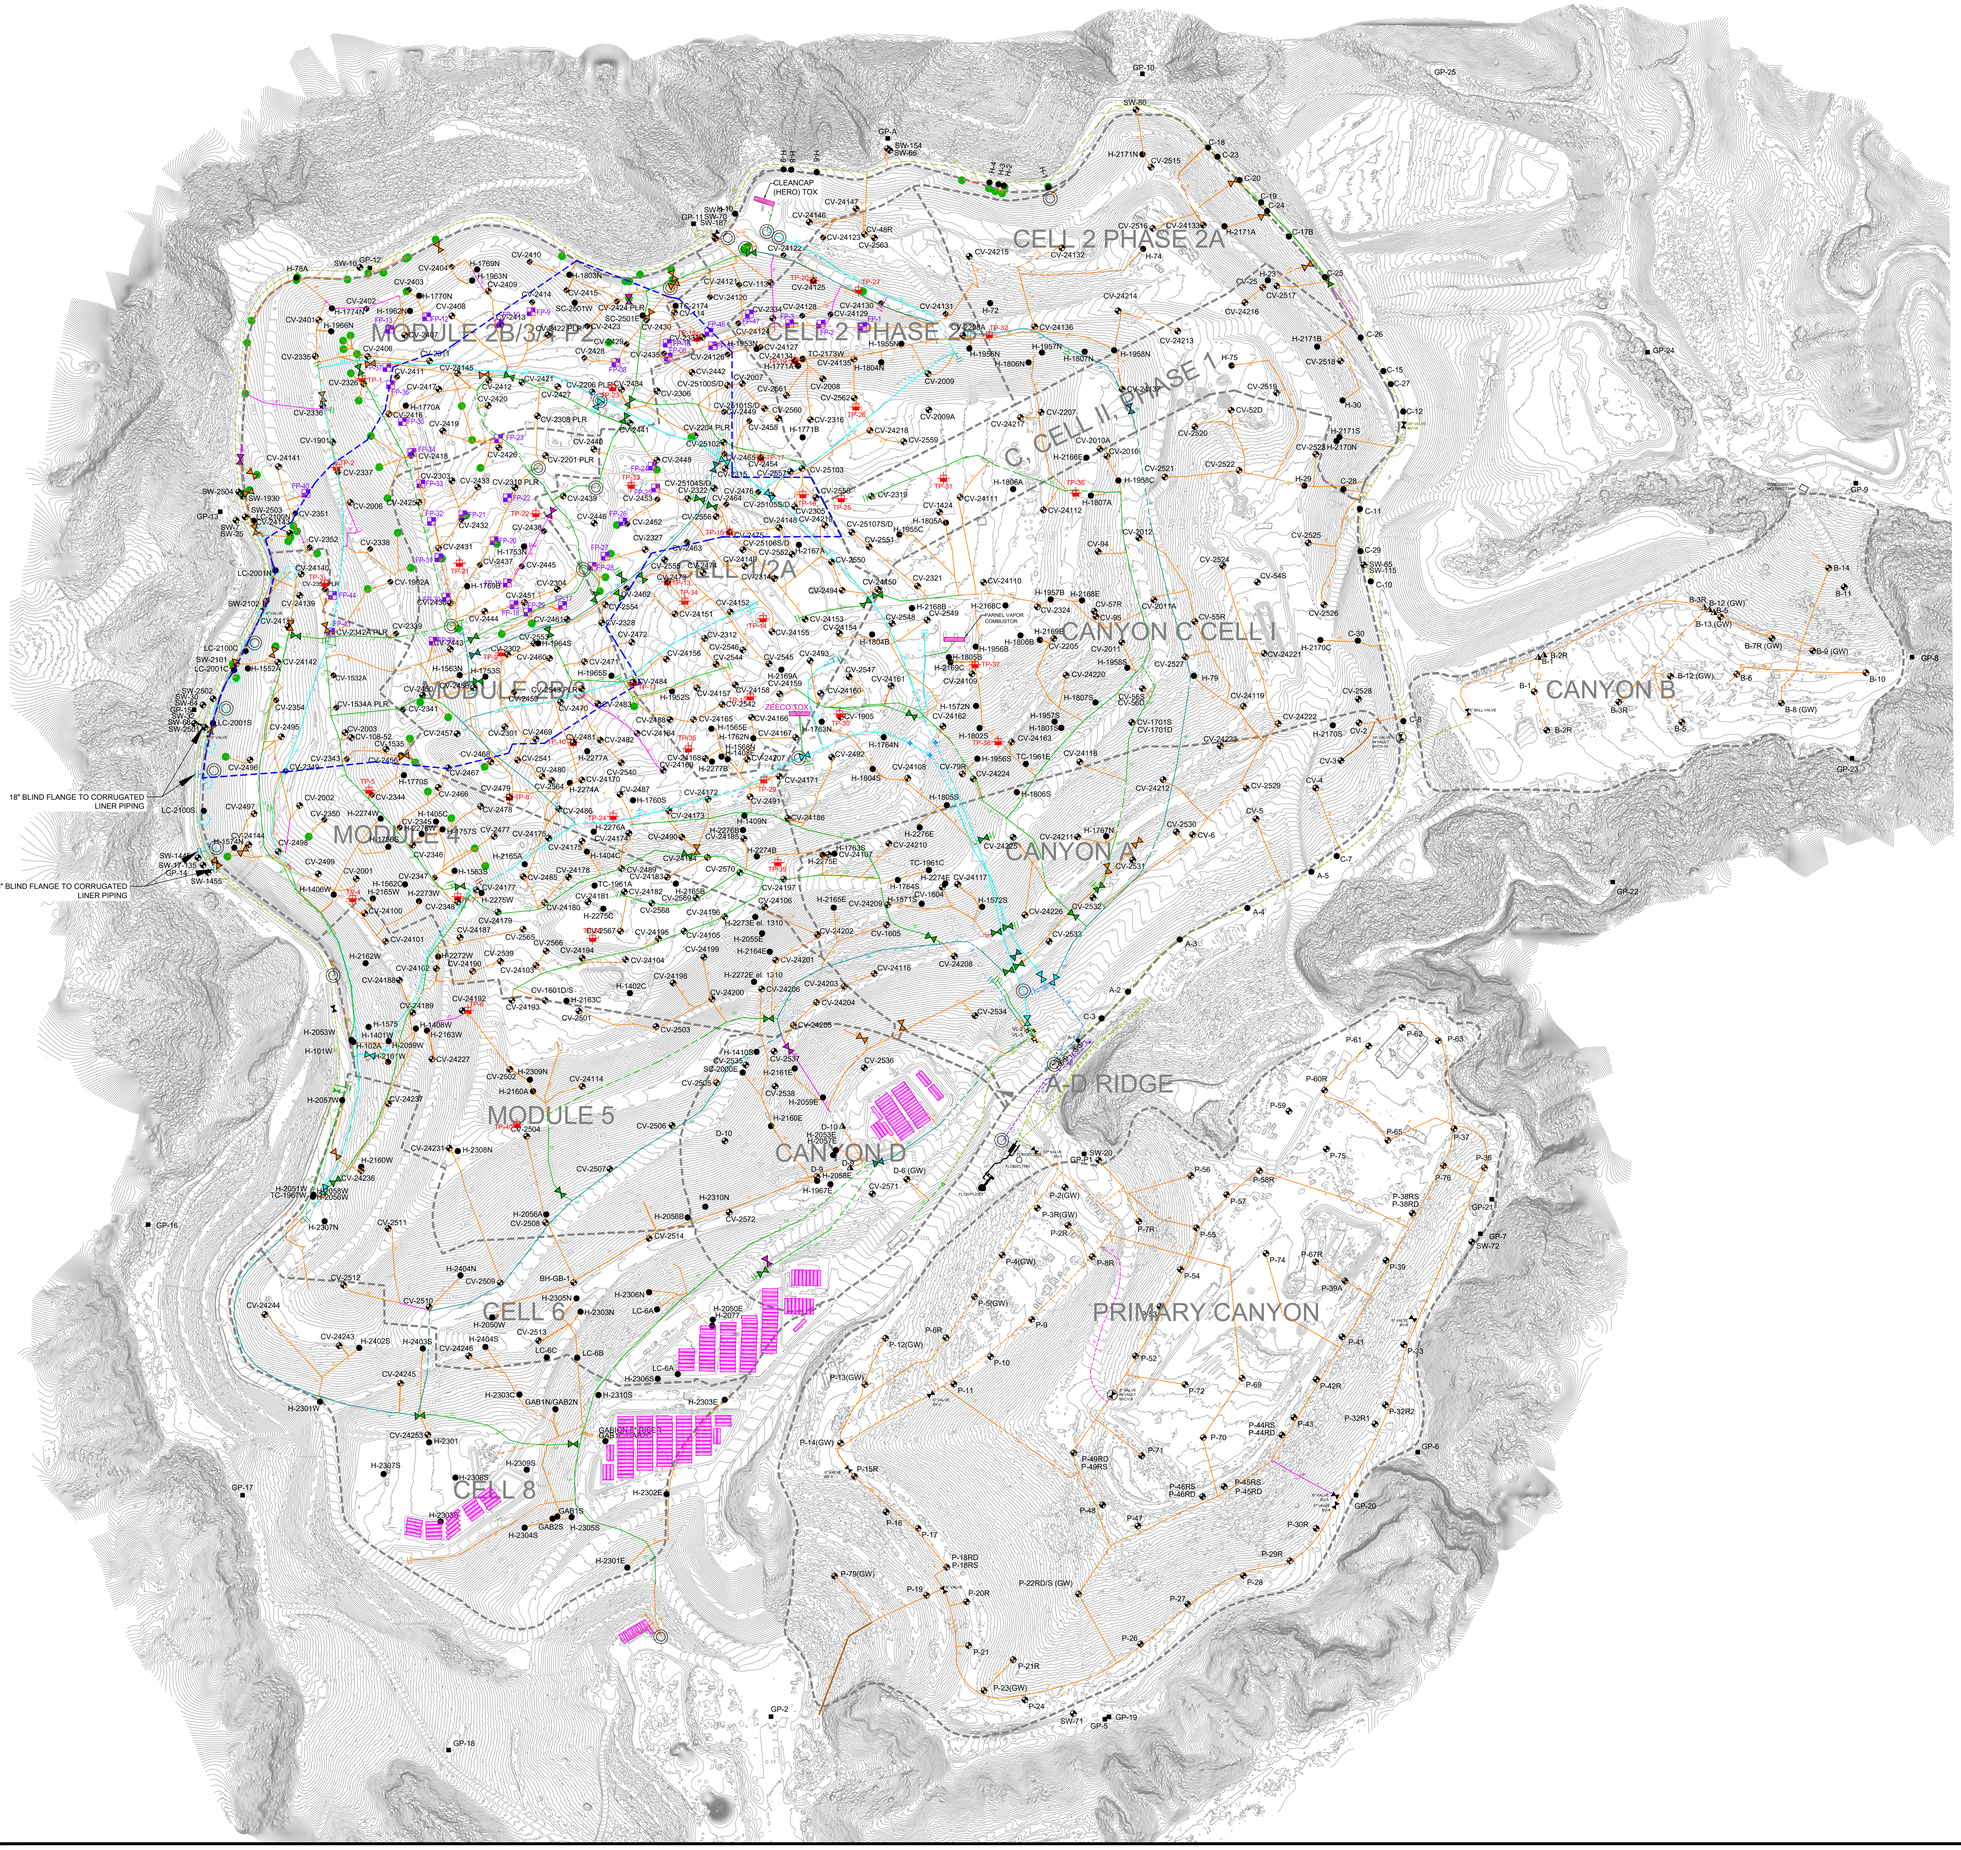

LEGEND

- 1150 — TOPOGRAPHIC CONTOUR
- EXISTING CELL LIMITS (APPROXIMATE)
- CV-XX — EXISTING LFG VERTICAL EXTRACTION WELL
- CV-XX PLR — EXISTING LFG VERTICAL EXTRACTION WELL - PRESSURIZED LEACHATE RELEASE
- BH-GB — EXISTING GABION LFG COLLECTOR WELL
- SW-XX — EXISTING SOIL VAPOR EXTRACTION WELL
- FP-XX — EXISTING SURFACE COLLECTOR WELLHEAD
- H-XX — EXISTING HORIZONTAL WELLS
- C-XX — EXISTING REMOTE VERTICAL WELLHEAD
- GP-XX — EXISTING PERIMETER MIGRATION PROBE
- TP-XX — EXISTING TEMPERATURE PROBE
- EXISTING ISOLATION VALVE
- AC — EXISTING ACTIVATED CARBON VESSEL
- EXISTING CONDENSATE SUMP
- EXISTING HDPE LINER RISER
- EXISTING CORRUGATED LINER RISER
- 36" — EXISTING 36" LFG COLLECTION HEADER PIPING
- 30" — EXISTING 30" LFG COLLECTION HEADER PIPING
- 24" — EXISTING 24" LFG COLLECTION HEADER PIPING
- 20" — EXISTING 20" LFG COLLECTION HEADER PIPING
- 18" — EXISTING 18" LFG COLLECTION HEADER PIPING
- 12" — EXISTING 12" LFG COLLECTION HEADER PIPING
- 10" — EXISTING 10" LFG COLLECTION HEADER PIPING
- 8" — EXISTING 8" LFG COLLECTION LATERAL PIPING
- 4"/6" — EXISTING 4"/6" LFG COLLECTION LATERAL PIPING
- 2" — EXISTING 2"/3" LFG COLLECTION LATERAL PIPING
- BELOW-GRADE PIPES ARE SHOWN DASHED
- REACTION AREA BOUNDARY (APPROXIMATE) - BASED ON DATA REVIEW
- EXISTING BLIND FLANGE
- EXISTING FRAC TANKS

GENERAL DRAWING NOTES:

1. EXISTING TOPOGRAPHIC SURVEY INFORMATION SHOWN WAS PROVIDED BY PROPELLOR. AERIAL PHOTOGRAPHY DATED FEBRUARY 10, 2026.
2. NORTH ARROW SHOWN HERE IS REFERENCE TO THE CALIFORNIA STATE PLANE ZONE V COORDINATE SYSTEM, NAD 83.
3. THE LOCATION OF ANY EXISTING PIPING, VALVES, TIE-IN LOCATIONS AND OTHER FEATURES ARE APPROXIMATE AND SHOULD BE USED FOR INFORMATION PURPOSES ONLY. ACTUAL FIELD CONDITIONS MAY VARY AND SUBJECT TO CHANGE BASED ON TOPOGRAPHIC FEATURES AND OTHER SITE-SPECIFIC FACTORS.
4. EXISTING GCCS AS-BUILT DATED MARCH 04, 2026.

DATE | REVISION | NO.

SHEET TITLE: EXISTING GCCS MAP

PROJECT TITLE: CHIQUITA CANYON LANDFILL CASTAIC, CALIFORNIA

CLIENT: CHIQUITA CANYON LANDFILL CASTAIC, CALIFORNIA

SCS ENGINEERS
ENVIRONMENTAL CONSULTANTS
2000 WEST CARSON STREET, SUITE 300
LONG BEACH, CA 90810
PH: (562) 426-9544

ACAD FILE: N:\CAD\ASBUILT-MASTERS
DRWN. BY: SRM
CHK. BY: -
APP. BY: -
PROJ. NO: -
QSK. BY: -

DATE: 03/04/2026

SCALE: AS SHOWN

1 of 1

N:\CAD\ASBUILT – MASTERS\CHIQUITA\GCCS\CCLF MASTER EXISTING GCCS MAP_2026-03-04.dwg Mar 04, 2026 – 7:07am By: smedina

Attachment J

Leachate Temperature Data

Chiquita Canyon Landfill
Leachate Tank Temperatures

Date: 2/24/2026

Technician: Angel Javalera

Time	Location	Temperature (F)
10:00am	LCRS Settling Frac Tank (20K Brown)	106
10:45am	Tank Farm #10	60
12:00pm	Tank Farm #13	70
12:30pm	Tank Farm #7	72

Comments

North Perimeter Receiving Tanks (Tank Farm #6) no longer in service.

East Perimeter Receiving Tanks (Tank Farm #2) no longer in service.

Canyon D Receiving Tanks no longer in service.

Attachment K

Leachate Seep Report

February 3, 2026

Via E-Mail
Baitong Chen, Air Quality Engineer, bchen@aqmd.gov
Nathaniel Dickel, Senior Air Quality Engineer, ndickel@aqmd.gov
Christina Ojeda, Air Quality Inspector, cojeda@aqmd.gov
South Coast Air Quality Management District
21865 East Copley Drive
Diamond Bar, California 91765-4182

Re: Chiquita Canyon, LLC's Weekly Leachate Inspection Report for Stipulated Order for Abatement (Case No. 6177-4), Condition 27(c)

All:

Pursuant to Condition 27(c) of the Stipulated Order for Abatement (the "SOFA") with the South Coast Air Quality Management District ("South Coast AQMD") in Case No. 6177-4, Chiquita Canyon, LLC ("Chiquita") encloses a compilation of the twice daily leachate seep inspection logs for the dates of January 26, 2026 through February 1, 2026.

Chiquita reported on January 27, 2026, that a seep in grid 185 began on January 19, 2026. As described in the January 27, 2026 report, liquid was first observed on January 19, 2026 during one of Chiquita's daily cover inspections. Chiquita initially believed the source of the liquid to be a leak, but after additional investigation, determined the source to be a seep. Chiquita repaired the failed weld in the cover; however, the repaired weld did not hold, likely as a result of moisture preventing the weld bead from properly bonding. On January 19, 2026, and again the following day January 20, 2026, Chiquita personnel pressure washed the geomembrane cover while applying vacuum to ensure the collection of all wash water and any standing liquid. Saturated soil was also removed and placed in appropriate containers for disposal. Chiquita considers this seep to be corrected.

On January 30, 2026, at approximately 2:30 a.m., a seep was observed in grid 210, as described in the enclosed logs. Between 6-10 gallons of leachate leaked from the ground beneath the cover and into the stormwater channel. The total area impacted was approximately 100 square feet. The impacted soil in the area was saturated. Odor from the seep ranged from strong odor to light odor. Chiquita personnel pressure washed the stormwater channel while applying vacuum to ensure the proper collection of all wash water and standing liquid. A berm was created around the location of the seep. A steel plate and geomembrane cover were then placed on top of the beamed area to mitigate the potential for odors. Finally, a hose was inserted to remove any standing liquid from

the bermed area in the event the seep produced any additional liquid. No liquid has been observed in the area since January 30, 2026. Notwithstanding, Chiquita personnel continue to inspect the area multiple times per day.

Please contact me if you have any questions regarding this matter.

Regards,

Sarah Phillips

Sarah Phillips
Corporate Compliance Manager
Waste Connections

Attachment: Leachate Inspection Logs from January 26 – February 1, 2026

4050 - Chiquita Leachate Seep/Pooling Inspection

26 Jan 2026 / Tom Roe

Complete

Conducted on	26 Jan 2026 6:55 AM PST
Prepared by	Tom Roe

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	Westside perimeter road.

4050 - Chiquita Leachate Seep/Pooling Inspection

26 Jan 2026 / Tom Roe

Complete

Conducted on	26 Jan 2026 2:33 PM PST
Prepared by	Tom Roe

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	North perimeter road.

4050 - Chiquita Leachate Seep/Pooling Inspection

27 Jan 2026 / Tom Roe

Complete

Conducted on	27 Jan 2026 6:56 AM PST
Prepared by	Tom Roe

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	Westside perimeter road.

4050 - Chiquita Leachate Seep/Pooling Inspection

27 Jan 2026 / Tom Roe

Complete

Conducted on	27 Jan 2026 2:02 PM PST
Prepared by	Tom Roe

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

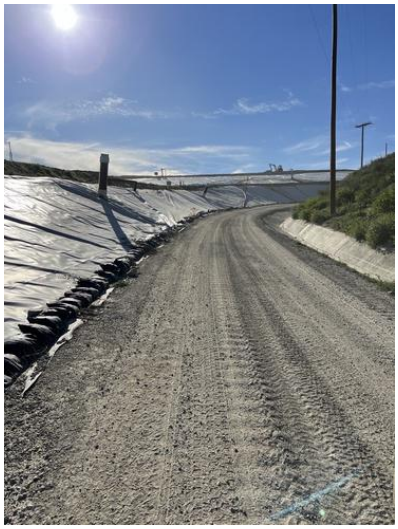

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	North perimeter road.

4050 - Chiquita Leachate Seep/Pooling Inspection

28 Jan 2026 / Tom Roe

Complete

Conducted on	28 Jan 2026 6:55 AM PST
Prepared by	Tom Roe

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	Westside perimeter road.

4050 - Chiquita Leachate Seep/Pooling Inspection

28 Jan 2026 / Tom Roe

Complete

Conducted on	28 Jan 2026 1:43 PM PST
Prepared by	Tom Roe

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	North perimeter road.

4050 - Chiquita Leachate Seep/Pooling Inspection

29 Jan 2026 / John Boucher

Complete

Conducted on	29 Jan 2026 7:19 AM PST
Prepared by	John Boucher

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	West side perimeter road

4050 - Chiquita Leachate Seep/Pooling Inspection

29 Jan 2026 / John Boucher

Complete

Conducted on	29 Jan 2026 2:45 PM PST
Prepared by	John Boucher

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	North side perimeter road

4050 - Chiquita Leachate Seep/Pooling Inspection

30 Jan 2026 / Tom Roe

Complete

Conducted on	30 Jan 2026 2:30 AM PST
Prepared by	Tom Roe

Leachate Seep Inspection	
Leachate seep/pooling Inspection	
Leachate seep/pooling Inspection 1	
Has a leachate seep/pooling been located?	Yes
Which grid is the leachate seep/pooling located?	210

Indicate on the map the location

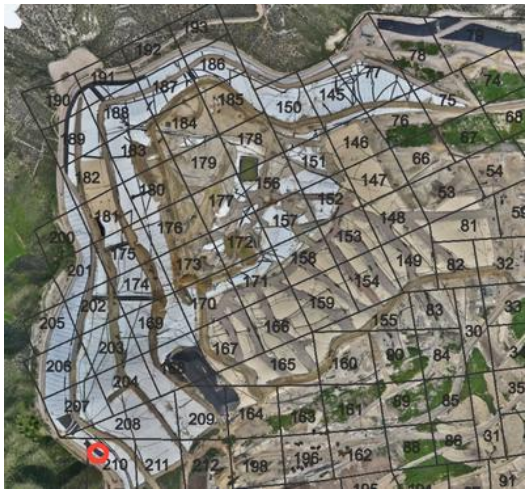

Drop Pin to record lat/long of seep/pooling location.	
Time seep/pooling was discovered	30 Jan 2026 2:30 AM PST
Estimated duration of presence of leachate at such location	3 1/2 hours
Estimated quantity of leachate	6-10 gallons
Extent of area impacted (approximate sq ft impacted)	100 sq ft
Odor type	Leachate
Odor intensity	4 - Strong Odor
Surrounding soil saturation level	Standing free liquid
Image of seep/pooling	
Did the seep/pooling travel into the stormwater channel?	Yes
Did the seep/pooling travel to the stormwater basin?	No
Actions taken to contain seep/pooling?	Containment measures described below.

4050 - Chiquita Leachate Seep/Pooling Inspection

30 Jan 2026 / John Boucher

Complete

Conducted on	30 Jan 2026 7:09 AM PST
Prepared by	John Boucher

Leachate Seep Inspection	
Leachate seep/pooling Inspection	
Leachate seep/pooling Inspection 1	
Has a leachate seep/pooling been located?	Yes
Which grid is the leachate seep/pooling located?	210

Indicate on the map the location

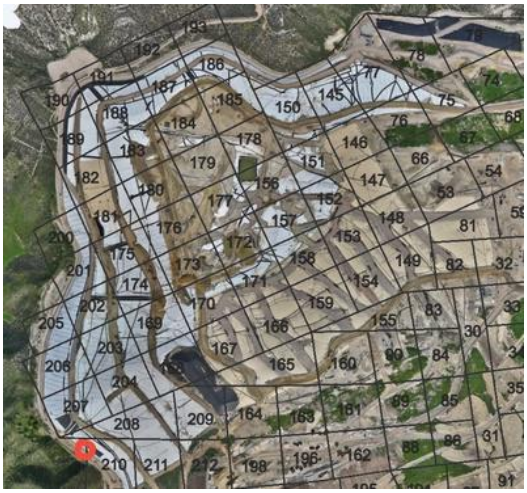

Drop Pin to record lat/long of seep/pooling location.	(34.43214061516819, -118.65141679755638)
Time seep/pooling was discovered	30 Jan 2026 7:09 AM PST
Estimated duration of presence of leachate at such location	4.5 hours
Estimated quantity of leachate	6-10 gallons
Extent of area impacted (approximate sq ft impacted)	100sq ft
Odor type	Leachate
Odor intensity	4 - Strong Odor
Surrounding soil saturation level	Standing free liquid

Image of seep/pooling

Photo 1

Photo 2

Did the seep/pooling travel into the stormwater channel? Yes

Photo 3

Did the seep/pooling travel to the stormwater basin? No

Actions taken to contain seep/pooling?

Leachate vacuumed out, storm water channel pressure washed and vacuumed, shallow hole dug and sandbag berm created around seep location to contain seep. work is ongoing to contain seep.

Photo 4

4050 - Chiquita Leachate Seep/Pooling Inspection

30 Jan 2026 / John Boucher

Complete

Conducted on	30 Jan 2026 2:37 PM PST
Prepared by	John Boucher

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Photo 2

Description of area in photo where there is no leachate seepage or pooling.	Seep from previous inspection was not observed. Berm was created around morning seep location. Steel plate and liner placed on top to prevent atmospheric exposure. Hose inserted to remove any standing liquid should any present itself.

4050 - Chiquita Leachate Seep/Pooling Inspection

31 Jan 2026 / John Boucher

Complete

Conducted on	31 Jan 2026 7:58 AM PST
Prepared by	John Boucher

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Seep from previous inspection has maintained containment and no actively seeping location has been observed.

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	West side perimeter road

4050 - Chiquita Leachate Seep/Pooling Inspection

31 Jan 2026 / John Boucher

Complete

Conducted on	31 Jan 2026 1:10 PM PST
Prepared by	John Boucher

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

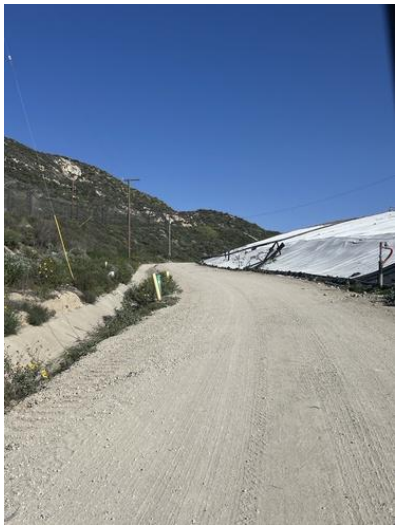

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	North side perimeter road

4050 - Chiquita Leachate Seep/Pooling Inspection

1 Feb 2026 / Tom Roe

Complete

Conducted on	1 Feb 2026 7:16 AM PST
Prepared by	Tom Roe

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	Westside perimeter road.

4050 - Chiquita Leachate Seep/Pooling Inspection

1 Feb 2026 / Tom Roe

Complete

Conducted on	1 Feb 2026 1:08 PM PST
Prepared by	Tom Roe

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	North perimeter road.

CHIQUITA CANYON
A Waste Connections Company

February 10, 2026

Via E-Mail
Baitong Chen, Air Quality Engineer, bchen@aqmd.gov
Nathaniel Dickel, Senior Air Quality Engineer, ndickel@aqmd.gov
Christina Ojeda, Air Quality Inspector, cojeda@aqmd.gov
South Coast Air Quality Management District
21865 East Copley Drive
Diamond Bar, California 91765-4182

Re: Chiquita Canyon, LLC's Weekly Leachate Inspection Report for Stipulated Order for Abatement (Case No. 6177-4), Condition 27(c)

All:

Pursuant to Condition 27(c) of the Stipulated Order for Abatement with the South Coast Air Quality Management District in Case No. 6177-4 (the "Order"), Chiquita Canyon, LLC ("Chiquita") encloses a compilation of the twice daily leachate seep inspection logs for the dates of February 2, 2026 through February 8, 2026. No leachate seepage or pooling was observed at the Chiquita Canyon Landfill during these inspections. There is no additional information to provide under Condition 27(c).

Chiquita reported on February 3, 2026, that a seep in grid 210 began on January 30, 2026, and that corrective actions were implemented that day. No liquid has been observed in that area since that day. Chiquita considers this seep to be corrected; however, Chiquita continues to inspect the area multiple times per day. Please contact me if you have any questions regarding this matter.

Regards,

Sarah Phillips

Sarah Phillips
Corporate Compliance Manager
Waste Connections

Attachment: Leachate Inspection Logs from February 2, 2026 – February 8, 2026

4050 - Chiquita Leachate Seep/Pooling Inspection

2 Feb 2026 / Tom Roe

Complete

Conducted on	2 Feb 2026 7:12 AM PST
Prepared by	Tom Roe

Leachate Seep Inspection	
Leachate seep/pooling Inspection	
Leachate seep/pooling Inspection 1	
Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	Westside perimeter road.

4050 - Chiquita Leachate Seep/Pooling Inspection

2 Feb 2026 / Tom Roe

Complete

Conducted on	2 Feb 2026 2:05 PM PST
Prepared by	Tom Roe

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	North perimeter road.

4050 - Chiquita Leachate Seep/Pooling Inspection

3 Feb 2026 / Tom Roe

Complete

Conducted on	3 Feb 2026 7:01 AM PST
Prepared by	Tom Roe

Leachate Seep Inspection	
Leachate seep/pooling Inspection	
Leachate seep/pooling Inspection 1	
Has a leachate seep/pooling been located?	No

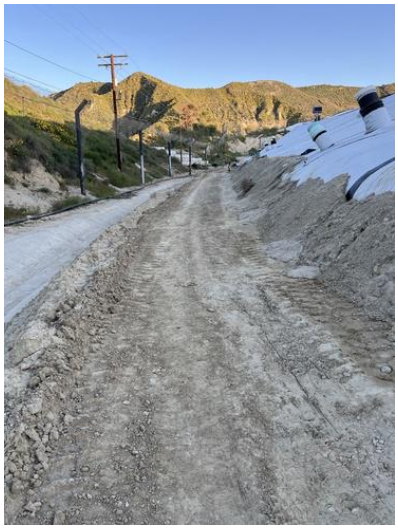

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	Westside perimeter road.

4050 - Chiquita Leachate Seep/Pooling Inspection

3 Feb 2026 / Tom Roe

Complete

Conducted on	3 Feb 2026 1:51 PM PST
Prepared by	Tom Roe

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	North perimeter road.

4050 - Chiquita Leachate Seep/Pooling Inspection

4 Feb 2026 / Tom Roe

Complete

Conducted on	4 Feb 2026 7:21 AM PST
Prepared by	Tom Roe

Leachate Seep Inspection	
Leachate seep/pooling Inspection	
Leachate seep/pooling Inspection 1	
Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	Westside perimeter road.

4050 - Chiquita Leachate Seep/Pooling Inspection

4 Feb 2026 / Tom Roe

Complete

Conducted on	4 Feb 2026 2:45 PM PST
Prepared by	Tom Roe

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

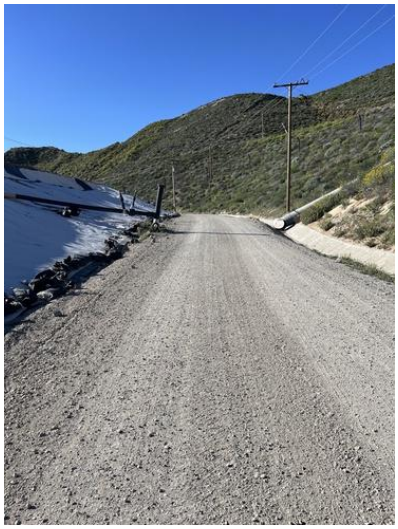

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	North perimeter road.

4050 - Chiquita Leachate Seep/Pooling Inspection

5 Feb 2026 / John Boucher

Complete

Conducted on	5 Feb 2026 6:56 AM PST
Prepared by	John Boucher

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	West side perimeter road

4050 - Chiquita Leachate Seep/Pooling Inspection

5 Feb 2026 / John Boucher

Complete

Conducted on	5 Feb 2026 2:01 PM PST
Prepared by	John Boucher

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	North side perimeter road

4050 - Chiquita Leachate Seep/Pooling Inspection

6 Feb 2026 / John Boucher

Complete

Conducted on	6 Feb 2026 7:08 AM PST
Prepared by	John Boucher

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	West side perimeter road

4050 - Chiquita Leachate Seep/Pooling Inspection

6 Feb 2026 / John Boucher

Complete

Conducted on	6 Feb 2026 2:26 PM PST
Prepared by	John Boucher

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	North side perimeter road

4050 - Chiquita Leachate Seep/Pooling Inspection

7 Feb 2026 / John Boucher

Complete

Conducted on	7 Feb 2026 7:32 AM PST
Prepared by	John Boucher

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

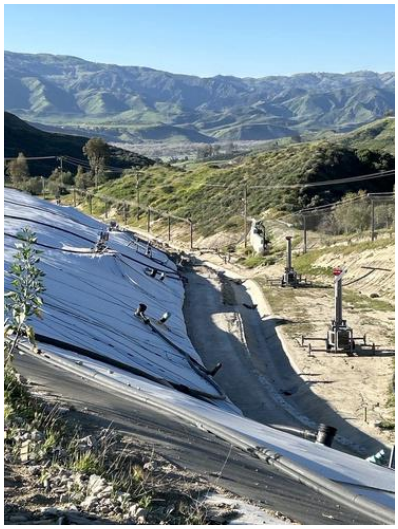

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	West side perimeter road

4050 - Chiquita Leachate Seep/Pooling Inspection

7 Feb 2026 / John Boucher

Complete

Conducted on	7 Feb 2026 1:00 PM PST
Prepared by	John Boucher

Leachate Seep Inspection	
Leachate seep/pooling Inspection	
Leachate seep/pooling Inspection 1	
Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	North side perimeter road

4050 - Chiquita Leachate Seep/Pooling Inspection

8 Feb 2026 / Tom Roe

Complete

Conducted on	8 Feb 2026 6:38 AM PST
Prepared by	Tom Roe

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	Westside perimeter road.

4050 - Chiquita Leachate Seep/Pooling Inspection

8 Feb 2026 / Tom Roe

Complete

Conducted on	8 Feb 2026 1:01 PM PST
Prepared by	Tom Roe

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	North perimeter road.

February 17, 2026

Via E-Mail
Baitong Chen, Air Quality Engineer, bchen@aqmd.gov
Nathaniel Dickel, Senior Air Quality Engineer, ndickel@aqmd.gov
Christina Ojeda, Air Quality Inspector, cojeda@aqmd.gov
South Coast Air Quality Management District
21865 East Copley Drive
Diamond Bar, California 91765-4182

Re: Chiquita Canyon, LLC's Weekly Leachate Inspection Report for Stipulated Order for Abatement (Case No. 6177-4), Condition 27(c)

All:

Pursuant to Condition 27(c) of the Stipulated Order for Abatement with the South Coast Air Quality Management District in Case No. 6177-4 (the "Order"), Chiquita Canyon, LLC ("Chiquita") encloses a compilation of the twice daily leachate seep inspection logs for the dates of February 9, 2026 through February 15, 2026.

During this week, there was a multi-day seep observed at the Landfill. On February 12, 2026, a seep was observed at the toe of the western slope in an area just west of grid 210 and south of grid 208. During this time, there was standing free liquid and a moderate odor of leachate detected.

At the time of discovery, the seep had reached the stormwater channel and a small amount had reached Stage 1 of the South Sedimentation Basin. Upon discovery of the seep, Chiquita immediately blocked the inlet to Stage 1 of the South Sedimentation Basin and placed soil check dams within the stormwater channel to stop the seep from traveling to the basin. A small visible sheen of dark liquid, approximately 10 feet by 15 feet in area, was observed in Stage 1 of the South Sedimentation Basin. Chiquita promptly deployed a vacuum truck to the basin and removed the leachate along with additional stormwater present within the vicinity of the inlet. Chiquita estimates that approximately 20-40 gallons of leachate entered Stage 1 of the basin. In total, approximately 3,360 gallons of liquid were removed from the basin, consisting primarily of stormwater in addition to the estimated volume of leachate. Chiquita believes that it successfully removed all leachate from the South Sedimentation Basin, which was confirmed with sampling results. As part of its cleanup efforts, Chiquita also pressure-washed the stormwater channel and culvert leading to the South Sedimentation Basin and removed the wash water by vacuum truck.

To contain the seep, Chiquita dug a containment area at the source of the seep at the western toe to collect the liquid. This containment area is approximately 40 feet in length and has an estimated capacity of approximately 300 gallons. The containment area is also covered by a steel plate, and a layer of 60-mil geomembrane cover to prevent potential emissions in the event liquids reappear. Since February 13, 2026, no active flow has been observed, and no liquid has accumulated in the containment

area. Chiquita is monitoring the containment area and is prepared to remove liquids using a vacuum truck in the event they reappear during the ongoing rain event. Further, rock has been added to the access road to ensure reliable access during wet conditions. In total, the cleanup of this seep, including the installation of the containment area, took approximately 24 hours.

A log for this seep was not initially prepared. The seep was detected outside of the normal twice-daily seep inspections conducted pursuant to Condition 27(b). During the routine inspection, upon reaching the location of the seep, the inspector observed the response team taking corrective measures to address the seep. The inspector erroneously believed the response team was documenting and reporting the incident and thus did not include the seep in the daily logs. This inspector will be retrained on inspection procedure. Chiquita anticipates that this training will be completed on or before February 20, 2026.

Please contact me if you have any questions regarding this matter.

Regards,

Sarah Phillips

Sarah Phillips
Corporate Compliance Manager
Waste Connections

Attachment: Leachate Inspection Logs from February 9, 2026 – February 15, 2026

4050 - Chiquita Leachate Seep/Pooling Inspection

9 Feb 2026 / Tom Roe

Complete

Conducted on	9 Feb 2026 7:07 AM PST
Prepared by	Tom Roe

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	Westside perimeter road.

4050 - Chiquita Leachate Seep/Pooling Inspection

9 Feb 2026 / Tom Roe

Complete

Conducted on	9 Feb 2026 2:00 PM PST
Prepared by	Tom Roe

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	North perimeter road.

4050 - Chiquita Leachate Seep/Pooling Inspection

10 Feb 2026 / Tom Roe

Complete

Conducted on	10 Feb 2026 6:59 AM PST
Prepared by	Tom Roe

Leachate Seep Inspection	
Leachate seep/pooling Inspection	
Leachate seep/pooling Inspection 1	
Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	Westside perimeter road.

4050 - Chiquita Leachate Seep/Pooling Inspection

10 Feb 2026 / Nancy Bahena Hernandez

Complete

Conducted on	10 Feb 2026 3:09 PM PST
Prepared by	Nancy Bahena Hernandez

Leachate Seep Inspection	
Leachate seep/pooling Inspection	
Leachate seep/pooling Inspection 1	
Has a leachate seep/pooling been located?	No

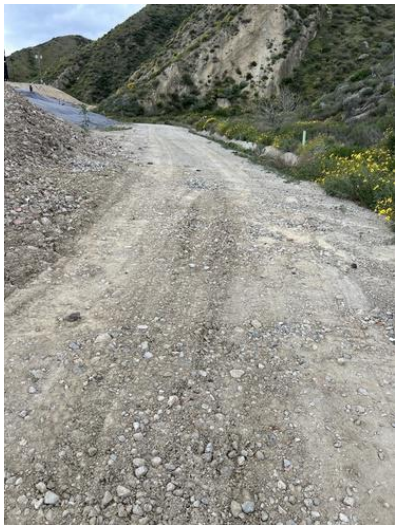

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	North side perimeter road

4050 - Chiquita Leachate Seep/Pooling Inspection

11 Feb 2026 / John Boucher

Complete

Conducted on	11 Feb 2026 7:19 AM PST
Prepared by	John Boucher

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	West side perimeter road

4050 - Chiquita Leachate Seep/Pooling Inspection

11 Feb 2026 / John Boucher

Complete

Conducted on	11 Feb 2026 2:36 PM PST
Prepared by	John Boucher

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	North side perimeter road

4050 - Chiquita Leachate Seep/Pooling Inspection

12 Feb 2026 / Nancy Bahena Hernandez

Complete

Conducted on	12 Feb 2026 7:34 AM PST
Prepared by	Nancy Bahena Hernandez

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	Northside perimeter road

4050 - Chiquita Leachate Seep/Pooling Inspection

12 Feb 2026 / Nancy Bahena Hernandez

Complete

Conducted on	12 Feb 2026 3:34 PM PST
Prepared by	Nancy Bahena Hernandez

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	West side perimeter road

4050 - Chiquita Leachate Seep/Pooling Inspection

13 Feb 2026 / John Boucher

Complete

Conducted on	13 Feb 2026 7:00 AM PST
Prepared by	John Boucher

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	West side perimeter road

4050 - Chiquita Leachate Seep/Pooling Inspection

13 Feb 2026 / John Boucher

Complete

Conducted on	13 Feb 2026 1:28 PM PST
Prepared by	John Boucher

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	North side perimeter road

4050 - Chiquita Leachate Seep/Pooling Inspection

14 Feb 2026 / John Boucher

Complete

Conducted on	14 Feb 2026 7:19 AM PST
Prepared by	John Boucher

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

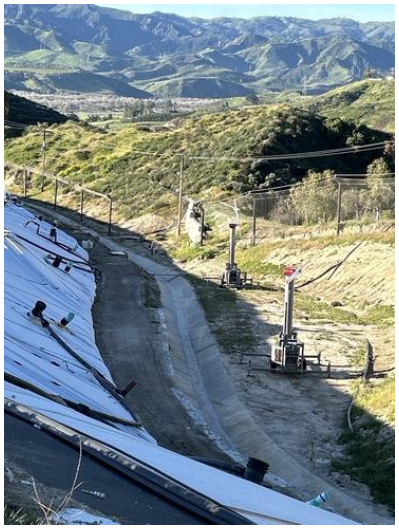

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	West side perimeter road

4050 - Chiquita Leachate Seep/Pooling Inspection

14 Feb 2026 / John Boucher

Complete

Conducted on	14 Feb 2026 1:01 PM PST
Prepared by	John Boucher

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	North side perimeter road

4050 - Chiquita Leachate Seep/Pooling Inspection

15 Feb 2026 / Tom Roe

Complete

Conducted on	15 Feb 2026 6:58 AM PST
Prepared by	Tom Roe

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	Westside perimeter road.

4050 - Chiquita Leachate Seep/Pooling Inspection

15 Feb 2026 / Tom Roe

Complete

Conducted on	15 Feb 2026 1:01 PM PST
Prepared by	Tom Roe

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	North perimeter road.

February 24, 2026

Via E-Mail
Baitong Chen, Air Quality Engineer, bchen@aqmd.gov
Nathaniel Dickel, Senior Air Quality Engineer, ndickel@aqmd.gov
Christina Ojeda, Air Quality Inspector, cojeda@aqmd.gov
South Coast Air Quality Management District
21865 East Copley Drive
Diamond Bar, California 91765-4182

Re: Chiquita Canyon, LLC's Weekly Leachate Inspection Report for Stipulated Order for Abatement (Case No. 6177-4), Condition 27(c)

All:

Pursuant to Condition 27(c) of the Stipulated Order for Abatement with the South Coast Air Quality Management District in Case No. 6177-4 (the "Order"), Chiquita Canyon, LLC ("Chiquita") encloses a compilation of the twice daily leachate seep inspection logs for the dates of February 16, 2026 through February 22, 2026. No leachate seepage or pooling was observed in the inspection areas at the Chiquita Canyon Landfill, as set forth in Condition 27(b) of the Order. There is no additional information to provide under Condition 27(c).

Regards,

Matt Breuer
Environmental Manager
Waste Connections

Attachment: Leachate Inspection Logs from February 16, 2026 – February 22, 2026

4050 - Chiquita Leachate Seep/Pooling Inspection

16 Feb 2026 / Tom Roe

Complete

Conducted on	16 Feb 2026 6:50 AM PST
Prepared by	Tom Roe

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	Westside perimeter road.

4050 - Chiquita Leachate Seep/Pooling Inspection

16 Feb 2026 / Tom Roe

Complete

Conducted on	16 Feb 2026 1:26 PM PST
Prepared by	Tom Roe

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	North perimeter road.

4050 - Chiquita Leachate Seep/Pooling Inspection

17 Feb 2026 / Tom Roe

Complete

Conducted on	17 Feb 2026 7:02 AM PST
Prepared by	Tom Roe

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	Westside perimeter road.

4050 - Chiquita Leachate Seep/Pooling Inspection

17 Feb 2026 / Tom Roe

Complete

Conducted on	17 Feb 2026 1:37 PM PST
Prepared by	Tom Roe

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	North perimeter road.

4050 - Chiquita Leachate Seep/Pooling Inspection

18 Feb 2026 / Tom Roe

Complete

Conducted on	18 Feb 2026 7:31 AM PST
Prepared by	Tom Roe

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	Westside perimeter road.

4050 - Chiquita Leachate Seep/Pooling Inspection

18 Feb 2026 / John Boucher

Complete

Conducted on	18 Feb 2026 2:39 PM PST
Prepared by	John Boucher

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	West side perimeter road

4050 - Chiquita Leachate Seep/Pooling Inspection

19 Feb 2026 / John Boucher

Complete

Conducted on	19 Feb 2026 7:04 AM PST
Prepared by	John Boucher

Leachate Seep Inspection	
Leachate seep/pooling Inspection	
Leachate seep/pooling Inspection 1	
Has a leachate seep/pooling been located?	No
No picture is available	
Description of area in photo where there is no leachate seepage or pooling.	No seep or pooling observed.

4050 - Chiquita Leachate Seep/Pooling Inspection

19 Feb 2026 / John Boucher

Complete

Conducted on	19 Feb 2026 1:51 PM PST
Prepared by	John Boucher

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

The seep from the morning inspection was not observed at this time

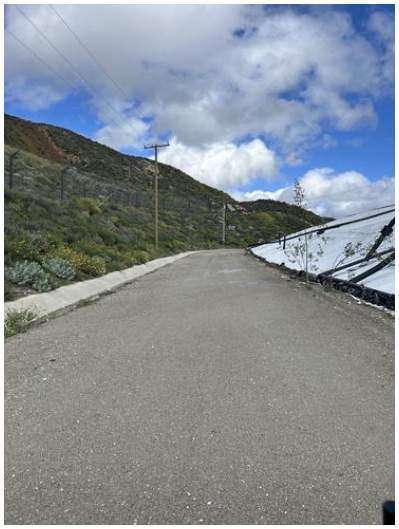

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	North side perimeter road

4050 - Chiquita Leachate Seep/Pooling Inspection

20 Feb 2026 / John Boucher

Complete

Conducted on	20 Feb 2026 7:04 AM PST
Prepared by	John Boucher

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	West side perimeter road

4050 - Chiquita Leachate Seep/Pooling Inspection

20 Feb 2026 / John Boucher

Complete

Conducted on	20 Feb 2026 1:47 PM PST
Prepared by	John Boucher

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	North side perimeter road

4050 - Chiquita Leachate Seep/Pooling Inspection

21 Feb 2026 / John Boucher

Complete

Conducted on	21 Feb 2026 7:56 AM PST
Prepared by	John Boucher

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	West side perimeter road

4050 - Chiquita Leachate Seep/Pooling Inspection

21 Feb 2026 / John Boucher

Complete

Conducted on	21 Feb 2026 1:01 PM PST
Prepared by	John Boucher

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	North side perimeter road

4050 - Chiquita Leachate Seep/Pooling Inspection

22 Feb 2026 / Tom Roe

Complete

Conducted on	22 Feb 2026 6:43 AM PST
Prepared by	Tom Roe

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	Westside perimeter road.

4050 - Chiquita Leachate Seep/Pooling Inspection

22 Feb 2026 / Tom Roe

Complete

Conducted on	22 Feb 2026 1:12 PM PST
Prepared by	Tom Roe

Leachate Seep Inspection	
Leachate seep/pooling Inspection	
Leachate seep/pooling Inspection 1	
Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	North perimeter road.

March 3, 2026

Via E-Mail
Baitong Chen, Air Quality Engineer, bchen@aqmd.gov
Nathaniel Dickel, Senior Air Quality Engineer, ndickel@aqmd.gov
Christina Ojeda, Air Quality Inspector, cojeda@aqmd.gov
South Coast Air Quality Management District
21865 East Copley Drive
Diamond Bar, California 91765-4182

Re: Chiquita Canyon, LLC's Weekly Leachate Inspection Report for Stipulated Order for Abatement (Case No. 6177-4), Condition 27(c)

All:

Pursuant to Condition 27(c) of the Stipulated Order for Abatement with the South Coast Air Quality Management District in Case No. 6177-4 (the "Order"), Chiquita Canyon, LLC ("Chiquita") encloses a compilation of the twice daily leachate seep inspection logs for the dates of February 23, 2026 through March 1, 2026.

During this week, there was a multi-day seep observed at the Landfill. On February 23, 2026, a seep was observed at the toe of the western slope in an area just west of grid 210 and south of grid 208. The seep occurred between February 23 and February 25. The exact location of the seep is set forth in the maps included in the attachment.

The total approximate amount of leachate collected from this seep was 3,855 gallons as of March 2, 2026. The extent of the area impacted varied – on the day the seep reached the stormwater channel, impacted area was approximately 20 square feet at location of seep, with approximately 3,000 feet of additional impacted area as a result of the seep traveling to the stormwater channel and the associated cleanup efforts; impacted area for the remaining days was approximately 20 square feet. The saturation of the soil ranged from "Standing Free Liquid" to "Saturated" and "Semi-dry." The odor fluctuated between "Strong Odor," "Moderate Odor," "Light Odor," and "Very Light Odor."

At the time of discovery, the seep had reached the stormwater channel and a small amount had reached Stage 1 of the South Sedimentation Basin. Chiquita estimates that approximately 5 gallons of leachate travelled through the stormwater channel and entered Stage 1 of the basin. Upon discovery of the seep, Chiquita immediately placed a total of six soil check dams within the stormwater channel to prevent additional liquids from the seep from entering the basin. Chiquita promptly deployed a vacuum truck to the basin and removed the approximately 5 gallons of leachate along with additional stormwater present within the vicinity of the inlet. In total, approximately 1,500 gallons of liquid were removed from the basin, consisting primarily of stormwater in addition to the estimated 5 gallons of leachate. As part of its cleanup efforts, Chiquita also pressure-washed the stormwater channel and culvert leading to the South Sedimentation Basin and removed the wash water by vacuum truck.

To contain the seep, Chiquita constructed a berm at the source of the seep. Chiquita also constructed a containment area that is currently covered by a steel plate and geomembrane cover to prevent potential emissions in the event liquids reappear. Chiquita is monitoring the containment area and is continuing to remove liquids using a vacuum truck as they reappear. In total, the cleanup of this seep, including the installation of the cover over the containment area, took approximately 80 hours.

Additionally, out of an abundance of caution and in an effort to be transparent, Chiquita also provides notice that a seep with approximately 0.5 gallons of leachate was observed on February 28, 2026 at approximately 10:23 a.m. in Grid 95, which is outside the Reaction Area as defined in Condition 9(a) of the Order and therefore outside the area required to be inspected under Condition 27. The liquid entered the stormwater channel but did not reach either stormwater basin. Chiquita constructed a check dam in the stormwater channel, removed impacted soil and placed it into a container for proper disposal, and performed additional cleanup. Chiquita promptly notified the Los Angeles Regional Water Quality Control Board ("Water Board") about the seep and will provide additional information about the seep and cleanup efforts in the 7-day report to the Water Board.

Please contact me if you have any questions regarding this matter.

Regards,

Sarah Phillips

Sarah Phillips
Corporate Compliance Manager

Attachment: Leachate Inspection Logs from February 23, 2026 – March 1, 2026

4050 - Chiquita Leachate Seep/Pooling Inspection

23 Feb 2026 / Tom Roe

Complete

Conducted on	23 Feb 2026 9:00 AM PST
Prepared by	Tom Roe

Leachate Seep Inspection	
Leachate seep/pooling Inspection	
Leachate seep/pooling Inspection 1	
Has a leachate seep/pooling been located?	Yes
Which grid is the leachate seep/pooling located?	Adjacent to 210

Indicate on the map the location

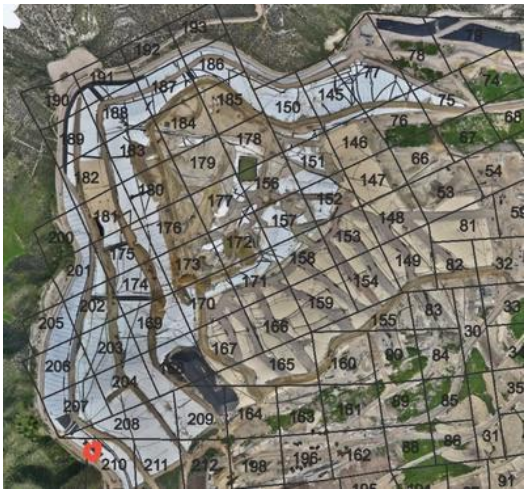

Drop Pin to record lat/long of seep/pooling location.	(34.43170688212353, -118.65096071220283)
Time seep/pooling was discovered	23 Feb 2026 3:15 AM PST
Estimated duration of presence of leachate at such location	6 hours
Estimated quantity of leachate	>150 gallons
Extent of area impacted (approximate sq ft impacted)	20 sq ft at location of seep and approximately 3,000 ft of stormwater channel.
Odor type	Leachate
Odor intensity	4 - Strong Odor
Surrounding soil saturation level	Standing free liquid

Image of seep/pooling

Photo 1

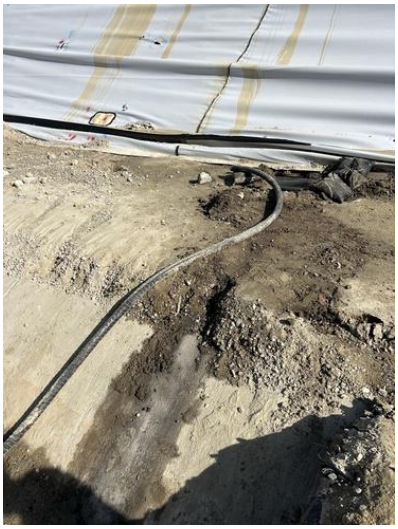

Photo 2

Did the seep/pooling travel into the stormwater channel? Yes

Photo 3

Photo 4

Did the seep/pooling travel to the stormwater basin? Yes

Actions taken to contain seep/pooling?

Berm placed around seep. Leachate being vacuumed out throughout day to minimize pooling. Stormwater channel pressure washed and liquid vacuumed out. Check dams put in place in stormwater channel.

4050 - Chiquita Leachate Seep/Pooling Inspection

23 Feb 2026 / Tom Roe

Complete

Conducted on	23 Feb 2026 1:38 PM PST
Prepared by	Tom Roe

Leachate Seep Inspection	
Leachate seep/pooling Inspection	
Leachate seep/pooling Inspection 1	
Has a leachate seep/pooling been located?	Yes
Which grid is the leachate seep/pooling located?	Adjacent to 210

Indicate on the map the location

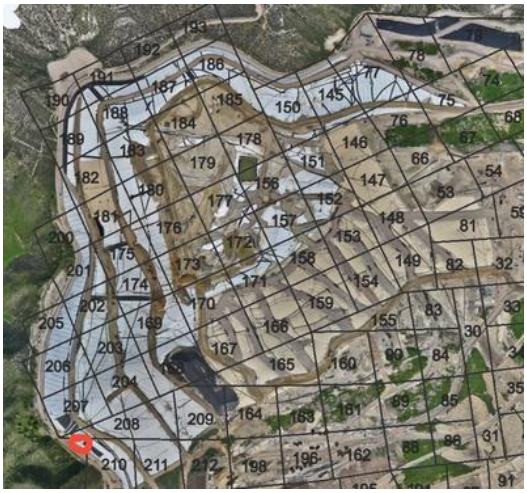

Drop Pin to record lat/long of seep/pooling location.	(34.43209505578834, -118.65137177761433)
Time seep/pooling was discovered	23 Feb 2026 2:00 PM PST
Estimated duration of presence of leachate at such location	11 hours
Estimated quantity of leachate	>150 gallons
Extent of area impacted (approximate sq ft impacted)	20 sq ft
Odor type	Leachate
Odor intensity	3 - Moderate Odor
Surrounding soil saturation level	Standing free liquid

Image of seep/pooling

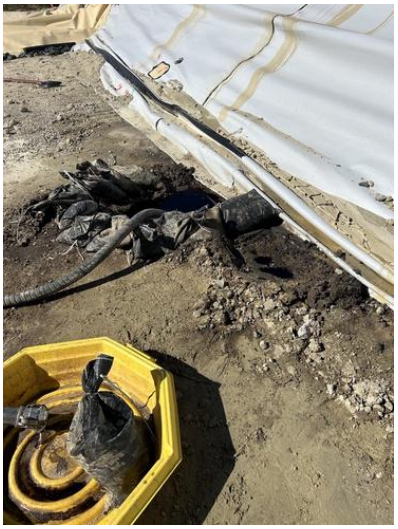

Photo 1

Did the seep/pooling travel into the stormwater channel?	No

Actions taken to contain seep/pooling?

Berm placed around seep. Leachate being vacuumed out throughout day to minimize pooling. Stormwater channel pressure washed and liquid vacuumed out. Check dams put in place in stormwater channel. No additional liquid reached the stormwater channel following the morning inspection.

4050 - Chiquita Leachate Seep/Pooling Inspection

24 Feb 2026 / Tom Roe

Complete

Conducted on	24 Feb 2026 9:23 AM PST
Prepared by	Tom Roe

Leachate Seep Inspection	
Leachate seep/pooling Inspection	
Leachate seep/pooling Inspection 1	
Has a leachate seep/pooling been located?	Yes
Which grid is the leachate seep/pooling located?	Adjacent to 210

Indicate on the map the location

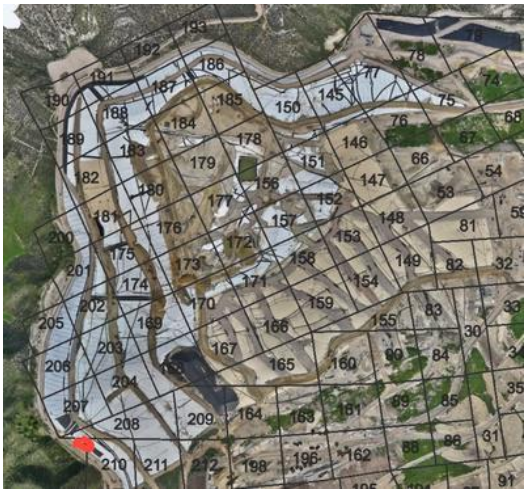

Drop Pin to record lat/long of seep/pooling location.	(34.43215542066448, -118.65154696884296)
Time seep/pooling was discovered	24 Feb 2026 9:47 AM PST
Estimated duration of presence of leachate at such location	31 hours
Estimated quantity of leachate	>150 gallons
Extent of area impacted (approximate sq ft impacted)	20 sq ft
Odor type	Leachate
Odor intensity	2 - Light Odor Detected
Surrounding soil saturation level	Saturated

Image of seep/pooling

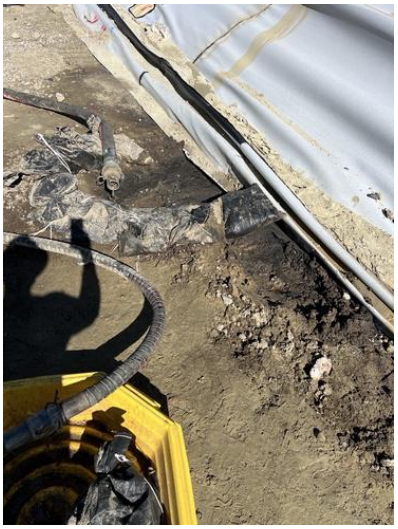

Photo 1

Did the seep/pooling travel into the stormwater channel?	No

Actions taken to contain seep/pooling?

Berm placed around seep. Leachate being vacuumed out throughout day to minimize pooling. Stormwater channel pressure washed and liquid vacuumed out. Check dams put in place in stormwater channel.

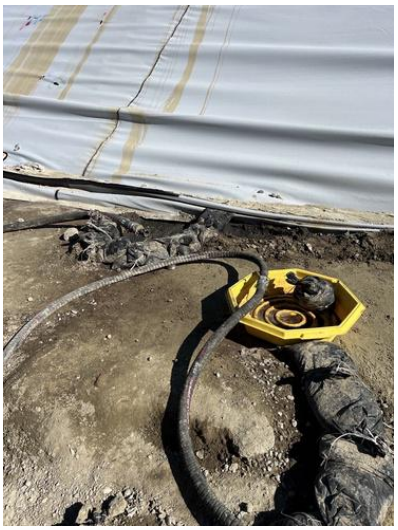

Photo 2

4050 - Chiquita Leachate Seep/Pooling Inspection

24 Feb 2026 / Tom Roe

Complete

Conducted on	24 Feb 2026 2:55 PM PST
Prepared by	Tom Roe

Leachate Seep Inspection	
Leachate seep/pooling Inspection	
Leachate seep/pooling Inspection 1	
Has a leachate seep/pooling been located?	Yes
Which grid is the leachate seep/pooling located?	Adjacent to 210

Indicate on the map the location

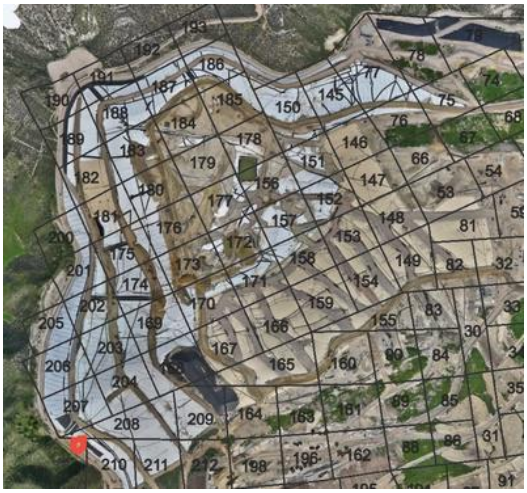

Drop Pin to record lat/long of seep/pooling location.	(34.43166455291356, -118.65101317790655)
Time seep/pooling was discovered	24 Feb 2026 3:21 PM PST
Estimated duration of presence of leachate at such location	35 hours
Estimated quantity of leachate	>150 gallons
Extent of area impacted (approximate sq ft impacted)	20 sq ft
Odor type	Leachate
Odor intensity	2 - Light Odor Detected
Surrounding soil saturation level	Saturated

Image of seep/pooling

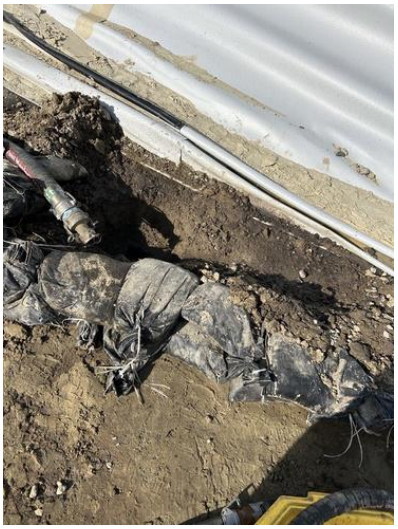

Photo 1

Did the seep/pooling travel into the stormwater channel?	No

Actions taken to contain seep/pooling?

Berm placed around seep. Leachate being vacuumed out throughout day to minimize pooling. Stormwater channel pressure washed and liquid vacuumed out. Check dams put in place in stormwater channel. Work to repair seep schedule to begin 2/25/26.

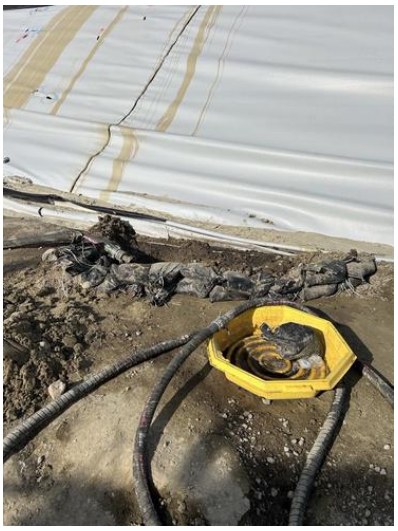

Photo 2

Photo 3

4050 - Chiquita Leachate Seep/Pooling Inspection

25 Feb 2026 / John Boucher

Complete

Conducted on	25 Feb 2026 7:11 AM PST
Prepared by	John Boucher

Leachate Seep Inspection	
Leachate seep/pooling Inspection	
Leachate seep/pooling Inspection 1	
Has a leachate seep/pooling been located?	Yes
Which grid is the leachate seep/pooling located?	Adjacent to 210

Indicate on the map the location

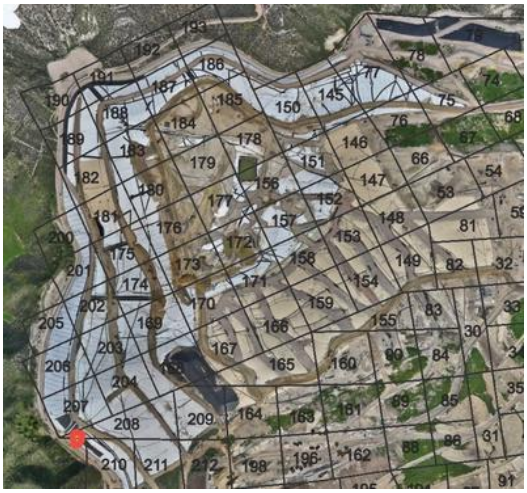

Drop Pin to record lat/long of seep/pooling location.	(34.43166455291356, -118.65101317790655)
Time seep/pooling was discovered	25 Feb 2026 7:11 AM PST
Estimated duration of presence of leachate at such location	51 hours
Estimated quantity of leachate	21-50 gallons
Extent of area impacted (approximate sq ft impacted)	20sq ft
Odor type	Leachate
Odor intensity	1 - Very Light Odor Detected
Surrounding soil saturation level	Semi-dry

Image of seep/pooling

Repairs began before picture could be taken.

Photo 1

Did the seep/pooling travel into the stormwater channel?	No

Actions taken to contain seep/pooling?

Berm was constructed to contain seep.
Construction work to repair the seep is ongoing.

Photo 2

4050 - Chiquita Leachate Seep/Pooling Inspection

25 Feb 2026 / Tom Roe

Complete

Conducted on	25 Feb 2026 3:01 PM PST
Prepared by	Tom Roe

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located? No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.

Westside perimeter road. Seep from morning inspection was not observed. Trench was dug to contain leachate and steel plates were placed on top. Leachate is periodically vacuumed out. Construction is ongoing to further contain the area.

4050 - Chiquita Leachate Seep/Pooling Inspection

26 Feb 2026 / John Boucher

Complete

Conducted on	26 Feb 2026 7:30 AM PST
Prepared by	John Boucher

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	Seep starting on 2/23/26 was not observed. Trench was dug to contain leachate and steel plates were placed on top. Leachate is periodically vacuumed out. Construction is ongoing to further contain the area.

4050 - Chiquita Leachate Seep/Pooling Inspection

26 Feb 2026 / John Boucher

Complete

Conducted on	26 Feb 2026 2:09 PM PST
Prepared by	John Boucher

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	The seep starting on 2/23/26 was not observed. Trench was dug to contain leachate,steel plates and liner were placed overtop to prevent atmospheric exposure. Leachate is periodically vacuumed out. Construction is ongoing to further contain the area.

4050 - Chiquita Leachate Seep/Pooling Inspection

27 Feb 2026 / John Boucher

Complete

Conducted on	27 Feb 2026 7:08 AM PST
Prepared by	John Boucher

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	The seep starting on 2/23/26 was not observed. Trench was dug to contain leachate,steel plates and liner were placed overtop to prevent atmospheric exposure. Leachate is periodically vacuumed out. Construction is ongoing to further contain the area.

4050 - Chiquita Leachate Seep/Pooling Inspection

27 Feb 2026 / John Boucher

Complete

Conducted on	27 Feb 2026 2:14 PM PST
Prepared by	John Boucher

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	The seep starting on 2/23/26 was not observed. Trench was dug to contain leachate,steel plates and liner were placed overtop to prevent atmospheric exposure. Leachate is periodically vacuumed out. Construction is ongoing to further contain the area.

4050 - Chiquita Leachate Seep/Pooling Inspection

28 Feb 2026 / John Boucher

Complete

Conducted on	28 Feb 2026 7:54 AM PST
Prepared by	John Boucher

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	The seep starting on 2/23/26 was not observed. Trench was dug to contain leachate,steel plates and liner were placed overtop to prevent atmospheric exposure. Leachate is periodically vacuumed out. Construction is ongoing to further contain the area.

4050 - Chiquita Leachate Seep/Pooling Inspection

28 Feb 2026 / John Boucher

Complete

Conducted on	28 Feb 2026 1:13 PM PST
Prepared by	John Boucher

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	The seep starting on 2/23/26 was not observed. Trench was dug to contain leachate,steel plates and liner were placed overtop to prevent atmospheric exposure. Leachate is periodically vacuumed out. Construction is ongoing to further contain the area.

4050 - Chiquita Leachate Seep/Pooling Inspection

1 Mar 2026 / Tom Roe

Complete

Conducted on	1 Mar 2026 7:08 AM PST
Prepared by	Tom Roe

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	Westside perimeter road. The seep starting on 2/23/26 was not observed. Trench was dug to contain leachate,steel plates and liner were placed overtop to prevent atmospheric exposure. Leachate is periodically vacuumed out. Construction is ongoing to further contain the area.

4050 - Chiquita Leachate Seep/Pooling Inspection

1 Mar 2026 / Tom Roe

Complete

Conducted on	1 Mar 2026 1:19 PM PST
Prepared by	Tom Roe

Leachate Seep Inspection

Leachate seep/pooling Inspection

Leachate seep/pooling Inspection 1

Has a leachate seep/pooling been located?	No

Photo 1

Description of area in photo where there is no leachate seepage or pooling.	North perimeter road.

Attachment L

Leachate Gallon Data

Leachate Gallons for the Month of February 2026

Off-site Disposal

Week	Date	Facility	Address	Estimated Gallons
1	2/1-2/1	Avalon	14700 S. Avalon Blvd. Gardena, CA 90248	24,340
1	2/1-2/1	East Valley Remediation	62150 Gene Welmas Way Mecca, CA 92254	5,390
1	2/1-2/1	Durham Regional Landfill	22316 South Harmon Rd. Florence, AZ 85132	5,802
1	2/1-2/1	Crystal Clean, Bakersfield	1620 E Brundage Ln, Bakersfield, CA 93307	11,521
2	2/2-2/8	Avalon	14700 S. Avalon Blvd. Gardena, CA 90248	398,837
2	2/2-2/8	East Valley Remediation	62150 Gene Welmas Way Mecca, CA 92254	252,792
2	2/2-2/8	Durham Regional Landfill	22316 South Harmon Rd. Florence, AZ 85132	170,568
2	2/2-2/8	Clean Harbors Texas	Clean Harbors, Deer Park 2027 Independence Parkway South La Porte, TX 77571	84,080
2	2/2-2/8	Clean Harbors Utah	Clean Harbors, Argonite 11600 North Aptus Road Grantsville, UT 84029	48,795
2	2/2-2/8	Clean Harbors Nebraska	Clean Harbors, Kimball 2247 South Highway 71 Kimball, NE 69145	62,918
2	2/2-2/8	Crystal Clean, Bakersfield	1620 E Brundage Ln, Bakersfield, CA 93307	134,698
3	2/9-2/15	Avalon	14700 S. Avalon Blvd. Gardena, CA 90248	26,856
3	2/9-2/15	East Valley Remediation	62150 Gene Welmas Way Mecca, CA 92254	263,792
3	2/9-2/15	Durham Regional Landfill	22316 South Harmon Rd. Florence, AZ 85132	352,492
3	2/9-2/15	Clean Harbors Texas	Clean Harbors, Deer Park 2027 Independence Parkway South La Porte, TX 77571	46,830
3	2/9-2/15	Clean Harbors Utah	Clean Harbors, Argonite 11600 North Aptus Road Grantsville, UT 84029	46,858
3	2/9-2/15	Clean Harbors Nebraska	Clean Harbors, Kimball 2247 South Highway 71 Kimball, NE 69145	92,842
3	2/9-2/15	Crystal Clean, Bakersfield	1620 E Brundage Ln, Bakersfield, CA 93307	538,795
4	2/16-2/22	East Valley Remediation	62150 Gene Welmas Way Mecca, CA 92254	279,185
4	2/16-2/22	Durham Regional Landfill	22316 South Harmon Rd. Florence, AZ 85132	400,603
4	2/16-2/22	Clean Harbors Utah	Clean Harbors, Argonite 11600 North Aptus Road Grantsville, UT 84029	52,014
4	2/16-2/22	Clean Harbors Nebraska	Clean Harbors, Kimball 2247 South Highway 71 Kimball, NE 69145	97,930
4	2/16-2/22	Crystal Clean, Bakersfield	1620 E Brundage Ln, Bakersfield, CA 93307	730,978
5	2/23-2/28	East Valley Remediation	62150 Gene Welmas Way Mecca, CA 92254	255,066
5	2/23-2/28	Durham Regional Landfill	22316 South Harmon Rd. Florence, AZ 85132	324,389

5	2/23-2/28	Clean Harbors Nebraska	Clean Harbors, Kimball 2247 South Highway 71 Kimball, NE 69145	113,887
5	2/23-2/28	Industrial Recycling, Baja	Industrial Recycling Monte Alban, 126 Benito Juarez, Cuidad de Mexico, C.P. 03020	14,193
5	2/23-2/28	Crystal Clean, Bakersfield	1620 E Brundage Ln, Bakersfield, CA 93307	395,231

On-site Extraction and Treatment

Week	Date	Estimated Gallons Extracted*	Estimated Gallons Treated On-Site
1	2/1/26-2/1/26	464,300	194,832
2	2/2/26-2/8/26	2,538,423	1,015,005
3	2/9/26-2/15/26	2,855,761	890,234
4	2/16/26-2/22/26	2,569,263	1,134,405
5	2/23/26-2/28/26	1,886,588	705,992

*Chiquita is currently investigating potential over-reporting by the on-site flow meters which may be resulting in overestimating the amount of leachate extraction volumes. Chiquita is continuing to evaluate this issue and potential corrective actions.

Attachment M

Leachate Pressure Gauge Readings

4050 - Daily Pressure Gauge Readings

Tom Roe

Complete

Score	224 / 224 (100%)	Flagged items	0	Actions	0

Site conducted	4050 - Chiquita Canyon Landfill -, Corporate (Overall), Western, Western/SO CA L/F
Conducted on	1 Feb 2026 8:15 AM PST
Prepared by	Tom Roe

Pressure Gauge Readings	224 / 224 (100%)
#7 Tank Farm	25 / 25 (100%)
SW 08	Maintenance Needed
SW 07	Maintenance Needed
SW 06	Maintenance Needed
SW 05	Maintenance Needed
SW 04	Maintenance Needed
SW 03	-0.06
SW 02	Maintenance Needed
SW 01	Maintenance Needed
44	-0.03
111	Maintenance Needed
LCM 11	Maintenance Needed
LCM 12	Maintenance Needed
LCM 13	Maintenance Needed
LCM 14	Maintenance Needed
LCM 15	-0.03
LCM 6	Maintenance Needed
LCM 7	Maintenance Needed
LCM 8	Maintenance Needed
LCM 9	-0.01
LCM 10	-0.02
LCM 1	0.13
LCM 2	Maintenance Needed

LCM 3	Maintenance Needed
LCM 4	0.24
LCM 5	-0.05
#10 Tank Farm Canyon D	39 / 39 (100%)
D1	-0.25
D2	-0.25
CD3	Maintenance Needed
CD4	Maintenance Needed
D17	Maintenance Needed
D16	0.25
D15	Maintenance Needed
D14	0.23
D13	Maintenance Needed
D12	-0.02
D11	-0.25
D10	0.25
D9	Maintenance Needed
D8	-0.04
D7	Maintenance Needed
D6	Maintenance Needed
D5	Maintenance Needed
D4	Maintenance Needed
D3	-0.25
D18	-0.05

D19	-0.02
D20	-0.11
D21	-0.25
D22	Maintenance Needed
D23	Maintenance Needed
D24	-0.04
D25	Maintenance Needed
D26	0.25
D27	-0.01
D28	Maintenance Needed
D29	Maintenance Needed
D30	-0.25
D31	Maintenance Needed
D32	-0.25
D/SW-01	Maintenance Needed
D/SW-02	Maintenance Needed
D/SW-03	Maintenance Needed
D/SW-04	Maintenance Needed
D/SW-05	Maintenance Needed
#13 Tank Farm	160 / 160 (100%)
C13-08	Tank Not In Use/In Staging Area
C13-07	Tank Not In Use/In Staging Area
C13-06	Tank Not In Use/In Staging Area
C13-05	Tank Not In Use/In Staging Area

C13-04	Tank Not In Use/In Staging Area
C13-03	Tank Not In Use/In Staging Area
C13-02	Tank Not In Use/In Staging Area
C13-01	Tank Not In Use/In Staging Area
C13-09	-0.25
C13-10	-0.25
C13-11	-0.25
C13-12	0.05
C13-13	-0.25
C13-14	-0.25
C13-15	Maintenance Needed
C13-16	-0.25
T1/T2 190	Maintenance Needed
U13-63	Maintenance Needed
U13-62	-0.02
U13-61	-0.01
U13-60	-0.01
U13-59	Maintenance Needed
U13-58	-0.02
U13-57	-0.03
U13-56	-0.03
U13-55	-0.05
U13-54	0.06
U13-53	-0.01

U13-52	Maintenance Needed
U13-51	Maintenance Needed
U13-50	-0.05
U13-49	-0.02
U13-48	-0.07
U13-47	-0.02
U13-46	-0.02
U13-45	0
U13-44	0.01
U13-43	0.02
U13-42	-0.04
U13-41	-0.02
U13-40	0
U13-39	-0.02
U13-38	-0.02
U13-37	Maintenance Needed
U13-36	-0.04
U13-35	-0.03
U13-34	-0.04
U13-33	-0.04
U13-32	-0.02
U13-31	-0.05
U13-30	Maintenance Needed
U13-29	-0.03

U13-28	-0.02
U13-27	-0.08
U13-26	-0.12
U13-25	-0.01
U13-24	-0.14
U13-23	-0.08
U13-22	-0.07
U13-21	-0.05
U13-20	Maintenance Needed
U13-19	-0.06
U13-18	-0.01
U13-17	-0.02
U13-16	0.03
U13-15	-0.02
U13-14	-0.02
U13-13	-0.20
U13-12	-0.25
U13-11	-0.25
U13-10	-0.25
U13-09	-0.15
U13-08	-0.25
U13-07	-0.25
U13-06	-0.05
U13-05	-0.25

U13-04	-0.14
U13-03	-0.08
U13-02	-0.04
U13-01	-0.25
L13-01	-0.08
L13-02	-0.06
L13-03	-0.06
L13-04	-0.06
L13-05	-0.07
L13-06	-0.01
L13-07	-0.05
L13-08	-0.05
L13-09	-0.05
L13-10	0.05
L13-11	-0.04
L13-12	-0.02
L13-13	-0.02
L13-14	-0.03
L13-15	-0.06
L13-16	-0.07
L13-17	-0.08
L13-18	-0.07
L13-19	-0.05
L13-20	-0.05

L13-21	-0.07
L13-22	-0.04
L13-23	-0.04
L13-24	-0.05
L13-25	-0.05
L13-26	-0.02
L13-27	-0.03
L13-28	-0.06
L13-29	Maintenance Needed
L13-30	0.05
L13-31	-0.09
L13-32	0.06
L13-33	-0.02
L13-34	-0.03
L13-35	-0.02
L13-36	0.17
L13-37	-0.07
L13-38	-0.05
L13-39	-0.03
L13-40	-0.03
L13-41	-0.02
L13-42	0
L13-43	-0.03
L13-44	-0.03

L13-45	-0.03
L13-46	-0.04
L13-47	-0.04
L13-48	-0.03
L13-49	-0.02
L13-50	-0.03
L13-51	-0.02
L13-52	-0.02
L13-53	-0.03
L13-54	-0.05
L13-55	-0.02
L13-56	-0.03
L13-57	-0.04
L13-58	0
L13-59	-0.02
L13-60	-0.03
L13-61	-0.14
L13-62	0
L13-63	-0.04
L13-64	-0.01
L13-65	-0.18
L13-66	-0.01
L13-67	-0.02
L13-68	-0.02

L13-69	-0.03
L13-70	0
L13-71	-0.06
L13-72	-0.03
L13-73	-0.15
L13-74	-0.05
L13-75	-0.07
L13-76	0
L13-77	-0.02
L13-78	-0.05
L13-79	-0.01
L13-80	-0.03

Certification

Tom Roe
1 Feb 2026 10:41 AM PST

4050 - Daily Pressure Gauge Readings

Nancy Bahena Hernandez

Complete

Score	224 / 224 (100%)	Flagged items	0	Actions	0

Site conducted	4050 - Chiquita Canyon Landfill -, Corporate (Overall), Western, Western/SO CA L/F
Conducted on	2 Feb 2026 9:00 AM PST
Prepared by	Nancy Bahena Hernandez

Pressure Gauge Readings	224 / 224 (100%)
#7 Tank Farm	25 / 25 (100%)
SW 08	Maintenance Needed
SW 07	Maintenance Needed
SW 06	Maintenance Needed
SW 05	Maintenance Needed
SW 04	Maintenance Needed
SW 03	-0.06
SW 02	Maintenance Needed
SW 01	Maintenance Needed
No meter	
44	0
111	Maintenance Needed
No meter	
LCM 11	Maintenance Needed
LCM 12	Maintenance Needed
LCM 13	Maintenance Needed
LCM 14	Maintenance Needed
LCM 15	0
LCM 6	Maintenance Needed
LCM 7	Maintenance Needed
LCM 8	Maintenance Needed
LCM 9	-0.01
LCM 10	-0.01
LCM 1	0.10

LCM 2	Maintenance Needed
LCM 3	Maintenance Needed
LCM 4	0.16
LCM 5	-0.08
#10 Tank Farm Canyon D	39 / 39 (100%)
D1	-0.25
D2	-0.25
CD3	Tank Not In Use/In Staging Area
CD4	Tank Not In Use/In Staging Area
D17	Maintenance Needed
D16	-0.12
D15	Maintenance Needed
D14	0.24
D13	Maintenance Needed
Meter not attached	
D12	-0.20
D11	-0.25
D10	0.25
D9	Maintenance Needed
Meter not attached	
D8	-0.02
D7	0
D6	Maintenance Needed
D5	Maintenance Needed
meter not attached	

D4	Maintenance Needed
Meter not attached	
D3	-0.25
D18	-0.05
D19	-0.02
D20	-0.11
D21	Maintenance Needed
Meter not attached	
D22	Maintenance Needed
D23	Maintenance Needed
D24	-0.05
D25	Maintenance Needed
Meter not attached	
D26	0.25
D27	Maintenance Needed
D28	Maintenance Needed
D29	Maintenance Needed
D30	-0.25
D31	Maintenance Needed
Meter not attached	
D32	-0.25
D/SW-01	Maintenance Needed
No meter	
D/SW-02	Maintenance Needed
No meter	
D/SW-03	Maintenance Needed

No meter	
D/SW-04	Maintenance Needed
No meter	
D/SW-05	Maintenance Needed
No meter	
#13 Tank Farm	160 / 160 (100%)
C13-08	0.10
C13-07	0.01
C13-06	0.01
C13-05	0
C13-04	0.02
C13-03	0.01
C13-02	0
C13-01	-0.01
C13-09	-0.25
C13-10	-0.25
C13-11	-0.25
C13-12	-0.04
C13-13	-0.25
C13-14	-0.25
C13-15	Maintenance Needed
C13-16	-0.25
T1/T2 190	Maintenance Needed
U13-63	-0.01
U13-62	-0.02

U13-61	0
U13-60	-0.02
U13-59	Maintenance Needed
U13-58	-0.01
U13-57	-0.02
U13-56	-0.02
U13-55	-0.05
U13-54	-0.22
U13-53	-0.05
U13-52	-0.23
U13-51	-0.02
U13-50	-0.01
U13-49	-0.02
U13-48	-0.10
U13-47	-0.01
U13-46	-0.01
U13-45	0
U13-44	0
U13-43	0
U13-42	-0.01
U13-41	-0.02
U13-40	0
U13-39	-0.02
U13-38	-0.02

U13-37	Maintenance Needed
Meter not attached	
U13-36	-0.07
U13-35	-0.06
U13-34	-0.07
U13-33	-0.07
U13-32	-0.07
U13-31	-0.05
U13-30	Maintenance Needed
Meter not attached	
U13-29	-0.04
U13-28	-0.01
U13-27	-0.10
U13-26	-0.16
U13-25	-0.15
U13-24	-0.22
U13-23	-0.07
U13-22	-0.06
U13-21	-0.05
U13-20	Maintenance Needed
Meter not attached	
U13-19	-0.06
U13-18	-0.01
U13-17	0
U13-16	-0.01

U13-15	0
U13-14	0
U13-13	-0.22
U13-12	-0.25
U13-11	-0.25
U13-10	-0.25
U13-09	-0.25
U13-08	-0.25
U13-07	-0.25
U13-06	-0.05
U13-05	-0.25
U13-04	-0.15
U13-03	-0.05
U13-02	-0.02
U13-01	-0.25
L13-01	-0.10
L13-02	-0.06
L13-03	-0.07
L13-04	-0.05
L13-05	-0.05
L13-06	0
L13-07	-0.05
L13-08	-0.06
L13-09	-0.06

L13-10	0.07
L13-11	Maintenance Needed
Meter not attached	
L13-12	0
L13-13	-0.02
L13-14	-0.02
L13-15	-0.08
L13-16	-0.10
L13-17	-0.10
L13-18	-0.08
L13-19	-0.08
L13-20	-0.05
L13-21	-0.10
L13-22	-0.06
L13-23	-0.06
L13-24	-0.07
L13-25	-0.04
L13-26	Maintenance Needed
Meter not attached	
L13-27	-0.05
L13-28	-0.10
L13-29	Maintenance Needed
Meter not attached	
L13-30	-0.01
L13-31	-0.05

L13-32	-0.05
L13-33	0.02
L13-34	-0.02
L13-35	-0.01
L13-36	0.25
L13-37	-0.10
L13-38	-0.05
L13-39	-0.02
L13-40	-0.02
L13-41	-0.02
L13-42	-0.03
L13-43	-0.02
L13-44	-0.01
L13-45	-0.01
L13-46	-0.02
L13-47	-0.02
L13-48	-0.03
L13-49	-0.02
L13-50	-0.02
L13-51	-0.03
L13-52	0
L13-53	-0.02
L13-54	-0.02
L13-55	-0.02

L13-56	0
L13-57	-0.01
L13-58	0
L13-59	-0.02
L13-60	-0.05
L13-61	-0.10
L13-62	-0.02
L13-63	-0.05
L13-64	-0.05
L13-65	-0.25
L13-66	-0.01
L13-67	-0.02
L13-68	-0.03
L13-69	0
L13-70	-0.02
L13-71	-0.07
L13-72	-0.07
L13-73	-0.25
L13-74	-0.05
L13-75	-0.06
L13-76	0
L13-77	0
L13-78	-0.10
L13-79	0

Certification

Nancy Bahena Hernandez
2 Feb 2026 3:26 PM PST

4050 - Daily Pressure Gauge Readings

Nancy Bahena Hernandez

Complete

Score	224 / 224 (100%)	Flagged items	0	Actions	0

Site conducted	4050 - Chiquita Canyon Landfill -, Corporate (Overall), Western, Western/SO CA L/F
Conducted on	3 Feb 2026 8:40 AM PST
Prepared by	Nancy Bahena Hernandez

Pressure Gauge Readings	224 / 224 (100%)
#7 Tank Farm	25 / 25 (100%)
SW 08	Maintenance Needed
SW 07	Maintenance Needed
SW 06	Maintenance Needed
SW 05	Maintenance Needed
SW 04	Maintenance Needed
SW 03	-0.06
SW 02	Maintenance Needed
SW 01	Maintenance Needed
No meter	
44	-0.01
111	Maintenance Needed
No meter	
LCM 11	Maintenance Needed
LCM 12	Maintenance Needed
LCM 13	Maintenance Needed
LCM 14	Maintenance Needed
LCM 15	0
LCM 6	Maintenance Needed
LCM 7	Maintenance Needed
LCM 8	Maintenance Needed
LCM 9	0
LCM 10	0
LCM 1	0.10

LCM 2	Maintenance Needed
LCM 3	Maintenance Needed
LCM 4	0.23
LCM 5	-0.09
#10 Tank Farm Canyon D	39 / 39 (100%)
D1	-0.25
D2	-0.25
CD3	Tank Not In Use/In Staging Area
CD4	Tank Not In Use/In Staging Area
D17	Maintenance Needed
D16	0.25
D15	Maintenance Needed
Meter not attached	
D14	0.20
D13	Maintenance Needed
Meter not attached	
D12	-0.07
D11	-0.25
D10	0.25
D9	Maintenance Needed
Meter not attached	
D8	-0.05
D7	0
D6	-0.01
D5	Maintenance Needed

Meter not attached	
D4	Maintenance Needed
Meter not attached	
D3	-0.25
D18	-0.05
D19	-0.01
D20	-0.11
D21	Maintenance Needed
Meter not attached	
D22	-0.02
D23	-0.01
D24	-0.05
D25	Maintenance Needed
Meter not attached	
D26	0.25
D27	Maintenance Needed
D28	Maintenance Needed
D29	Maintenance Needed
D30	-0.25
D31	Maintenance Needed
D32	-0.25
D/SW-01	Maintenance Needed
No meter	
D/SW-02	Maintenance Needed
No meter	
D/SW-03	Maintenance Needed

No meter	
D/SW-04	Maintenance Needed
No meter	
D/SW-05	Maintenance Needed
No meter	
#13 Tank Farm	160 / 160 (100%)
C13-08	0.04
C13-07	-0.01
C13-06	-0.03
C13-05	-0.04
C13-04	-0.01
C13-03	-0.01
C13-02	-0.01
C13-01	-0.05
C13-09	-0.25
C13-10	-0.25
C13-11	-0.25
C13-12	0.06
C13-13	-0.25
C13-14	-0.25
C13-15	Maintenance Needed
C13-16	-0.25
T1/T2 190	Maintenance Needed
U13-63	-0.03
U13-62	-0.03

U13-61	0
U13-60	-0.02
U13-59	Maintenance Needed
U13-58	-0.01
U13-57	-0.02
U13-56	-0.01
U13-55	-0.05
U13-54	-0.22
U13-53	-0.03
U13-52	Maintenance Needed
U13-51	Maintenance Needed
U13-50	-0.05
U13-49	-0.25
U13-48	-0.10
U13-47	-0.02
U13-46	-0.02
U13-45	0
U13-44	0
U13-43	0
U13-42	-0.02
U13-41	0
U13-40	0
U13-39	-0.02
U13-38	-0.02

U13-37	Maintenance Needed
Meter not attached	
U13-36	-0.07
U13-35	-0.07
U13-34	-0.06
U13-33	-0.06
U13-32	-0.02
U13-31	-0.06
U13-30	Maintenance Needed
Meter not attached	
U13-29	-0.04
U13-28	-0.01
U13-27	-0.10
U13-26	-0.12
U13-25	-0.02
U13-24	-0.15
U13-23	-0.07
U13-22	Maintenance Needed
U13-21	-0.05
U13-20	Maintenance Needed
Meter not attached	
U13-19	-0.07
U13-18	0
U13-17	-0.02
U13-16	-0.22

U13-15	0
U13-14	-0.01
U13-13	-0.20
U13-12	-0.24
U13-11	-0.25
U13-10	-0.25
U13-09	-0.04
U13-08	-0.25
U13-07	-0.25
U13-06	-0.02
U13-05	-0.25
U13-04	-0.12
U13-03	-0.01
U13-02	0
U13-01	0
L13-01	-0.07
L13-02	-0.06
L13-03	-0.07
L13-04	-0.05
L13-05	-0.05
L13-06	0
L13-07	-0.07
L13-08	-0.05
L13-09	-0.06

L13-10	0.06
L13-11	Maintenance Needed
Meter not attached	
L13-12	0
L13-13	-0.05
L13-14	-0.01
L13-15	-0.07
L13-16	-0.10
L13-17	-0.07
L13-18	-0.10
L13-19	-0.06
L13-20	-0.06
L13-21	-0.10
L13-22	-0.06
L13-23	-0.06
L13-24	-0.06
L13-25	-0.03
L13-26	Maintenance Needed
Meter not attached	
L13-27	-0.04
L13-28	-0.08
L13-29	Maintenance Needed
Meter not attached	
L13-30	-0.06
L13-31	0

L13-32	-0.05
L13-33	0.03
L13-34	-0.02
L13-35	-0.02
L13-36	-0.09
L13-37	0
L13-38	-0.04
L13-39	-0.05
L13-40	-0.01
L13-41	-0.01
L13-42	0.25
L13-43	0.01
L13-44	Maintenance Needed
L13-45	-0.01
L13-46	-0.05
L13-47	-0.05
L13-48	-0.05
L13-49	-0.05
L13-50	-0.05
L13-51	-0.03
L13-52	-0.01
L13-53	-0.05
L13-54	-0.05
L13-55	-0.01

L13-56	-0.02
L13-57	-0.02
L13-58	0
L13-59	-0.04
L13-60	-0.05
L13-61	-0.15
L13-62	-0.03
L13-63	-0.06
L13-64	-0.04
L13-65	-0.25
L13-66	0
L13-67	-0.02
L13-68	-0.05
L13-69	-0.05
L13-70	-0.02
L13-71	-0.06
L13-72	-0.04
L13-73	-0.25
L13-74	-0.02
L13-75	-0.05
L13-76	0
L13-77	-0.05
L13-78	-0.05
L13-79	0

Certification

Nancy Bahena Hernandez
3 Feb 2026 3:40 PM PST

4050 - Daily Pressure Gauge Readings

Nancy Bahena Hernandez

Complete

Score	224 / 224 (100%)	Flagged items	0	Actions	0

Site conducted	4050 - Chiquita Canyon Landfill -, Corporate (Overall), Western, Western/SO CA L/F
Conducted on	4 Feb 2026 9:14 AM PST
Prepared by	Nancy Bahena Hernandez

Pressure Gauge Readings	224 / 224 (100%)
#7 Tank Farm	25 / 25 (100%)
SW 08	Maintenance Needed
SW 07	Maintenance Needed
SW 06	Maintenance Needed
SW 05	Maintenance Needed
SW 04	Maintenance Needed
SW 03	-0.06
SW 02	Maintenance Needed
SW 01	Maintenance Needed
No meter	
44	-0.02
111	Maintenance Needed
No meter	
LCM 11	Maintenance Needed
LCM 12	Maintenance Needed
LCM 13	Maintenance Needed
LCM 14	Maintenance Needed
LCM 15	-0.02
LCM 6	Maintenance Needed
LCM 7	Maintenance Needed
LCM 8	Maintenance Needed
LCM 9	Maintenance Needed
LCM 10	-0.01
LCM 1	Maintenance Needed

LCM 2	Maintenance Needed
LCM 3	Maintenance Needed
LCM 4	0.25
LCM 5	0.25
#10 Tank Farm Canyon D	39 / 39 (100%)
D1	-0.25
D2	-0.25
CD3	Maintenance Needed
CD4	Maintenance Needed
D17	-0.03
D16	0.25
D15	Maintenance Needed
Meter not attached	
D14	0.25
D13	Maintenance Needed
Meter not attached	
D12	-0.25
D11	Maintenance Needed
D10	-0.25
D9	Maintenance Needed
Meter not attached	
D8	-0.05
D7	0
D6	Maintenance Needed
D5	Maintenance Needed

Meter not attached	
D4	Maintenance Needed
Meter not attached	
D3	-0.25
D18	-0.05
D19	0
D20	-0.10
D21	Maintenance Needed
Meter not attached	
D22	Maintenance Needed
D23	Maintenance Needed
D24	-0.05
D25	Maintenance Needed
D26	0.25
D27	Maintenance Needed
D28	Maintenance Needed
D29	Maintenance Needed
D30	-0.24
D31	Maintenance Needed
D32	-0.25
D/SW-01	Maintenance Needed
No meter	
D/SW-02	Maintenance Needed
No meter	
D/SW-03	Maintenance Needed
No meter	

D/SW-04	Maintenance Needed
No meter	
D/SW-05	Maintenance Needed
No meter	
#13 Tank Farm	160 / 160 (100%)
C13-08	0.07
C13-07	-0.01
C13-06	0
C13-05	-0.02
C13-04	0.03
C13-03	0.01
C13-02	0
C13-01	-0.02
C13-09	-0.25
C13-10	-0.25
C13-11	-0.25
C13-12	0.04
C13-13	-0.25
C13-14	-0.25
C13-15	Maintenance Needed
C13-16	-0.25
T1/T2 190	Maintenance Needed
U13-63	Maintenance Needed
U13-62	-0.03
U13-61	0

U13-60	-0.05
U13-59	Maintenance Needed
U13-58	-0.02
U13-57	-0.02
U13-56	-0.03
U13-55	-0.05
U13-54	-0.20
U13-53	-0.05
U13-52	Maintenance Needed
U13-51	Maintenance Needed
U13-50	-0.10
U13-49	-0.10
U13-48	-0.05
U13-47	0
U13-46	0
U13-45	0
U13-44	0
U13-43	-0.03
U13-42	-0.05
U13-41	-0.01
U13-40	0
U13-39	-0.02
U13-38	-0.02
U13-37	Maintenance Needed

U13-36	-0.05
U13-35	-0.05
U13-34	-0.05
U13-33	-0.05
U13-32	-0.01
U13-31	-0.03
U13-30	Maintenance Needed
Meter not attached	
U13-29	-0.05
U13-28	0
U13-27	-0.10
U13-26	-0.12
U13-25	-0.10
U13-24	-0.15
U13-23	-0.10
U13-22	Maintenance Needed
U13-21	-0.10
U13-20	Maintenance Needed
Meter not attached	
U13-19	-0.10
U13-18	-0.02
U13-17	-0.02
U13-16	-0.06
U13-15	0
U13-14	-0.01

U13-13	-0.15
U13-12	-0.25
U13-11	-0.25
U13-10	-0.25
U13-09	-0.21
U13-08	-0.25
U13-07	-0.25
U13-06	-0.05
U13-05	-0.25
U13-04	-0.14
U13-03	-0.01
U13-02	-0.01
U13-01	-0.25
L13-01	-0.06
L13-02	-0.04
L13-03	-0.06
L13-04	-0.05
L13-05	-0.05
L13-06	0
L13-07	-0.07
L13-08	-0.06
L13-09	-0.06
L13-10	0.10
L13-11	Maintenance Needed

Meter not attached	
L13-12	-0.01
L13-13	-0.01
L13-14	-0.04
L13-15	-0.06
L13-16	-0.09
L13-17	-0.07
L13-18	-0.10
L13-19	-0.08
L13-20	-0.09
L13-21	-0.10
L13-22	-0.05
L13-23	-0.05
L13-24	-0.07
L13-25	-0.05
L13-26	Maintenance Needed
Meter not attached	
L13-27	-0.05
L13-28	-0.07
L13-29	Maintenance Needed
Meter not attached	
L13-30	-0.08
L13-31	0.02
L13-32	-0.06
L13-33	0.05

L13-34	-0.02
L13-35	-0.02
L13-36	-0.10
L13-37	-0.10
L13-38	-0.05
L13-39	-0.04
L13-40	0.10
L13-41	-0.02
L13-42	-0.02
L13-43	-0.02
L13-44	Maintenance Needed
L13-45	-0.02
L13-46	-0.02
L13-47	-0.02
L13-48	-0.05
L13-49	-0.02
L13-50	-0.02
L13-51	-0.02
L13-52	-0.05
L13-53	-0.04
L13-54	-0.05
L13-55	0
L13-56	0
L13-57	0

L13-58	0
L13-59	-0.04
L13-60	-0.05
L13-61	-0.16
L13-62	-0.03
L13-63	-0.06
L13-64	-0.04
L13-65	-0.25
L13-66	0
L13-67	-0.02
L13-68	-0.05
L13-69	-0.05
L13-70	-0.03
L13-71	-0.07
L13-72	-0.07
L13-73	-0.25
L13-74	-0.02
L13-75	-0.06
L13-76	0.10
L13-77	0
L13-78	-0.05
L13-79	0
L13-80	-0.01

Certification

Nancy Bahena Hernandez
4 Feb 2026 4:40 PM PST

4050 - Daily Pressure Gauge Readings

Nancy Bahena Hernandez

Complete

Score	224 / 224 (100%)	Flagged items	0	Actions	0

Site conducted	4050 - Chiquita Canyon Landfill -, Corporate (Overall), Western, Western/SO CA L/F
Conducted on	5 Feb 2026 11:39 AM PST
Prepared by	Nancy Bahena Hernandez

Pressure Gauge Readings	224 / 224 (100%)
#7 Tank Farm	25 / 25 (100%)
SW 08	Maintenance Needed
SW 07	Maintenance Needed
SW 06	Maintenance Needed
SW 05	Maintenance Needed
SW 04	Maintenance Needed
SW 03	-0.05
SW 02	Maintenance Needed
SW 01	Maintenance Needed
No meter	
44	-0.01
111	Maintenance Needed
No meter	
LCM 11	Maintenance Needed
LCM 12	Maintenance Needed
LCM 13	Maintenance Needed
LCM 14	Maintenance Needed
LCM 15	0
LCM 6	Maintenance Needed
LCM 7	Maintenance Needed
LCM 8	Maintenance Needed
LCM 9	-0.01
LCM 10	0
LCM 1	Maintenance Needed

LCM 2	Maintenance Needed
LCM 3	Maintenance Needed
LCM 4	0.25
LCM 5	0.25
#10 Tank Farm Canyon D	39 / 39 (100%)
D1	-0.25
D2	-0.25
CD3	Tank Not In Use/In Staging Area
CD4	Tank Not In Use/In Staging Area
D17	Maintenance Needed
D16	0.25
D15	Maintenance Needed
Meter not attached	
D14	0.25
D13	Maintenance Needed
No meter attached	
D12	-0.25
D11	Maintenance Needed
D10	-0.25
D9	Maintenance Needed
Meter not attached	
D8	-0.02
D7	Maintenance Needed
D6	Maintenance Needed
D5	Maintenance Needed

Meter not attached	
D4	Maintenance Needed
Meter not attached	
D3	-0.25
D18	-0.06
D19	-0.01
D20	-0.10
D21	Maintenance Needed
Meter not attached	
D22	Maintenance Needed
D23	Maintenance Needed
D24	-0.03
D25	Maintenance Needed
Meter not attached	
D26	0.25
D27	Maintenance Needed
D28	0.25
D29	Maintenance Needed
D30	-0.25
D31	Maintenance Needed
Meter not attached	
D32	Maintenance Needed
D/SW-01	Maintenance Needed
No meter	
D/SW-02	Maintenance Needed
No meter	

D/SW-03	Maintenance Needed
No meter	
D/SW-04	Maintenance Needed
No meter	
D/SW-05	Maintenance Needed
No meter	
#13 Tank Farm	160 / 160 (100%)
C13-08	0.08
C13-07	0
C13-06	-0.01
C13-05	0.02
C13-04	0.01
C13-03	0
C13-02	-0.02
C13-01	-0.25
C13-09	0.05
C13-10	-0.25
C13-11	0.06
C13-12	-0.10
C13-13	-0.20
C13-14	-0.25
C13-15	Maintenance Needed
C13-16	-0.25
T1/T2 190	Maintenance Needed
U13-63	0

U13-62	-0.01
U13-61	0
U13-60	-0.02
U13-59	Maintenance Needed
U13-58	-0.01
U13-57	-0.02
U13-56	-0.01
U13-55	-0.05
U13-54	-0.16
U13-53	-0.02
U13-52	Maintenance Needed
U13-51	Maintenance Needed
U13-50	-0.02
U13-49	-0.02
U13-48	-0.10
U13-47	-0.02
U13-46	0
U13-45	0
U13-44	0
U13-43	0
U13-42	0
U13-41	-0.01
U13-40	0
U13-39	0

U13-38	-0.01
U13-37	Maintenance Needed
Meter not attached	
U13-36	-0.02
U13-35	-0.02
U13-34	-0.03
U13-33	-0.04
U13-32	-0.02
U13-31	-0.05
U13-30	Maintenance Needed
Meter not attached	
U13-29	-0.03
U13-28	0
U13-27	-0.10
U13-26	-0.10
U13-25	-0.10
U13-24	-0.10
U13-23	-0.07
U13-22	-0.02
U13-21	-0.05
U13-20	Maintenance Needed
Meter not attached	
U13-19	-0.05
U13-18	0
U13-17	0

U13-16	0
U13-15	0
U13-14	0
U13-13	-0.20
U13-12	-0.25
U13-11	-0.25
U13-10	-0.25
U13-09	-0.20
U13-08	-0.25
U13-07	-0.25
U13-06	-0.04
U13-05	-0.25
U13-04	-0.15
U13-03	-0.01
U13-02	-0.02
U13-01	-0.25
L13-01	0.20
L13-02	-0.05
L13-03	-0.06
L13-04	-0.02
L13-05	0
L13-06	0
L13-07	-0.05
L13-08	-0.05

L13-09	-0.05
L13-10	0.05
L13-11	Maintenance Needed
Meter not attached	
L13-12	0
L13-13	0
L13-14	-0.01
L13-15	-0.06
L13-16	-0.06
L13-17	-0.06
L13-18	-0.07
L13-19	-0.06
L13-20	-0.05
L13-21	-0.06
L13-22	-0.04
L13-23	-0.04
L13-24	-0.06
L13-25	-0.01
L13-26	Maintenance Needed
Meter not attached	
L13-27	-0.04
L13-28	-0.07
L13-29	Maintenance Needed
Meter not attached	
L13-30	-0.05

L13-31	-0.01
L13-32	-0.05
L13-33	0.05
L13-34	-0.04
L13-35	-0.02
L13-36	-0.07
L13-37	-0.10
L13-38	-0.05
L13-39	-0.04
L13-40	-0.03
L13-41	-0.02
L13-42	-0.04
L13-43	-0.02
L13-44	Maintenance Needed
L13-45	0
L13-46	0
L13-47	0
L13-48	0
L13-49	0
L13-50	-0.01
L13-51	-0.01
L13-52	0
L13-53	-0.01
L13-54	-0.01

L13-55	0
L13-56	-0.01
L13-57	-0.01
L13-58	0
L13-59	0
L13-60	-0.04
L13-61	-0.15
L13-62	0
L13-63	-0.02
L13-64	-0.02
L13-65	-0.25
L13-66	0
L13-67	-0.02
L13-68	-0.04
L13-69	-0.05
L13-70	-0.03
L13-71	-0.07
L13-72	-0.07
L13-73	-0.25
L13-74	-0.01
L13-75	-0.06
L13-76	-0.02
L13-77	-0.02
L13-78	-0.05

L13-79	-0.01
L13-80	-0.02

Certification

Nancy Bahena Hernandez
5 Feb 2026 3:26 PM PST

4050 - Daily Pressure Gauge Readings

Nancy Bahena Hernandez

Complete

Score	224 / 224 (100%)	Flagged items	0	Actions	0

Site conducted	4050 - Chiquita Canyon Landfill -, Corporate (Overall), Western, Western/SO CA L/F
Conducted on	6 Feb 2026 11:48 AM PST
Prepared by	Nancy Bahena Hernandez

Pressure Gauge Readings	224 / 224 (100%)
#7 Tank Farm	25 / 25 (100%)
SW 08	Maintenance Needed
SW 07	Maintenance Needed
SW 06	Maintenance Needed
SW 05	Maintenance Needed
SW 04	Maintenance Needed
SW 03	-0.06
SW 02	Maintenance Needed
SW 01	Maintenance Needed
No meter	
44	-0.01
111	Maintenance Needed
No meter	
LCM 11	Maintenance Needed
LCM 12	Maintenance Needed
LCM 13	Maintenance Needed
LCM 14	Maintenance Needed
LCM 15	-0.01
LCM 6	Maintenance Needed
LCM 7	Maintenance Needed
LCM 8	Maintenance Needed
LCM 9	0
LCM 10	0
LCM 1	Maintenance Needed

LCM 2	Maintenance Needed
LCM 3	Maintenance Needed
LCM 4	0.25
LCM 5	0.13
#10 Tank Farm Canyon D	39 / 39 (100%)
D1	-0.25
D2	-0.25
CD3	Tank Not In Use/In Staging Area
CD4	Tank Not In Use/In Staging Area
D17	Maintenance Needed
D16	Maintenance Needed
D15	Maintenance Needed
Meter not attached	
D14	0.25
D13	Maintenance Needed
Meter not attached	
D12	-0.25
D11	Maintenance Needed
D10	-0.25
D9	Maintenance Needed
D8	-0.02
D7	0
D6	Maintenance Needed
D5	Maintenance Needed
Meter not attached	

D4	Maintenance Needed
Meter not attached	
D3	-0.25
D18	-0.05
D19	-0.01
D20	-0.08
D21	Maintenance Needed
Meter not attached	
D22	Maintenance Needed
D23	Maintenance Needed
D24	-0.05
D25	Maintenance Needed
Meter not attached	
D26	0.25
D27	Maintenance Needed
D28	0.25
D29	Maintenance Needed
D30	-0.25
D31	Maintenance Needed
Meter not attached	
D32	Maintenance Needed
D/SW-01	Maintenance Needed
No meter	
D/SW-02	Maintenance Needed
No meter	
D/SW-03	Maintenance Needed

No meter	
D/SW-04	Maintenance Needed
No meter	
D/SW-05	Maintenance Needed
No meter	
#13 Tank Farm	160 / 160 (100%)
C13-08	0.05
C13-07	-0.01
C13-06	-0.01
C13-05	-0.01
C13-04	0.02
C13-03	0.01
C13-02	0
C13-01	-0.02
C13-09	-0.25
C13-10	-0.25
C13-11	-0.25
C13-12	0.05
C13-13	-0.25
C13-14	-0.25
C13-15	Maintenance Needed
C13-16	-0.25
T1/T2 190	Maintenance Needed
Broken hose nipple	
U13-63	-0.02

U13-62	-0.02
U13-61	Maintenance Needed
U13-60	-0.02
U13-59	Maintenance Needed
U13-58	-0.02
U13-57	-0.01
U13-56	-0.01
U13-55	-0.05
U13-54	-0.15

Water inside meter

U13-53	-0.02
U13-52	-0.23
U13-51	Maintenance Needed
U13-50	-0.03
U13-49	-0.10
U13-48	-0.05
U13-47	-0.03
U13-46	-0.03
U13-45	0
U13-44	0
U13-43	0
U13-42	-0.02
U13-41	-0.01
U13-40	0

U13-39	-0.02
U13-38	-0.01
U13-37	Maintenance Needed
Meter not attached	
U13-36	-0.05
U13-35	-0.10
U13-34	-0.05
U13-33	-0.05
U13-32	-0.04
U13-31	-0.05
U13-30	Maintenance Needed
Meter not attached	
U13-29	-0.05
U13-28	-0.02
U13-27	-0.11
U13-26	-0.15
U13-25	-0.11
U13-24	-0.15
U13-23	-0.07
U13-22	-0.06
U13-21	-0.05
Meter not attached	
U13-20	Maintenance Needed
U13-19	-0.06
U13-18	-0.01

U13-17	-0.01
U13-16	-0.01
U13-15	-0.02
U13-14	-0.01
U13-13	-0.20
U13-12	-0.25
U13-11	-0.25
U13-10	-0.25
U13-09	-0.20
U13-08	-0.25
U13-07	-0.03
U13-06	-0.25
U13-05	-0.15
U13-04	-0.01
U13-03	-0.01
U13-02	-0.01
U13-01	-0.25
L13-01	-0.07
L13-02	-0.06
L13-03	-0.07
L13-04	-0.07
L13-05	-0.08
L13-06	-0.02
L13-07	0

L13-08	0
L13-09	-0.02
L13-10	-0.25
L13-11	Maintenance Needed
Meter not attached	
L13-12	-0.01
L13-13	0
L13-14	-0.01
L13-15	-0.07
L13-16	-0.07
L13-17	-0.07
L13-18	-0.07
L13-19	-0.07
L13-20	-0.06
L13-21	-0.07
L13-22	-0.05
L13-23	-0.05
L13-24	-0.07
L13-25	0
L13-26	Maintenance Needed
Meter not attached	
L13-27	-0.04
L13-28	-0.10
L13-29	Maintenance Needed
Meter not attached	

L13-30	-0.05
L13-31	0
L13-32	-0.05
L13-33	0.05
L13-34	-0.04
L13-35	-0.04
L13-36	-0.07
L13-37	-0.07
L13-38	-0.05
L13-39	-0.02
L13-40	-0.05
L13-41	-0.03
L13-42	-0.04
L13-43	-0.04
L13-44	Maintenance Needed
Broken hose nipple	
L13-45	-0.02
L13-46	-0.03
L13-47	-0.02
L13-48	-0.02
L13-49	-0.02
L13-50	0
L13-51	-0.01
L13-52	-0.01

L13-53	-0.03
L13-54	-0.02
L13-55	-0.01
L13-56	-0.02
L13-57	-0.03
L13-58	0
L13-59	-0.02
L13-60	-0.05
L13-61	-0.15
L13-62	-0.02
L13-63	0.01
L13-64	-0.05
L13-65	-0.20
L13-66	0.01
L13-67	-0.05
L13-68	-0.04
L13-69	-0.04
L13-70	-0.04
L13-71	-0.07
L13-72	-0.07
L13-73	-0.20
L13-74	-0.05
Water inside meter	
L13-75	-0.08

L13-76	-0.01
L13-77	-0.02
L13-78	-0.05
L13-79	-0.05
L13-80	-0.01

Certification

Nancy Bahena Hernandez
6 Feb 2026 5:15 PM PST

4050 - Daily Pressure Gauge Readings

John Boucher

Complete

Score	224 / 224 (100%)	Flagged items	0	Actions	0

Site conducted	4050 - Chiquita Canyon Landfill -, Corporate (Overall), Western, Western/SO CA L/F
Conducted on	7 Feb 2026 7:33 AM PST
Prepared by	John Boucher

Pressure Gauge Readings	224 / 224 (100%)
#7 Tank Farm	25 / 25 (100%)
SW 08	Maintenance Needed
SW 07	Maintenance Needed
SW 06	Maintenance Needed
SW 05	Maintenance Needed
SW 04	Maintenance Needed
SW 03	-0.06
SW 02	Maintenance Needed
SW 01	Maintenance Needed
44	-0.01
111	Maintenance Needed
LCM 11	Maintenance Needed
LCM 12	Maintenance Needed
LCM 13	Maintenance Needed
LCM 14	Maintenance Needed
LCM 15	-0.02
LCM 6	Maintenance Needed
LCM 7	Maintenance Needed
LCM 8	Maintenance Needed
LCM 9	-0.01
LCM 10	-0.01
LCM 1	0.15
LCM 2	Maintenance Needed

LCM 3	Maintenance Needed
LCM 4	0.25
LCM 5	-0.16
#10 Tank Farm Canyon D	39 / 39 (100%)
D1	-0.25
D2	-0.25
CD3	Tank Not In Use/In Staging Area
CD4	Tank Not In Use/In Staging Area
D17	Maintenance Needed
D16	Maintenance Needed
D15	Maintenance Needed
D14	0.25
D13	Maintenance Needed
D12	-0.25
D11	-0.13
D10	0.25
D9	Maintenance Needed
D8	Maintenance Needed
D7	-0.01
D6	Maintenance Needed
D5	Maintenance Needed
D4	Maintenance Needed
D3	-0.25
D18	-0.05

D19	-0.03
D20	-0.13
D21	Maintenance Needed
D22	Maintenance Needed
D23	Maintenance Needed
D24	-0.04
D25	Maintenance Needed
D26	0.25
D27	Maintenance Needed
D28	0.25
D29	Maintenance Needed
D30	-0.25
D31	Maintenance Needed
D32	-0.01
D/SW-01	Tank Not In Use/In Staging Area
D/SW-02	Tank Not In Use/In Staging Area
D/SW-03	Tank Not In Use/In Staging Area
D/SW-04	Tank Not In Use/In Staging Area
D/SW-05	Tank Not In Use/In Staging Area
#13 Tank Farm	160 / 160 (100%)
C13-08	0.06
C13-07	-0.03
C13-06	-0.03
C13-05	-0.03

C13-04	0
C13-03	0
C13-02	0
C13-01	-0.04
C13-09	-0.25
C13-10	-0.25
C13-11	-0.25
C13-12	0.05
C13-13	-0.25
C13-14	-0.25
C13-15	-0.04
C13-16	-0.25
T1/T2 190	Maintenance Needed
U13-63	-0.02
U13-62	-0.03
U13-61	-0.01
U13-60	-0.01
U13-59	Maintenance Needed
U13-58	-0.01
U13-57	-0.02
U13-56	-0.02
U13-55	-0.05
U13-54	0.14
U13-53	-0.03

U13-52	-0.20
U13-51	Maintenance Needed
U13-50	-0.06
U13-49	-0.02
U13-48	-0.07
U13-47	-0.03
U13-46	0
U13-45	0
U13-44	-0.23
U13-43	0.05
U13-42	-0.04
U13-41	-0.02
U13-40	0
U13-39	-0.01
U13-38	-0.01
U13-37	Maintenance Needed
U13-36	-0.03
U13-35	-0.02
U13-34	-0.03
U13-33	-0.04
U13-32	-0.02
U13-31	-0.05
U13-30	Maintenance Needed
U13-29	-0.02

U13-28	-0.01
U13-27	-0.05
U13-26	-0.08
U13-25	0.04
U13-24	-0.08
U13-23	-0.04
U13-22	-0.05
U13-21	-0.03
U13-20	Maintenance Needed
U13-19	-0.04
U13-18	-0.03
U13-17	-0.05
U13-16	-0.10
U13-15	-0.03
U13-14	-0.02
U13-13	-0.03
U13-12	-0.25
U13-11	-0.25
U13-10	-0.25
U13-09	-0.10
U13-08	-0.25
U13-07	-0.25
U13-06	-0.04
U13-05	-0.25

U13-04	-0.10
U13-03	-0.03
U13-02	-0.07
U13-01	-0.25
L13-01	-0.05
L13-02	-0.04
L13-03	-0.05
L13-04	-0.04
L13-05	-0.05
L13-06	0
L13-07	-0.04
L13-08	-0.03
L13-09	-0.03
L13-10	0.03
L13-11	Maintenance Needed
L13-12	-0.01
L13-13	-0.03
L13-14	0
L13-15	0.25
L13-16	0.25
L13-17	-0.06
L13-18	-0.05
L13-19	-0.04
L13-20	-0.03

L13-21	-0.05
L13-22	-0.03
L13-23	-0.01
L13-24	-0.02
L13-25	-0.04
L13-26	Maintenance Needed
L13-27	-0.04
L13-28	-0.03
L13-29	Maintenance Needed
L13-30	-0.05
L13-31	-0.03
L13-32	-0.04
L13-33	0.02
L13-34	-0.03
L13-35	-0.03
L13-36	-0.04
L13-37	-0.08
L13-38	-0.05
L13-39	-0.04
L13-40	-0.04
L13-41	-0.03
L13-42	-0.02
L13-43	-0.03
L13-44	0

L13-45	-0.03
L13-46	-0.02
L13-47	-0.03
L13-48	-0.03
L13-49	-0.01
L13-50	-0.04
L13-51	-0.01
L13-52	-0.01
L13-53	-0.01
L13-54	-0.04
L13-55	-0.02
L13-56	-0.01
L13-57	-0.03
L13-58	-0.01
L13-59	0
L13-60	0
L13-61	-0.15
L13-62	-0.01
L13-63	-0.05
L13-64	-0.02
L13-65	-0.01
L13-66	-0.23
L13-67	-0.03
L13-68	-0.03

L13-69	-0.04
L13-70	-0.03
L13-71	-0.05
L13-72	-0.05
L13-73	-0.15
L13-74	-0.03
L13-75	-0.05
L13-76	-0.05
L13-77	-0.03
L13-78	-0.05
L13-79	-0.02
L13-80	-0.03

Certification

John Boucher
7 Feb 2026 10:21 AM PST

4050 - Daily Pressure Gauge Readings

Tom Roe

Complete

Score	224 / 224 (100%)	**Flagged items**	0	**Actions**	0

Site conducted	Marked as ‘my site is not listed here’
Conducted on	8 Feb 2026 7:47 AM PST
Prepared by	Tom Roe

Pressure Gauge Readings	224 / 224 (100%)
#7 Tank Farm	25 / 25 (100%)
SW 08	Maintenance Needed
SW 07	Maintenance Needed
SW 06	Maintenance Needed
SW 05	Maintenance Needed
SW 04	Maintenance Needed
SW 03	-0.06
SW 02	Maintenance Needed
SW 01	Maintenance Needed
44	-0.03
111	Maintenance Needed
LCM 11	Maintenance Needed
LCM 12	Maintenance Needed
LCM 13	Maintenance Needed
LCM 14	Maintenance Needed
LCM 15	-0.03
LCM 6	Maintenance Needed
LCM 7	Maintenance Needed
LCM 8	Maintenance Needed
LCM 9	-0.01
LCM 10	-0.01
LCM 1	0.12
LCM 2	Maintenance Needed

LCM 3	Maintenance Needed
LCM 4	0.25
LCM 5	0.20
#10 Tank Farm Canyon D	39 / 39 (100%)
D1	-0.25
D2	-0.25
CD3	Maintenance Needed
CD4	Maintenance Needed
D17	Maintenance Needed
D16	Maintenance Needed
D15	Maintenance Needed
D14	0.05
D13	Maintenance Needed
D12	-0.25
D11	Maintenance Needed
D10	0.08
D9	Maintenance Needed
D8	Maintenance Needed
D7	Maintenance Needed
D6	Maintenance Needed
D5	Maintenance Needed
D4	Maintenance Needed
D3	-0.25
D18	-0.06

D19	-0.02
D20	-0.11
D21	Maintenance Needed
D22	Maintenance Needed
D23	Maintenance Needed
D24	-0.04
D25	Maintenance Needed
D26	0.25
D27	Maintenance Needed
D28	0.25
D29	Maintenance Needed
D30	-0.25
D31	Maintenance Needed
D32	Maintenance Needed
D/SW-01	Maintenance Needed
D/SW-02	Maintenance Needed
D/SW-03	Maintenance Needed
D/SW-04	Maintenance Needed
D/SW-05	Maintenance Needed
#13 Tank Farm	160 / 160 (100%)
C13-08	0.06
C13-07	-0.02
C13-06	-0.03
C13-05	-0.03

C13-04	0.01
C13-03	0
C13-02	-0.02
C13-01	-0.04
C13-09	-0.25
C13-10	-0.25
C13-11	-0.25
C13-12	0.05
C13-13	-0.25
C13-14	-0.25
C13-15	Maintenance Needed
C13-16	-0.25
T1/T2 190	Maintenance Needed
U13-63	Maintenance Needed
U13-62	-0.03
U13-61	-0.02
U13-60	-0.02
U13-59	Maintenance Needed
U13-58	-0.02
U13-57	-0.03
U13-56	-0.03
U13-55	-0.05
U13-54	0.14
U13-53	-0.01

U13-52	Maintenance Needed
U13-51	Maintenance Needed
U13-50	-0.04
U13-49	-0.02
U13-48	-0.05
U13-47	-0.02
U13-46	-0.01
U13-45	0
U13-44	0.08
U13-43	0.01
U13-42	-0.04
U13-41	-0.02
U13-40	0
U13-39	-0.02
U13-38	-0.02
U13-37	Maintenance Needed
U13-36	-0.04
U13-35	-0.03
U13-34	-0.04
U13-33	-0.04
U13-32	-0.02
U13-31	-0.05
U13-30	Maintenance Needed
U13-29	-0.02

U13-28	-0.01
U13-27	-0.07
U13-26	-0.10
U13-25	-0.06
U13-24	-0.12
U13-23	-0.06
U13-22	-0.04
U13-21	-0.05
U13-20	Maintenance Needed
U13-19	-0.05
U13-18	-0.03
U13-17	-0.06
U13-16	-0.12
U13-15	-0.04
U13-14	-0.03
U13-13	-0.03
U13-12	-0.25
U13-11	-0.25
U13-10	-0.25
U13-09	-0.18
U13-08	-0.25
U13-07	-0.25
U13-06	-0.05
U13-05	-0.25

U13-04	-0.12
U13-03	Tank Not In Use/In Staging Area
U13-02	-0.09
U13-01	-0.25
L13-01	-0.06
L13-02	-0.04
L13-03	-0.06
L13-04	-0.05
L13-05	-0.04
L13-06	-0.01
L13-07	-0.04
L13-08	-0.04
L13-09	-0.04
L13-10	0.03
L13-11	Maintenance Needed
L13-12	0
L13-13	-0.03
L13-14	-0.01
L13-15	-0.04
L13-16	-0.05
L13-17	-0.05
L13-18	-0.05
L13-19	-0.04
L13-20	-0.03

L13-21	-0.05
L13-22	-0.03
L13-23	0
L13-24	0.25
L13-25	0.05
L13-26	Maintenance Needed
L13-27	-0.03
L13-28	-0.02
L13-29	Maintenance Needed
L13-30	-0.05
L13-31	-0.02
L13-32	-0.04
L13-33	0.03
L13-34	-0.03
L13-35	-0.02
L13-36	-0.05
L13-37	-0.08
L13-38	-0.06
L13-39	-0.03
L13-40	-0.04
L13-41	-0.02
L13-42	-0.02
L13-43	-0.03
L13-44	-0.01

L13-45	-0.03
L13-46	-0.03
L13-47	-0.04
L13-48	-0.03
L13-49	-0.02
L13-50	-0.02
L13-51	-0.02
L13-52	-0.01
L13-53	-0.02
L13-54	-0.05
L13-55	-0.02
L13-56	-0.03
L13-57	-0.03
L13-58	0
L13-59	-0.03
L13-60	-0.03
L13-61	-0.14
L13-62	0
L13-63	-0.05
L13-64	-0.02
L13-65	-0.15
L13-66	0
L13-67	Maintenance Needed
L13-68	-0.03

L13-69	-0.04
L13-70	-0.02
L13-71	-0.05
L13-72	-0.05
L13-73	-0.14
L13-74	-0.05
L13-75	-0.05
L13-76	-0.02
L13-77	-0.03
L13-78	-0.05
L13-79	-0.01
L13-80	-0.03

Certification

Tom Roe
8 Feb 2026 9:55 AM PST

4050 - Daily Pressure Gauge Readings

Nancy Bahena Hernandez

Complete

Score	224 / 224 (100%)	**Flagged items**	0	**Actions**	0

Site conducted	4050 - Chiquita Canyon Landfill -, Corporate (Overall), Western, Western/SO CA L/F
Conducted on	9 Feb 2026 11:43 AM PST
Prepared by	Nancy Bahena Hernandez

Pressure Gauge Readings	224 / 224 (100%)
#7 Tank Farm	25 / 25 (100%)
SW 08	Maintenance Needed
SW 07	Maintenance Needed
SW 06	Maintenance Needed
SW 05	Maintenance Needed
SW 04	Maintenance Needed
SW 03	-0.07
SW 02	Maintenance Needed
SW 01	Maintenance Needed
No meter	
44	-0.02
111	Maintenance Needed
No meter	
LCM 11	Maintenance Needed
LCM 12	Maintenance Needed
LCM 13	Maintenance Needed
LCM 14	Maintenance Needed
LCM 15	0
LCM 6	Maintenance Needed
LCM 7	Maintenance Needed
LCM 8	Maintenance Needed
LCM 9	0
LCM 10	0
LCM 1	Maintenance Needed

LCM 2	Maintenance Needed
LCM 3	Maintenance Needed
LCM 4	0.24
LCM 5	0.10
#10 Tank Farm Canyon D	39 / 39 (100%)
D1	-0.15
D2	-0.25
CD3	Maintenance Needed
CD4	Maintenance Needed
D17	Maintenance Needed
D16	Maintenance Needed
D15	Maintenance Needed
D14	-0.01
D13	Maintenance Needed
Meter not attached	
D12	-0.25
D11	Maintenance Needed
D10	-0.25
D9	Maintenance Needed
Meter not attached	
D8	Maintenance Needed
D7	Maintenance Needed
D6	Maintenance Needed
D5	Maintenance Needed
Meter not attached	

D4	Maintenance Needed
Meter not attached	
D3	-0.25
D18	Maintenance Needed
D19	-0.01
D20	-0.12
D21	Maintenance Needed
Meter not attached	
D22	-0.01
D23	0
D24	-0.04
D25	Maintenance Needed
Meter not attached	
D26	0.25
D27	Maintenance Needed
D28	0.25
D29	Maintenance Needed
D30	-0.25
D31	Maintenance Needed
Meter not attached	
D32	Maintenance Needed
D/SW-01	Maintenance Needed
No meter	
D/SW-02	Maintenance Needed
No meter	
D/SW-03	Maintenance Needed

No meter	
D/SW-04	Maintenance Needed
No meter	
D/SW-05	Maintenance Needed
No meter	
#13 Tank Farm	160 / 160 (100%)
C13-08	-0.05
C13-07	-0.03
C13-06	-0.03
C13-05	-0.01
C13-04	-0.01
C13-03	-0.01
C13-02	0
C13-01	-0.03
C13-09	-0.25
C13-10	-0.25
C13-11	-0.25
C13-12	-0.03
C13-13	-0.25
C13-14	-0.25
C13-15	Maintenance Needed
C13-16	-0.25
T1/T2 190	Maintenance Needed
Broken hose nipple	
U13-63	Maintenance Needed

U13-62	-0.02
U13-61	0
U13-60	Maintenance Needed
U13-59	0
U13-58	-0.02
U13-57	-0.01
U13-56	-0.04
U13-55	-0.15
U13-54	-0.04
U13-53	Maintenance Needed
U13-52	Maintenance Needed
U13-51	Maintenance Needed
U13-50	0
U13-49	-0.05
U13-48	-0.05
U13-47	-0.02
U13-46	-0.02
U13-45	0
U13-44	0
U13-43	0
U13-42	-0.02
U13-41	-0.02
U13-40	0
U13-39	0

U13-38	-0.01
U13-37	Maintenance Needed
Meter not attached	
U13-36	-0.04
U13-35	-0.15
U13-34	-0.05
U13-33	-0.05
U13-32	-0.02
U13-31	-0.04
U13-30	Maintenance Needed
Meter not attached	
U13-29	-0.02
U13-28	-0.01
U13-27	-0.06
U13-26	-0.10
U13-25	-0.05
U13-24	-0.12
U13-23	-0.05
U13-22	-0.02
U13-21	-0.04
U13-20	Maintenance Needed
Meter not attached	
U13-19	-0.05
U13-18	-0.02
U13-17	-0.04

U13-16	-0.10
U13-15	-0.02
U13-14	-0.02
U13-13	-0.02
U13-12	-0.25
U13-11	-0.25
U13-10	-0.25
U13-09	-0.10
U13-08	-0.25
U13-07	-0.25
U13-06	-0.05
U13-05	-0.25
U13-04	-0.11
U13-03	-0.02
U13-02	-0.10
U13-01	-0.25
L13-01	-0.05
L13-02	-0.04
L13-03	-0.05
L13-04	-0.05
L13-05	-0.05
L13-06	0
L13-07	-0.05
L13-08	-0.05

L13-09	-0.03
L13-10	0.05
L13-11	Maintenance Needed
Meter not attached	
L13-12	0
L13-13	0
L13-14	-0.01
L13-15	-0.05
L13-16	-0.06
L13-17	-0.06
L13-18	-0.05
L13-19	-0.05
L13-20	-0.05
L13-21	-0.06
L13-22	-0.03
L13-23	-0.03
L13-24	-0.05
L13-25	0
L13-26	Maintenance Needed
Meter not attached	
L13-27	-0.01
L13-28	-0.05
L13-29	Maintenance Needed
Meter not attached	
L13-30	-0.05

L13-31	-0.01
L13-32	-0.05
L13-33	0.02
L13-34	-0.02
L13-35	-0.02
L13-36	-0.06
L13-37	-0.07
L13-38	-0.05
L13-39	-0.02
L13-40	-0.03
L13-41	-0.02
L13-42	-0.02
L13-43	-0.02
L13-44	Maintenance Needed
L13-45	-0.01
L13-46	-0.02
L13-47	-0.02
L13-48	-0.01
L13-49	-0.01
L13-50	-0.01
L13-51	0
L13-52	0
L13-53	0
L13-54	-0.01

L13-55	-0.01
L13-56	-0.01
L13-57	-0.01
L13-58	0
L13-59	0
L13-60	0
L13-61	-0.13
L13-62	0.01
L13-63	0
L13-64	0.01
L13-65	-0.20
L13-66	0
L13-67	-0.02
L13-68	-0.02
L13-69	-0.02
L13-70	-0.02
L13-71	-0.05
L13-72	-0.05
L13-73	-0.25
L13-74	-0.01
L13-75	-0.05
L13-76	-0.05
L13-77	-0.03
L13-78	-0.05

L13-79	-0.02
L13-80	-0.03

Certification

Nancy Bahena Hernandez
9 Feb 2026 5:00 PM PST

4050 - Daily Pressure Gauge Readings

Nancy Bahena Hernandez

Complete

Score	224 / 224 (100%)	Flagged items	0	Actions	0

Site conducted	4050 - Chiquita Canyon Landfill -, Corporate (Overall), Western, Western/SO CA L/F
Conducted on	10 Feb 2026 8:47 AM PST
Prepared by	Nancy Bahena Hernandez

Pressure Gauge Readings	224 / 224 (100%)
#7 Tank Farm	25 / 25 (100%)
SW 08	Maintenance Needed
SW 07	Maintenance Needed
SW 06	Maintenance Needed
SW 05	Maintenance Needed
SW 04	Maintenance Needed
SW 03	-0.06
SW 02	Maintenance Needed
SW 01	Maintenance Needed
No meter	
44	-0.02
111	Maintenance Needed
No meter	
LCM 11	Maintenance Needed
LCM 12	Maintenance Needed
LCM 13	Maintenance Needed
LCM 14	Maintenance Needed
LCM 15	-0.01
LCM 6	Maintenance Needed
LCM 7	Maintenance Needed
LCM 8	Maintenance Needed
LCM 9	-0.01
LCM 10	-0.02
LCM 1	Maintenance Needed

LCM 2	Maintenance Needed
LCM 3	Maintenance Needed
LCM 4	0.25
LCM 5	0.13
#10 Tank Farm Canyon D	39 / 39 (100%)
D1	-0.25
D2	-0.25
CD3	Maintenance Needed
CD4	Maintenance Needed
D17	Maintenance Needed
D16	Maintenance Needed
D15	Maintenance Needed
Meter not attached	
D14	0
D13	Maintenance Needed
Meter not attached	
D12	-0.25
D11	Maintenance Needed
D10	-0.25
D9	Maintenance Needed
Meter not attached	
D8	Maintenance Needed
D7	0
D6	Maintenance Needed
D5	Maintenance Needed

Meter not attached	
D4	Maintenance Needed
Meter not attached	
D3	-0.25
D18	Maintenance Needed
D19	0
D20	-0.11
D21	Maintenance Needed
Meter not attached / damaged	
D22	Maintenance Needed
D23	Maintenance Needed
D24	-0.05
D25	Maintenance Needed
Meter not attached	
D26	0.25
D27	Maintenance Needed
D28	0.25
D29	Maintenance Needed
D30	-0.25
D31	Maintenance Needed
Meter not attached	
D32	Maintenance Needed
D/SW-01	Maintenance Needed
No meter	
D/SW-02	Maintenance Needed
No meter	

D/SW-03	Maintenance Needed
No meter	
D/SW-04	Maintenance Needed
No meter	
D/SW-05	Maintenance Needed
No meter	
#13 Tank Farm	160 / 160 (100%)
C13-08	0.05
C13-07	-0.02
C13-06	-0.02
C13-05	-0.03
C13-04	0
C13-03	0
C13-02	-0.01
C13-01	-0.05
C13-09	-0.25
C13-10	0.10
C13-11	-0.25
C13-12	0.05
C13-13	-0.10
C13-14	-0.25
C13-15	Maintenance Needed
C13-16	-0.25
T1/T2 190	Maintenance Needed
U13-63	-0.02

U13-62	-0.03
U13-61	0
U13-60	0
U13-59	0
U13-58	0
U13-57	-0.01
U13-56	-0.02
U13-55	-0.05
U13-54	0.03
U13-53	-0.02
U13-52	-0.20
U13-51	Maintenance Needed
U13-50	-0.01
U13-49	-0.02
U13-48	-0.02
U13-47	-0.03
U13-46	0
U13-45	-0.02
U13-44	0
U13-43	0
U13-42	-0.03
U13-41	-0.03
U13-40	0
U13-39	-0.01

U13-38	-0.01
U13-37	Maintenance Needed
Meter not attached	
U13-36	-0.03
U13-35	-0.03
U13-34	-0.04
U13-33	-0.04
U13-32	-0.02
U13-31	-0.05
U13-30	Maintenance Needed
Meter not attached	
U13-29	-0.01
U13-28	0
U13-27	-0.02
U13-26	-0.05
U13-25	-0.01
U13-24	-0.06
U13-23	-0.04
U13-22	-0.03
U13-21	-0.05
U13-20	Maintenance Needed
Meter not attached	
U13-19	-0.05
U13-18	-0.01
U13-17	-0.05

U13-16	-0.10
U13-15	-0.04
U13-14	-0.02
U13-13	-0.02
U13-12	-0.25
U13-11	-0.25
U13-10	-0.25
U13-09	-0.15
U13-08	-0.25
U13-07	-0.25
U13-06	-0.05
U13-05	-0.25
U13-04	-0.12
U13-03	-0.05
U13-02	-0.10
U13-01	-0.25
L13-01	-0.05
L13-02	-0.05
L13-03	-0.06
L13-04	-0.05
L13-05	-0.07
L13-06	-0.01
L13-07	-0.05
L13-08	-0.05

L13-09	-0.05
L13-10	0.05
L13-11	Maintenance Needed
Meter not attached	
L13-12	-0.03
L13-13	-0.02
L13-14	-0.01
L13-15	-0.05
L13-16	-0.07
L13-17	-0.05
L13-18	-0.06
L13-19	-0.05
L13-20	0.05
L13-21	0.01
L13-22	0.01
L13-23	0.01
L13-24	-0.05
L13-25	-0.01
L13-26	Maintenance Needed
Meter not attached	
L13-27	-0.01
L13-28	-0.06
L13-29	Maintenance Needed
Meter not attached	
L13-30	-0.07

L13-31	-0.01
L13-32	-0.05
L13-33	0.01
L13-34	-0.02
L13-35	-0.02
L13-36	-0.05
L13-37	-0.08
L13-38	-0.05
L13-39	-0.04
L13-40	-0.04
L13-41	-0.02
L13-42	-0.02
L13-43	-0.03
L13-44	Maintenance Needed
L13-45	-0.01
L13-46	-0.05
L13-47	-0.02
L13-48	-0.03
L13-49	-0.02
L13-50	-0.03
L13-51	-0.01
L13-52	0
L13-53	-0.01
L13-54	-0.01

L13-55	-0.01
L13-56	-0.01
L13-57	-0.02
L13-58	0
L13-59	-0.02
L13-60	-0.02
L13-61	-0.10
L13-62	0
L13-63	-0.02
L13-64	-0.02
L13-65	-0.12
L13-66	-0.01
L13-67	-0.05
Needs new tape	
L13-68	-0.02
L13-69	-0.05
L13-70	-0.02
L13-71	-0.06
L13-72	-0.05
L13-73	-0.20
L13-74	-0.05
L13-75	-0.05
L13-76	-0.03
L13-77	-0.01

L13-78	-0.05
L13-79	-0.02
L13-80	-0.02

Certification

Nancy Bahena Hernandez
10 Feb 2026 3:10 PM PST

4050 - Daily Pressure Gauge Readings

Nancy Bahena Hernandez

Complete

Score	224 / 224 (100%)	Flagged items	0	Actions	0

Site conducted	4050 - Chiquita Canyon Landfill -, Corporate (Overall), Western, Western/SO CA L/F
Conducted on	11 Feb 2026 2:36 PM PST
Prepared by	Nancy Bahena Hernandez

Pressure Gauge Readings	224 / 224 (100%)
#7 Tank Farm	25 / 25 (100%)
SW 08	Maintenance Needed
SW 07	Maintenance Needed
SW 06	Maintenance Needed
SW 05	Maintenance Needed
SW 04	Maintenance Needed
SW 03	-0.06
SW 02	Maintenance Needed
SW 01	Maintenance Needed
No meter	
44	-0.15
111	Maintenance Needed
No meter	
LCM 11	Maintenance Needed
LCM 12	Maintenance Needed
LCM 13	Maintenance Needed
LCM 14	Maintenance Needed
LCM 15	-0.02
LCM 6	Maintenance Needed
LCM 7	Maintenance Needed
LCM 8	Maintenance Needed
LCM 9	-0.10
LCM 10	-0.03
LCM 1	Maintenance Needed

LCM 2	Maintenance Needed
LCM 3	Maintenance Needed
LCM 4	0.25
LCM 5	0.25
#10 Tank Farm Canyon D	39 / 39 (100%)
D1	-0.25
D2	-0.07
CD3	Maintenance Needed
CD4	Maintenance Needed
D17	Maintenance Needed
D16	Maintenance Needed
D15	Maintenance Needed
Meter not attached	
D14	0.02
D13	Maintenance Needed
Meter not attached	
D12	-0.25
D11	Maintenance Needed
D10	-0.25
D9	Maintenance Needed
Meter not attached	
D8	Maintenance Needed
D7	Maintenance Needed
D6	-0.01
D5	Maintenance Needed

Meter not attached	
D4	Maintenance Needed
Meter not attached	
D3	-0.25
D18	Maintenance Needed
D19	Maintenance Needed
D20	-0.12
D21	Maintenance Needed
Meter not attached	
D22	Maintenance Needed
D23	Maintenance Needed
D24	-0.05
D25	Maintenance Needed
Meter not attached	
D26	0.11
D27	Maintenance Needed
D28	0.25
D29	Maintenance Needed
D30	Maintenance Needed
D31	Maintenance Needed
Meter not attached	
D32	Maintenance Needed
D/SW-01	Maintenance Needed
No meter	
D/SW-02	Maintenance Needed
No meter	

D/SW-03	Maintenance Needed
No meter	
D/SW-04	Maintenance Needed
No meter	
D/SW-05	Maintenance Needed
No meter	
#13 Tank Farm	160 / 160 (100%)
C13-08	0.06
C13-07	-0.02
C13-06	-0.01
C13-05	-0.01
C13-04	0
C13-03	0
C13-02	0
C13-01	-0.02
C13-09	-0.25
C13-10	-0.20
C13-11	-0.25
C13-12	0.05
C13-13	-0.25
C13-14	-0.25
C13-15	Maintenance Needed
C13-16	-0.25
T1/T2 190	Maintenance Needed
U13-63	Maintenance Needed

U13-62	-0.15
U13-61	-0.01
U13-60	-0.02
U13-59	-0.02
U13-58	-0.01
U13-57	-0.02
U13-56	-0.02
U13-55	-0.05
U13-54	-0.03
U13-53	-0.05
U13-52	Maintenance Needed
U13-51	Maintenance Needed
U13-50	-0.10
U13-49	-0.05
U13-48	-0.06
U13-47	-0.02
U13-46	0
U13-45	-0.02
U13-44	0
U13-43	0
U13-42	Maintenance Needed
U13-41	-0.02
U13-40	-0.02
U13-39	-0.01

U13-38	-0.01
U13-37	Maintenance Needed
Meter not attached	
U13-36	-0.05
U13-35	-0.05
U13-34	-0.05
U13-33	-0.05
U13-32	-0.04
U13-31	-0.20
U13-30	Maintenance Needed
Meter not attached	
U13-29	-0.04
U13-28	-0.02
U13-27	-0.06
U13-26	-0.10
U13-25	-0.07
U13-24	-0.10
U13-23	-0.06
U13-22	-0.06
U13-21	-0.05
U13-20	Maintenance Needed
Meter not attached	
U13-19	-0.05
U13-18	-0.02
U13-17	-0.05

U13-16	-0.08
U13-15	-0.05
U13-14	-0.03
U13-13	-0.01
U13-12	-0.25
U13-11	-0.25
U13-10	-0.25
U13-09	-0.10
U13-08	-0.25
U13-07	-0.25
U13-06	-0.03
U13-05	-0.25
U13-04	-0.10
U13-03	-0.02
U13-02	-0.07
U13-01	-0.25
L13-01	-0.05
L13-02	-0.01
L13-03	-0.05
L13-04	-0.02
L13-05	-0.02
L13-06	-0.20
L13-07	-0.04
L13-08	-0.06

L13-09	-0.05
L13-10	0.02
L13-11	Maintenance Needed
Meter not attached	
L13-12	-0.02
L13-13	0
L13-14	-0.03
L13-15	-0.05
L13-16	-0.06
L13-17	-0.02
L13-18	-0.02
L13-19	-0.01
L13-20	0.02
L13-21	-0.01
L13-22	0.01
L13-23	0.15
L13-24	-0.05
L13-25	-0.04
L13-26	Maintenance Needed
Meter not attached	
L13-27	-0.04
L13-28	-0.05
L13-29	Maintenance Needed
Meter not attached	
L13-30	-0.05

L13-31	0.25
L13-32	-0.07
L13-33	0.25
L13-34	-0.05
L13-35	-0.02
L13-36	-0.09
L13-37	-0.10
L13-38	-0.06
L13-39	-0.03
L13-40	-0.04
L13-41	-0.02
L13-42	-0.03
L13-43	-0.05
L13-44	Maintenance Needed
L13-45	-0.02
L13-46	-0.05
L13-47	-0.04
L13-48	-0.02
L13-49	-0.02
L13-50	-0.05
L13-51	-0.02
L13-52	-0.01
L13-53	-0.02
L13-54	-0.03

L13-55	0
L13-56	-0.02
L13-57	-0.03
L13-58	-0.03
L13-59	-0.02
L13-60	-0.02
L13-61	-0.15
L13-62	0
L13-63	-0.05
L13-64	-0.02
L13-65	-0.20
L13-66	0
L13-67	Maintenance Needed

Meter not attached

L13-68	-0.02
L13-69	-0.02
L13-70	-0.02
L13-71	-0.05
L13-72	-0.02
L13-73	-0.17
L13-74	-0.01
L13-75	-0.05
L13-76	-0.05
L13-77	-0.04

L13-78	-0.05
L13-79	-0.02
L13-80	-0.05

Certification

Nancy Bahena Hernandez
11 Feb 2026 4:50 PM PST

4050 - Daily Pressure Gauge Readings

Nancy Bahena Hernandez

Complete

Score	224 / 224 (100%)	**Flagged items**	0	**Actions**	0

Site conducted	4050 - Chiquita Canyon Landfill -, Corporate (Overall), Western, Western/SO CA L/F
Conducted on	12 Feb 2026 10:52 AM PST
Prepared by	Nancy Bahena Hernandez

Pressure Gauge Readings	224 / 224 (100%)
#7 Tank Farm	25 / 25 (100%)
SW 08	Maintenance Needed
SW 07	Maintenance Needed
SW 06	Maintenance Needed
SW 05	Maintenance Needed
SW 04	Maintenance Needed
SW 03	-0.04
SW 02	Maintenance Needed
SW 01	Maintenance Needed
No meter	
44	Maintenance Needed
No meter	
111	Maintenance Needed
No meter	
LCM 11	Maintenance Needed
LCM 12	Maintenance Needed
LCM 13	Maintenance Needed
LCM 14	Maintenance Needed
LCM 15	-0.01
LCM 6	Maintenance Needed
LCM 7	Maintenance Needed
LCM 8	Maintenance Needed
LCM 9	-0.03
LCM 10	-0.02

LCM 1	Maintenance Needed
LCM 2	Maintenance Needed
LCM 3	Maintenance Needed
LCM 4	0.25
LCM 5	0.15
#10 Tank Farm Canyon D	39 / 39 (100%)
D1	-0.25
D2	-0.06
CD3	Maintenance Needed
CD4	Maintenance Needed
D17	Maintenance Needed
D16	Maintenance Needed
D15	Maintenance Needed
Meter not attached	
D14	0.04
D13	Maintenance Needed
Meter not attached	
D12	-0.25
D11	Maintenance Needed
D10	0.10
D9	Maintenance Needed
Meter not attached	
D8	Maintenance Needed
D7	Maintenance Needed
D6	Maintenance Needed

D5	Maintenance Needed
Meter not attached	
D4	Maintenance Needed
Meter not attached	
D3	-0.25
D18	Maintenance Needed
D19	Maintenance Needed
D20	-0.11
D21	Maintenance Needed
Meter not attached	
D22	Maintenance Needed
D23	-0.01
D24	-0.03
D25	Maintenance Needed
Meter not attached	
D26	0.25
D27	Maintenance Needed
D28	0.25
D29	Maintenance Needed
D30	Maintenance Needed
D31	Maintenance Needed
Meter not attached	
D32	Maintenance Needed
D/SW-01	Maintenance Needed
No meter	
D/SW-02	Maintenance Needed

No meter	
D/SW-03	Maintenance Needed
No meter	
D/SW-04	Maintenance Needed
No meter	
D/SW-05	Maintenance Needed
No meter	
#13 Tank Farm	160 / 160 (100%)
C13-08	0.06
C13-07	-0.01
C13-06	-0.02
C13-05	-0.01
C13-04	0.01
C13-03	0.01
C13-02	-0.01
C13-01	-0.01
C13-09	-0.25
C13-10	-0.25
C13-11	-0.25
C13-12	0.05
C13-13	-0.20
C13-14	-0.25
C13-15	Maintenance Needed
C13-16	-0.25
T1/T2 190	Maintenance Needed

U13-63	Maintenance Needed
U13-62	-0.01
U13-61	0
U13-60	-0.02
U13-59	-0.01
U13-58	-0.01
U13-57	-0.02
U13-56	-0.02
U13-55	-0.05
U13-54	-0.10
U13-53	-0.05
U13-52	Maintenance Needed
U13-51	Maintenance Needed
U13-50	-0.02
U13-49	-0.02
U13-48	-0.06
U13-47	-0.05
U13-46	-0.02
U13-45	-0.02
U13-44	-0.01
U13-43	0
U13-42	Maintenance Needed
U13-41	-0.02
U13-40	-0.02

U13-39	-0.02
U13-38	-0.02
U13-37	Maintenance Needed
Meter not attached	
U13-36	-0.06
U13-35	-0.05
U13-34	-0.05
U13-33	-0.05
U13-32	-0.04
U13-31	-0.25
U13-30	Maintenance Needed
Meter not attached	
U13-29	-0.02
U13-28	-0.02
U13-27	-0.07
U13-26	-0.10
U13-25	-0.08
U13-24	-0.10
U13-23	-0.05
U13-22	-0.05
U13-21	-0.05
U13-20	Maintenance Needed
Meter not attached	
U13-19	-0.05
U13-18	-0.04

U13-17	-0.05
U13-16	-0.10
U13-15	-0.02
U13-14	-0.02
U13-13	-0.02
U13-12	-0.25
U13-11	-0.25
U13-10	-0.25
U13-09	-0.12
U13-08	-0.25
U13-07	-0.25
U13-06	-0.05
U13-05	-0.25
U13-04	-0.15
U13-03	-0.04
U13-02	-0.10
U13-01	-0.25
L13-01	-0.06
L13-02	-0.01
L13-03	-0.07
L13-04	-0.06
L13-05	-0.08
L13-06	-0.02
L13-07	-0.06

L13-08	-0.06
L13-09	-0.05
L13-10	0.05
L13-11	Maintenance Needed
Meter not attached	
L13-12	-0.02
L13-13	-0.02
L13-14	-0.02
L13-15	-0.05
L13-16	-0.05
L13-17	-0.06
L13-18	-0.06
L13-19	-0.05
L13-20	-0.05
L13-21	-0.07
L13-22	-0.05
L13-23	-0.02
L13-24	-0.06
L13-25	-0.03
L13-26	Maintenance Needed
Never not attached	
L13-27	-0.02
L13-28	-0.05
L13-29	Maintenance Needed
Meter not attached	

L13-30	-0.17
L13-31	0.25
L13-32	-0.02
L13-33	-0.04
L13-34	0.01
L13-35	-0.02
L13-36	-0.02
L13-37	0.25
L13-38	-0.10
L13-39	-0.03
L13-40	-0.02
L13-41	-0.02
L13-42	-0.03
L13-43	-0.02
L13-44	-0.05
L13-45	Maintenance Needed
L13-46	-0.02
L13-47	-0.03
L13-48	-0.02
L13-49	-0.02
L13-50	-0.02
L13-51	-0.03
L13-52	-0.02
L13-53	-0.02

L13-54	-0.02
L13-55	-0.02
L13-56	-0.02
L13-57	-0.02
L13-58	-0.05
L13-59	-0.02
L13-60	-0.02
L13-61	-0.04
L13-62	-0.10
L13-63	-0.01
L13-64	-0.01
L13-65	-0.01
L13-66	-0.20
L13-67	0
L13-68	Maintenance Needed
Needs tape	
L13-69	-0.02
L13-70	-0.03
L13-71	-0.02
L13-72	-0.06
L13-73	-0.05
L13-74	-0.10
L13-75	-0.03
L13-76	-0.06

L13-77	-0.01
L13-78	-0.02
L13-79	-0.05
L13-80	-0.02

Certification

Nancy Bahena Hernandez
12 Feb 2026 4:23 PM PST

4050 - Daily Pressure Gauge Readings

Nancy Bahena Hernandez

Complete

Score	224 / 224 (100%)	Flagged items	0	Actions	0

Site conducted	4050 - Chiquita Canyon Landfill -, Corporate (Overall), Western, Western/SO CA L/F
Conducted on	13 Feb 2026 3:46 PM PST
Prepared by	Nancy Bahena Hernandez

Pressure Gauge Readings	224 / 224 (100%)
#7 Tank Farm	25 / 25 (100%)
SW 08	Maintenance Needed
SW 07	Maintenance Needed
SW 06	Maintenance Needed
SW 05	Maintenance Needed
SW 04	Maintenance Needed
SW 03	-0.05
SW 02	Maintenance Needed
SW 01	Maintenance Needed
No Meter	
44	-0.03
111	Maintenance Needed
No meter	
LCM 11	Maintenance Needed
LCM 12	Maintenance Needed
LCM 13	Maintenance Needed
LCM 14	Maintenance Needed
LCM 15	0
LCM 6	Maintenance Needed
LCM 7	Maintenance Needed
LCM 8	Maintenance Needed
LCM 9	-0.01
LCM 10	-0.02
LCM 1	Maintenance Needed

LCM 2	Maintenance Needed
LCM 3	Maintenance Needed
LCM 4	0.25
LCM 5	0.20
#10 Tank Farm Canyon D	39 / 39 (100%)
D1	-0.25
D2	-0.15
CD3	Maintenance Needed
CD4	Maintenance Needed
D17	Maintenance Needed
D16	Maintenance Needed
D15	Maintenance Needed
Meter not attached	
D14	-0.04
D13	Maintenance Needed
Meter not attached	
D12	-0.25
D11	Maintenance Needed
D10	-0.25
D9	Maintenance Needed
Meter not attached	
D8	Maintenance Needed
D7	0
D6	Maintenance Needed
D5	Maintenance Needed

Meter not attached	
D4	Maintenance Needed
Meter not attached	
D3	-0.25
D18	Maintenance Needed
D19	Maintenance Needed
D20	-0.10
D21	Maintenance Needed
D22	0
D23	Maintenance Needed
D24	-0.03
D25	Maintenance Needed
Meter not attached	
D26	-0.25
D27	Maintenance Needed
D28	0.25
D29	Maintenance Needed
D30	Maintenance Needed
D31	Maintenance Needed
Meter not attached	
D32	Maintenance Needed
D/SW-01	Maintenance Needed
D/SW-02	Maintenance Needed
D/SW-03	Maintenance Needed
D/SW-04	Maintenance Needed

D/SW-05	Maintenance Needed
#13 Tank Farm	160 / 160 (100%)
C13-08	0.06
C13-07	0.01
C13-06	0
C13-05	-0.01
C13-04	-0.01
C13-03	0
C13-02	0
C13-01	0
C13-09	-0.25
C13-10	-0.25
C13-11	-0.25
C13-12	0.05
C13-13	-0.25
C13-14	-0.25
C13-15	Maintenance Needed
C13-16	-0.25
T1/T2 190	Maintenance Needed
U13-63	Maintenance Needed
U13-62	-0.03
U13-61	Maintenance Needed
U13-60	-0.01
U13-59	0

U13-58	-0.02
U13-57	-0.02
U13-56	-0.02
U13-55	-0.06
U13-54	-0.10
U13-53	-0.05
U13-52	Maintenance Needed
U13-51	-0.02
U13-50	0
U13-49	0
U13-48	-0.02
U13-47	-0.02
U13-46	-0.02
U13-45	-0.02
U13-44	0
U13-43	0
U13-42	Maintenance Needed
U13-41	0
U13-40	0
U13-39	0
U13-38	-0.01
U13-37	Maintenance Needed
Meter not attached	
U13-36	-0.05

U13-35	-0.05
U13-34	-0.05
U13-33	-0.06
U13-32	-0.02
U13-31	-0.05
U13-30	Maintenance Needed
Meter not attached	
U13-29	-0.02
U13-28	0
U13-27	-0.06
U13-26	-0.10
U13-25	-0.07
U13-24	-0.10
U13-23	-0.05
U13-22	-0.05
U13-21	-0.05
U13-20	Maintenance Needed
Meter not attached	
U13-19	-0.05
U13-18	-0.02
U13-17	-0.04
U13-16	-0.06
U13-15	-0.02
U13-14	-0.01
U13-13	-0.01

U13-12	-0.25
U13-11	-0.25
U13-10	-0.25
U13-09	-0.12
U13-08	-0.25
U13-07	-0.25
U13-06	-0.05
U13-05	-0.25
U13-04	-0.06
U13-03	-0.04
U13-02	-0.10
U13-01	-0.25
L13-01	0.25
L13-02	-0.01
L13-03	-0.05
L13-04	-0.02
L13-05	-0.05
L13-06	-0.02
L13-07	-0.06
L13-08	-0.05
L13-09	-0.06
L13-10	0.05
L13-11	Maintenance Needed

Meter not attached

L13-12	-0.02
L13-13	0
L13-14	0
L13-15	-0.06
L13-16	-0.06
L13-17	-0.06
L13-18	-0.05
L13-19	-0.05
L13-20	-0.05
L13-21	-0.06
L13-22	-0.05
L13-23	-0.02
L13-24	-0.07
L13-25	0
L13-26	Maintenance Needed
Meter not attached	
L13-27	-0.01
L13-28	-0.07
L13-29	Maintenance Needed
Meter not attached	
L13-30	0.05
L13-31	0
L13-32	-0.05
L13-33	0.02
L13-34	-0.04

L13-35	-0.02
L13-36	-0.06
L13-37	-0.07
L13-38	-0.05
L13-39	-0.03
L13-40	-0.05
L13-41	-0.02
L13-42	-0.02
L13-43	-0.02
L13-44	Maintenance Needed
L13-45	-0.02
L13-46	-0.04
L13-47	-0.02
L13-48	-0.02
L13-49	-0.02
L13-50	-0.05
L13-51	-0.02
L13-52	-0.02
L13-53	-0.02
L13-54	-0.05
L13-55	-0.02
L13-56	-0.02
L13-57	-0.02
L13-58	0

L13-59	-0.01
L13-60	-0.05
L13-61	-0.15
L13-62	-0.01
L13-63	-0.01
L13-64	0
L13-65	-0.23
L13-66	0
L13-67	Maintenance Needed

Meter not attached
Needs tape

L13-68	-0.02
L13-69	-0.02
L13-70	-0.02
L13-71	-0.05
L13-72	-0.05
L13-73	-0.25
L13-74	-0.02
L13-75	-0.05
L13-76	0
L13-77	0
L13-78	0
L13-79	0
L13-80	Maintenance Needed

Meter not attached

Certification

Nancy Bahena Hernandez
13 Feb 2026 4:53 PM PST

4050 - Daily Pressure Gauge Readings

John Boucher

Complete

Score	224 / 224 (100%)	Flagged items	0	Actions	0

Site conducted	4050 - Chiquita Canyon Landfill -, Corporate (Overall), Western, Western/SO CA L/F
Conducted on	14 Feb 2026 7:29 AM PST
Prepared by	John Boucher

Pressure Gauge Readings	224 / 224 (100%)
#7 Tank Farm	25 / 25 (100%)
SW 08	Maintenance Needed
SW 07	Maintenance Needed
SW 06	Maintenance Needed
SW 05	Maintenance Needed
SW 04	Maintenance Needed
SW 03	-0.04
SW 02	Maintenance Needed
SW 01	Maintenance Needed
44	-0.02
111	Maintenance Needed
LCM 11	Maintenance Needed
LCM 12	Maintenance Needed
LCM 13	Maintenance Needed
LCM 14	Maintenance Needed
LCM 15	0
LCM 6	Maintenance Needed
LCM 7	Maintenance Needed
LCM 8	Maintenance Needed
LCM 9	-0.01
LCM 10	-0.02
LCM 1	Maintenance Needed
LCM 2	Maintenance Needed

LCM 3	Maintenance Needed
LCM 4	0.25
LCM 5	0.20
#10 Tank Farm Canyon D	39 / 39 (100%)
D1	-0.25
D2	-0.15
CD3	Maintenance Needed
CD4	Maintenance Needed
D17	Maintenance Needed
D16	Maintenance Needed
D15	Maintenance Needed
D14	-0.04
D13	Maintenance Needed
D12	-0.25
D11	Maintenance Needed
D10	-0.25
D9	Maintenance Needed
D8	Maintenance Needed
D7	0
D6	Maintenance Needed
D5	Maintenance Needed
D4	Maintenance Needed
D3	-0.25
D18	Maintenance Needed

D19	Maintenance Needed
D20	-0.10
D21	Maintenance Needed
D22	0
D23	Maintenance Needed
D24	-0.02
D25	Maintenance Needed
D26	-0.25
D27	Maintenance Needed
D28	0.25
D29	Maintenance Needed
D30	Maintenance Needed
D31	Maintenance Needed
D32	Maintenance Needed
D/SW-01	Maintenance Needed
D/SW-02	Maintenance Needed
D/SW-03	Maintenance Needed
D/SW-04	Maintenance Needed
D/SW-05	Maintenance Needed
#13 Tank Farm	160 / 160 (100%)
C13-08	-0.05
C13-07	-0.01
C13-06	0
C13-05	0

C13-04	0
C13-03	0
C13-02	0
C13-01	0
C13-09	-0.25
C13-10	-0.25
C13-11	-0.25
C13-12	-0.03
C13-13	-0.25
C13-14	-0.25
C13-15	Maintenance Needed
C13-16	-0.25
T1/T2 190	Maintenance Needed
U13-63	Maintenance Needed
U13-62	-0.02
U13-61	Maintenance Needed
U13-60	-0.01
U13-59	0
U13-58	-0.02
U13-57	-0.01
U13-56	-0.01
U13-55	-0.06
U13-54	-0.10
U13-53	-0.06

U13-52	Maintenance Needed
U13-51	-0.02
U13-50	0
U13-49	0
U13-48	-0.02
U13-47	-0.04
U13-46	-0.01
U13-45	-0.02
U13-44	0
U13-43	0
U13-42	Maintenance Needed
U13-41	0
U13-40	0
U13-39	0
U13-38	-0.01
U13-37	Maintenance Needed
U13-36	-0.06
U13-35	-0.05
U13-34	-0.07
U13-33	-0.06
U13-32	-0.03
U13-31	-0.06
U13-30	Maintenance Needed
U13-29	-0.02

U13-28	0
U13-27	-0.05
U13-26	-0.10
U13-25	-0.06
U13-24	-0.10
U13-23	-0.05
U13-22	-0.05
U13-21	-0.03
U13-20	Maintenance Needed
U13-19	-0.05
U13-18	-0.01
U13-17	-0.05
U13-16	-0.06
U13-15	-0.01
U13-14	0
U13-13	0
U13-12	-0.25
U13-11	-0.25
U13-10	-0.25
U13-09	-0.10
U13-08	-0.25
U13-07	-0.25
U13-06	-0.05
U13-05	-0.25

U13-04	-0.04
U13-03	-0.05
U13-02	-0.10
U13-01	-0.25
L13-01	-0.25
L13-02	-0.25
L13-03	-0.02
L13-04	-0.02
L13-05	-0.04
L13-06	-0.01
L13-07	-0.06
L13-08	-0.04
L13-09	-0.05
L13-10	0.06
L13-11	Maintenance Needed
L13-12	-0.02
L13-13	0
L13-14	0
L13-15	-0.05
L13-16	-0.06
L13-17	-0.05
L13-18	-0.05
L13-19	-0.05
L13-20	-0.05

L13-21	-0.05
L13-22	-0.01
L13-23	-0.09
L13-24	-0.06
L13-25	Maintenance Needed
L13-26	Maintenance Needed
L13-27	0
L13-28	-0.05
L13-29	Maintenance Needed
L13-30	0.05
L13-31	-0.01
L13-32	-0.05
L13-33	-0.05
L13-34	-0.05
L13-35	-0.01
L13-36	-0.05
L13-37	-0.05
L13-38	-0.05
L13-39	-0.03
L13-40	-0.05
L13-41	-0.02
L13-42	-0.01
L13-43	-0.02
L13-44	Maintenance Needed

L13-45	-0.01
L13-46	-0.05
L13-47	-0.01
L13-48	-0.01
L13-49	-0.01
L13-50	-0.05
L13-51	-0.01
L13-52	-0.02
L13-53	-0.02
L13-54	-0.05
L13-55	-0.02
L13-56	-0.02
L13-57	-0.02
L13-58	0
L13-59	0
L13-60	-0.05
L13-61	-0.14
L13-62	-0.01
L13-63	-0.01
L13-64	0
L13-65	-0.24
L13-66	0
L13-67	Maintenance Needed
L13-68	0

L13-69	-0.01
L13-70	-0.01
L13-71	-0.05
L13-72	-0.05
L13-73	-0.25
L13-74	-0.01
L13-75	-0.04
L13-76	0
L13-77	0
L13-78	0
L13-79	0
L13-80	Maintenance Needed

Certification

John Boucher
14 Feb 2026 10:33 AM PST

4050 - Daily Pressure Gauge Readings

Tom Roe

Complete

Score	224 / 224 (100%)	Flagged items	0	Actions	0

Site conducted	4050 - Chiquita Canyon Landfill -, Corporate (Overall), Western, Western/SO CA L/F
Conducted on	15 Feb 2026 7:36 AM PST
Prepared by	Tom Roe

Pressure Gauge Readings	224 / 224 (100%)
#7 Tank Farm	25 / 25 (100%)
SW 08	0
SW 07	Maintenance Needed
SW 06	Maintenance Needed
SW 05	Maintenance Needed
SW 04	Maintenance Needed
SW 03	-0.06
SW 02	Maintenance Needed
SW 01	Maintenance Needed
44	-0.02
111	Maintenance Needed
LCM 11	Maintenance Needed
LCM 12	Maintenance Needed
LCM 13	Maintenance Needed
LCM 14	Maintenance Needed
LCM 15	-0.03
LCM 6	Maintenance Needed
LCM 7	Maintenance Needed
LCM 8	Maintenance Needed
LCM 9	-0.03
LCM 10	-0.02
LCM 1	0.12
LCM 2	Maintenance Needed

LCM 3	Maintenance Needed
LCM 4	0.25
LCM 5	0.16
#10 Tank Farm Canyon D	39 / 39 (100%)
D1	-0.25
D2	-0.06
CD3	Maintenance Needed
CD4	Maintenance Needed
D17	Maintenance Needed
D16	Maintenance Needed
D15	Maintenance Needed
D14	0
D13	Maintenance Needed
D12	-0.25
D11	Maintenance Needed
D10	-0.14
D9	Maintenance Needed
D8	Maintenance Needed
D7	-0.01
D6	Maintenance Needed
D5	Maintenance Needed
D4	Maintenance Needed
D3	-0.25
D18	Maintenance Needed

D19	Maintenance Needed
D20	-0.11
D21	Maintenance Needed
D22	Maintenance Needed
D23	Maintenance Needed
D24	-0.04
D25	Maintenance Needed
D26	0.25
D27	Maintenance Needed
D28	0.25
D29	Maintenance Needed
D30	Maintenance Needed
D31	Maintenance Needed
D32	Maintenance Needed
D/SW-01	Maintenance Needed
D/SW-02	Maintenance Needed
D/SW-03	Maintenance Needed
D/SW-04	Maintenance Needed
D/SW-05	Maintenance Needed
#13 Tank Farm	160 / 160 (100%)
C13-08	0.05
C13-07	-0.03
C13-06	-0.02
C13-05	-0.03

C13-04	0
C13-03	-0.01
C13-02	-0.02
C13-01	-0.05
C13-09	-0.25
C13-10	-0.25
C13-11	-0.25
C13-12	0.05
C13-13	-0.25
C13-14	-0.25
C13-15	Maintenance Needed
C13-16	-0.25
T1/T2 190	Maintenance Needed
U13-63	Maintenance Needed
U13-62	-0.03
U13-61	-0.02
U13-60	-0.01
U13-59	-0.01
U13-58	-0.01
U13-57	-0.03
U13-56	-0.03
U13-55	-0.05
U13-54	0.13
U13-53	-0.03

U13-52	Maintenance Needed
U13-51	-0.02
U13-50	-0.05
U13-49	-0.04
U13-48	-0.05
U13-47	-0.03
U13-46	-0.02
U13-45	-0.01
U13-44	0
U13-43	0
U13-42	Maintenance Needed
U13-41	-0.03
U13-40	-0.01
U13-39	-0.02
U13-38	-0.02
U13-37	Maintenance Needed
U13-36	-0.03
U13-35	-0.04
U13-34	-0.04
U13-33	-0.05
U13-32	-0.03
U13-31	-0.05
U13-30	-0.07
U13-29	-0.02

U13-28	-0.01
U13-27	-0.05
U13-26	-0.08
U13-25	-0.05
U13-24	-0.10
U13-23	-0.06
U13-22	-0.05
U13-21	-0.04
U13-20	Maintenance Needed
U13-19	-0.04
U13-18	-0.02
U13-17	-0.05
U13-16	-0.08
U13-15	-0.03
U13-14	-0.03
U13-13	-0.02
U13-12	-0.25
U13-11	-0.25
U13-10	-0.25
U13-09	-0.10
U13-08	-0.25
U13-07	-0.25
U13-06	-0.04
U13-05	-0.25

U13-04	-0.15
U13-03	-0.05
U13-02	-0.09
U13-01	-0.25
L13-01	-0.05
L13-02	-0.04
L13-03	-0.06
L13-04	-0.05
L13-05	-0.05
L13-06	-0.02
L13-07	-0.05
L13-08	-0.04
L13-09	-0.04
L13-10	0.03
L13-11	Maintenance Needed
L13-12	-0.02
L13-13	-0.02
L13-14	-0.02
L13-15	-0.05
L13-16	-0.06
L13-17	-0.06
L13-18	-0.05
L13-19	-0.04
L13-20	-0.04

L13-21	-0.05
L13-22	-0.03
L13-23	-0.01
L13-24	0.10
L13-25	-0.01
L13-26	Maintenance Needed
L13-27	-0.02
L13-28	-0.03
L13-29	Maintenance Needed
L13-30	-0.05
L13-31	-0.03
L13-32	-0.05
L13-33	0.02
L13-34	-0.03
L13-35	-0.03
L13-36	-0.05
L13-37	-0.08
L13-38	-0.05
L13-39	-0.03
L13-40	-0.04
L13-41	-0.03
L13-42	-0.02
L13-43	-0.03
L13-44	Maintenance Needed

L13-45	-0.02
L13-46	-0.04
L13-47	-0.02
L13-48	-0.02
L13-49	0
L13-50	0.01
L13-51	-0.02
L13-52	-0.01
L13-53	-0.02
L13-54	-0.04
L13-55	-0.02
L13-56	-0.03
L13-57	-0.04
L13-58	-0.02
L13-59	-0.02
L13-60	-0.03
L13-61	-0.14
L13-62	0
L13-63	-0.04
L13-64	-0.02
L13-65	-0.16
L13-66	-0.01
L13-67	Maintenance Needed
L13-68	-0.03

L13-69	-0.04
L13-70	-0.02
L13-71	-0.05
L13-72	-0.04
L13-73	-0.06
L13-74	-0.03
L13-75	-0.05
L13-76	-0.03
L13-77	-0.04
L13-78	-0.05
L13-79	-0.02
L13-80	Maintenance Needed

Certification

Tom Roe
15 Feb 2026 9:56 AM PST

4050 - Daily Pressure Gauge Readings

Nancy Bahena Hernandez

Complete

Score	224 / 224 (100%)	Flagged items	0	Actions	0

Site conducted	4050 - Chiquita Canyon Landfill -, Corporate (Overall), Western, Western/SO CA L/F
Conducted on	16 Feb 2026 2:04 PM PST
Prepared by	Nancy Bahena Hernandez

Pressure Gauge Readings	224 / 224 (100%)
#7 Tank Farm	25 / 25 (100%)
SW 08	Maintenance Needed
SW 07	Maintenance Needed
SW 06	Maintenance Needed
SW 05	Maintenance Needed
SW 04	Maintenance Needed
SW 03	-0.05
SW 02	-0.02
SW 01	Maintenance Needed
No meter	
44	-0.06
111	Maintenance Needed
No meter	
LCM 11	Maintenance Needed
LCM 12	Maintenance Needed
LCM 13	Maintenance Needed
LCM 14	Maintenance Needed
LCM 15	-0.05
LCM 6	Maintenance Needed
LCM 7	Maintenance Needed
LCM 8	Maintenance Needed
LCM 9	Maintenance Needed
LCM 10	-0.02
LCM 1	Maintenance Needed

LCM 2	Maintenance Needed
LCM 3	Maintenance Needed
LCM 4	0.25
LCM 5	0.25
#10 Tank Farm Canyon D	39 / 39 (100%)
D1	-0.25
D2	-0.07
CD3	Maintenance Needed
CD4	Maintenance Needed
D17	Maintenance Needed
D16	Maintenance Needed
D15	Maintenance Needed
Meter not attached	
D14	-0.05
D13	Maintenance Needed
Meter not attached	
D12	-0.25
Meter not attached	
D11	Maintenance Needed
Meter not attached	
D10	-0.25
D9	Maintenance Needed
Meter not attached	
D8	Maintenance Needed
D7	Maintenance Needed
D6	Maintenance Needed

D5	Maintenance Needed
Meter not attached	
D4	Maintenance Needed
Meter not attached	
D3	-0.25
D18	Maintenance Needed
D19	Maintenance Needed
D20	-0.10
D21	Maintenance Needed
Meter not attached	
D22	Maintenance Needed
D23	Maintenance Needed
D24	-0.06
D25	Maintenance Needed
Meter not attached	
D26	Maintenance Needed
D27	Maintenance Needed
D28	-0.10
D29	Maintenance Needed
D30	Maintenance Needed
D31	Maintenance Needed
D32	Maintenance Needed
D/SW-01	Maintenance Needed
D/SW-02	Maintenance Needed
D/SW-03	Maintenance Needed

D/SW-04	Maintenance Needed
D/SW-05	Maintenance Needed
#13 Tank Farm	160 / 160 (100%)
C13-08	0
C13-07	-0.08
C13-06	-0.03
C13-05	-0.05
C13-04	-0.02
C13-03	-0.05
C13-02	-0.05
C13-01	-0.08
C13-09	-0.25
C13-10	-0.25
C13-11	-0.25
C13-12	0.05
C13-13	-0.25
C13-14	-0.25
C13-15	Maintenance Needed
C13-16	-0.25
T1/T2 190	Maintenance Needed
U13-63	Maintenance Needed
U13-62	-0.05
U13-61	-0.03
U13-60	-0.02

U13-59	0
U13-58	-0.05
U13-57	-0.02
U13-56	-0.10
U13-55	-0.08
U13-54	0.10
U13-53	-0.05
U13-52	-0.22
U13-51	-0.03
U13-50	-0.02
U13-49	-0.01
U13-48	-0.05
U13-47	-0.05
U13-46	-0.02
U13-45	-0.10
U13-44	0
U13-43	0
U13-42	Maintenance Needed
U13-41	-0.05
U13-40	-0.02
U13-39	-0.05
U13-38	-0.02
U13-37	Maintenance Needed

Meter not attached

U13-36	-0.07
U13-35	-0.07
U13-34	-0.12
U13-33	-0.07
U13-32	-0.05
U13-31	-0.12
U13-30	Maintenance Needed
Meter not attached	
U13-29	-0.08
U13-28	-0.05
U13-27	-0.10
U13-26	-0.15
U13-25	-0.25
U13-24	-0.25
U13-23	-0.07
U13-22	-0.06
U13-21	-0.10
U13-20	Maintenance Needed
Meter not attached	
U13-19	-0.05
U13-18	-0.02
U13-17	-0.03
U13-16	-0.07
U13-15	-0.02
U13-14	-0.02

U13-13	0
U13-12	-0.25
U13-11	-0.25
U13-10	-0.25
U13-09	-0.05
U13-08	-0.25
U13-07	-0.25
U13-06	-0.05
U13-05	-0.25
U13-04	-0.07
U13-03	-0.07
U13-02	-0.10
U13-01	-0.25
L13-01	-0.06
L13-02	-0.07
L13-03	-0.07
L13-04	-0.10
L13-05	-0.25
L13-06	-0.02
L13-07	-0.07
L13-08	-0.07
L13-09	-0.12
L13-10	0.05
L13-11	Maintenance Needed

Meter not attached

L13-12	-0.05
L13-13	0.09
L13-14	-0.02
L13-15	-0.10
L13-16	-0.10
L13-17	-0.10
L13-18	-0.06
L13-19	-0.06
L13-20	-0.12
L13-21	-0.12
L13-22	-0.02
L13-23	-0.05
L13-24	-0.10
L13-25	0
L13-26	Maintenance Needed

Meter not attached

L13-27	-0.05
L13-28	-0.10
L13-29	Maintenance Needed
L13-30	-0.05
L13-31	-0.01
L13-32	-0.05
L13-33	-0.15
L13-34	-0.06

L13-35	-0.04
L13-36	-0.06
L13-37	-0.10
L13-38	-0.06
L13-39	-0.05
L13-40	-0.05
L13-41	-0.02
L13-42	-0.05
L13-43	-0.03
L13-44	Maintenance Needed
L13-45	-0.01
L13-46	-0.06
L13-47	-0.07
L13-48	-0.01
L13-49	-0.02
L13-50	-0.05
L13-51	-0.03
L13-52	-0.01
L13-53	-0.01
L13-54	-0.05
L13-55	-0.03
L13-56	-0.01
L13-57	-0.05
L13-58	-0.01

L13-59	-0.05
L13-60	-0.05
L13-61	-0.15
L13-62	0
L13-63	0
L13-64	-0.25
L13-65	-0.07
L13-66	0
L13-67	Maintenance Needed
Meter not attached	
L13-68	-0.07
L13-69	-0.06
L13-70	-0.13
L13-71	-0.07
L13-72	-0.05
L13-73	-0.02
L13-74	-0.05
L13-75	-0.05
L13-76	-0.02
L13-77	-0.05
L13-78	-0.10
L13-79	-0.01
L13-80	Maintenance Needed
Meter not attached	

Certification

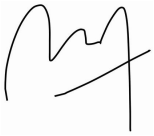

Nancy Bahena Hernandez
16 Feb 2026 3:51 PM PST

4050 - Daily Pressure Gauge Readings

Nancy Bahena Hernandez

Complete

Score	224 / 224 (100%)	Flagged items	0	Actions	0

Site conducted	4050 - Chiquita Canyon Landfill -, Corporate (Overall), Western, Western/SO CA L/F
Conducted on	17 Feb 2026 11:35 AM PST
Prepared by	Nancy Bahena Hernandez

Pressure Gauge Readings	224 / 224 (100%)
#7 Tank Farm	25 / 25 (100%)
SW 08	Maintenance Needed
SW 07	Maintenance Needed
SW 06	Maintenance Needed
SW 05	Maintenance Needed
SW 04	Maintenance Needed
SW 03	-0.06
SW 02	Maintenance Needed
SW 01	Maintenance Needed
No meter	
44	-0.10
111	Maintenance Needed
No meter	
LCM 11	Maintenance Needed
LCM 12	Maintenance Needed
LCM 13	Maintenance Needed
LCM 14	Maintenance Needed
LCM 15	-0.06
LCM 6	Maintenance Needed
LCM 7	Maintenance Needed
LCM 8	Maintenance Needed
LCM 9	-0.02
LCM 10	-0.02
LCM 1	Maintenance Needed

LCM 2	Maintenance Needed
LCM 3	Maintenance Needed
LCM 4	0.25
LCM 5	0.25
#10 Tank Farm Canyon D	39 / 39 (100%)
D1	-0.05
D2	-0.25
CD3	Maintenance Needed
CD4	Maintenance Needed
D17	Maintenance Needed
D16	Maintenance Needed
D15	Maintenance Needed
Meter not attached	
D14	-0.12
D13	Maintenance Needed
Meter not attached	
D12	-0.25
D11	Maintenance Needed
D10	-0.25
D9	Maintenance Needed
Meter not attached	
D8	Maintenance Needed
D7	0
D6	Maintenance Needed
D5	Maintenance Needed

Meter not attached	
D4	Maintenance Needed
D3	-0.25
D18	Maintenance Needed
D19	Maintenance Needed
D20	-0.10
D21	Maintenance Needed
Meter not attached	
D22	Maintenance Needed
D23	Maintenance Needed
D24	-0.05
D25	Maintenance Needed
Meter not attached	
D26	0.05
D27	Maintenance Needed
D28	-0.25
D29	Maintenance Needed
D30	Maintenance Needed
D31	Maintenance Needed
Meter not attached	
D32	Maintenance Needed
D/SW-01	Maintenance Needed
D/SW-02	Maintenance Needed
D/SW-03	Maintenance Needed
D/SW-04	Maintenance Needed

D/SW-05	Maintenance Needed
#13 Tank Farm	160 / 160 (100%)
C13-08	0
C13-07	-0.02
C13-06	-0.02
C13-05	-0.05
C13-04	-0.03
C13-03	-0.02
C13-02	-0.03
C13-01	-0.05
C13-09	-0.25
C13-10	-0.25
C13-11	-0.25
C13-12	0.05
C13-13	-0.25
C13-14	-0.25
C13-15	Maintenance Needed
C13-16	-0.25
T1/T2 190	Maintenance Needed
U13-63	-0.02
U13-62	-0.05
U13-61	0
U13-60	-0.01
U13-59	-0.01

U13-58	-0.01
U13-57	-0.01
U13-56	-0.02
U13-55	-0.05
U13-54	0.05
U13-53	-0.02
U13-52	Maintenance Needed
U13-51	-0.02
U13-50	-0.02
U13-49	-0.02
U13-48	-0.03
U13-47	-0.05
U13-46	-0.02
U13-45	-0.10
U13-44	0
U13-43	0
U13-42	Maintenance Needed
U13-41	-0.01
U13-40	-0.01
U13-39	0
U13-38	-0.02
U13-37	Maintenance Needed
Meter not attached	
U13-36	-0.08

U13-35	-0.09
U13-34	-0.06
U13-33	-0.10
U13-32	-0.05
U13-31	-0.12
U13-30	Maintenance Needed
Meter not attached	
U13-29	-0.03
U13-28	-0.02
U13-27	-0.10
U13-26	-0.12
U13-25	-0.12
U13-24	-0.12
U13-23	-0.07
U13-22	-0.07
U13-21	-0.05
U13-20	Maintenance Needed
Meter not attached	
U13-19	-0.05
U13-18	-0.07
U13-17	-0.07
U13-16	-0.10
U13-15	-0.05
U13-14	-0.05
U13-13	-0.05

U13-12	-0.25
U13-11	-0.25
U13-10	-0.25
U13-09	-0.05
U13-08	-0.25
U13-07	-0.25
U13-06	-0.05
U13-05	-0.25
U13-04	-0.10
U13-03	-0.10
U13-02	-0.07
U13-01	-0.22
L13-01	-0.07
L13-02	-0.05
L13-03	-0.13
L13-04	-0.07
L13-05	-0.07
L13-06	-0.05
L13-07	-0.04
L13-08	-0.03
L13-09	-0.05
L13-10	0.02
L13-11	Maintenance Needed

Meter not attached

L13-12	-0.07
L13-13	-0.05
L13-14	-0.02
L13-15	0
L13-16	-0.02
L13-17	Maintenance Needed
Meter not attached	
L13-18	-0.10
L13-19	-0.05
L13-20	-0.05
L13-21	-0.08
L13-22	-0.05
L13-23	-0.05
L13-24	-0.06
L13-25	-0.05
L13-26	Maintenance Needed
Meter not attached	
L13-27	-0.03
L13-28	-0.07
L13-29	Maintenance Needed
Meter not attached	
L13-30	-0.10
L13-31	-0.02
L13-32	-0.05
L13-33	0.02

L13-34	-0.05
L13-35	-0.05
L13-36	-0.07
L13-37	-0.07
L13-38	-0.10
L13-39	-0.05
L13-40	-0.05
L13-41	-0.04
L13-42	-0.05
L13-43	-0.05
L13-44	Maintenance Needed
L13-45	-0.03
L13-46	-0.10
L13-47	-0.05
L13-48	-0.05
L13-49	-0.02
L13-50	-0.05
L13-51	-0.05
L13-52	-0.02
L13-53	-0.05
L13-54	-0.05
L13-55	-0.05
L13-56	-0.04
L13-57	-0.04

L13-58	-0.01
L13-59	-0.05
L13-60	-0.03
L13-61	-0.15
L13-62	-0.02
L13-63	-0.02
L13-64	-0.10
L13-65	-0.12
L13-66	-0.02
L13-67	Maintenance Needed
Meter not attached	
L13-68	-0.02
L13-69	-0.06
L13-70	-0.20
L13-71	-0.07
L13-72	-0.06
L13-73	-0.05
L13-74	-0.03
L13-75	-0.07
L13-76	-0.02
L13-77	-0.05
L13-78	-0.10
L13-79	-0.02
L13-80	Maintenance Needed
Meter not attached	

Certification

Nancy Bahena Hernandez
17 Feb 2026 3:41 PM PST

4050 - Daily Pressure Gauge Readings

Nancy Bahena Hernandez

Complete

Score	224 / 224 (100%)	Flagged items	0	Actions	0

Site conducted	4050 - Chiquita Canyon Landfill -, Corporate (Overall), Western, Western/SO CA L/F
Conducted on	18 Feb 2026 1:32 PM PST
Prepared by	Nancy Bahena Hernandez

Pressure Gauge Readings	224 / 224 (100%)
#7 Tank Farm	25 / 25 (100%)
SW 08	Maintenance Needed
SW 07	Maintenance Needed
SW 06	Maintenance Needed
SW 05	Maintenance Needed
SW 04	Maintenance Needed
SW 03	-0.04
SW 02	Maintenance Needed
SW 01	Maintenance Needed
No meter	
44	-0.02
111	Maintenance Needed
No meter	
LCM 11	Maintenance Needed
LCM 12	Maintenance Needed
LCM 13	Maintenance Needed
LCM 14	Maintenance Needed
LCM 15	-0.03
LCM 6	Maintenance Needed
LCM 7	Maintenance Needed
LCM 8	Maintenance Needed
LCM 9	-0.02
LCM 10	-0.02
LCM 1	Maintenance Needed

LCM 2	Maintenance Needed
LCM 3	Maintenance Needed
LCM 4	0.25
LCM 5	0.23
#10 Tank Farm Canyon D	39 / 39 (100%)
D1	-0.10
D2	-0.25
CD3	Maintenance Needed
CD4	Maintenance Needed
D17	Maintenance Needed
D16	Maintenance Needed
D15	Maintenance Needed
Meter not attached	
D14	0.25
D13	Maintenance Needed
Meter not attached	
D12	-0.25
D11	Maintenance Needed
D10	0.25
D9	Maintenance Needed
Meter not attached	
D8	Maintenance Needed
D7	-0.02
D6	Maintenance Needed
D5	Maintenance Needed

Meter not attached	
D4	Maintenance Needed
Meter not attached	
D3	-0.25
D18	Maintenance Needed
D19	Maintenance Needed
D20	-0.11
D21	Maintenance Needed
Meter not attached	
D22	Maintenance Needed
D23	Maintenance Needed
D24	Maintenance Needed
D25	Maintenance Needed
Meter not attached	
D26	Maintenance Needed
D27	Maintenance Needed
D28	0
D29	Maintenance Needed
D30	Maintenance Needed
D31	Maintenance Needed
Meter not attached	
D32	Maintenance Needed
D/SW-01	Maintenance Needed
D/SW-02	Maintenance Needed
D/SW-03	Maintenance Needed
D/SW-04	Maintenance Needed

D/SW-05	Maintenance Needed
#13 Tank Farm	160 / 160 (100%)
C13-08	0.02
C13-07	-0.02
C13-06	0
C13-05	-0.01
C13-04	-0.10
C13-03	-0.02
C13-02	-0.02
C13-01	-0.05
C13-09	-0.25
C13-10	-0.25
C13-11	-0.25
C13-12	0.05
C13-13	-0.25
C13-14	-0.25
C13-15	Maintenance Needed
C13-16	-0.25
T1/T2 190	Maintenance Needed
U13-63	Maintenance Needed
U13-62	Maintenance Needed
U13-61	0
U13-60	0
U13-59	-0.01

U13-58	-0.01
U13-57	-0.01
U13-56	-0.02
U13-55	-0.05
U13-54	-0.05
U13-53	-0.01
U13-52	Maintenance Needed
U13-51	-0.02
U13-50	-0.06
U13-49	-0.02
U13-48	-0.03
U13-47	-0.15
U13-46	-0.02
U13-45	-0.02
U13-44	-0.01
U13-43	0
U13-42	Maintenance Needed
U13-41	-0.05
U13-40	-0.15
U13-39	0
U13-38	-0.01
U13-37	Maintenance Needed
Meter not attached	
U13-36	-0.05

U13-35	-0.07
U13-34	-0.04
U13-33	-0.06
U13-32	-0.03
U13-31	-0.22
U13-30	Maintenance Needed
Meter not attached	
U13-29	-0.04
U13-28	-0.02
U13-27	-0.10
U13-26	-0.15
U13-25	-0.10
U13-24	-0.15
U13-23	-0.07
U13-22	-0.07
U13-21	-0.06
U13-20	Maintenance Needed
Meter not attached	
U13-19	-0.05
U13-18	-0.02
U13-17	-0.06
U13-16	-0.08
U13-15	-0.03
U13-14	-0.02
U13-13	-0.02

U13-12	-0.25
U13-11	-0.25
U13-10	-0.25
U13-09	-0.05
U13-08	-0.25
U13-07	-0.25
U13-06	-0.05
U13-05	-0.05
U13-04	-0.05
U13-03	-0.02
U13-02	-0.02
U13-01	-0.01
L13-01	-0.07
L13-02	-0.06
L13-03	-0.07
L13-04	-0.05
L13-05	-0.02
L13-06	-0.20
L13-07	-0.02
L13-08	0.05
L13-09	0.10
L13-10	0.05
L13-11	Maintenance Needed
L13-12	-0.02

L13-13	-0.01
L13-14	-0.02
L13-15	-0.06
L13-16	-0.07
L13-17	Maintenance Needed
Meter not attached	
L13-18	-0.07
L13-19	-0.06
L13-20	-0.06
L13-21	-0.07
L13-22	-0.05
L13-23	-0.05
L13-24	-0.06
L13-25	0
L13-26	Maintenance Needed
Meter not attached	
L13-27	-0.02
L13-28	-0.07
L13-29	Maintenance Needed
Meter not attached	
L13-30	-0.05
L13-31	-0.01
L13-32	-0.05
L13-33	0.01
L13-34	-0.04

L13-35	-0.02
L13-36	-0.06
L13-37	0.20
L13-38	-0.06
L13-39	-0.02
L13-40	-0.05
L13-41	0
L13-42	-0.05
L13-43	-0.04
L13-44	Maintenance Needed
L13-45	-0.02
L13-46	-0.15
L13-47	-0.03
L13-48	-0.02
L13-49	-0.02
L13-50	-0.04
L13-51	-0.15
L13-52	-0.02
L13-53	-0.01
L13-54	-0.03
L13-55	-0.01
L13-56	-0.01
L13-57	-0.05
L13-58	-0.02

L13-59	-0.02
L13-60	-0.02
L13-61	-0.15
L13-62	-0.02
L13-63	0
L13-64	Maintenance Needed
Meter not attached	
L13-65	-0.17
L13-66	0
L13-67	Maintenance Needed
Meter not attached	
L13-68	-0.03
L13-69	-0.04
L13-70	-0.02
L13-71	-0.06
L13-72	-0.05
L13-73	-0.15
L13-74	-0.01
L13-75	-0.05
L13-76	-0.04
L13-77	-0.02
L13-78	-0.05
L13-79	-0.01
L13-80	Maintenance Needed
Meter not attached	

Certification

Nancy Bahena Hernandez
18 Feb 2026 5:08 PM PST

4050 - Daily Pressure Gauge Readings

Nancy Bahena Hernandez

Complete

Score	224 / 224 (100%)	Flagged items	0	Actions	0

Site conducted	4050 - Chiquita Canyon Landfill -, Corporate (Overall), Western, Western/SO CA L/F
Conducted on	19 Feb 2026 1:17 PM PST
Prepared by	Nancy Bahena Hernandez

Pressure Gauge Readings	224 / 224 (100%)
#7 Tank Farm	25 / 25 (100%)
SW 08	Maintenance Needed
SW 07	Maintenance Needed
SW 06	Maintenance Needed
SW 05	Maintenance Needed
SW 04	Maintenance Needed
SW 03	-0.07
SW 02	Maintenance Needed
SW 01	Maintenance Needed
No meter	
44	-0.02
111	Maintenance Needed
No meter	
LCM 11	Maintenance Needed
LCM 12	Maintenance Needed
LCM 13	Maintenance Needed
LCM 14	Maintenance Needed
LCM 15	-0.02
LCM 6	Maintenance Needed
LCM 7	Maintenance Needed
LCM 8	Maintenance Needed
LCM 9	0
LCM 10	Maintenance Needed
LCM 1	Maintenance Needed

LCM 2	Maintenance Needed
LCM 3	Maintenance Needed
LCM 4	0.25
LCM 5	0.25
#10 Tank Farm Canyon D	39 / 39 (100%)
D1	-0.05
D2	-0.25
CD3	Maintenance Needed
CD4	Maintenance Needed
D17	Maintenance Needed
D16	Maintenance Needed
D15	Maintenance Needed
Meter not attached	
D14	0.25
D13	Maintenance Needed
Meter not attached	
D12	-0.25
D11	Maintenance Needed
D10	0.25
D9	Maintenance Needed
Meter not attached	
D8	-0.05
D7	-0.10
D6	Maintenance Needed
D5	Maintenance Needed

Meter not attached	
D4	Maintenance Needed
Meter not attached	
D3	-0.25
D18	Maintenance Needed
D19	Maintenance Needed
D20	-0.10
D21	Maintenance Needed
Meter not attached	
D22	Maintenance Needed
D23	Maintenance Needed
D24	-0.10
D25	Maintenance Needed
Meter not attached	
D26	-0.15
D27	Maintenance Needed
D28	Maintenance Needed
D29	Maintenance Needed
D30	Maintenance Needed
D31	Maintenance Needed
Meter not attached	
D32	Maintenance Needed
D/SW-01	Maintenance Needed
No meter	
D/SW-02	Maintenance Needed
No meter	

D/SW-03	Maintenance Needed
No meter	
D/SW-04	Maintenance Needed
No meter	
D/SW-05	Maintenance Needed
No meter	
#13 Tank Farm	160 / 160 (100%)
C13-08	-0.12
C13-07	-0.05
C13-06	-0.02
C13-05	-0.12
C13-04	-0.06
C13-03	-0.07
C13-02	-0.15
C13-01	-0.05
C13-09	-0.25
C13-10	-0.25
C13-11	-0.25
C13-12	0.05
C13-13	-0.25
C13-14	-0.25
C13-15	Maintenance Needed
C13-16	-0.25
T1/T2 190	Maintenance Needed
U13-63	Maintenance Needed

U13-62	Maintenance Needed
U13-61	0
U13-60	-0.02
U13-59	-0.02
U13-58	-0.02
U13-57	-0.01
U13-56	-0.07
U13-55	-0.05
U13-54	0.05
U13-53	-0.10
U13-52	-0.25
U13-51	-0.10
U13-50	-0.07
U13-49	-0.02
U13-48	-0.12
U13-47	-0.10
U13-46	-0.02
U13-45	-0.02
U13-44	0
U13-43	0
U13-42	Maintenance Needed
U13-41	-0.01
U13-40	-0.22
U13-39	-0.01

U13-38	-0.02
U13-37	Maintenance Needed
Meter not attached	
U13-36	-0.07
U13-35	-0.05
U13-34	-0.05
U13-33	-0.12
U13-32	-0.02
U13-31	-0.22
U13-30	Maintenance Needed
Meter not attached	
U13-29	-0.02
U13-28	-0.01
U13-27	-0.06
U13-26	-0.12
U13-25	-0.12
U13-24	-0.15
U13-23	-0.08
U13-22	-0.12
U13-21	-0.06
U13-20	Maintenance Needed
Meter not attached	
U13-19	-0.07
U13-18	-0.05
U13-17	-0.05

U13-16	-0.08
U13-15	-0.05
U13-14	-0.06
U13-13	-0.02
U13-12	-0.25
U13-11	-0.25
U13-10	-0.25
U13-09	-0.07
U13-08	-0.25
U13-07	-0.25
U13-06	-0.02
U13-05	-0.25
U13-04	-0.07
U13-03	-0.10
U13-02	-0.07
U13-01	-0.20
L13-01	0.25
L13-02	-0.07
L13-03	-0.07
L13-04	0.01
L13-05	-0.03
L13-06	-0.15
L13-07	-0.05
L13-08	-0.05

L13-09	-0.05
L13-10	0.02
L13-11	Maintenance Needed
Meter not attached	
L13-12	-0.14
L13-13	-0.01
L13-14	-0.02
L13-15	-0.06
L13-16	-0.07
L13-17	Maintenance Needed
Meter not attached	
L13-18	-0.07
L13-19	-0.07
L13-20	-0.05
L13-21	-0.25
L13-22	-0.05
L13-23	-0.06
L13-24	-0.07
L13-25	-0.06
L13-26	Maintenance Needed
Meter not attached	
L13-27	-0.02
L13-28	-0.05
L13-29	Maintenance Needed
Meter not attached	

L13-30	-0.05
L13-31	0
L13-32	-0.05
L13-33	0.02
L13-34	-0.03
L13-35	-0.02
L13-36	-0.15
L13-37	0
L13-38	-0.02
L13-39	-0.02
L13-40	-0.02
L13-41	-0.01
L13-42	0
L13-43	-0.01
L13-44	Maintenance Needed
L13-45	-0.02
L13-46	-0.16
L13-47	-0.03
L13-48	-0.13
L13-49	-0.02
L13-50	-0.15
L13-51	-0.01
L13-52	-0.01
L13-53	-0.10

L13-54	-0.05
L13-55	-0.10
L13-56	-0.02
L13-57	-0.14
L13-58	0
L13-59	-0.04
L13-60	-0.05
L13-61	-0.15
L13-62	-0.05
L13-63	-0.01
L13-64	Maintenance Needed
Meter not attached	
L13-65	-0.20
L13-66	0
L13-67	Maintenance Needed
Meter not attached	
L13-68	-0.03
L13-69	-0.12
L13-70	-0.02
L13-71	-0.07
L13-72	-0.05
L13-73	-0.12
L13-74	-0.15
L13-75	-0.05
L13-76	-0.05

L13-77	-0.05
L13-78	-0.06
L13-79	-0.07
L13-80	Maintenance Needed

Meter not attached

Certification

Nancy Bahena Hernandez
19 Feb 2026 3:19 PM PST

4050 - Daily Pressure Gauge Readings

John Boucher

Complete

Score	224 / 224 (100%)	Flagged items	0	Actions	0

Site conducted	4050 - Chiquita Canyon Landfill -, Corporate (Overall), Western, Western/SO CA L/F
Conducted on	20 Feb 2026 7:06 AM PST
Prepared by	John Boucher

Pressure Gauge Readings	224 / 224 (100%)
#7 Tank Farm	25 / 25 (100%)
SW 08	-0.04
SW 07	Maintenance Needed
SW 06	Maintenance Needed
SW 05	Maintenance Needed
SW 04	Maintenance Needed
SW 03	-0.06
SW 02	Maintenance Needed
SW 01	Maintenance Needed
44	-0.04
111	Maintenance Needed
LCM 11	Maintenance Needed
LCM 12	Maintenance Needed
LCM 13	Maintenance Needed
LCM 14	Maintenance Needed
LCM 15	-0.01
LCM 6	Maintenance Needed
LCM 7	Maintenance Needed
LCM 8	Maintenance Needed
LCM 9	-0.01
LCM 10	0
LCM 1	Maintenance Needed
LCM 2	Maintenance Needed

LCM 3	Maintenance Needed
LCM 4	0.25
LCM 5	0.12
#10 Tank Farm Canyon D	39 / 39 (100%)
D1	-0.05
D2	-0.25
CD3	Maintenance Needed
CD4	Maintenance Needed
D17	-0.04
D16	Maintenance Needed
D15	Maintenance Needed
D14	0.18
D13	Maintenance Needed
D12	-0.25
D11	Maintenance Needed
D10	-0.25
D9	Maintenance Needed
D8	Maintenance Needed
D7	-0.02
D6	Maintenance Needed
D5	Maintenance Needed
D4	Maintenance Needed
D3	-0.25
D18	-0.05

D19	-0.02
D20	-0.09
D21	Maintenance Needed
D22	Maintenance Needed
D23	Maintenance Needed
D24	-0.04
D25	Maintenance Needed
D26	-0.11
D27	Maintenance Needed
D28	Maintenance Needed
D29	Maintenance Needed
D30	Maintenance Needed
D31	Maintenance Needed
D32	Maintenance Needed
D/SW-01	Maintenance Needed
D/SW-02	Maintenance Needed
D/SW-03	Maintenance Needed
D/SW-04	Maintenance Needed
D/SW-05	Maintenance Needed
#13 Tank Farm	160 / 160 (100%)
C13-08	-0.10
C13-07	-0.03
C13-06	-0.03
C13-05	-0.10

C13-04	-0.04
C13-03	-0.08
C13-02	-0.03
C13-01	-0.05
C13-09	-0.25
C13-10	-0.25
C13-11	-0.25
C13-12	0.05
C13-13	-0.25
C13-14	-0.25
C13-15	-0.03
C13-16	-0.25
T1/T2 190	Maintenance Needed
U13-63	-0.03
U13-62	Maintenance Needed
U13-61	-0.01
U13-60	-0.01
U13-59	-0.01
U13-58	-0.02
U13-57	-0.03
U13-56	-0.03
U13-55	-0.06
U13-54	-0.08
U13-53	-0.03

U13-52	-0.22
U13-51	-0.02
U13-50	-0.11
U13-49	0
U13-48	-0.02
U13-47	-0.03
U13-46	0
U13-45	-0.01
U13-44	0
U13-43	0
U13-42	Maintenance Needed
U13-41	-0.03
U13-40	-0.15
U13-39	-0.03
U13-38	-0.04
U13-37	Maintenance Needed
U13-36	-0.05
U13-35	-0.25
U13-34	-0.06
U13-33	-0.05
U13-32	-0.03
U13-31	-0.13
U13-30	-0.07
U13-29	-0.03

U13-28	-0.02
U13-27	-0.09
U13-26	-0.12
U13-25	-0.10
U13-24	-0.14
U13-23	-0.08
U13-22	-0.08
U13-21	-0.05
U13-20	Maintenance Needed
U13-19	-0.08
U13-18	-0.03
U13-17	-0.05
U13-16	-0.09
U13-15	-0.04
U13-14	-0.03
U13-13	-0.03
U13-12	-0.25
U13-11	-0.25
U13-10	-0.25
U13-09	-0.06
U13-08	-0.25
U13-07	-0.25
U13-06	-0.05
U13-05	-0.25

U13-04	-0.10
U13-03	-0.10
U13-02	-0.08
U13-01	-0.25
L13-01	-0.07
L13-02	-0.07
L13-03	-0.06
L13-04	-0.05
L13-05	-0.03
L13-06	-0.04
L13-07	-0.07
L13-08	-0.05
L13-09	-0.05
L13-10	0.04
L13-11	Maintenance Needed
L13-12	-0.08
L13-13	-0.03
L13-14	-0.03
L13-15	-0.05
L13-16	-0.05
L13-17	Maintenance Needed
L13-18	0.17
L13-19	-0.03
L13-20	-0.02

L13-21	-0.04
L13-22	-0.04
L13-23	-0.05
L13-24	-0.05
L13-25	-0.02
L13-26	Maintenance Needed
L13-27	-0.03
L13-28	-0.07
L13-29	Maintenance Needed
L13-30	-0.06
L13-31	-0.02
L13-32	-0.05
L13-33	0.03
L13-34	-0.04
L13-35	-0.03
L13-36	-0.07
L13-37	-0.08
L13-38	-0.12
L13-39	-0.03
L13-40	-0.04
L13-41	-0.03
L13-42	-0.03
L13-43	-0.02
L13-44	-0.03

L13-45	-0.10
L13-46	-0.03
L13-47	-0.03
L13-48	-0.03
L13-49	-0.09
L13-50	-0.03
L13-51	-0.03
L13-52	-0.25
L13-53	-0.05
L13-54	-0.03
L13-55	-0.03
L13-56	-0.05
L13-57	-0.02
L13-58	-0.04
L13-59	-0.04
L13-60	-0.15
L13-61	-0.01
L13-62	-0.03
L13-63	Maintenance Needed
L13-64	-0.19
L13-65	0
L13-66	Maintenance Needed
L13-67	-0.03
L13-68	-0.04

L13-69	-0.05
L13-70	-0.07
L13-71	-0.04
L13-72	-0.05
L13-73	-0.03
L13-74	-0.06
L13-75	0.06
L13-76	-0.04
L13-77	-0.05
L13-78	-0.03
L13-79	-0.01
L13-80	Maintenance Needed

Certification

John Boucher
20 Feb 2026 11:53 AM PST

4050 - Daily Pressure Gauge Readings

John Boucher

Complete

Score	224 / 224 (100%)	Flagged items	0	Actions	0

Site conducted	4050 - Chiquita Canyon Landfill -, Corporate (Overall), Western, Western/SO CA L/F
Conducted on	21 Feb 2026 7:57 AM PST
Prepared by	John Boucher

Pressure Gauge Readings	224 / 224 (100%)
#7 Tank Farm	25 / 25 (100%)
SW 08	-0.05
SW 07	Maintenance Needed
SW 06	Maintenance Needed
SW 05	Maintenance Needed
SW 04	Maintenance Needed
SW 03	-0.06
SW 02	Maintenance Needed
SW 01	Maintenance Needed
44	-0.04
111	Maintenance Needed
LCM 11	Maintenance Needed
LCM 12	Maintenance Needed
LCM 13	Maintenance Needed
LCM 14	Maintenance Needed
LCM 15	-0.01
LCM 6	Maintenance Needed
LCM 7	Maintenance Needed
LCM 8	Maintenance Needed
LCM 9	0
LCM 10	0
LCM 1	Maintenance Needed
LCM 2	Maintenance Needed

LCM 3	Maintenance Needed
LCM 4	0.25
LCM 5	-0.10
#10 Tank Farm Canyon D	39 / 39 (100%)
D1	-0.07
D2	-0.25
CD3	Maintenance Needed
CD4	Maintenance Needed
D17	-0.05
D16	Maintenance Needed
D15	Maintenance Needed
D14	0.25
D13	Maintenance Needed
D12	-0.25
D11	Maintenance Needed
D10	0.25
D9	Maintenance Needed
D8	-0.05
D7	-0.02
D6	-0.03
D5	Maintenance Needed
D4	Maintenance Needed
D3	-0.25
D18	Maintenance Needed

D19	Maintenance Needed
D20	-0.10
D21	Maintenance Needed
D22	Maintenance Needed
D23	Maintenance Needed
D24	-0.03
D25	Maintenance Needed
D26	-0.07
D27	Maintenance Needed
D28	Maintenance Needed
D29	Maintenance Needed
D30	Maintenance Needed
D31	Maintenance Needed
D32	Maintenance Needed
D/SW-01	Maintenance Needed
D/SW-02	Maintenance Needed
D/SW-03	Maintenance Needed
D/SW-04	Maintenance Needed
D/SW-05	Maintenance Needed
#13 Tank Farm	160 / 160 (100%)
C13-08	0.07
C13-07	-0.03
C13-06	-0.03
C13-05	-0.04

C13-04	-0.01
C13-03	0.01
C13-02	-0.02
C13-01	-0.04
C13-09	-0.25
C13-10	0.25
C13-11	-0.25
C13-12	0.05
C13-13	-0.25
C13-14	-0.25
C13-15	-0.05
C13-16	-0.25
T1/T2 190	Maintenance Needed
U13-63	Maintenance Needed
U13-62	Maintenance Needed
U13-61	0.01
U13-60	-0.02
U13-59	-0.02
U13-58	-0.04
U13-57	-0.03
U13-56	-0.03
U13-55	-0.06
U13-54	-0.08
U13-53	-0.02

U13-52	-0.23
U13-51	-0.01
U13-50	-0.09
U13-49	-0.02
U13-48	-0.08
U13-47	-0.03
U13-46	0
U13-45	0
U13-44	0
U13-43	0
U13-42	Maintenance Needed
U13-41	-0.03
U13-40	-0.15
U13-39	-0.02
U13-38	-0.03
U13-37	Maintenance Needed
U13-36	-0.05
U13-35	-0.03
U13-34	-0.05
U13-33	-0.04
U13-32	-0.02
U13-31	-0.09
U13-30	Maintenance Needed
U13-29	-0.03

U13-28	0
U13-27	-0.07
U13-26	-0.10
U13-25	-0.09
U13-24	-0.12
U13-23	-0.06
U13-22	-0.05
U13-21	-0.05
U13-20	Maintenance Needed
U13-19	-0.08
U13-18	-0.03
U13-17	-0.03
U13-16	-0.07
U13-15	-0.03
U13-14	-0.03
U13-13	-0.02
U13-12	-0.25
U13-11	-0.25
U13-10	-0.25
U13-09	-0.13
U13-08	-0.25
U13-07	-0.25
U13-06	-0.03
U13-05	-0.25

U13-04	-0.09
U13-03	-0.10
U13-02	-0.07
U13-01	-0.22
L13-01	-0.05
L13-02	-0.03
L13-03	-0.04
L13-04	-0.03
L13-05	-0.02
L13-06	0
L13-07	-0.03
L13-08	0
L13-09	0.05
L13-10	-0.25
L13-11	Maintenance Needed
L13-12	-0.01
L13-13	-0.03
L13-14	-0.25
L13-15	-0.05
L13-16	-0.07
L13-17	Maintenance Needed
L13-18	-0.08
L13-19	-0.07
L13-20	-0.05

L13-21	-0.06
L13-22	-0.04
L13-23	-0.03
L13-24	-0.05
L13-25	-0.03
L13-26	Maintenance Needed
L13-27	-0.03
L13-28	-0.06
L13-29	Maintenance Needed
L13-30	-0.05
L13-31	0
L13-32	-0.05
L13-33	0.03
L13-34	0.01
L13-35	-0.03
L13-36	-0.08
L13-37	-0.10
L13-38	-0.06
L13-39	-0.03
L13-40	-0.03
L13-41	-0.03
L13-42	-0.03
L13-43	-0.03
L13-44	0

L13-45	-0.01
L13-46	-0.04
L13-47	-0.04
L13-48	-0.02
L13-49	-0.02
L13-50	-0.03
L13-51	-0.02
L13-52	0
L13-53	-0.01
L13-54	-0.03
L13-55	-0.02
L13-56	-0.03
L13-57	-0.03
L13-58	-0.01
L13-59	-0.04
L13-60	-0.04
L13-61	-0.15
L13-62	-0.02
L13-63	-0.05
L13-64	Maintenance Needed
L13-65	-0.23
L13-66	0.25
L13-67	Maintenance Needed
L13-68	-0.05

L13-69	-0.05
L13-70	-0.04
L13-71	-0.05
L13-72	0.06
L13-73	-0.02
L13-74	-0.02
L13-75	-0.05
L13-76	-0.02
L13-77	-0.02
L13-78	-0.05
L13-79	-0.02
L13-80	Maintenance Needed

Certification

John Boucher
21 Feb 2026 10:54 AM PST

4050 - Daily Pressure Gauge Readings

Tom Roe

Complete

Score	224 / 224 (100%)	Flagged items	0	Actions	0

Site conducted	4050 - Chiquita Canyon Landfill -, Corporate (Overall), Western, Western/SO CA L/F
Conducted on	22 Feb 2026 7:51 AM PST
Prepared by	Tom Roe

Pressure Gauge Readings	224 / 224 (100%)
#7 Tank Farm	25 / 25 (100%)
SW 08	-0.04
SW 07	Maintenance Needed
SW 06	Maintenance Needed
SW 05	Maintenance Needed
SW 04	Maintenance Needed
SW 03	-0.06
SW 02	Maintenance Needed
SW 01	Maintenance Needed
44	-0.05
111	Maintenance Needed
LCM 11	Maintenance Needed
LCM 12	Maintenance Needed
LCM 13	Maintenance Needed
LCM 14	Maintenance Needed
LCM 15	-0.03
LCM 6	Maintenance Needed
LCM 7	Maintenance Needed
LCM 8	Maintenance Needed
LCM 9	-0.02
LCM 10	-0.02
LCM 1	0.11
LCM 2	Maintenance Needed

LCM 3	Maintenance Needed
LCM 4	0.25
LCM 5	0.10
#10 Tank Farm Canyon D	39 / 39 (100%)
D1	-0.05
D2	-0.25
CD3	Maintenance Needed
CD4	Maintenance Needed
D17	Maintenance Needed
D16	Maintenance Needed
D15	Maintenance Needed
D14	0.25
D13	Maintenance Needed
D12	-0.25
D11	Maintenance Needed
D10	0.25
D9	Maintenance Needed
D8	Maintenance Needed
D7	Maintenance Needed
D6	Maintenance Needed
D5	Maintenance Needed
D4	Maintenance Needed
D3	-0.25
D18	Maintenance Needed

D19	Maintenance Needed
D20	-0.10
D21	Maintenance Needed
D22	Maintenance Needed
D23	Maintenance Needed
D24	-0.04
D25	Maintenance Needed
D26	0.25
D27	Maintenance Needed
D28	Maintenance Needed
D29	Maintenance Needed
D30	Maintenance Needed
D31	Maintenance Needed
D32	Maintenance Needed
D/SW-01	Maintenance Needed
D/SW-02	Maintenance Needed
D/SW-03	Maintenance Needed
D/SW-04	Maintenance Needed
D/SW-05	Maintenance Needed
#13 Tank Farm	160 / 160 (100%)
C13-08	0.06
C13-07	-0.02
C13-06	-0.03
C13-05	-0.03

C13-04	0.01
C13-03	0
C13-02	-0.02
C13-01	-0.03
C13-09	-0.25
C13-10	-0.25
C13-11	-0.25
C13-12	0.05
C13-13	-0.25
C13-14	-0.25
C13-15	Maintenance Needed
C13-16	-0.25
T1/T2 190	Maintenance Needed
U13-63	Maintenance Needed
U13-62	Maintenance Needed
U13-61	-0.02
U13-60	-0.02
U13-59	-0.01
U13-58	-0.02
U13-57	-0.03
U13-56	-0.03
U13-55	-0.05
U13-54	0.13
U13-53	-0.02

U13-52	Maintenance Needed
U13-51	-0.02
U13-50	-0.07
U13-49	0
U13-48	-0.06
U13-47	-0.02
U13-46	-0.02
U13-45	0
U13-44	0
U13-43	0
U13-42	Maintenance Needed
U13-41	-0.02
U13-40	-0.01
U13-39	-0.02
U13-38	-0.03
U13-37	Maintenance Needed
U13-36	-0.04
U13-35	-0.02
U13-34	-0.04
U13-33	-0.04
U13-32	-0.03
U13-31	-0.05
U13-30	Maintenance Needed
U13-29	-0.03

U13-28	-0.02
U13-27	-0.08
U13-26	-0.10
U13-25	-0.08
U13-24	-0.13
U13-23	-0.07
U13-22	-0.06
U13-21	-0.06
U13-20	Maintenance Needed
U13-19	-0.07
U13-18	-0.02
U13-17	-0.04
U13-16	-0.07
U13-15	-0.03
U13-14	-0.03
U13-13	-0.03
U13-12	-0.19
U13-11	-0.25
U13-10	-0.25
U13-09	-0.04
U13-08	-0.25
U13-07	-0.25
U13-06	-0.04
U13-05	-0.25

U13-04	-0.09
U13-03	-0.10
U13-02	-0.07
U13-01	-0.12
L13-01	-0.06
L13-02	-0.04
L13-03	-0.06
L13-04	-0.05
L13-05	-0.04
L13-06	-0.02
L13-07	0.03
L13-08	0.05
L13-09	0.25
L13-10	0
L13-11	Maintenance Needed
L13-12	-0.03
L13-13	-0.02
L13-14	-0.03
L13-15	-0.02
L13-16	-0.05
L13-17	Maintenance Needed
L13-18	-0.05
L13-19	-0.05
L13-20	-0.04

L13-21	-0.06
L13-22	-0.03
L13-23	-0.02
L13-24	-0.05
L13-25	-0.04
L13-26	Maintenance Needed
L13-27	-0.03
L13-28	-0.06
L13-29	Maintenance Needed
L13-30	-0.05
L13-31	-0.03
L13-32	-0.05
L13-33	0.02
L13-34	-0.04
L13-35	-0.03
L13-36	-0.05
L13-37	-0.09
L13-38	-0.06
L13-39	-0.03
L13-40	-0.04
L13-41	-0.03
L13-42	-0.03
L13-43	-0.04
L13-44	Maintenance Needed

L13-45	-0.03
L13-46	-0.04
L13-47	-0.04
L13-48	-0.03
L13-49	-0.02
L13-50	-0.04
L13-51	-0.02
L13-52	-0.01
L13-53	-0.02
L13-54	-0.05
L13-55	-0.02
L13-56	-0.03
L13-57	-0.01
L13-58	-0.02
L13-59	-0.03
L13-60	-0.04
L13-61	-0.15
L13-62	-0.01
L13-63	-0.05
L13-64	Maintenance Needed
L13-65	-0.17
L13-66	-0.02
L13-67	Maintenance Needed
L13-68	-0.02

L13-69	-0.03
L13-70	-0.01
L13-71	-0.05
L13-72	-0.04
L13-73	0.05
L13-74	-0.01
L13-75	-0.05
L13-76	-0.02
L13-77	-0.03
L13-78	-0.04
L13-79	-0.01
L13-80	Maintenance Needed

Certification

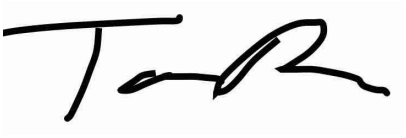

Tom Roe
22 Feb 2026 10:47 AM PST

4050 - Daily Pressure Gauge Readings

Nancy Bahena Hernandez

Complete

Score	224 / 224 (100%)	Flagged items	0	Actions	0

Site conducted	4050 - Chiquita Canyon Landfill -, Corporate (Overall), Western, Western/SO CA L/F
Conducted on	23 Feb 2026 1:58 PM PST
Prepared by	Nancy Bahena Hernandez

Pressure Gauge Readings	224 / 224 (100%)
#7 Tank Farm	25 / 25 (100%)
SW 08	-0.01
SW 07	Maintenance Needed
SW 06	Maintenance Needed
SW 05	Maintenance Needed
SW 04	Maintenance Needed
SW 03	-0.06
SW 02	Maintenance Needed
SW 01	Maintenance Needed
No meter	
44	-0.01
111	Maintenance Needed
No meter	
LCM 11	Maintenance Needed
LCM 12	Maintenance Needed
LCM 13	Maintenance Needed
LCM 14	Maintenance Needed
LCM 15	0
LCM 6	Maintenance Needed
LCM 7	Maintenance Needed
LCM 8	Maintenance Needed
LCM 9	-0.02
LCM 10	-0.02
LCM 1	Maintenance Needed

LCM 2	Maintenance Needed
LCM 3	Maintenance Needed
LCM 4	0.25
LCM 5	0.25
#10 Tank Farm Canyon D	39 / 39 (100%)
D1	-0.05
D2	-0.25
CD3	Maintenance Needed
No meter attached	
CD4	Maintenance Needed
No meter attached	
D17	Maintenance Needed
D16	Maintenance Needed
D15	Maintenance Needed
Meter not attached	
D14	0.25
D13	Maintenance Needed
Meter not attached	
D12	-0.25
D11	Maintenance Needed
D10	Maintenance Needed
D9	Maintenance Needed
No meter attached	
D8	Maintenance Needed
D7	0
D6	Maintenance Needed

D5	Maintenance Needed
D4	Maintenance Needed
Meter not attached	
D3	-0.25
D18	Maintenance Needed
D19	Maintenance Needed
D20	-0.12
D21	Maintenance Needed
Meter not attached	
D22	Maintenance Needed
D23	Maintenance Needed
D24	-0.04
D25	Maintenance Needed
No meter attached	
D26	0.15
D27	Maintenance Needed
D28	Maintenance Needed
D29	Maintenance Needed
D30	Maintenance Needed
D31	Maintenance Needed
Meter not attached	
D32	Maintenance Needed
D/SW-01	Maintenance Needed
No meter	
D/SW-02	Maintenance Needed
No meter	

D/SW-03	Maintenance Needed
No meter	
D/SW-04	Maintenance Needed
No meter	
D/SW-05	Maintenance Needed
No meter	
#13 Tank Farm	160 / 160 (100%)
C13-08	0.08
C13-07	0
C13-06	0.01
C13-05	0
C13-04	0.02
C13-03	0.01
C13-02	0.01
C13-01	0
C13-09	-0.25
C13-10	-0.25
C13-11	-0.25
C13-12	0.03
C13-13	-0.25
C13-14	-0.25
C13-15	Maintenance Needed
C13-16	Maintenance Needed
T1/T2 190	Maintenance Needed
U13-63	Maintenance Needed

U13-62	-0.02
U13-61	0
U13-60	-0.02
U13-59	-0.01
U13-58	0
U13-57	-0.02
U13-56	-0.02
U13-55	-0.05
U13-54	Maintenance Needed
U13-53	-0.03
U13-52	-0.25
U13-51	-0.01
U13-50	-0.10
U13-49	0
U13-48	-0.15
U13-47	-0.05
U13-46	-0.02
U13-45	0
U13-44	-0.01
U13-43	0
U13-42	Maintenance Needed
U13-41	0
U13-40	0
U13-39	0

U13-38	0
U13-37	Maintenance Needed
No meter attached	
U13-36	-0.01
U13-35	-0.05
U13-34	-0.05
U13-33	-0.05
U13-32	-0.01
U13-31	-0.05
U13-30	Maintenance Needed
No meter attached	
U13-29	-0.02
U13-28	0
U13-27	-0.06
U13-26	-0.10
U13-25	-0.07
U13-24	-0.10
U13-23	-0.05
U13-22	Maintenance Needed
U13-21	-0.05
U13-20	Maintenance Needed
No meter attached	
U13-19	-0.05
U13-18	-0.01
U13-17	-0.02

U13-16	-0.06
U13-15	-0.01
U13-14	-0.01
U13-13	0
U13-12	-0.25
U13-11	-0.25
U13-10	-0.25
U13-09	-0.12
U13-08	-0.25
U13-07	-0.25
U13-06	-0.02
U13-05	-0.25
U13-04	-0.07
U13-03	-0.05
U13-02	-0.05
U13-01	-0.20
L13-01	-0.25
L13-02	-0.05
L13-03	-0.06
L13-04	-0.05
L13-05	-0.04
L13-06	-0.01
L13-07	-0.05
L13-08	-0.05

L13-09	-0.04
L13-10	0.05
L13-11	Maintenance Needed
No meter attached	
L13-12	0
L13-13	-0.02
L13-14	0
L13-15	0
L13-16	-0.02
L13-17	Maintenance Needed
Meter not attached to the tank	
L13-18	-0.05
L13-19	-0.05
L13-20	-0.05
L13-21	-0.06
L13-22	-0.02
L13-23	-0.02
L13-24	-0.05
L13-25	-0.01
L13-26	Maintenance Needed
Meter not attached	
L13-27	-0.01
L13-28	-0.05
L13-29	Maintenance Needed
Meter not attached	

L13-30	-0.05
L13-31	0
L13-32	-0.05
L13-33	0.05
L13-34	-0.02
L13-35	-0.01
L13-36	-0.06
L13-37	-0.10
L13-38	-0.02
L13-39	-0.02
L13-40	-0.02
L13-41	-0.02
L13-42	-0.02
L13-43	-0.02
L13-44	Maintenance Needed
L13-45	-0.01
L13-46	-0.02
L13-47	-0.02
L13-48	-0.02
L13-49	-0.01
L13-50	-0.01
L13-51	-0.01
L13-52	-0.01
L13-53	-0.02

L13-54	0
L13-55	-0.02
L13-56	Maintenance Needed
L13-57	0
L13-58	-0.02
L13-59	-0.15
L13-60	-0.01
L13-61	-0.01
L13-62	0
L13-63	-0.01
L13-64	Maintenance Needed

No meter attached

L13-65	-0.25
L13-66	0
L13-67	Maintenance Needed

No Meter attached

L13-68	-0.01
L13-69	-0.02
L13-70	0
L13-71	-0.06
L13-72	-0.05
L13-73	-0.20
L13-74	Maintenance Needed
L13-75	-0.05
L13-76	0

L13-77	-0.02
L13-78	-0.02
L13-79	0
L13-80	Maintenance Needed

No meter attached

Certification

Nancy bahena hernandez
23 Feb 2026 4:50 PM PST

4050 - Daily Pressure Gauge Readings

Nancy Bahena Hernandez

Complete

Score	224 / 224 (100%)	Flagged items	0	Actions	0

Site conducted	4050 - Chiquita Canyon Landfill -, Corporate (Overall), Western, Western/SO CA L/F
Conducted on	24 Feb 2026 8:09 AM PST
Prepared by	Nancy Bahena Hernandez

Pressure Gauge Readings	224 / 224 (100%)
#7 Tank Farm	25 / 25 (100%)
SW 08	-0.01
SW 07	Maintenance Needed
SW 06	Maintenance Needed
SW 05	Maintenance Needed
SW 04	Maintenance Needed
SW 03	-0.06
SW 02	Maintenance Needed
SW 01	Maintenance Needed
No meter	
44	-0.05
111	Maintenance Needed
No meter	
LCM 11	Maintenance Needed
LCM 12	Maintenance Needed
LCM 13	Maintenance Needed
LCM 14	Maintenance Needed
LCM 15	-0.02
LCM 6	Maintenance Needed
LCM 7	Maintenance Needed
LCM 8	-0.02
LCM 9	0
LCM 10	Maintenance Needed
LCM 1	Maintenance Needed

LCM 2	Maintenance Needed
LCM 3	Maintenance Needed
LCM 4	0.25
LCM 5	0.25
#10 Tank Farm Canyon D	39 / 39 (100%)
D1	-0.05
D2	-0.25
CD3	Maintenance Needed
CD4	Maintenance Needed
D17	Maintenance Needed
D16	Maintenance Needed
D15	Maintenance Needed
Meter not attached	
D14	0.25
D13	Maintenance Needed
Meter not attached	
D12	-0.25
D11	Maintenance Needed
D10	Maintenance Needed
D9	Maintenance Needed
Meter not attached	
D8	Maintenance Needed
D7	Maintenance Needed
D6	Maintenance Needed
D5	Maintenance Needed

Meter not attached	
D4	Maintenance Needed
Meter not attached	
D3	-0.25
D18	Maintenance Needed
D19	Maintenance Needed
D20	-0.12
D21	Maintenance Needed
Meter not attached	
D22	Maintenance Needed
D23	Maintenance Needed
D24	-0.03
D25	Maintenance Needed
D26	0.25
D27	Maintenance Needed
D28	Maintenance Needed
D29	Maintenance Needed
D30	Maintenance Needed
D31	Maintenance Needed
Meter not attached	
D32	Maintenance Needed
D/SW-01	Maintenance Needed
No meter	
D/SW-02	Maintenance Needed
No meter	
D/SW-03	Maintenance Needed

No meter	
D/SW-04	Maintenance Needed
No meter	
D/SW-05	Maintenance Needed
No meter	
#13 Tank Farm	160 / 160 (100%)
C13-08	0.05
C13-07	-0.02
C13-06	-0.01
C13-05	-0.02
C13-04	0.01
C13-03	0
C13-02	-0.01
C13-01	-0.03
C13-09	-0.25
C13-10	-0.25
C13-11	-0.25
C13-12	0.04
C13-13	-0.25
C13-14	-0.25
C13-15	Maintenance Needed
C13-16	-0.25
T1/T2 190	Maintenance Needed
U13-63	Maintenance Needed
U13-62	-0.01

U13-61	0
U13-60	0
U13-59	0
U13-58	0
U13-57	0
U13-56	-0.01
U13-55	-0.04
U13-54	0
U13-53	-0.05
U13-52	Maintenance Needed
U13-51	0
U13-50	-0.06
U13-49	-0.01
U13-48	-0.08
U13-47	-0.02
U13-46	0
U13-45	0
U13-44	0
U13-43	0
U13-42	Maintenance Needed
U13-41	0
U13-40	0
U13-39	-0.01
U13-38	-0.01

U13-37	Maintenance Needed
Meter not attached	
U13-36	-0.02
U13-35	-0.06
U13-34	-0.02
U13-33	-0.05
U13-32	-0.01
U13-31	-0.05
U13-30	Maintenance Needed
Meter not attached	
U13-29	-0.01
U13-28	0
U13-27	-0.05
U13-26	-0.06
U13-25	0.01
U13-24	-0.05
U13-23	-0.02
U13-22	-0.02
U13-21	-0.03
U13-20	Maintenance Needed
Meter not attached	
U13-19	-0.04
U13-18	-0.01
U13-17	-0.05
U13-16	-0.05

U13-15	-0.02
U13-14	-0.02
U13-13	0
U13-12	-0.21
U13-11	-0.24
U13-10	-0.25
U13-09	-0.10
U13-08	-0.25
U13-07	-0.25
U13-06	-0.02
U13-05	-0.22
U13-04	-0.07
U13-03	-0.07
U13-02	-0.05
U13-01	-0.20
L13-01	-0.14
L13-02	0.21
L13-03	-0.05
L13-04	0.16
L13-05	Maintenance Needed
L13-06	-0.05
L13-07	-0.05
L13-08	-0.06
L13-09	-0.05

L13-10	0.05
L13-11	Maintenance Needed
L13-12	-0.03
L13-13	-0.02
L13-14	-0.05
L13-15	-0.06
L13-16	-0.04
L13-17	Maintenance Needed
Meter not attached	
L13-18	-0.05
L13-19	-0.05
L13-20	-0.05
L13-21	-0.05
L13-22	-0.05
L13-23	-0.04
L13-24	-0.05
L13-25	-0.02
L13-26	Maintenance Needed
L13-27	-0.03
L13-28	-0.06
L13-29	Maintenance Needed
Meter not attached	
L13-30	-0.05
L13-31	-0.02
L13-32	-0.04

L13-33	0.02
L13-34	-0.02
L13-35	-0.02
L13-36	-0.07
L13-37	-0.10
L13-38	-0.05
L13-39	-0.02
L13-40	-0.04
L13-41	-0.02
L13-42	-0.05
L13-43	-0.05
L13-44	Maintenance Needed
L13-45	-0.05
L13-46	-0.02
L13-47	-0.03
L13-48	-0.01
L13-49	-0.02
L13-50	-0.03
L13-51	-0.01
L13-52	0
L13-53	-0.01
L13-54	-0.02
L13-55	-0.01
L13-56	-0.02

L13-57	-0.03
L13-58	-0.01
L13-59	-0.01
L13-60	-0.01
L13-61	-0.15
L13-62	-0.01
L13-63	-0.04
L13-64	Maintenance Needed
No meter attached	
L13-65	-0.25
L13-66	0
L13-67	Maintenance Needed
Meter not attached	
L13-68	-0.02
L13-69	-0.01
L13-70	-0.25
L13-71	-0.06
L13-72	-0.06
L13-73	-0.20
L13-74	0
L13-75	-0.06
L13-76	0
L13-77	0
L13-78	-0.03
L13-79	0

L13-80

Maintenance Needed

Meter not attached

Certification

Nancy Bahena Hernandez
24 Feb 2026 3:05 PM PST

4050 - Daily Pressure Gauge Readings

Nancy Bahena Hernandez

Complete

Score	224 / 224 (100%)	Flagged items	0	Actions	0

Site conducted	4050 - Chiquita Canyon Landfill -, Corporate (Overall), Western, Western/SO CA L/F
Conducted on	25 Feb 2026 9:03 AM PST
Prepared by	Nancy Bahena Hernandez

Pressure Gauge Readings	224 / 224 (100%)
#7 Tank Farm	25 / 25 (100%)
SW 08	Maintenance Needed
SW 07	Maintenance Needed
SW 06	Maintenance Needed
SW 05	Maintenance Needed
SW 04	Maintenance Needed
SW 03	-0.06
SW 02	Maintenance Needed
SW 01	Maintenance Needed
No meter	
44	0
111	Maintenance Needed
No meter	
LCM 11	Maintenance Needed
LCM 12	Maintenance Needed
LCM 13	Maintenance Needed
LCM 14	Maintenance Needed
LCM 15	-0.01
LCM 6	Maintenance Needed
LCM 7	Maintenance Needed
LCM 8	Maintenance Needed
LCM 9	-0.01
LCM 10	0
LCM 1	Maintenance Needed

LCM 2	Maintenance Needed
LCM 3	Maintenance Needed
LCM 4	0.25
LCM 5	0.15
#10 Tank Farm Canyon D	39 / 39 (100%)
D1	-0.05
D2	-0.25
CD3	Maintenance Needed
CD4	Maintenance Needed
D17	Maintenance Needed
D16	Maintenance Needed
D15	Maintenance Needed
Meter not attached to the tank	
D14	0.25
D13	Maintenance Needed
Meter not attached to the tank	
D12	-0.25
D11	-0.12
D10	0.25
D9	Maintenance Needed
Meter not attached to the tank	
D8	Maintenance Needed
D7	0
D6	-0.02
D5	Maintenance Needed

Meter not attached to the tank	
D4	Maintenance Needed
Meter not attached to the tank	
D3	-0.25
D18	Maintenance Needed
D19	Maintenance Needed
D20	-0.10
D21	Maintenance Needed
Meter not attached to the tank	
D22	-0.02
D23	Maintenance Needed
D24	-0.02
D25	Maintenance Needed
D26	0.25
D27	Maintenance Needed
D28	Maintenance Needed
D29	Maintenance Needed
D30	Maintenance Needed
D31	Maintenance Needed
Meter not attached to the tank	
D32	Maintenance Needed
D/SW-01	Maintenance Needed
No meter	
D/SW-02	Maintenance Needed
No meter	
D/SW-03	Maintenance Needed

No meter	
D/SW-04	Maintenance Needed
No meter	
D/SW-05	Maintenance Needed
No meter	
#13 Tank Farm	160 / 160 (100%)
C13-08	0.03
C13-07	-0.02
C13-06	-0.02
C13-05	-0.02
C13-04	0
C13-03	0
C13-02	0
C13-01	-0.05
C13-09	-0.25
C13-10	-0.25
C13-11	-0.25
C13-12	0.05
C13-13	-0.25
C13-14	-0.25
C13-15	Maintenance Needed
C13-16	-0.25
T1/T2 190	Maintenance Needed
U13-63	Maintenance Needed
U13-62	-0.02

U13-61	Maintenance Needed
U13-60	-0.02
U13-59	0
U13-58	0
U13-57	-0.02
U13-56	-0.01
U13-55	-0.05
U13-54	-0.25
U13-53	-0.02
U13-52	Maintenance Needed
U13-51	-0.01
U13-50	0
U13-49	0
U13-48	-0.05
U13-47	-0.01
U13-46	0
U13-45	0
U13-44	0
U13-43	0
U13-42	Maintenance Needed
U13-41	0
U13-40	0
U13-39	0
U13-38	-0.01

U13-37	Maintenance Needed
Meter not attached	
U13-36	-0.01
U13-35	-0.23
U13-34	-0.05
U13-33	-0.04
U13-32	-0.03
U13-31	-0.05
U13-30	Maintenance Needed
Meter not attached	
U13-29	-0.02
U13-28	0
U13-27	-0.07
U13-26	-0.10
U13-25	-0.07
U13-24	-0.10
U13-23	-0.07
U13-22	-0.06
U13-21	-0.03
U13-20	Maintenance Needed
Meter not attached	
U13-19	-0.05
U13-18	-0.02
U13-17	-0.02
U13-16	-0.05

U13-15	-0.01
U13-14	0
U13-13	-0.22
U13-12	-0.25
U13-11	-0.25
U13-10	-0.05
U13-09	-0.25
U13-08	-0.25
U13-07	-0.25
U13-06	-0.02
U13-05	-0.25
U13-04	-0.07
U13-03	-0.07
U13-02	-0.06
U13-01	-0.20
L13-01	-0.05
L13-02	-0.02
L13-03	-0.04
L13-04	-0.02
L13-05	0
L13-06	-0.02
L13-07	-0.04
L13-08	-0.05
L13-09	-0.04

L13-10	0.02
L13-11	Maintenance Needed
Meter not attached	
L13-12	-0.02
L13-13	-0.02
L13-14	-0.02
L13-15	-0.04
L13-16	Maintenance Needed
L13-17	Maintenance Needed
No meter attached	
L13-18	-0.04
L13-19	-0.03
L13-20	-0.02
L13-21	-0.04
L13-22	-0.03
L13-23	0.25
L13-24	-0.02
L13-25	0
L13-26	Maintenance Needed
Meter not attached	
L13-27	-0.01
L13-28	-0.02
L13-29	Maintenance Needed
No meter attached	
L13-30	-0.04

L13-31	-0.01
L13-32	-0.04
L13-33	0.02
L13-34	-0.02
L13-35	-0.02
L13-36	-0.05
L13-37	-0.07
L13-38	-0.03
L13-39	-0.01
L13-40	-0.02
L13-41	-0.02
L13-42	-0.02
L13-43	-0.02
L13-44	Maintenance Needed
L13-45	-0.02
L13-46	-0.04
L13-47	-0.02
L13-48	-0.01
L13-49	-0.02
L13-50	-0.04
L13-51	-0.01
L13-52	0
L13-53	-0.01
L13-54	-0.04

L13-55	-0.01
L13-56	-0.01
L13-57	-0.02
L13-58	0
L13-59	-0.02
L13-60	-0.02
L13-61	-0.15
L13-62	0
L13-63	-0.02
L13-64	Maintenance Needed
Meter not attached	
L13-65	-0.25
L13-66	-0.01
L13-67	Maintenance Needed
Meter not attached	
L13-68	-0.01
L13-69	-0.02
L13-70	-0.01
L13-71	-0.05
L13-72	-0.05
L13-73	-0.20
L13-74	0
L13-75	-0.05
L13-76	0
L13-77	-0.01

L13-78	-0.04
L13-79	0
L13-80	Maintenance Needed

Meter not attached

Certification

Nancy Bahena Hernandez
25 Feb 2026 3:49 PM PST

4050 - Daily Pressure Gauge Readings

Nancy Bahena Hernandez

Complete

Score	224 / 224 (100%)	Flagged items	0	Actions	0

Site conducted	4050 - Chiquita Canyon Landfill -, Corporate (Overall), Western, Western/SO CA L/F
Conducted on	26 Feb 2026 2:30 PM PST
Prepared by	Nancy Bahena Hernandez

Pressure Gauge Readings	224 / 224 (100%)
#7 Tank Farm	25 / 25 (100%)
SW 08	0.02
SW 07	-0.05
SW 06	-0.04
SW 05	0.03
SW 04	-0.04
SW 03	-0.05
SW 02	-0.02
SW 01	Maintenance Needed
No gauge	
44	-0.16
111	Maintenance Needed
No gauge	
LCM 11	-0.02
LCM 12	-0.03
LCM 13	-0.01
LCM 14	0
LCM 15	0
LCM 6	-0.05
LCM 7	Maintenance Needed
LCM 8	Maintenance Needed
LCM 9	-0.02
LCM 10	-0.01
LCM 1	Maintenance Needed

new gauge needed/broken

LCM 2	Maintenance Needed
LCM 3	Maintenance Needed
LCM 4	0.25
LCM 5	0.13
#10 Tank Farm Canyon D	39 / 39 (100%)
D1	-0.12
D2	-0.25
CD3	Maintenance Needed
CD4	Maintenance Needed
D17	-0.02
D16	0.25
D15	Maintenance Needed

Remount Gauge

D14	0.01
D13	Maintenance Needed

Remount Gauge

D12	-0.25
D11	0.25
D10	0.25
D9	Maintenance Needed

Remount gauge

D8	Maintenance Needed
D7	0
D6	Maintenance Needed

D5	Maintenance Needed
Remount gauge	
D4	Maintenance Needed
Remount gauge	
D3	-0.25
D18	-0.05
D19	Maintenance Needed
D20	-0.15
D21	Maintenance Needed
Needs a new gauge	
D22	Maintenance Needed
No gauge	
D23	-0.01
D24	-0.02
D25	Maintenance Needed
No gauge	
D26	0.25
D27	-0.01
D28	-0.25
D29	Maintenance Needed
D30	-0.25
D31	Maintenance Needed
Remount gauge	
D32	-0.25
D/SW-01	Maintenance Needed
No gauge	

D/SW-02	Maintenance Needed
No gauge	
D/SW-03	Maintenance Needed
No gauge	
D/SW-04	Maintenance Needed
No gauge	
D/SW-05	Maintenance Needed
No gauge	
#13 Tank Farm	160 / 160 (100%)
C13-08	0.05
C13-07	0
C13-06	0.01
C13-05	0
C13-04	0.01
C13-03	0
C13-02	0
C13-01	0
C13-09	-0.25
C13-10	-0.25
C13-11	-0.25
C13-12	0.05
C13-13	-0.25
C13-14	-0.25
C13-15	Maintenance Needed
C13-16	-0.25

T1/T2 190	Maintenance Needed
U13-63	Maintenance Needed
U13-62	-0.05
U13-61	0
U13-60	-0.02
U13-59	-0.01
U13-58	-0.05
U13-57	-0.01
U13-56	-0.02
U13-55	0
U13-54	-0.25
U13-53	-0.05
U13-52	Maintenance Needed
U13-51	-0.02
U13-50	-0.05
U13-49	0
U13-48	-0.12
U13-47	0
U13-46	0
U13-45	0
U13-44	0
U13-43	0
U13-42	Maintenance Needed
U13-41	-0.02

U13-40	-0.02
U13-39	-0.02
U13-38	-0.01
U13-37	Maintenance Needed
Remount gauge	
U13-36	-0.05
U13-35	-0.04
U13-34	-0.05
U13-33	-0.05
U13-32	-0.04
U13-31	-0.07
U13-30	Maintenance Needed
Remount gauge	
U13-29	-0.02
U13-28	-0.01
U13-27	-0.06
U13-26	-0.12
U13-25	-0.11
U13-24	-0.12
U13-23	-0.07
U13-22	-0.05
U13-21	-0.05
U13-20	Maintenance Needed
Remount gauge	
U13-19	-0.05

U13-18	0
U13-17	-0.05
U13-16	-0.05
U13-15	-0.02
U13-14	-0.01
U13-13	-0.01
U13-12	-0.25
U13-11	-0.25
U13-10	-0.25
U13-09	-0.15
U13-08	-0.25
U13-07	-0.25
U13-06	-0.02
U13-05	-0.25
U13-04	-0.07
U13-03	-0.07
U13-02	-0.05
U13-01	-0.25
L13-01	-0.07
L13-02	-0.05
L13-03	-0.04
L13-04	-0.05
L13-05	-0.05
L13-06	-0.02

L13-07	-0.07
L13-08	-0.05
L13-09	-0.05
L13-10	0.05
L13-11	Maintenance Needed
Remount gauge	
L13-12	0.03
L13-13	0
L13-14	-0.01
L13-15	-0.07
L13-16	Maintenance Needed
L13-17	Maintenance Needed
Remount gauge	
L13-18	-0.02
L13-19	-0.05
L13-20	0
L13-21	-0.05
L13-22	-0.02
L13-23	-0.02
L13-24	-0.06
L13-25	-0.02
L13-26	Maintenance Needed
Remount gauge	
L13-27	-0.02
L13-28	-0.06

L13-29	Maintenance Needed
Remount gauge	
L13-30	-0.05
L13-31	0
L13-32	-0.02
L13-33	0.05
L13-34	-0.02
L13-35	-0.25
L13-36	-0.07
L13-37	-0.12
L13-38	-0.05
L13-39	-0.03
L13-40	-0.05
L13-41	-0.02
L13-42	-0.05
L13-43	0
L13-44	Maintenance Needed
L13-45	-0.02
L13-46	-0.03
L13-47	-0.05
L13-48	-0.03
L13-49	-0.03
L13-50	-0.04
L13-51	-0.02

L13-52	-0.01
L13-53	-0.01
L13-54	-0.02
L13-55	-0.01
L13-56	0
L13-57	-0.01
L13-58	0
L13-59	-0.05
L13-60	-0.05
L13-61	-0.16
L13-62	0
L13-63	-0.05
L13-64	Maintenance Needed
Remount gauge	
L13-65	-0.25
L13-66	-0.01
L13-67	Maintenance Needed
Remount gauge	
L13-68	-0.01
L13-69	-0.02
L13-70	-0.02
L13-71	-0.06
L13-72	-0.05
L13-73	-0.22
L13-74	-0.05

L13-75	-0.05
L13-76	0
L13-77	0
L13-78	-0.01
L13-79	0
L13-80	Maintenance Needed

Remount gauge

Certification

Nancy Bahena Hernandez
26 Feb 2026 4:00 PM PST

4050 - Daily Pressure Gauge Readings

Nancy Bahena Hernandez

Complete

Score	224 / 224 (100%)	Flagged items	0	Actions	0

Site conducted	4050 - Chiquita Canyon Landfill -, Corporate (Overall), Western, Western/SO CA L/F
Conducted on	27 Feb 2026 8:57 AM PST
Prepared by	Nancy Bahena Hernandez

Pressure Gauge Readings	224 / 224 (100%)
#7 Tank Farm	25 / 25 (100%)
SW 08	0
SW 07	-0.05
SW 06	-0.05
SW 05	0.01
SW 04	0
SW 03	-0.06
SW 02	0.25
SW 01	Maintenance Needed
Missing gauge	
44	-0.01
111	Maintenance Needed
Missing gauge	
LCM 11	-0.04
LCM 12	-0.02
LCM 13	-0.02
LCM 14	-0.03
LCM 15	0
LCM 6	-0.01
LCM 7	Maintenance Needed
LCM 8	Maintenance Needed
LCM 9	Maintenance Needed
LCM 10	-0.02
LCM 1	Maintenance Needed

Replace gauge/ broken	
LCM 2	Maintenance Needed
LCM 3	Maintenance Needed
LCM 4	0.25
LCM 5	0.06
#10 Tank Farm Canyon D	39 / 39 (100%)
D1	-0.02
D2	-0.25
CD3	Maintenance Needed
CD4	Maintenance Needed
D17	0.25
D16	0.25
D15	Maintenance Needed
Remount gauge	
D14	0.04
D13	Maintenance Needed
Remount gauge	
D12	-0.25
D11	0.25
D10	0.25
D9	Maintenance Needed
Remount gauge	
D8	Maintenance Needed
D7	0
D6	Maintenance Needed

D5	Maintenance Needed
Remount gauge	
D4	Maintenance Needed
Remount gauge	
D3	-0.25
D18	-0.05
D19	Maintenance Needed
D20	-0.12
D21	Maintenance Needed
Gauge replacement needed	
D22	Maintenance Needed
Missing gauge	
D23	0
D24	-0.02
D25	Maintenance Needed
Missing gauge	
D26	0.25
D27	-0.01
D28	-0.25
D29	Maintenance Needed
D30	-0.25
D31	Maintenance Needed
Remount gauge	
D32	-0.25
D/SW-01	Maintenance Needed
No gauge	

D/SW-02	Maintenance Needed
No gauge	
D/SW-03	Maintenance Needed
No gauge	
D/SW-04	Maintenance Needed
No gauge	
D/SW-05	Maintenance Needed
No gauge	
#13 Tank Farm	160 / 160 (100%)
C13-08	0.10
C13-07	0
C13-06	0
C13-05	0
C13-04	0.01
C13-03	0
C13-02	0
C13-01	0
C13-09	-0.25
C13-10	-0.25
C13-11	-0.25
C13-12	0.02
C13-13	-0.25
C13-14	-0.25
C13-15	Maintenance Needed
C13-16	-0.25

T1/T2 190	Maintenance Needed
U13-63	Maintenance Needed
U13-62	-0.01
U13-61	0
U13-60	-0.01
U13-59	0
U13-58	0
U13-57	-0.01
U13-56	-0.01
U13-55	-0.05
U13-54	-0.25
U13-53	-0.03
U13-52	Maintenance Needed
U13-51	0
U13-50	-0.06
U13-49	0
U13-48	-0.18
U13-47	-0.01
U13-46	-0.02
U13-45	0
U13-44	-0.01
U13-43	0
U13-42	Maintenance Needed
U13-41	0

U13-40	0
U13-39	Maintenance Needed
U13-38	0
U13-37	Maintenance Needed
Remount gauge	
U13-36	-0.02
U13-35	-0.10
U13-34	-0.05
U13-33	-0.05
U13-32	-0.02
U13-31	-0.03
U13-30	Maintenance Needed
Remount gauge	
U13-29	-0.02
U13-28	0
U13-27	-0.06
U13-26	-0.09
U13-25	-0.06
U13-24	-0.10
U13-23	-0.05
U13-22	-0.06
U13-21	-0.02
U13-20	Maintenance Needed
Remount gauge	
U13-19	-0.04

U13-18	0.01
U13-17	-0.02
U13-16	-0.05
U13-15	-0.01
U13-14	-0.01
U13-13	0
U13-12	-0.25
U13-11	-0.25
U13-10	-0.25
U13-09	-0.04
U13-08	-0.25
U13-07	-0.25
U13-06	-0.01
U13-05	-0.25
U13-04	-0.07
U13-03	-0.07
U13-02	-0.06
U13-01	-0.22
L13-01	-0.05
L13-02	-0.05
L13-03	-0.05
L13-04	-0.02
L13-05	-0.05
L13-06	-0.02

L13-07	-0.05
L13-08	-0.05
L13-09	-0.05
L13-10	0.05
L13-11	Maintenance Needed
Remount gauge	
L13-12	-0.01
L13-13	-0.01
L13-14	0
L13-15	-0.05
L13-16	Maintenance Needed
L13-17	Maintenance Needed
Remount gauge	
L13-18	-0.05
L13-19	-0.04
L13-20	-0.03
L13-21	-0.05
L13-22	-0.02
L13-23	-0.03
L13-24	-0.05
L13-25	0.01
L13-26	Maintenance Needed
Remount gauge	
L13-27	0
L13-28	-0.05

L13-29	Maintenance Needed
Remount gauge	
L13-30	0.01
L13-31	0
L13-32	-0.04
L13-33	0.02
L13-34	-0.01
L13-35	-0.02
L13-36	0.25
L13-37	-0.10
L13-38	-0.05
L13-39	-0.05
L13-40	0
L13-41	-0.01
L13-42	-0.02
L13-43	-0.02
L13-44	Maintenance Needed
L13-45	-0.01
L13-46	-0.02
L13-47	-0.02
L13-48	-0.02
L13-49	-0.02
L13-50	-0.02
L13-51	-0.02

L13-52	0
L13-53	-0.02
L13-54	-0.02
L13-55	-0.01
L13-56	0
L13-57	-0.01
L13-58	0
L13-59	-0.02
L13-60	-0.02
L13-61	-0.15
L13-62	0
L13-63	-0.02
L13-64	Maintenance Needed
Remount gauge	
L13-65	-0.25
L13-66	0
L13-67	Maintenance Needed
Remount gauge	
L13-68	-0.02
L13-69	-0.04
L13-70	-0.02
L13-71	-0.06
L13-72	-0.05
L13-73	-0.25
L13-74	-0.03

L13-75	-0.10
L13-76	0
L13-77	0
L13-78	-0.01
L13-79	0
L13-80	Maintenance Needed

Remount gauge

Certification

Nancy Bahena Hernandez
27 Feb 2026 3:44 PM PST

4050 - Daily Pressure Gauge Readings

John Boucher

Complete

Score	224 / 224 (100%)	Flagged items	0	Actions	0

Site conducted	4050 - Chiquita Canyon Landfill -, Corporate (Overall), Western, Western/SO CA L/F
Conducted on	28 Feb 2026 7:55 AM PST
Prepared by	John Boucher

Pressure Gauge Readings	224 / 224 (100%)
#7 Tank Farm	25 / 25 (100%)
SW 08	0
SW 07	-0.06
SW 06	-0.05
SW 05	0.01
SW 04	0
SW 03	-0.06
SW 02	0.25
SW 01	Maintenance Needed
44	-0.01
111	Maintenance Needed
LCM 11	-0.04
LCM 12	-0.02
LCM 13	-0.01
LCM 14	-0.04
LCM 15	0
LCM 6	-0.01
LCM 7	Maintenance Needed
LCM 8	Maintenance Needed
LCM 9	Maintenance Needed
LCM 10	-0.01
LCM 1	Maintenance Needed
LCM 2	Maintenance Needed

LCM 3	Maintenance Needed
LCM 4	0.25
LCM 5	0.06
#10 Tank Farm Canyon D	39 / 39 (100%)
D1	-0.03
D2	Maintenance Needed
CD3	Maintenance Needed
CD4	Maintenance Needed
D17	-0.04
D16	0.25
D15	Maintenance Needed
D14	0.03
D13	Maintenance Needed
D12	-0.25
D11	-0.25
D10	0.25
D9	Maintenance Needed
D8	-0.03
D7	-0.02
D6	Maintenance Needed
D5	Maintenance Needed
D4	Maintenance Needed
D3	-0.25
D18	-0.05

D19	Maintenance Needed
D20	-0.10
D21	-0.25
D22	Maintenance Needed
D23	-0.03
D24	-0.03
D25	Maintenance Needed
D26	0.25
D27	-0.03
D28	-0.25
D29	Maintenance Needed
D30	-0.25
D31	Maintenance Needed
D32	-0.25
D/SW-01	Maintenance Needed
D/SW-02	Maintenance Needed
D/SW-03	Maintenance Needed
D/SW-04	Maintenance Needed
D/SW-05	Maintenance Needed
#13 Tank Farm	160 / 160 (100%)
C13-08	0.08
C13-07	-0.03
C13-06	-0.01
C13-05	-0.03

C13-04	0
C13-03	0.02
C13-02	-0.01
C13-01	-0.04
C13-09	-0.25
C13-10	-0.25
C13-11	-0.25
C13-12	0.05
C13-13	-0.25
C13-14	-0.25
C13-15	-0.03
C13-16	-0.25
T1/T2 190	Maintenance Needed
U13-63	Maintenance Needed
U13-62	-0.03
U13-61	-0.01
U13-60	-0.01
U13-59	-0.01
U13-58	-0.01
U13-57	-0.02
U13-56	-0.03
U13-55	-0.05
U13-54	0
U13-53	-0.02

U13-52	-0.02
U13-51	-0.06
U13-50	-0.01
U13-49	-0.08
U13-48	-0.04
U13-47	-0.01
U13-46	0.01
U13-45	0
U13-44	0.02
U13-43	Maintenance Needed
U13-42	0
U13-41	0.01
U13-40	-0.01
U13-39	-0.02
U13-38	Maintenance Needed
U13-37	-0.03
U13-36	0.03
U13-35	-0.04
U13-34	-0.04
U13-33	-0.03
U13-32	-0.04
U13-31	Maintenance Needed
U13-30	-0.02
U13-29	-0.01

U13-28	-0.05
U13-27	-0.07
U13-26	-0.04
U13-25	-0.05
U13-24	-0.11
U13-23	-0.05
U13-22	-0.05
U13-21	0
U13-20	Maintenance Needed
U13-19	-0.04
U13-18	-0.01
U13-17	-0.02
U13-16	-0.05
U13-15	-0.01
U13-14	-0.01
U13-13	0
U13-12	-0.24
U13-11	-0.25
U13-10	-0.25
U13-09	-0.04
U13-08	-0.25
U13-07	-0.25
U13-06	-0.01
U13-05	-0.25

U13-04	-0.06
U13-03	-0.06
U13-02	-0.05
U13-01	-0.05
L13-01	-0.04
L13-02	-0.01
L13-03	-0.01
L13-04	-0.01
L13-05	-0.05
L13-06	-0.01
L13-07	-0.05
L13-08	-0.04
L13-09	-0.05
L13-10	0.04
L13-11	Maintenance Needed
L13-12	-0.01
L13-13	-0.02
L13-14	-0.01
L13-15	-0.05
L13-16	Maintenance Needed
L13-17	Maintenance Needed
L13-18	-0.05
L13-19	-0.04
L13-20	-0.03

L13-21	-0.05
L13-22	-0.01
L13-23	-0.03
L13-24	-0.05
L13-25	0.01
L13-26	Maintenance Needed
L13-27	0
L13-28	-0.04
L13-29	Maintenance Needed
L13-30	0.02
L13-31	0
L13-32	-0.04
L13-33	0.02
L13-34	-0.01
L13-35	-0.02
L13-36	0.25
L13-37	0.09
L13-38	-0.05
L13-39	-0.04
L13-40	0
L13-41	-0.01
L13-42	-0.02
L13-43	-0.02
L13-44	Maintenance Needed

L13-45	-0.01
L13-46	-0.01
L13-47	-0.01
L13-48	-0.03
L13-49	-0.02
L13-50	-0.02
L13-51	-0.02
L13-52	0
L13-53	-0.02
L13-54	-0.02
L13-55	-0.01
L13-56	0
L13-57	-0.01
L13-58	0
L13-59	-0.01
L13-60	-0.02
L13-61	-0.14
L13-62	0
L13-63	-0.01
L13-64	Maintenance Needed
L13-65	-0.25
L13-66	0
L13-67	Maintenance Needed
L13-68	-0.01

L13-69	-0.04
L13-70	-0.02
L13-71	-0.06
L13-72	-0.05
L13-73	-0.25
L13-74	-0.02
L13-75	-0.10
L13-76	0
L13-77	0
L13-78	-0.02
L13-79	0
L13-80	Maintenance Needed

Certification

John Boucher
28 Feb 2026 10:15 AM PST

Attachment N

Leachate Tank Flow Summary Report

Tank Farm Flows Summary Report Excel

Chiquita Canyon Landfill
29201 Henry Mayo Dr
Castaic, CA 91384

SCS ENGINEERS

07224127.00 | «Report.Timestamp»

274 Granite Run Drive
Lancaster, PA 17601
717-550-6330

SCS	Engineers	Tank Farm 7B Summary					
Date	**Tank 7B Flow Min (SCFM)**	**Tank 7B Flow Avg (SCFM)**	**Tank 7B Flow Max (SCFM)**	**Tank 7B Temp Min (°F)**	**Tank 7B Temp Avg (°F)**	**Tank 7B Temp Max (°F)**	**Total Tank 7B Flow (kSCF)**
Feb 1, 2026	160.31	581.54	1472.26	47.20	68.13	103.20	837.41
Feb 2, 2026	134.57	845.17	2611.64	46.40	67.38	102.40	1217.04
Feb 3, 2026	147.54	1037.99	4099.38	45.00	68.69	102.00	1494.71
Feb 4, 2026	184.91	877.55	2044.47	54.00	71.87	101.20	1263.68
Feb 5, 2026	<NA>	2389.05	19957.44	47.80	66.43	96.00	3440.23
Feb 6, 2026	175.58	307.57	961.84	50.20	68.38	106.40	442.90
Feb 7, 2026	191.46	274.51	808.50	46.80	69.50	103.20	395.30
Feb 8, 2026	163.20	237.42	404.04	48.20	71.56	108.00	341.88
Feb 9, 2026	175.85	245.75	1085.56	48.40	67.44	99.60	353.88
Feb 10, 2026	150.43	221.49	295.41	53.20	60.52	74.40	318.95
Feb 11, 2026	174.18	271.23	5089.47	45.60	60.40	85.20	390.57
Feb 12, 2026	237.96	295.08	418.32	42.80	61.97	93.20	424.92
Feb 13, 2026	284.76	538.05	1335.24	40.40	62.35	92.80	774.79
Feb 14, 2026	218.39	346.41	908.75	39.60	61.65	97.20	498.82
Feb 15, 2026	277.37	397.15	566.93	46.80	58.45	79.20	571.90
Feb 16, 2026	244.62	421.39	1380.03	44.80	50.19	54.80	606.80
Feb 17, 2026	278.51	371.77	575.58	41.60	51.38	68.00	535.34
Feb 18, 2026	214.57	348.56	1723.72	40.80	56.89	83.60	501.92
Feb 19, 2026	301.86	440.53	613.81	37.00	46.47	64.40	634.36
Feb 20, 2026	215.98	422.53	2381.11	33.40	49.91	80.40	608.44
Feb 21, 2026	290.64	481.65	695.01	33.40	55.36	83.20	693.58
Feb 22, 2026	214.43	410.78	3284.46	38.20	60.33	91.20	591.52
Feb 23, 2026	177.04	338.46	542.71	41.40	64.48	97.60	487.38
Feb 24, 2026	259.14	439.24	3186.23	46.40	68.51	106.40	632.51
Feb 25, 2026	230.03	549.78	1405.63	47.80	69.94	102.00	791.68
Feb 26, 2026	274.65	825.55	29264.60	52.80	73.38	101.60	1188.79
Feb 27, 2026	259.13	433.31	9264.67	56.80	77.84	111.20	623.96
Feb 28, 2026	253.47	362.86	4481.74	52.80	75.68	112.80	522.52
Summary		**525.44**			**63.75**		**21,185.81**
			2 of 4				Scsengineers.com

Note: Tank Farm 7B flowmeter malfunction on February 5, 2026

SCS	Engineers	Tank Farm 10 Summary					
Date	**Tank 10 Flow Min (SCFM)**	**Tank 10 Flow Avg (SCFM)**	**Tank 10 Flow Max (SCFM)**	**Tank 10 Temp Min (°F)**	**Tank 10 Temp Avg (°F)**	**Tank 10 Temp Max (°F)**	**Total Tank 10 Flow (kSCF)**
Feb 1, 2026	76.41	92.70	107.36	49.60	71.83	116.80	133.49
Feb 2, 2026	57.11	88.23	104.12	47.40	70.66	116.00	127.05
Feb 3, 2026	53.18	89.71	100.02	49.00	71.74	108.80	129.18
Feb 4, 2026	78.15	90.65	102.11	55.20	74.99	113.60	130.53
Feb 5, 2026	25.10	88.56	100.33	50.40	68.36	108.00	127.52
Feb 6, 2026	72.14	88.62	99.10	51.20	69.68	113.60	127.61
Feb 7, 2026	74.39	87.26	96.34	48.60	70.94	113.60	125.66
Feb 8, 2026	63.07	80.48	95.07	49.20	74.11	120.80	115.89
Feb 9, 2026	70.33	82.57	112.30	49.40	69.03	111.20	118.90
Feb 10, 2026	68.08	85.11	92.18	53.60	60.72	75.20	122.55
Feb 11, 2026	64.32	82.33	92.26	46.20	61.95	91.60	118.56
Feb 12, 2026	63.01	77.60	87.48	43.60	65.82	112.00	111.74
Feb 13, 2026	64.22	75.87	87.18	42.40	67.51	112.80	109.26
Feb 14, 2026	64.44	78.93	86.40	41.60	64.59	106.40	113.65
Feb 15, 2026	71.16	80.24	84.11	48.80	60.45	86.80	115.55
Feb 16, 2026	80.27	84.63	88.48	46.00	51.25	56.00	121.86
Feb 17, 2026	76.11	84.40	88.22	43.40	52.61	76.40	121.53
Feb 18, 2026	68.33	79.24	86.43	41.40	60.38	97.60	114.11
Feb 19, 2026	75.07	83.58	86.46	37.60	47.03	70.40	120.35
Feb 20, 2026	66.30	78.89	87.20	34.20	52.74	95.20	113.60
Feb 21, 2026	65.50	76.50	83.45	35.00	59.66	99.20	110.16
Feb 22, 2026	65.20	75.53	83.16	39.60	64.82	104.00	108.76
Feb 23, 2026	40.20	72.63	81.50	44.00	68.99	112.00	104.59
Feb 24, 2026	60.04	75.56	83.07	48.00	72.81	125.60	108.81
Feb 25, 2026	54.16	70.41	83.27	49.40	74.93	123.20	101.40
Feb 26, 2026	65.48	74.56	83.11	53.20	77.32	118.40	107.37
Feb 27, 2026	63.11	77.28	85.32	56.80	82.68	128.80	111.28
Feb 28, 2026	63.21	78.28	88.39	54.00	79.64	133.60	112.72
Summary		**81.44**			**66.69**		**3,283.67**
			3 of 4				Scsengineers.com

SCS	Engineers	Tank Farm 13 Summary					
Date	**Tank 13 Flow Min (SCFM)**	**Tank 13 Flow Avg (SCFM)**	**Tank 13 Flow Max (SCFM)**	**Tank 13 Temp Min (°F)**	**Tank 13 Temp Avg (°F)**	**Tank 13 Temp Max (°F)**	**Total Tank 13 Flow (kSCF)**
Feb 1, 2026	263.19	299.04	339.11	52.00	68.02	98.00	430.62
Feb 2, 2026	182.85	285.77	327.54	50.60	67.53	97.60	411.50
Feb 3, 2026	172.97	289.21	320.19	50.60	68.37	94.00	416.46
Feb 4, 2026	260.44	292.58	318.32	56.40	70.75	95.60	421.32
Feb 5, 2026	83.19	282.57	316.62	51.60	66.20	90.00	406.91
Feb 6, 2026	252.59	284.46	309.09	54.00	68.15	99.60	409.62
Feb 7, 2026	257.57	282.47	301.45	52.00	68.42	93.20	406.76
Feb 8, 2026	212.00	260.85	303.87	52.40	70.96	100.80	375.63
Feb 9, 2026	240.16	283.72	660.52	52.00	67.28	93.20	408.56
Feb 10, 2026	218.37	287.58	344.66	56.40	62.26	72.80	414.11
Feb 11, 2026	191.57	264.97	304.95	50.80	62.87	82.80	381.56
Feb 12, 2026	174.72	222.05	257.36	48.60	63.39	90.00	319.75
Feb 13, 2026	164.87	214.72	287.84	45.60	63.50	89.20	309.20
Feb 14, 2026	159.02	226.82	307.98	45.00	62.04	90.40	326.62
Feb 15, 2026	177.18	211.03	260.19	50.60	60.20	77.20	303.88
Feb 16, 2026	194.25	203.37	214.33	49.40	53.65	56.80	292.85
Feb 17, 2026	187.44	202.31	212.41	47.20	54.31	70.00	291.32
Feb 18, 2026	179.58	195.52	212.63	45.60	59.12	81.60	281.54
Feb 19, 2026	190.72	203.38	211.71	43.40	50.60	66.80	292.87
Feb 20, 2026	177.86	197.52	209.83	40.80	54.60	80.40	284.43
Feb 21, 2026	179.98	194.99	207.04	40.60	57.49	80.00	280.79
Feb 22, 2026	170.12	193.69	240.18	43.20	60.44	84.40	278.91
Feb 23, 2026	108.13	210.01	276.62	45.20	63.75	90.80	302.41
Feb 24, 2026	160.40	207.73	272.76	49.60	66.58	96.40	299.14
Feb 25, 2026	133.54	170.19	224.51	51.00	69.05	99.20	245.07
Feb 26, 2026	150.62	171.67	196.71	54.80	71.13	94.40	247.21
Feb 27, 2026	155.78	176.33	199.74	58.80	74.71	101.20	253.92
Feb 28, 2026	149.89	170.66	189.86	56.00	72.94	100.80	245.76
Summary		**231.61**			**64.23**		**9,338.71**
			4 of 4				Scsengineers.com

Attachment O

Various Location Equipment/PERP Log

Permit, VIN or Registration # of Equipment	Application # (if applicable)	Location of Equipment	Date In	Date Out	Comments
Reg# 164437 (Rent-A-Bin)		Pick Up Area	1/3/2025	Still Onsite	Eagle Crusher (third-party consultant)
Reg# 198839 & 198840 (United # 11456733)		Flares	1/28/2025	Still Onsite	Standby Generator for 3 Flares if lose power
Reg# 149175 (Rent-A-Bin)		Pick Up Area	6/1/2025	Still Onsite	McCloskey Screen (third-party consultant)
Reg# 184642 (United # 10966686)		Tank Farm 9	6/13/2025	Still Onsite	Standby Generator for Hero TOx if lose power
Reg# 199845 (United # 11442219)		Tank Farm 9	7/25/2025	Still Onsite	Standby Generator for Flare if lose power
Reg# 219024 (PDQ #76605)		Tank Farm 9	12/4/2025	2/24/2026	Pump for Continuum (third-party consultant)
Reg# 203347 (HERC Pump # 800-31-0889)		East Basin	1/1/2026	Still Onsite	Basin Pump as needed
Reg# 200469 (HERC Pump # 800-35-7162)		East Basin	1/1/2026	Still Onsite	Basin Pump as needed
Reg# 218467 (HERC Pump # 800-34-3231)		East Basin	1/2/2026	Still Onsite	Basin Pump as needed
Reg# 213795 (PDQ # 398303)		Tank Farm 9	2/13/2026	2/24/2026	Pump for Continuum (third-party consultant)

Attachment P

Geosynthetic Cover Weekly Inspections

4050 - Weekly Geosynthetic Cover Inspection-Condition 97

29 Jan 2026 / John Boucher/Tom Roe

Complete

Score	0 / 0 (0%)	Flagged items	0	Actions	0

Conducted on	29 Jan 2026 11:34 AM PST
Prepared by	John Boucher/Tom Roe

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	Yes
Date/Time Issue Found	29 Jan 2026 11:34 AM PST

Take photo of identified issues

Photo 1

Notate what the issue is and what needs to be repaired	Boot torn from liner. Needs to be patched and extrusion welded

Grid Location

Grid 169

Take photo of repair

Photo 2

Description of repair work	Pole was removed and hole was patched and extrusion welded.
Date and time of repair	2 Feb 2026 1:20 PM PST
Are further permanent repairs required?	No

Media summary

Photo 1

Photo 2

4050 - Weekly Geosynthetic Cover Inspection-Condition 97

5 Feb 2026 / John Boucher/Tom Roe

Complete

Score	0 / 0 (0%)	**Flagged items**	0	**Actions**	0

Conducted on	5 Feb 2026 6:58 AM PST
Prepared by	John Boucher/Tom Roe

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	Yes
Date/Time Issue Found	6 Feb 2026 12:39 PM PST

Take photo of identified issues

Photo 1

Notate what the issue is and what needs to be repaired	Boot separated from liner. Needs to be patched and extrusion welded

Grid Location

Take photo of repair

Photo 2

Description of repair work	Boot was replaced and extrusion welded
Date and time of repair	7 Feb 2026 8:30 AM PST
Are further permanent repairs required?	No
Identified Issue 2	
Are there any issues with the geosynthetic cover?	Yes
Date/Time Issue Found	6 Feb 2026 12:59 PM PST

Take photo of identified issues

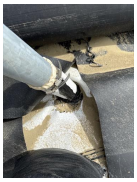

Photo 3

Notate what the issue is and what needs to be repaired	Liner boot separated from liner, needs to be patched and extrusion welded

Grid Location

Grid 174

Take photo of repair

Photo 4

Description of repair work	Boot was replaced and extrusion welded
Date and time of repair	7 Feb 2026 9:10 AM PST
Are further permanent repairs required?	No

Identified Issue 3

Are there any issues with the geosynthetic cover?	Yes
Date/Time Issue Found	6 Feb 2026 1:05 PM PST

Take photo of identified issues

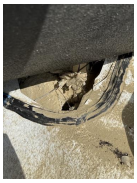

Photo 5

Notate what the issue is and what needs to be repaired	Liner boot separated from liner. Needs to be patched and extrusion welded

Grid Location

Grid 169

Take photo of repair

Photo 6

Description of repair work	Boot was replaced and extrusion welded
Date and time of repair	7 Feb 2026 9:40 AM PST
Are further permanent repairs required?	No

Identified Issue 4

Are there any issues with the geosynthetic cover?	Yes
Date/Time Issue Found	9 Feb 2026 1:44 PM PST

Take photo of identified issues

Photo 7

Notate what the issue is and what needs to be repaired	Tear on accordion boot needs to be extrusion welded.

Grid Location

Grid 81

Take photo of repair

Photo 8

Photo 9

Description of repair work	Tear was taped upon discovery and later patched and extrusion welded.
Date and time of repair	9 Feb 2026 1:47 PM PST

Final repair completed on 2/10/26

Are further permanent repairs required?	No

Media summary

Photo 1

Photo 2

Photo 3

Photo 4

Photo 5

Photo 6

Photo 7

Photo 8

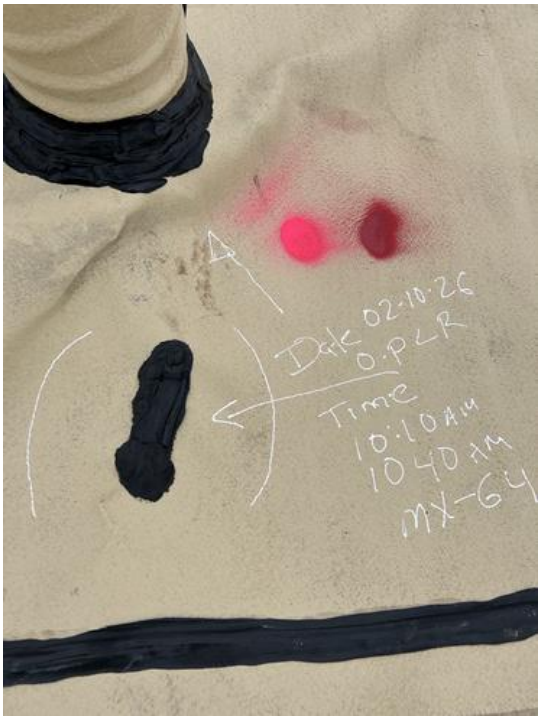

Photo 9

4050 - Weekly Geosynthetic Cover Inspection-Condition 97

11 Feb 2026 / John Boucher

Complete

Score	0 / 0 (0%)	Flagged items	0	Actions	0
Conducted on				11 Feb 2026 7:20 AM PST	
Prepared by				John Boucher	

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	Yes
Date/Time Issue Found	11 Feb 2026 11:32 AM PST

Take photo of identified issues

Photo 1

Notate what the issue is and what needs to be repaired	Liner boot separated from liner. Needs to be patched and extrusion welded

Grid Location

Take photo of repair

Photo 2

Description of repair work	Boot was replaced
Date and time of repair	12 Feb 2026 8:30 AM PST
Are further permanent repairs required?	No
Identified Issue 2	
Are there any issues with the geosynthetic cover?	Yes
Date/Time Issue Found	11 Feb 2026 11:58 AM PST

Take photo of identified issues

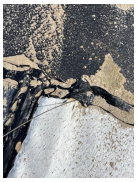

Photo 3

Notate what the issue is and what needs to be repaired	Small gap found in liner seam. Needs to be patched and extrusion welded

Grid Location

Grid 176

Take photo of repair

Photo 4

Description of repair work	Seam was patched and extrusion welded
Date and time of repair	12 Feb 2026 9:26 AM PST
Are further permanent repairs required?	No

Media summary

Photo 1

Photo 2

Photo 3

Photo 4

4050 - Weekly Geosynthetic Cover Inspection-Condition 97

19 Feb 2026 / John Boucher/Tom Roe

Complete

Score	0 / 0 (0%)	Flagged items	0	Actions	0

Conducted on	19 Feb 2026 10:52 AM PST
Prepared by	John Boucher/Tom Roe

Identification of Issues	
Identified Issue	
Identified Issue 1	
Are there any issues with the geosynthetic cover?	Yes
Date/Time Issue Found	24 Feb 2026 11:59 AM PST

Take photo of identified issues

Photo 1

Notate what the issue is and what needs to be repaired	Tear around boot needs to be patched/extrusion welded.

Grid Location

Take photo of repair

Photo 2

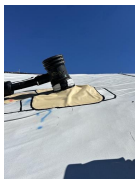

Photo 3

Description of repair work	Tear taped upon discovery.
Date and time of repair	24 Feb 2026 12:03 PM PST
Are further permanent repairs required?	No

Repairs completed on 3/2/26

Identified Issue 2	
Are there any issues with the geosynthetic cover?	Yes
Date/Time Issue Found	24 Feb 2026 12:06 PM PST

Take photo of identified issues

Photo 4

Notate what the issue is and what needs to be repaired	Tear around boot needs to be patched/extrusion welded.

Grid Location

Take photo of repair

Photo 5

Photo 6

Description of repair work	Tear taped upon discovery and later a new boot was installed and extrusion welded.
Date and time of repair	24 Feb 2026 12:09 PM PST
Are further permanent repairs required?	No

Repairs completed on 3/2/26

Identified Issue 3

Are there any issues with the geosynthetic cover?	Yes
Date/Time Issue Found	24 Feb 2026 12:13 PM PST

Take photo of identified issues

Photo 7

Notate what the issue is and what needs to be repaired	Tear around boot needs to be patched/extrusion welded.

Grid Location

Take photo of repair

Photo 8

Photo 9

Description of repair work	Tear taped and sandbagged upon discovery and later patched and extrusion welded.
Date and time of repair	24 Feb 2026 12:16 PM PST
Are further permanent repairs required?	No

Repairs completed on 3/2/26

Media summary

Photo 1

Photo 2

Photo 3

Photo 4

Photo 5

Photo 6

Photo 7

Photo 8

Photo 9