

From: Matt Breuer <Matthew.Breuer@WasteConnections.com>
Sent: Saturday, February 14, 2026 6:38 PM
To: gvergara@aqmd.gov
Cc: Kevin Green; Sarah Phillips; Dylan Smith; Christina Ojeda
Subject: Notice to Comply - Rule 1150.1 C58344
Attachments: E58344_signed.pdf; SCAQMD Inspection 20260204 - Field Response and Corrective Actions Report.pdf; SCS Field Response to SCAQMD February 4, 2026 NTC

[EXTERNAL SENDER: Use caution with links/attachments]

Hi Gerardo,

Attached is the signed Notice to Comply E58344 noting compliance achieved for all items, SCS Field Response Report documenting the actions taken, and email submittal from SCS.

Thank you,

Matt Breuer, PE
Region Environmental Manager
Waste Connections - Western Region
425-414-2903 (mobile)



2/4/2026

DATE OF INSPECTION

NOTICE TO COMPLY

Facility Name: Chiquita Canyon Landfill		Facility ID#: 119219	Sector: VB
Location Address: 29201 Henry Mayo Dr.		City: Castaic	Zip: 91384
Mailing Address: 29201 Henry Mayo Dr.		City: Castaic	Zip: 91384

This Notice to Comply is being issued to:

- Request additional information needed to determine compliance with clean air requirements.
 Correct a minor violation found during an inspection.

Failure to respond or take corrective action, or providing false statements in response to this Notice to Comply can lead to issuance of a Notice of Violation pursuant to the California Health and Safety Code. The facility cited above is subject to re-inspection at any time to ensure compliance.

YOU ARE HEREBY DIRECTED TO COMPLY WITH:

#	AQMD RULE/ CAL H&S CODE	REQUIREMENT	COMPLIANCE DUE DATE	COMPLIANCE ACHIEVED DATE
1	1150.1 (d)(13)	Any component leak exceeding 500 ppmv must be tagged and repaired within 10 calendar days. Address the following: Blower unit used	2/14/26	2/13/2026
2		for the in association with the ZEECO thermal oxidizer. Submit written documentation completion of repairs and follow-up monitoring.		
3	1150.1 (e)(3)	Address, tag, and repair the following areas within 10 calendar days: CV 24037, areas surrounding H2ST4-IN, H2ST2-IN, ZEECOSMP. Submit written documentation	2/14/26	2/12/2026
4		completion of repairs and follow-up monitoring.		
5				
6				

Served To: Kevin Green		Served By: Gerardo Vergara		
Title: District Manager		Date Served: 2/4/2026	Phone: 909-396-2179	Fax:
Email Address: Kevin.green@wasteconnections.com	Phone: 661-812-5846	Email Address: gvergara	@aqmd.gov	Forms/Applications/Info available at: www.aqmd.gov

Instructions:

- For each minor violation cited above, compliance shall be achieved by the compliance deadline specified for that particular violation.
- Within 5 working days of achieving compliance for each respective violation, the owner/responsible officer of the cited facility must complete and return a signed copy of this Notice to Comply to the South Coast Air Quality Management District at the address listed above.
- Please copy and return this Notice to Comply as many times as necessary to provide the required information. On each copy, include the date on which compliance was achieved. Date, sign, and send all completed copies to the attention of the inspector named above.

I hereby certify that the facility cited in this Notice to Comply has achieved compliance with the requirements listed above.

Kevin Green _____ District Manager _____ *KV* _____
 NAME OF OWNER/RESPONSIBLE OFFICIAL TITLE SIGNATURE DATE

NOTICE#: E 58344

FILE COPY (Blue)

FACILITY COPY (Gold)

INSPECTOR COPY (White)

From: Kim, Jenny <JennyKim@scsengineers.com>
Sent: Friday, February 13, 2026 8:41 PM
To: Kevin Green; Matthew.Breuer@WasteConnections.com
Subject: SCS Field Response to SCAQMD February 4, 2026 NTC
Attachments: SCAQMD Inspection 20260204 - Field Response and Corrective Actions Report.pdf

Kevin and Matt,

Attached is SCS' Field Response Report for documentation of corrective actions implemented following the SCAQMD Inspection that took place at Chiquita Canyon Landfill on 2/4/2026. Please let me know if you have any questions or need additional information.

Thanks,
Jenny

Jenny Kim, P.E.
Project Manager
SCS Engineers
Cell Phone - 626-609-9188
jennykim@scsengineers.com

This electronic mail transmittal ("E-mail") is intended only for the use of the individual or entity to which it is addressed and may contain information that is confidential and exempt from disclosure under applicable law, including, but not limited to, information protected by the attorney/client privilege. If the reader of this E-mail is not the intended recipient or the employee or agent responsible for delivering the E-mail to the intended recipient, you are hereby notified that any dissemination, distribution or copying of this E-mail communication is strictly prohibited. If you have received this E-mail communication in error, please notify us immediately by return E-mail and delete the original E-mail from your computer system. Thank you.

SCS Field Response to SCAQMD February 4, 2026 NTC

On Wednesday, February 4, 2026, the South Coast Air Quality Management District (SCAQMD) conducted a site inspection at Chiquita Canyon Landfill. During the inspection, Chiquita Canyon, LLC (Chiquita) staff accompanied an SCAQMD Inspector, who conducted TVA sweeps at several locations around the landfill. On Friday, February 6, 2026, Chiquita staff notified SCS field staff of five (5) alleged exceedances greater than 500 ppmv detected during these sweeps.

The five alleged exceedance locations were noted in SCAQMD's Notice to Comply (NTC) as follows:

1. Well CV-24037
2. Zeeco blower housing
3. Zeeco Sump
4. H2S Vessel 2 Inlet
5. H2S Vessel 4 Inlet

Corrective Actions Implemented

On Monday, February 9, 2026, the SCS field staff addressed three (3) of the locations identified by Chiquita. The following corrective actions were performed:

- At the H2S Inlet Piping for Vessels 1, 2, 3 and 4:
 - Fresh soil was brought to each individual inlet vessel and compacted using both a hand compactor and a backhoe bucket to ensure adequate sealing and minimize emissions. (Note: work was conducted at Vessels 1 and 3 as preventative maintenance).
- At Well CV-24037:
 - Fresh soil was placed around the casing of the well and compacted using a backhoe bucket and hand compactor. This action was intended to improve containment and prevent further emissions.

On Wednesday, February 11, 2026, additional corrective actions were executed:

- Zeeco Knockout and Zeeco Sump:
 - Fresh soil was added around the casing for both units and compacted using a backhoe bucket as well as a hand compactor. This step was taken to reinforce containment and address the issues found during the inspection.

On Friday, February 13, 2026, additional corrective actions were executed:

- Zeeco blower housing seal:

- A temporary repair was made using a bag and tape to seal the leak found on the Zeeco blower housing. For permanent repair, the blower will be sent into Lone Star Blower, who has been notified of the necessary repairs. While the blower is off-site for repair, a spare blower will be utilized in order to keep Zeeco online.

10-Day Rechecks


On February 12, 2026, SCS field staff used a TVA-2020 to conduct follow-up monitoring at four (4) of the remediated locations. On February 13, 2026, follow-up monitoring was conducted for the fifth exceedance location at the Zeeco blower following the repair noted above. During the re-monitoring events, all five (5) locations were below the 500 ppmv threshold and no further action is required. SCS will conduct 30-day rechecks at these locations on or before March 5, 2026.

Initial and Follow-up Monitoring Results

Initial Monitoring Event Results						Remedial Period End Dates		Remedial Work		Follow-up Monitoring Results			
ID	Technician	Location Description	Source of Emissions (Well or Area)	Date (mm/dd/yy)	TOC (ppmv)	First 10-Day	Second 10-Day	Date (mm/dd/yy)	Description	Date (mm/dd/yy)	Instrument ID	Technician	TOC (ppmv)
1	SCAQMD	CV-24037	WELL	02/04/26	>500	02/14/26	02/24/26	02/09/26	Added soil and compacted	2/12/2026	202023046611	Erik Navarro	8.2
2	SCAQMD	Zeeco blower housing	AREA	02/04/26	>500	02/14/26	02/24/26	02/13/26	Sealed blower housing using bag and tape	2/13/2026	202023046611	Victor Amaya	109
3	SCAQMD	Zeeco Sump	AREA	02/04/26	>500	02/14/26	02/24/26	02/11/26	Added soil and compacted	2/12/2026	202023046611	Erik Navarro	52
4	SCAQMD	H2S Vessel 2 Inlet	AREA	02/04/26	>500	02/14/26	02/24/26	02/09/26	Added soil and compacted	2/12/2026	202023046611	Erik Navarro	125
5	SCAQMD	H2S Vessel 4 Inlet	AREA	02/04/26	>500	02/14/26	02/24/26	02/09/26	Added soil and compacted	2/12/2026	202023046611	Erik Navarro	122

Photos of Remediated Locations

Well CV-24037

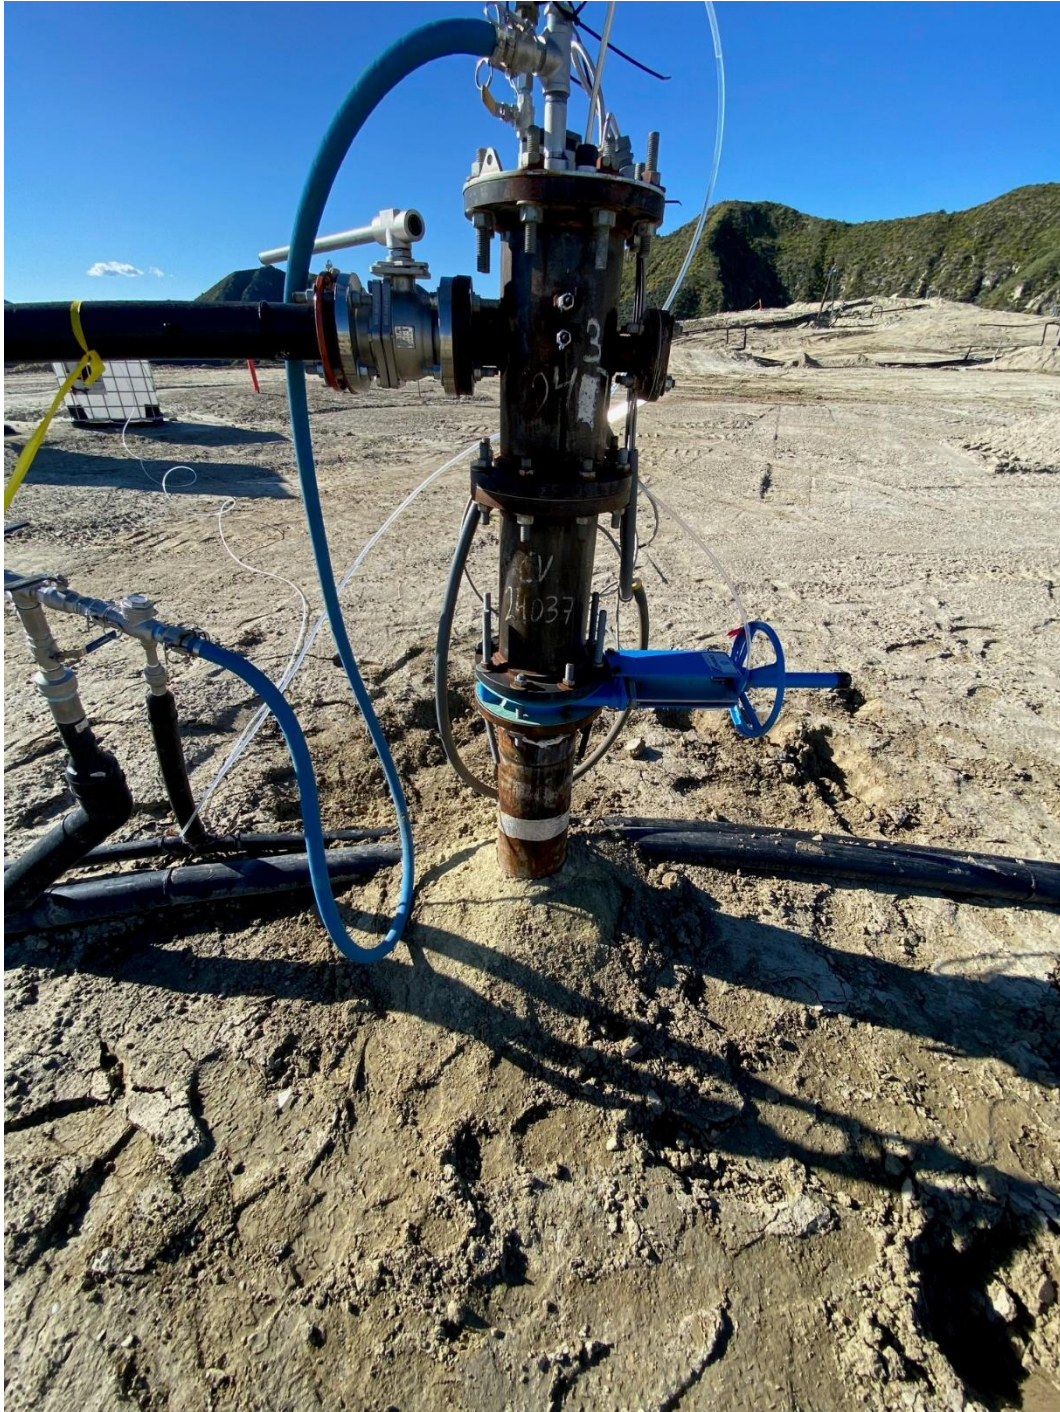

Photos of Remediated Locations

Zeeco Blower housing



Photos of Remediated Locations

Zeeco Sump



Photos of Remediated Locations

H2S Vessel 2



Photos of Remediated Locations

H2S Vessel 4

